

# Service Technical Information

MODEL NO. CSD-A310 / TD31 / TD32 / TD33 / TD41 / TD42 CA-DW237 / DW247 / DW257 / DW537
SUBJECT Frictional noise is produced when the CD lid is closed

REF.No. :G - A0 - 041 - E0

DATE :31. AUG. 2000

<CONTENTS>

Please take the following countermeasure when there is a complaint that "frictional noise is produced when the lid CD is closed".

<COUNTERMEASURE>

Replace the HLDR CHUCK ASSY according to the following procedure:

1. Remove the chuck part from the CD lid.  
(Remove from the rear side as shown in Fig-1.)
2. Release the hooks at three locations, and then remove the HLDR CHUCK.  
(See Fig-2 and 3)
3. Mount the new HLDR CHUCK ASSY (replacement part).  
Make sure that the hooks at all three locations are engaged.
4. Mount the chuck part to the CD lid.



Fig-1

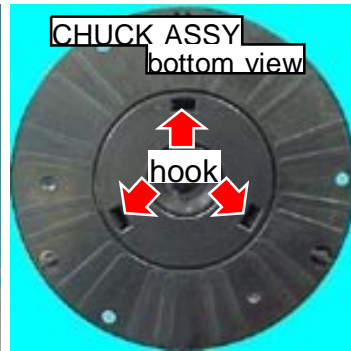


Fig-2

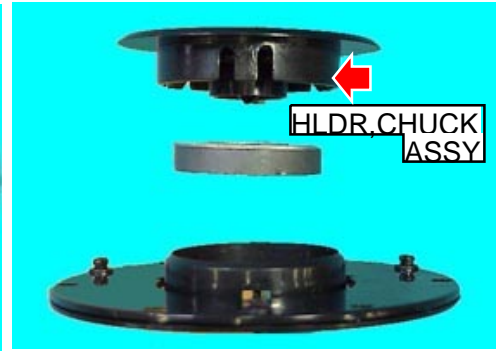


Fig-3

Ref.	Parts Code	Description	Remarks
-	8A-CDB-230-010	HLDR,CHUCK ASSY	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	S****06B****	-