

Service Technical Information

MODEL NO. LCX-137 / 157 / 337 / 356 / 357 / AC1 / DR37
SUBJECT No power

REF.No. :G - A0 - 070 -E0

DATE :22. SEP. 2000

<CONTENTS>

If " No Power " is reported, take the following procedure:


<SYMPTOM>

The clock is not displayed when AC Plug in, and pressing the power button does not bring any effect.

<COUNTERMEASURE>

Take the following steps to replace the parts:

1. Remove the P.W.B FRONT from the front cabinet.
2. Change R250 from 3.3 kΩ to 1 kΩ.
3. Check if X202 on the P.W.B FRONT is oscillating. If not oscillating, change X202 to the new one shown in the table below.

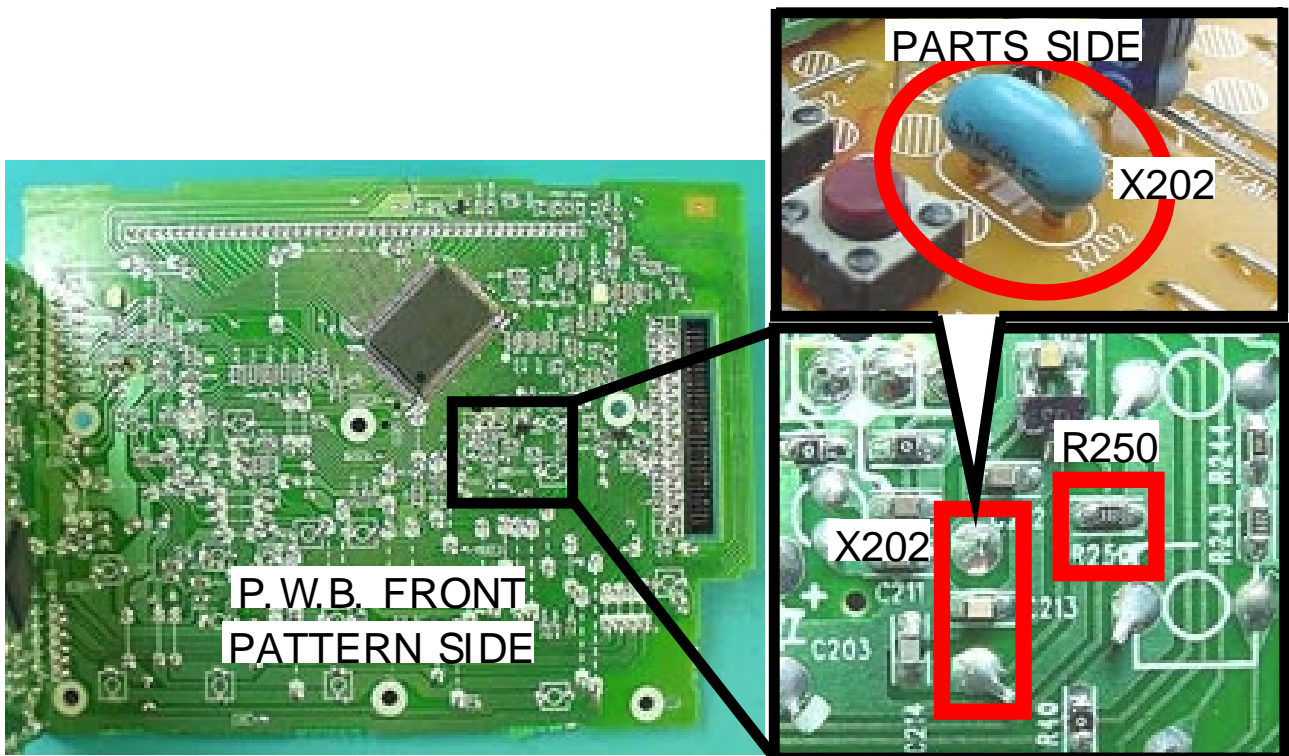

Ref.	Parts Code	Description	Remarks
X202	87-030-376-080	VIB,CER CSA5.76MG200	-
R250	88-108-102-080	RESISTOR,1/16W 1K	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	S****0810001	12.NOV.2000