MP1800A Signal Quality Analyzer/ MT1810A 4 Slot Chassis Release Notes

Thank you for choosing Anritsu products for your business.

This release note provides the latest information about version 8.02.04 of the software for the Anritsu MP1800A/MT1810A and current known bugs.

We look forward to continuing business with you in the future.

Release Version Ver.8.02.04

Contents

COR

Item	Content				
1. Release Information	Describes information for this release				
•••P2					
2. Known Bugs ····P24	Describes known software bugs in this version to be fixed by future releases				
3. Added Functions	Describes added functions for this release				
•••P25					
4. Usage Notes	Describes precautions for using this equipment				
•••P33					

1 Release Information

U CORPORA

The time required to upgrade from the old version to the new firmware version is listed below:

New version: 8.02.04

Old version: 8.02.03

Time required for version upgrade: 15 to 25 minutes

The required time is the total of the download time using Setup Utility and the install time.

The actual upgrade time depends on the number and type of installed modules.

In addition, this version upgrade has no impact on remote operations.

/Inritsu

1.1 Supported Modules 1.1.1 Plug-in Modules

U CORPO

The following table shows the modules that can be installed in the MP1800A and MT1810A.

Module Code	Module Name
MU181000A	12.5 GHz Synthesizer
MU181000B	12.5 GHz 4 port Synthesizer
MU181020A	12.5 Gbit/s PPG
MU181020B	14 Gbit/s PPG
MU181040A	12.5 Gbit/s ED
MU181040B	14 Gbit/s ED
MU181600A	Optical Transceiver (XFP)
MU181601A	Optical Transceiver (SFP)
MU181620A	Stressed Eye Transmitter
MU181640A	Optical Receiver
MU181800A	12.5 GHz Clock Distributor
MU181800B	14 GHz Clock Distributor
MU182020A	25 Gbit/s 1ch MUX
MU182021A	25 Gbit/s 2ch DEMUX
MU182040A	25 Gbit/s 1ch MUX
MU182041A	25 Gbit/s 2ch DEMUX
MU181500B	Jitter Modulation Source
MU183020A	28G/32G bit/s PPG
MU183040A	28G/32G bit/s ED
MU183021A	28G/32G bit/s 4ch PPG
MU183041A	28G/32G bit/s 4ch ED
MU183040B	28G/32G bit/s High Sensitivity ED
MU183041B	28G/32G bit/s 4ch High Sensitivity ED

1.1.2 Connecting USB Equipment

Units that can be controlled by connecting to the MP1800A using a USB cable are listed below.

Model	Name
MP1825B	4Tap Emphasis
MP1861A	56G/64G bit/s MUX
MP1862A	56G/64G bit/s DEMUX

1.2 Slot Installation Position

COR

This section explains the position for installing each module in the MP1800A and MT1810A slots.

1.2.1 Restrictions on PPG and ED Installation Slots

The optional MU181020A/B PPG and MU181040A/B ED modules are installed in different slots in the MP1800A or MT1810A-014/015 main frame as shown in the following tables 1.2.1-1, 1.2.1-2, and 1.2.1-3.

Slot No	Α	В	С	D
Slot 1				—
Slot 2	_	_	_	—
Slot 3	PPG	_	PPG	PPG
Slot 4	-	ED	ED	PPG
Slot 5	-	_	_	_
Slot 6	-			—

Table 1.2.1-1 PPG/ED Installation Slots for MP1800A/MT1810A-014

Table 1.2.1-2 PPG/ED Installation	Slots for MP1800A/MT1810A-015
-----------------------------------	-------------------------------

	Slot No	Α	В	С	D	E	F	G	Н	Ι	J	K	L
Ħ	Slot 1	-	-	-	PPG	PPG	PPG	ED	ED	ED	PPG	PPG	PPG
/nc	Slot 2	—	_	-	PPG	PPG	PPG	ED	ED	ED	PPG	PPG	PPG
l Sy	Slot 3	PPG		PPG	_	PPG	PPG	_	ED	ED	—	PPG	ED
с Чер	Slot 4	—	ED	ED	—	—	PPG	_	_	ED	ED	ED	ED
/ In	Slot 5	—	_	—	—	_	_	_	_	_	—	—	—
	Slot 6	-	-	-	-			Ι		-	—	-	
ion	Slot 1	—	—	—	—	—	4ch	—	—	4ch	—	—	—
	Slot 2	—	-	_	_	-	PPG	PPG – –	_	ED _	_	-	
sh nat	Slot 3	—	-	_	_	-		_	_		_	_	-
4c nbi	Slot 4	—	-	_	_	-		_	_		_	_	-
Cor	Slot 5	—	-	_	_	-	_	_	_	_	—	_	-
•	Slot 6	-		-	-		-				—		-
	Slot1	_	_	—	2ch	2ch	2ch	2ch	2ch	2ch	2ch	2ch	2ch
ion	Slot 2	—	_	—	PPG	PPG	PPG	ED	ED	ED	PPG	PPG	PPG
sh nat	Slot 3	—	-	_	_	PRG	2ch	_	ED	2ch	—	PRG	2ch
2c nbir	Slot 4	—	_	—	—	_	PPG	_	_	ED	ED	ED	ED
Cor	Slot 5	_	_	—	—	_	-	_	_	_	—	_	-
Ŭ	Slot 6	—		_	-	_	—	_	_	-	_	_	_

4/41

	Slot No	Α	В	С	D	E	F	G	Н	I I	J	K
<u>ب</u> ج	Slot 1	PPG		-	PPG	PPG	PPG	-	—	-	PPG	PPG
der	Slot 2	_	-	_	PPG	PPG	PPG	_	—	_	PPG	PPG
en Sen	Slot 3			PPG	-	PPG	PPG	-	—	ED	-	PPG
철수	Slot 4		ED	ED	-	—	PPG	-	ED	ED	-	—
<u> </u>	Slot 5			-	-	—		ED	ED	ED	-	—
	Slot 6			-	-	—		ED	ED	ED	ED	ED
	Slot 1	—	_	_	_	—	4ch	_	—	_	—	—
ion	Slot 2	—	-	-	-	—	PPG	-	—	-	—	—
nat	Slot 3	—	-	-	-	—		-	—	4ch	—	—
hdi hdi	Slot 4	—	-	-	-	—		-	—	ED	—	—
So	Slot 5	—	_	—	_	—	_	_	—		—	—
Ŭ	Slot 6	—	-	_	_	—	_	_	—		_	—
	Slot 1	_	_	_	2ch	2ch	2ch	_	_	_	2ch	2ch
ion	Slot 2	—	_	—	PPG	PPG	PPG	—	—	—	PPG	PPG
nat	Slot 3	_	-	-	-	PRG	2ch	-	_	2ch	_	PRG
nbi	Slot 4	—	_	-	-	_	PPG	—	ED	ED	—	—
Co	Slot 5	_	_	_	—	—	_	2ch	2ch	2ch	—	—
	Slot 6	—	_	_	_	—	_	ED	ED	ED	ED	ED

Table 1.2.1-3 PPG/ED Installation Slots for MP1800A-016

	Slot No	L	М	Ν	0	Р	Q
	Slot 1	PPG	PPG	PPG	PPG	PPG	PPG
dei vnc	Slot 2	PPG	PPG	PPG	PPG	PPG	PPG
i S	Slot 3	PPG		PPG	PPG		ED
Сtę	Slot 4	PPG			PPG	ED	ED
/ In	Slot 5	-	ED	ED	ED	ED	ED
	Slot 6	ED	ED	ED	ED	ED	ED
	Slot 1	4ch	-	-	4ch	-	PPG
ion	Slot 2	PPG	-	_	PPG	_	PPG
:h nat	Slot 3		-	_		_	4ch
4c nbi	Slot 4		-	_		_	ED
Cor	Slot 5	-	-	-	ED	-	
Ū	Slot 6	ED	-	_	ED	_	
_	Slot 1	2ch	2ch	2ch	2ch	2ch	2ch
ion	Slot 2	PPG	PPG	PPG	PPG	PPG	PPG
2ch nbinati	Slot 3	2ch	_	PRG	2ch	-	2ch
	Slot 4	PPG			PPG)ED	ED
Con	Slot 5	—	2ch	2ch	2ch	2ch	2ch
0	Slot 6	EÐ.	ED	ED	ED	ED	ED

_	: Slots where PPG and ED cannot be installed
PPG	: Slots where MU181020A/B PPG can be installed
ED	: Slots where MU181040A/B ED can be installed
Dashed Line	:Slots where PPG/ED disabled at Combination

For the installation position of the main frame, refer to the Anritsu homepage (<u>http://www.anritsu.com</u>).



1.2.2 Restrictions on MUX and DEMUX Installation Slots

COR

There are no restrictions when installing the MU182020A/21A (hereafter MUX) and MU182040A/41A (hereafter DEMUX) as single units in the main frame when the PPG and ED cannot be used together.

However, when installing the PPG and MUX in the main frame, in addition to restrictions on the number of PPG slots and positions (section 1.2.1), there are restrictions on the MUX installation slots as well. Tables 1.2.2-1 and 1.2.2-2 show the permutations for installing the PPG and MUX using the supplied accessory cables. The functions are only guaranteed for the PPG and MUX installation locations at shipment and using the supplied accessory cables so stickers are affixed to show that calibration has been completed and to prevent screws becoming loose. Note that the performance is not guaranteed if the position of the PPG and MUX with stickers are changed.

When installing the ED and DEMUX, follow the restrictions on the number of EDs installed and positions (section 1.2.1) and install the DEMUX in an empty slot.

Slot No	А	В	С	D	E
Slot 1	PPG	PPG	PPG	ED	ED
Slot 2	PPG	PPG	PPG	ED	ED
Slot 3	PPG	PPG	1ch MUX	ED	ED
Slot 4	PPG	PPG		ED	ED
Slot 5	2ch MUX	1ch MUX		2ch DEMUX	1ch DEMUX
Slot 6	2ch MUX	1ch MUX		2ch DEMUX	1ch DEMUX

Table 1.2.2-1 MUX/DEMUX Installation Slots for MP1800A/MT1810A-015

Slot No	F	G
Slot 1	ED	PPG
Slot 2	ED	PPG
Slot 3	1ch DEMUX	ED
Slot 4		ED
Slot 5		1ch MUX
Slot 6		1ch DEMUX

Slot No	A	В	С	D	E
Slot 1	PPG	PPG	PPG	2ch DEMUX	1ch DEMUX
Slot 2	PPG	PPG	PPG	2ch DEMUX	1ch DEMUX
Slot 3	PPG	PPG	1ch MUX	ED	ED
Slot 4	PPG	PPG		ED	ED
Slot 5	2ch MUX	1ch MUX		ED	ED
Slot 6	2ch MUX	1ch MUX		ED	ED

Table 1.2.2-2 MUX/DEMUX Installation Slots for MP1800A-016

Slot No	F	G
Slot 1		PPG
Slot 2		PPG
Slot 3		1ch MUX
Slot 4	1ch DEMUX	1ch DEMUX
Slot 5	ED	ED
Slot 6	ED	ED

PPG	: Slots where MU181020A/B PPG can be installed
ED	: Slots where MU181040A/B PPG can be installed
1ch MUX	: Slots where MU182020A 1ch MUX can be installed
2ch MUX	: Slots where MU182021A 2ch MUX can be installed
1ch DEMUX	: Slots where MU182040A 1ch DEMUX can be installed
2ch DEMUX	: Slots where MU182041A 2ch DEMUX can be installed



1.2.3 Restrictions on 32G PPG and ED Installation Slots

CORPO

The optional MU183020A 32G PPG, MU183021A 32G 4ch PPG, MU183040A/B 32G ED and MU183041A/B 32G 4ch ED modules are installed in different slots in the MP1800A or MT1810A main frame as shown in the following tables 1.2.3-1, and 1.2.3-2.

Slot No	Α	В	С	D	E
Slot 1				Ι	-
Slot 2		-	-	-	-
Slot 3	PPG	_	PPG	4ch	4ch
Slot 4	-	ED	ED	PPG	ED
Slot 5	-		_	-	_
Slot 6					_

Table 1.2.3-2 PPG/ED Installation Slots for MP1800A-015/016 and MT1810A-015

rt	Slot No	Α	В	С	D	E	F	G	Н	I	J	K	L*
	Slot 1		-		PPG	-	PPG	4ch	—	4ch	4ch	4ch	PPG
der	Slot 2	-	-	-	PPG	-	PPG	PPG	—	PPG	PPG	ED	PPG
nen	Slot 3	PPG	_	PPG	_	ED	ED	—	4ch	4ch	4ch	4ch	PPG
dep	Slot 4	-	ED	ED	-	ED	ED	—	ED	ED	PPG	ED	PPG
Ĕ	Slot 5	-	-	-	-	-	-	—	—	-	—	-	
	Slot 6			-	-	-	-	—	—	-	—	-	
Channel Synchronization	Slot 1	—	—	—	CH	—	СН	—	—	—		—	
	Slot 2	—	_	—	Sync	-	Sync	_	—	—	CH	_	CH
	Slot 3	—	_	—	_	-	—	—	—	—	Sync	_	Sync
	Slot 4	—	_	—	_	-	—	—	—	—		_	
	Slot 5	—	_	—	_	-	—	—	—	—	—	_	—
	Slot 6	_	_	_	_	_	-	_	—	-	_	_	_

_	: Slots where 32G PPG and 32G ED cannot be installed
PPG	: Slots where MU183020A 32G PPG can be installed
ED	: Slots where MU183040A/B 32G ED can be installed
4ch PPG	: Slots where MU183021A 32G 4ch PPG can be installed
4ch ED	: Slots where MU183041A/B 32G 4ch ED can be installed
CH Sync	: Slots where two or four 32G 2ch/4ch PPG boards can be installed at
	Channel Synchronization. The 32G 1ch PPG cannot perform Channel
	Synchronization.
*	: Only the MP1800A/MT1810A-015 is supported.

For the installation position of the main frame, refer to the Anritsu homepage (<u>http://www.anritsu.com</u>).

1.2.4 Restrictions on Simultaneous PPG and ED, or 32G PPG and ED Installations

The MP1800A and MT1810A (this equipment hereafter) support simultaneous installation of the optional MU181020A/B (PPG), MU182020A (MUX), MU181040A/B (ED),

MU182040A (DEMUX), MU183020A (32G PPG), and MU183040A/B (32G ED) under the conditions described below.

Tables 1.2.4-1 and 1.2.4-2 show the number of slots and positions where the PPG and ED, or 32G PPD and 32G ED can be installed with this firmware version.

CH Sync and Combination are not supported for the PPG and 32 PPG, and nor is Combination for the ED and 32G ED. However, the 32G ED error buzzer does not sound when these options are installed simultaneously.

	Slot No	A	В	С	D	E
Ħ	Slot 1	PPG	ED	—	—	32G PPG
de	Slot 2	PPG	ED	—	—	32G ED
Der	Slot 3	MUX	DEMUX	32G PPG	PPG	PPG
dep	Slot 4	32G ED	32G PPG	ED	32G ED	ED
Ц	Slot 5	—	—	—	—	—
	Slot 6	—	—	—	—	—
uo	Slot1	CH Sync 2ch Combi	2ch Combi	—	—	CH Sync 2ch Combi
zati	Slot 2			—	—	2ch Combi
hroniz oinatio	Slot 3	—	—	CH Sync 2ch Combi	—	—
Sync Comb	Slot 4	2ch Combi	CH Sync 2ch Combi	_	2ch Combi	—
н	Slot 5	_	_	_	_	_
	Slot 6	—	—	—	—	—

Table 1.2.4-1 MP1800A-015, MT1810A-015 PPG/ED Installation Slots



	Slot No	F	G	Н	I	J	K
¥	Slot 1	32G PPG	—	32G PPG	32G PPG	—	—
dei	Slot 2	—	32G ED	32G ED	32G ED	—	—
neu	Slot 3	PPG	PPG	PPG	—	PPG	32G ED
dep	Slot 4	ED	ED	—	ED	32G PPG	ED
<u>_</u>	Slot 5	—	—	—	—	—	—
	Slot 6	—	—	—	—	—	—
с	Slot1	CH Sync	_	CH Sync	CH Sync	_	_
tio		2ch Combi		2ch Combi	2ch Combi		
iiza	Slot 2	—	2ch Combi	2ch Combi	2ch Combi	_	_
ron nat	Slot 3	—	—	—	—	—	2ch Combi
nbi nbi	Slot 4	—	—	—	—	CH Sync	—
žö						2ch Combi	
Ξ	Slot 5	—	—	—	—	—	—
U U	Slot 6	—	_	_	—	_	_

Table 1.2.4-2 MP1800A-016 PPG/ED Installation Slots

	Slot No	А	В	С	D	E
는 Slot 1 PPG		—	—	—	32G PPG	
lde	Slot 2	PPG	—	—	—	32G ED
Der	Slot 3	MUX	32G PPG	32G PPG	PPG	PPG
de	Slot 4	32G ED	DEMUX	ED	32G ED	ED
Ĕ	Slot 5	_	ED	—	—	—
	Slot 6	—	ED	—	—	—
_	Slot1	CH Sync	_	_	_	CH Sync
tio		2ch Combi				2ch Combi
iiza	Slot 2			—	—	2ch Combi
ron nat	Slot 3	—	CH Sync	CH Sync	—	—
l L L			2ch Combi	2ch Combi		
n vi	Slot 4	2ch Combi	—	—	2ch Combi	—
ш	Slot 5	_	2ch Combi	_	_	_
Ö	Slot 6	_		_	_	_



	Slot No	F	G	Н			К
Ħ	Slot 1	32G PPG	_	32G PPG	32G PPG		_
der	Slot 2	—	32G ED	32G ED	32G ED	_	—
len	Slot 3	PPG	PPG	PPG	—	PPG	32G ED
deb	Slot 4	ED	ED	—	ED	32G PPG	ED
Ĕ	Slot 5	—	—	—	—	_	—
	Slot 6	—	—	—	—	_	—
L L	Slot1	CH Sync	—	CH Sync	CH Sync	_	—
tio		2ch Combi		2ch Combi	2ch Combi		
iza	Slot 2	—	2ch Combi	2ch Combi	2ch Combi	-	—
ron nat	Slot 3	—	—	—	—	—	2ch Combi
Ч С Г С	Slot 4	—	—	—	—	CH Sync	—
2 S						2ch Combi	
ш	Slot 5	_	_	_	_		_
U U	Slot 6	—	_	_	—	_	_

_	: Slots where PPG/ED or 32G PPG/ED cannot be installed
PPG	: Slots where MU181020A/B 12.5G/14G PPG can be installed
ED	: Slots MU181040A/B 12.5G/14G ED can be installed
32G PPG	: Slots where MU183020A 32G PPG can be installed
32G ED	: Slots where MU183040A/B 32G ED can be installed
MUX	: Slot for MU182020A 1ch MUX
DEMUX	: Slot for MU182040A 1ch DEMUX
CH Sync	: Slots where either two 12.5G/14G PPG boards or 32G PPG 2ch
	Channel Synchronization can be installed
2ch Combi	: Slots where either two 12.5G/14G PPG boards or 32G PPG 2ch
	Combination can be installed

For the installation position of the main frame, refer to the Anritsu homepage (<u>http://www.anritsu.com</u>).

1.3 Connecting via USB

This section explains connection of equipment (listed on section 1.1.2) to the MP1800A via USB cable.

1.3.1 Hot Swap

USB equipment is connected to the MP1800A using a USB cable. However, hot swapping is not supported, so take care not to hot swap connected equipment.

Read following manuals before use.

- Chapter 2.5 Connecting Controller in the MP1825B 4Tap Emphasis Operation Manual (Doc. No. M-W3482AE).
- Chapter 2.1.4 Usage Patterns of MP1861 in the MP1861A 56G/64G bit/s MUX Operation Manual (Doc. No. M-W3756AE)
- Chapter 2.1.4 Usage Patterns of MP1862 in the MP1862A 56G/64G bit/s DEMUX Operation Manual (Doc. No. M-W3757AE)

14/41

1.4 Improvements

Version Item (B	ug Mngt No.)	Phenomenon
Ver.8.02.04 Syn Loss	error occurs at	When using the MP1862A 56G/64 Gbit/s DEMUX without
56.2 Gbit/s	s with MP1862A	Option-x01 64Gbit/s Extension installed, a Sync Loss
DEMUX (0	CM943:81)	occurs at a bit rate setting of 56.2G bit/s.
		This bug occurs in software versions 8.00.00 to 8.02.03.
Ver.8.02.03 No data or	utput when	When using the MU183021A 32G 4ch PPG, when the
Using 32G	4ch PPG	Combination Setting is independent, 2ch Combination, or
(CIVI943:2)	3)	and Data4. When the Combination Setting is 4ch
		Combination 64Gy2ch Combination 2ch CH Sync or
		Channel Sync Data1-4 there is no data ounut at all of
		Data1 toData4.
		This bug does not occur with the MU183020A 32G PPG,
		and it can be used as normal.
		This bug occurs in software versions 8.02.01.
Cannot op	en 4PAM	The following pattern files for generating 4PAM patterns
pattern file	es (CM943:11)	cannot be opened using the MU18302xA 32G PPG:
		• JP03A
		• JP03B
		Squarewave
MP1800A	panel keys do	When software versions prior to V7.09.xx are installed in
not operat	e (CM941:17)	the main frame with Option-x07 installed, the MP1800A
		front-panel keys and rotary encoder fail to operate.
Ver.8.02.01 EOI not re	cognized at	EOI is not recognized as terminate command at GPIB
GPIB rem	ote (CIVI940:69)	remote.
	therpet remote	ALE LITEMENT TEMPOLE, SOMETIMES THE Application clashes
(CM940.6	7)	and sending a query command
Ver 8 00 05 Diagnosti	<u>, tool test</u>	The diagnostic result is Fail if the MP1861/62A Opt-01
result is F	ail when	64Gbit/s Extension is not installed when using the
MP1861A	/62A Opt-01	diagnostic tool with the MP1861A 56G/64Gbit/s MUX and
not install	ed	MP1862A 56G/64Gbit/s DEMUX.
(CM940:9)4)	This happens because the operation bit rate without the
	,	MP1861/62A Opt-01 installed is 56 Gbit/s while the
		diagnostic test is run at 64 Gbit/s.
	10001	I his bug occurs in software versions 8.00.00 to 8.00.04.
	1862A,	Sometimes, the I hreshold Margin result of Eye Margin
Inreshold	i wargin result	Inteasurement using the MP 1862A 64G DEMUX IS Nall the
		This bug occurs in software versions 8 00 00 to 8 00 04
Ver 8 00 04 Sometime	MP1825R	Sometimes the MP1825B 4Tap Emphasis Input setting is
Fmnhasig	settings are	not returned when the settings file is opened
not return	ed at file	This bug occurs in version 8.00.00.8.00.01.8.00.02 and
openina(C	CM940:77)	8.00.03.

Version	Item (Bug Mngt No.)	Phenomenon
Ver.8.00.03	The Jitter amount does not add correctly when the 32G PPG and Emphasis are linked (CM940:84)	When the MU18302xA 32G PPG and MP1825B 4Tap Emphasis are linked, there is an error in the amount of Jitter generated from the MU181500B Jitter Modulation Source and the Jitter amount does not add correctly. This phenomenon occurs when the MU18302xA, MP1825B, and MU181500B are linked, and the actual Jitter modulation amount is half the amount at the MU181500B screen setting. This bug occurs in version 8.00.00,8.00.01 and 8.00.02.
Ver.8.00.02	Sometimes during remote operation, opening a Quick Save file may cause the application to crash (CM089:91) There are some bit rates at which synchronization between 32G PPG modules may be abnormal (CM089:90)	The main application may crash when using the :SYSTem:MMEMory:QRECall remote command to read a Quick Save file. The frequency of this problem depends on the module configuration. At some bit rates, synchronization may not be performed normally between modules using multiple MU183020A 32G PPG units.Errors occur in the data output of the PPG
Ver.7.10.02	Sometimes, the application freezes on exiting with two or more of MU18302xA 32G PPG or MU18304x 32G ED modules installed (CM089:66)	When exiting the main application, sometimes the screen freezes and the main application cannot be terminated normally. This problem occurs when two or more of the following modules are installed simultaneously in the same main frame. MU183020A 28G/32Gbit/s PPG MU183021A 28G/32Gbit/s 4ch PPG MU183040A 28G/32Gbit/s ED MU183041A 28G/32Gbit/s 4ch ED MU183040B 28G/32Gbit/s High Sensitivity ED MU183041B 28G/32Gbit/s 4ch High Sensitivity ED



Version	Item (Bug Mngt No.)	Phenomenon
Ver.7.08.10	Sometimes, synthesizer module firmware update fails when using Setup Utility, leaving module unrecognized	Sometimes, after installing the MX180000A V7.08.09 software, when downloading the synthesizer firmware using the Setup Utility, the firmware does not update normally, leaving the synthesizer module unrecognized. This bug has been observed when the MU183020A/21A 32G PPG, MU183040A/B, 41A/B 32G ED and following modules are installed in the same main frame. MU181000A/B Synthesizer MU181600A XFP MU181601A SFP MU181800A Distributor
Ver.7.08.09	MU181000A/B not recognized by MT1810A sometimes (CM808:32)	Sometimes, the MU181000A/B Synthesizer module is not recognized when installed in the MT1810A 81000A/B and is not displayed on the screen. The following modules are affected by this bug. MU181000A/B Synthesizer MU181600A XFP MU181601A SFP MU181800A Distributor
	Self test fails some items for MU181040A/B (CM808:43)	When the MU181040A/B is installed, the following self-test items fail although the hardware modules are normal: Clock Recovery
Ver.7.08.07	Sometimes, data not output at power-on (CM160807:70) An error occurs at continuous long-term measurement using the	Sometimes, the MU183020A/21A 32 PPG data is not output immediately after power-on. If this happens, switch the main frame power off and on again. An error occurs at continuous long-term measurement using the 32G PPG.Errors occur in the data output when the PPG is operated continuously for long periods.
	32G PPG. (CM160808:20) Fixed bug in 32G ED Auto	When the input amplitude is large (2 Vp-p) in the Auto
	Search Coarse mode (CM160807:71)	Search Mode of the MU183040A/41A 32G ED, sometimes the peak point cannot be searched in the Threshold direction.
	Fixed SJ bug in MU181500B (CM160808:10)	When the modulation frequency of the MU181500B SJ/SJ2 generation function is 100 MHz to 250 MHz, sometimes the actual modulation is about 10% smaller than the set modulation amount.
	Fixed bug in 12.5G ED Auto-Measurement (CM160808:05)	When the MU181040A/B Clock Recovery Opt-20 is installed, sometimes the Eye Diagram auto-measurement operation is abnormal when the recovered clock is used.

Version	Item (Bug Mngt No.)	Phenomenon
Ver.7.08.05	Fixed bug in 12.5G ED	When the MU181040A/B Clock Recovery Opt-20 is
	Auto Search Fine mode	installed, sometimes the Auto Search Fine mode is
	(CM160807:69)	abnormal when the recovered clock is used.
Ver.7.07.00	Fixed bug in 32G ED Auto	Sometimes, search does not find the best point in the
	Search Fine mode	Phase direction when in the Auto Search Fine mode of the
	(CM160807:35)	MU183040A/B and MU183041A/B 32G ED.
	Bug in MP1825B output	Sometimes, the output amplitude momentarily exceeds
	amplitude	the setting when changing the MP1825B Waveform
	(CM160807:40)	Format setting.
Ver.7.04.00	Corrected bug in formula	A bug in the Best Fit Line formula for Bathtub
	for calculating Best Fit	measurement was corrected.
	Line at Bathtub	
	measurement	
	(CM160804:79)	
Ver.7.03.00	Bug in Bathtub	If Bathtub measurement is terminated halfway
	measurement	unexpectedly, sometimes the correct measurement
	(CIVI 160805:05)	
Ver.7.02.00	SSC bug in MU181500B	When the MU181500B Pattern Generator setting is
	(CM160805:00)	switched to Full-rate, the applied Spread Spectrum Clock
		(SSC) modulation deviation becomes twice the set value.
	.	
	Changed to add	The following change was made when clicking the Single
	MU183020A/21A Single	button at the Error Addition tab when the
	EII01 (CM160805:02)	MU 183020A/2TA Combination Setting is 2ch
	(CIVIT00805.02)	[Combination of 4ch Combination. [Before change] Errors are added to all Combination
		interfaces (2 or 4 errors added with one click)
		[After change] An error is added to the clicked interface (1
		error with one click).
	Sometimes, no response	Sometimes there is no command response when
	when repeating specific	repeating the remote command for the Auto Adjust
	remote command	operation.
	(CM160805:07)	
Ver. 7.01.06	Sometimes, Emphasis	When Waveform Format is set to 3Post-cursor or
	cannot be added for	2Pre-cursor, Emphasis cannot be added correctly to the
	specific waveform formats	output waveform when Cursor2 is set to minus (–).
	(CM160804:83)	During long torm remain an arcticle acception of the
	Sometimes, system	During long-term remote operation, sometimes the
	long torm romate	application freezes of crashes. This problem can occur
	operation	
	(CM160804·89)	MU181040A/B 12 5G/14G ED
		MU183020A/21A 32G PPG
		MU183040A/41A 32G ED
Ver. 7.01.06	when repeating specific remote command (CM160805:07) Sometimes, Emphasis cannot be added for specific waveform formats (CM160804:83) Sometimes, system freezes/crashes during long-term remote operation (CM160804:89)	 When Waveform Format is set to 3Post-cursor or 2Pre-cursor, Emphasis cannot be added correctly to the output waveform when Cursor2 is set to minus (–). During long-term remote operation, sometimes the application freezes or crashes. This problem can occur with the following module configurations: MU181020A/B 12.5G/14G PPG MU181040A/B 12.5G/14G ED MU183020A/21A 32G PPG MU183040A/41A 32G ED

Version	Item (Bug Mngt No.)	Phenomenon
Ver. 7.01.01	MU181040A/B Frame OFF sync bug (CM160804:76)	Sometimes, normal synchronization is not achieved when the MU181040A/B Sync Control is set to Frame OFF.
	Auto Search Fine mode reproducibility bug (CM160804:66)	Sometimes, the measurements results are much bigger than the expected value at measurements that repeat the Auto Search Fine operation.
	MU181500B SJ Setting bug (CM160804:80)	Sometimes, when combined with the PPG and changing the MU181500B SJ/SJ2 Amplitude setting, a bit shift occurs in the PPG Data output.
Ver.6.03.01	Auto-measure ps units display bug (CM160804:59)	When Phase Units is set to [ps] at the Eye Margin, Bathtub, Q measurement and Auto Search screens, no value is displayed after the decimal point for the Phase measurement result.
Ver.6.03.00	Settings file compatibility bug (CM160803 :99)	PPG settings file saved with Ver. 3.00.0x cannot be opened with Ver. 6.00.0x.
Ver.6.02.00	Sometimes, there is a bug in Bathtub measurement reproducibility (CM160804 :23)	At repeated Bathtub measurements, sometimes the reference Threshold voltage changes. As a result, the measured value changes.
	Sometimes, the system crashes when executing Eye Diagram measurements with a particular configuration (CM160804 :22)	Sometimes, the system crashes when executing Eye Diagram measurements immediately after the configuration is changed to 2ch Combination.
Ver. 6.00.06	Sometimes, there is a bug at MU181500B BUJ LPF setting (CM160803 :90)	When the MU181500B Jitter Modulation Source BUJ Low Pass Filter is set, the 500 MHz filter settings may be displayed and not displayed repeatedly close to a carrier frequency of 4 GHz and normal selection is impossible.
Ver. 6.00.05	Sometimes, Bathtub measurement is not completed (CM160803 :56)	Sometimes, Bathtub measurement does not proceed and does not end even after a long time period has elapsed.
	Sometimes, the PPG output pattern is abnormal (CM160803 :69)	Sometimes, a normal pattern is not output from the MU181020A/B PPG for the F module configuration shown in Table 1.2.1-3.
	Sometimes, a pattern file read error occurs (CM160803 :68)	If the number of characters on one line of the pattern file (.txt file) exceeds 70, it cannot be read by the MU181020A/B PPG and the MU181040A/B ED.

Version	Item (Bug Mngt No.)	Phenomenon
Ver. 6.00.03	Sometimes, an error may occur in the output pattern (CM160803 :54)	When using non-PRBS pattern types, sometimes there may be an error in the output of the MU181020A/B PPG.
	Occasionally there may be random dispersion in Eye margin measurement results (CM160803 :53)	When repeating Eye margin measurements under the same conditions using the MU181040A/B ED or MU182040A/41A DEMUX, occasionally there may be large random dispersion in the measurement results.
Ver. 5.04.02	In some configurations, an error may sometimes occur in the output pattern	With the A, B, C, J and K modules listed in Table 1.2.1-2, sometimes there is an error in the MU181020A/B PPG output pattern.
	In Ch Sync mode, sometimes, pattern generation position may slip (CM160803 :42)	When the MU181020A/B PPG pattern type is set to Mixed Data or Mixed Alternate and the pattern type is switched to PRBS after pattern editing, sometimes the Channel Synchronization mode output pattern creation position may slip.
Ver. 5.04.00	Depending on configuration, sometimes Capture function does not operate normally (CM160803 :11)	With the module configuration L or O shown in Table 1.2.1-3, sometimes the ED capture function does not operate normally with 4ch Combination.
	Sometimes, system timeout occurs when executing ED Auto Search with specific configuration (CM160803:10)	With the module configuration L or O shown in Table 1.2.1-3, sometimes the system times out when executing Auto Search at the MU181040A with 4ch Combination.
Ver. 5.03.01	MX180000A-x01,x02 Pre-Code, De-Code DQPSK bug (CM160802:73)	Incorrect operation of the MX180000A-x01 Pre-Code, and MX180000A-x02 De-Code DQPSK causes incorrect Pre-Code/De-Code.
	Application causes system crash at Initialize (CM160801:90)	When the MU181040A/B is installed, sometimes the system crashes at Initialize, Combination switching, or Self Test.



Version	Item (Bug Mngt No.)	Phenomenon
Ver. 5.02.08	Bug causes DEMUX Eye margin results to be small (CM16080:33)	At Eye margin measurement using the MU182040A/41A DEMUX, the measurement results displayed in the Phase are direction are small. Depending on the input data phase, sometimes normal measurement is impossible because at measurement in the Phase direction, the movable Delay range appears to be exceeded.
	Bug causes incorrect operation of ED Auto Search Fine mode (CM16080:19)	When the MU181040A/B ED input data setting is Differential50 Ω /100 Ω , sometimes, operation is abnormal when Auto Search Fine is executed.
Ver. 5.02.07	Error in PPG output pattern (CM16080:88)	Sometimes, there may be errors in the MU181020A/B PPG output pattern.
Ver. 5.02.05	Bug in MU181020A/B-013 output (CM16080:63)	Sometimes, the Data/XData Output is not correct when using the MU181020A/B-013 and setting a larger Cross Point than 85.1%.
Ver. 5.02.04	Errors not added correctly at Mixed Data pattern setting (CM160801:158)	When the Mixed Data test pattern is set at the MU181020A/B, errors are added to the entire Area when Error Addition is set to ON irrespective of the Area setting for Error Addition at the Error Addition tab.
Ver. 5.01.00	Bug in MU182040A/41A Eye Margin Measurement (CM16080:47)	At Eye Margin measurement with the MU182040A/41A DEMUX, when starting measurement with Auto Search ON, sometimes an illegal error is detected and measurement aborts.
	Sometimes, EI Count performed at Error Free (CM16080:43)	With four MU181040A/B modules installed, when the Combination setting is set to Independent, sometimes El is counted, irrespective of the error free status.
	Sometimes, measurement not restarted correctly at 2ch Combination setting (CM16080:39)	With four MU181040A/B modules installed, when the Combination setting is set to 2ch Combination, when the measurement cycle setting is changed during measurement, sometimes measurement is not restarted normally.
Ver. 5.00.04	Sometimes, Pattern Sync not output correctly (CM18430:70)	Sometimes, Pattern Sync is not output correctly when using the MU181020A and MU181040A and setting a large value for Pattern Sync Position when the test pattern is PRBS and then changing the test pattern to Mixed Data.
	Sometimes Defined Interface not set correctly (CM18430:20)	When Defined Interface is set to NECL at the MU181020A, sometimes the Amplitude is not set correctly.
	Errors when reading Data Input settings file (CM18430:19)	When reading a settings file at the MU181040A, sometimes the Data Input settings items are not set correctly. The settings at the application screen are correct but the internal settings are different from the screen settings, so operation is abnormal.
Ver. 4.01.01	Sometimes, Threshold value cannot be set correctly after executing Auto Adjust (CM160800:81)	Using the MU181040A, when a large change is made to the Offset value of the input signal data while the Auto Adjust function is executing and then Auto Adjust is set to Off, sometimes, the input Data Threshold value cannot be set correctly.

Version	Item (Bug Mngt No.)	Phenomenon
Ver. 4.00.01	Optimized Bathtub measurement point number (CM160800:63)	The number of phase direction measurement points for auto Bathtub measurement is optimized, shortening measurement times compared to previous versions. In addition, the TJ, DJ, and RJ calculation method has changed. When reading measurement results files created with Ver. 4.00.00 or earlier, although the TJ, DJ, and RJ values are calculated using the old calculation method and displayed, when the [Calculation Error Threshold] setting is changed, the displayed results are recalculated using the new Ver. 4.00.01 calculation method.
Ver. 4.00.00	When MU181020A inserted in Slot 3 or Slot 4, sometimes Gating Output abnormal (CM160800:55)	When the MU181020A is inserted in Slot 3 or Slot 4 of the MP1800A/MT1810A-015 and the frequency is set to 8.8 to 9.0 GHz, sometimes the Gating Output is abnormal. If this phenomenon occurs, insert the MU181020A in Slot 1 to obtain the normal Gating Output.
Ver. 3.00.02	Sometimes, error buzzer sounds in error-free condition (CM133800:76)	When the error buzzer is set to ON with only the MU181040A inserted in slot 1 and 2, or slot 1, 2 and 3 of the MP1800A-015/MT1810A-015, sometimes, the error buzzer sounds irrespective of whether there is an error or not.
	Sometimes, Jitter output abnormal at power-on (CM160800:04)	When the power is set to off and then on again while the MU181000A/B-x01 Jitter Output is ON and the Modulation Frequency is set to Hz or kHz, sometimes, the Jitter output is abnormal. If this phenomenon occurs, normal output can be recovered by toggling the Jitter Output ON/OFF.
	Self test fails some items for MT1810A Unit 2 to 4 (CM160800:07)	Sometimes, the following self-test items fail the hardware test when the MT1810A Main Frame ID is set to 2 to 4 although the hardware modules are normal: Frequency Coverage, Data Output, Pattern Test, Data Amplitude, Clock Recovery, Module Operation To prevent this phenomenon, set the Main Frame ID to 1 when running the MT1810A self test.
	Sometimes, MU181020A-001 Aux Output settings not backed-up correctly (CM160800:50) MU181600A unable to identify XFP module correctly (CM160800:51)	When the MU181020A-001 CMU Bit Rate Frequency units are set to kHz, sometimes, the Aux Output 1/N Clock setting is not backed-up correctly. When 1/N Clock is set to 64 or more and the application is restarted, the setting is set incorrectly to 63; reset the correct value manually. The Anritsu-recommended 850 and 1550 nm XFP modules cannot be correctly identified by the MU181600A. As a result, the output optical wavelength is not displayed.

Version	Item (Bug Mngt No.)	Phenomenon
Ver. 2.00.00	Saving settings file (CMN001)	Although MU181020A and MU181040A settings can be saved to the specified folder using Save and Quick Save at the MX180000A File menu, required Save data is also saved outside the specified folder. This does not cause any problems in normal usage but when copying this saved settings data to another instrument, note that the other instrument is not able to read this settings data.
	Clock setting disabled for ED (CMN122037:43)	When the ED Clock Delay option (MU181040A-x30) is not installed, if remote command INPut:CLOCk:CALibration, which cannot be responded to without the Clock Delay option, is transmitted, the Clock setting screen is grayed out and operation is disabled.
Ver. 1.01.03	At continuous operation, sometimes, Connection Disconnect error occurs (CM122036:85)	At continuous operation with either only the MU181040A installed or both the MU181000A and MU181040A installed, sometimes a Connection Disconnect error occurs at around 12 hours of operation.
	At alarm, sometimes error buzzer sounds (CM122037:00)	At an alarm/error buzzer operation, sometimes, the error buzzer is masked at an alarm, and sometimes, the error buzzer sounds at an alarm.
	Sometimes, pattern file for existing MP1632C not read (CM122037:29)	Sometimes, a pattern file created using the existing MP1632C cannot be read.
	Sometimes, no Aux output at power-on (CM122036:89)	At power-on when the test pattern is Mixed pattern and Aux output is set to Pattern Sync, there is no output from Aux output. In this case, change the Aux output setting to 1/N Clock and then back to Pattern Sync to recover the Aux output.
	Sometimes, threshold setting slips at remote control (CM122036:94)	When a negative value is set using the remote command:INPut:DATA:THReshold, the set value slips by 0.001 V.
	Sometimes, application quits abnormally when querying capture status using remote command (CM122037:21)	After performing capture by remote command, sometimes the application quits abnormally when querying the capture status using the remote command :SENSe:CAPTure:ACQuisition:STATe?
	After starting main unit, sometimes unable to set Sequence Match Pattern by remote control (RMT001)	When restarting the MP1800A/MT1810A after initializing the MX180000A and then selecting Sequence at the ED Pattern screen Test Pattern setting, when Match Pattern is set using the remote control command without displaying the Match Pattern Condition screen, sometimes, the setting cannot be performed correctly. In this case, display the Match Pattern Condition screen again and perform remote control after closing the screen using the OK button. In addition, when a Sequence pattern Block is added, advance perform Match Pattern continue for the added Plant.

2 Known Software Bugs

U CORPORATIO

Version	Item (Bug Mngt No.)	Phenomenon
Ver. 7.04.00	Sometimes, output pattern bits drift when frequency changed	Sometimes, the output pattern bits drift between channels when using the MU183020A 32G PPG in the Inter-module Synchronization mode, the MU183021A 32G 4ch PPG in either the Combination or Channel Synchronization mode and changing the frequency. This bit drift can be removed by clicking the Data1~4 Delay Calibration button.
Ver. 7.03.00	Sometimes, synchronization not achieved when Combination and Mixed pattern set	Synchronization is not achieved sometimes when using the MU181040A/B ED and setting Mixed pattern at 2ch/4ch Combination.
Ver. 5.04.02	Sometimes, Sync Loss occurs at bit rates of 6 Gbit/s or less using MP1800A-14 option (CM160802 :90)	Sync Loss may occur sometimes when using the MP1800A-14 option at bit rates of 6 Gbit/s or less. Workaround by resynchronizing by toggling the MU181040A/B ED Auto Sync ON/OFF.

24/41

3 Added Functions

The following functions have been added to the relevant version.

Version	ltem	Function
Ver.8.02.03	Added presettings file for using PCIe to MP1825B	A presettings file for using PCIe Gen 3 has been added to the Co-efficient settings of the MP1825B.
	Emphasis Added Mask evaluation function to 32G ED Eye	A Mask evaluation function has been added to the Eye Contour settings of the MU183040A/B and MU183041A/B 32G ED.
	Upgraded 32G ED auto-measurement	The MU18304xA/B 32G ED auto-measurement function now supports Differential 100-Ω input. The upgraded auto-measurements are: • Eye Margin
		 Eye Diagram Bathtub Q Analysis Eye Contour
	Upgraded 32G ED PAM BER measurement	A manual setting function for Threshold and Phase has been added to the MU18304xB 32G High-sensitivity ED PAM BER measurement function. As a result, each Eye BER measurement point can be fine-adjusted.
	Added ESD/EOS Video replay function	A function has been added for playing the video explaining ESD/EOS countermeasures at software start-up.
Ver.8.02.01	AddedremotecommandstoMP1825BEmphasis	Commands have been added to the MP1825B to switch the Clock rate when linked with the MP1825B. :SYSTem:INPut:CRATe :SYSTem:INPut:CRATe?
	Added 4PAM pattern files for 32G PPG and 32G ED	Pattern files have been added for 4PAM signal generation and BER measurement when using the MU18302xA 32G PPG and MU18304xB 32G High sensitivity ED as follows:
		PRBS13Q, GrayPRBS13Q, PRQS10, SSPR, JP03A, JP03B, Squarewave Refer to Appendix G of the MU18302xA 32G PPG
	Added quick	operation manual and Appendix F of the MU18304xB 32G ED operation manual for use of the pattern files.
	settings for standard bit rates to 32G PPG	added to the MU18302xA 32G PPG. The supported bit rate is set by selecting the standard.
	Added functions to customized screen	A setting file function has been added to the customized screen. The customized setting items can be saved/opened at the File menu. In addition, the following presets file has been added. Clock Setting (Jitter and 32G PGG tracking) Jitter_Emphasis_BER (Jitter, Emp, 32G ED Result display)

25/41

	Added 4PAM signal BER measurement function to 32G ED Upgraded RJ modulation function for MU181500B	A 4PAM signal BER measurement function has been added to the MU18304xB 32G High sensitivity ED. The Total bit rate for the 4PAM signal can be measured using either ED 1ch or ED 3ch. A p-p/rms conversion coefficient setting has been added to the RJ modulation function of the MU181500B Jitter Signal Source.
	Added Eye Contour function to 32G ED	An Eye Contour function has been added to the MU183040A/B and MU183041A/B 32G ED. The measurement time is shortened in comparison to Eye Diagram, and the measurement accuracy is improved by upgrading the Estimate method.
	Upgraded 32G ED PAM Auto Search function	The MU18304xB 32G High sensitivity ED 4PAM Auto Search function has been upgraded to support Differential input.
	Added PAM Auto Search function to 32G ED Auto Measurement	The PAM Auto Search function has been added to each MU18304xB 32G High sensitivity ED Auto Measurement. PAM Auto Search can be set at each of the Eye Margin, Eye Diagram, Bathtub, and Q Analysis screens.
Ver.8.00.02	Upgraded 32G PPG Multi-channel Calibration function	Part of the MU18302xA 32G PPG Multi-channel Calibration function has been changed and upgraded. When using an external synthesizer, previously a 16.05-GHz clock was required but calibration can now be performed using clocks up to 12.5 GHz.
	Upgraded 14G PPG Multi-channel Calibration function	Part of the MU181020B 14G PPG Multi-channel Calibration function has been has been changed and upgraded. When the 14G PPG and MU181000A/B 12.5G synthesizer are installed in the same main frame, calibration can be performed automatically up to 12.5 Gbit/s.

Version	Item	Function
Ver.8.00.01	Added supported	Support for the following modules has been added:
	modules	MP1862A 56G/64G bit/s MUX
Ver.7.10.01	Added MP1800A	The MP1800A-x07 (OS Upgrade to Windows7) has been
	option	added.
Ver.7.09.02	Added MU181500B Jitter Signal Source function	Extended MU181500B SJ and SSC operation range. The maximum Jitter generation amounts are as follows: SJ (Linked operation with MU18202xA 32G PPG) 50UI -> 2000UI @ 10 Hz to 0.1 MHz 50UI -> 200UI @ 0.1 to 1 MHz 10UI -> 16UI @ 1 to 10 MHz 0.55UI -> 1UI @ 10 to 250 MHz SSC 5000 ppm -> 5300 ppm 34 kHz -> 37 kHz
	Added MP1825B 4 Tap Emphasis function	Added Coefficient setting. It is possible to output De-Emphasis waveform in conformance with each standard.
	Added MU183040A/B 32G ED function	Added PAM Auto-Search function to MU183040B and MU183041B 32G ED. This searches for optimum threshold for 4PAM signal and optimum phase. Added Auto-Measurement Q Analysis function to
Ver.7.08.07	Added module combinations for installation in MP1800A and MT1810A	MU183040A/B and MU183041A/B 32G ED. Added support for simultaneous installation of MU181020A/B, MU181040A/B, and MU183020A/40A modules in either MP1800A or MT1810A. Refer to section 1.2.3 for the restrictions on 32G PPG and ED Installation Slots and 1.2.4 for the restrictions on simultaneous installation of the PPG and ED, or 32G PPG and ED.
	Added MP1825B 4 Tap Emphasis function	Added function for setting negative value at Cursor1 to following Waveform Formats 1Post/1Pre-cursor
		When MP1825B is linked with MU183020A/21A and the Delay (Option x30/31) is installed in the MU183020A/21A, the Data/Clock phase difference can be adjusted by Data/Clock Adjustment function. In this case MP1825B-04 Variable Data Delay and MP1825B-06 32.1Gbit/s Extension are not required.

Version	Item	Function
Ver.7.08.04	Added MU183040B/41B-2 2/23 options	The following options have been added to the MU183040B/41B 32G ED: MU183040B/41B-22 2.4G to 28.1G Clock Recovery MU183040B/41B-23 25.5G to 32.1G Clock Recovery
	Added function for 32G PPG, and 32G ED	The grouping function has been added to the MU183020A/21A 32G PPG, MU183040A/41A, and MU183040B/41B 32G ED. The grouping function supports batch setting of Output/Input and Pattern for multiple channels of the 32G PPG and 32G ED.
Ver.7.07.00	Added MP1825B 4 Tap Emphasis function	A De-Emphasis setting has been added. The 1Post/1Pre-cursor Waveform Format is supported. Switching with the existing Pre-Emphasis setting is supported. 1Post/2Pre-cursor has been added to the Pre-Emphasis setting Waveform Format. A function for switching the Cursor setting units has been added. Setting Units: dB, Vp-p, %
	Added MU183020A/21A 32G PPG function	The Half Period Jitter function has been added. This function supports adjustment of the Half Period Jitter (width in EYE Pattern phase direction).
	Added MU181500B Jitter Signal Source function	The SJ and SJ2 setting resolutions have been changed. The setting resolutions have been changed to 0.00xUI at the following modulation frequencies (Fm). 10 kHz \leq Fm \leq 1 MHz 0.xUI \rightarrow 0.00xUI 1.000001 MHz \leq Fm \leq 10 MHz 0.0xUI \rightarrow 0.00xUI x = 1, 2, or 4
Ver.7.06.02	Added supported modules	Support for the following modules has been added: MU183040B 28G/32G bit/s High Sensitivity ED MU183041B 28G/32G bit/s 4ch High Sensitivity ED
	Added MP1825B option	The MP1825B-006 (32.1Gbit/s Extension) has been added. When MP1825B is linked with MU183020A/21A and the Delay (Option x30/31) is installed in the MU183020A/21A, the Data/Clock phase difference can be adjusted by Data/Clock Adjustment function. In this case MP1825B-04 Variable Data Delay is not required.
	Added 32G Unit Sync Function	Added function for synchronizing output pattern between multiple MP1800A units. It is possible to output up to 16 channels of synchronized signals when using four MP1800A units with installed MU183020A/MU183021A.

Version	Item	Function
Ver.7.04.00	Added Multi-	Added Multi Channel Calibration function used by
	Channel	MU183020A/21A Multi Channel function and by
	Calibration function	synchronization function between modules under
	(for 32G PPG)	optimum conditions.
	Added module	Added support for simultaneous installation of
	combinations for	MU181020A/B, MU181040A/B, and MU183020A/40A
	Installation in	modules in either MP1800A or MI1810A.
		Refer to section 1.2.4 for the restrictions on simultaneous
	WITTOTOA	
	Added	Added support for user customized operation of the
	user-customizable	following modules:
	modules	MU181500B,
		MU183020A/21A/40A/41A
	Added Bathtub	Added function to Bathtub measurement results for
	measurement	displaying J2 and J9.
	function	
Ver. 7.03.00	Added	Added Capture function to MU183040A/41A to capture
	MU183040A/41A	and analyze test patterns.
	functions	
	Added	Added function to MU183020A/21A for driving at 1/4
	MU183020A/21A	Clock Frequency for output Data Bitrate.
	functions	When Clock Source is set to External, this function
		supports driving at bit rates of 25.0 to 32.1 Gbit/s at input
		of a clock of 6.25 to 8.025 Gbit/s.
Ver. 7.02.00	Added 1/4 Clock	Added 1/4 rate clock mode to MU181500B. As a result,
	Mode to	can now add jitter to pattern generation source operating
	MU181500B	at 1/4 clock rate.
Ver. 7.01.01	Added supported	Support for the following modules has been added:
	modules	MU183021A 28G/32G bit/s 4ch PPG
Vor. 7.00.06	Added supported	NU 18304 TA 28G/32G DIVS 4CT ED
ver. 7.00.00	modules	MU183020A 28C/32C bit/c DDC
	modules	MU183040A 28G/32G bit/s FD
Ver. 6.03.00	Added MP1825B	Added function for setting negative value at Cursor2 to
	4Tap Emphasis	following Waveform Formats
	function	2Post/1Pre-cursor
		3Post-cursor
		2Post-cursor
		Added function for calculating optimum emphasis setting
		depending on DUT characteristics.
		Requires DUT S-parameter file to calculate settings.
		Adds 2Pre-cursor to Waveform Format.

Version	Item	Function
Ver. 6.02.00	Shorten auto-measure time	Reviewed MU181040A/B ED and MU182040A/41A DEMUX auto-measurement sequences (Eye Margin, Eye Diagram, Bathtub) and shortened measurement times.
	Support for Windows 7 PC operating system	Added support for Windows 7 OS for PC controller.
Ver. 6.00.00	Added supported modules	Support for the following modules has been added: MU181500B Jitter Modulation Source MP1825B 4Tap Emphasis
	Added MU182020A/21A and MU182040A/41A option	The MU182020A/21A-003 (28.1Gbit/s Extension) and the MU182040A/41A-003 (28.1Gbit/s Extension) have been added.
	Optimized measurement sequence for Auto Search Fine mode	Optimizing the measurement sequence of the Fine mode of the Auto Search function of the MU181040A/B Error Detector and MU182040A/41A DEMUX makes it possible to determine the optimum voltage threshold and phase even when the input data amplitude is small.
Ver. 5.04.00	Added Multi Channel Calibration Function	Added Calibration function to use Channel Synchronization and Combination functions under optimum conditions with multiple MU181020A/B PPG units.
Ver. 5.03.01	Added Unit Sync Function	Added function for synchronizing output pattern between multiple MP1800A units. It is possible to output up to 16 channels of synchronized signals when using four MP1800A units with installed MU181020A/B options.
	Added remote control commands	The following remote control commands have been added: Command for switching each module screen and tabs :DISPlay:ACTive Command for switching items displayed at Result tab of MU181040A/B and MU182040A/41A :SENSe:DISPlay:SETTing :DEMux:DISPlay:SETTing Refer to the MX180000A Control Software Remote Control Operation Manual (M-W2799AE) for the

Version	Item	Function
Ver. 5.02.08	Added Enhanced (high-speed processing) mode to Ethernet interface for remote control	The Enhanced (high-speed processing) mode has been added to the Ethernet interface for remote control. When Ethernet is selected at the Remote Control tab of the Setup Utility, either the Normal mode (previous mode) or Enhanced mode (high-speed processing mode) can be selected. When the Enhanced mode is selected and the Apply button is clicked, the Enhanced mode is enabled when the Application is started, speeding up remote control processing over the Ethernet interface.
	Added MU181020B and MU181040B option	The MU181020B-003 (14.05Gbit/s Extension) and the MU181040B-003 (14.05Gbit/s Extension) have been added.
Ver. 5.02.04	Added MX180000A-x01 and –x02 Pre-Code and De-Code options	The MX180000A-x01 Pre-Code and –x02 De-Code options plus supporting remote commands have been added to the product line. As a result, precode data can be generated and precoded data can be decoded.
Ver. 5.01.01	Expanded MU181020A/B-x13 option cross point setting range	The upper limit of the cross point setting range for the MU181020A/B-x13 option has been increased from 85% to 90%.
	Changed output ON/OFF control when MU181020A Data Output option not installed	The ON/OFF output control when there is no MU181020A Data Output option has been changed as follows: Before change: No ON/OFF function After change: Added ON/OFF control (However, ALL0s pattern output at OFF)
Ver. 5.00.04	Added supported modules	Support for the following modules has been added: MU181020B 14 Gbit/s PPG MU181040B 14 Gbit/s ED MU182020A 25 Gbit/s 1ch MUX MU182021A 25 Gbit/s 2ch MUX MU182040A 25 Gbit/s 1ch DEMUX MU182041A 25 Gbit/s 2ch DEMUX MU181800B 14 GHz Clock Distributor



Version	Item	Function
Ver. 4.01.00	Added MU181020A Data Output option	The MU181020A-x13 (Variable Data Output (0.5 to 3.5Vp-p)) has been added along with supported remote commands.
	Changed setting resolution for ED clock recovery frequency	The clock recovery frequency setting resolution for the MU181040A-001 and MU181040A-x20 is changed from 2 MHz to 1 kHz. In addition, the setting frequency for a specified resolution can be displayed in kHz. Refer to item 4. Usage Precautions.
Ver. 4.00.00	Added MU181620A and MU181640A to supported modules	The MU181620A Stressed Eye Transmitter module and the MU181640A Optical Receiver module have been added to the supported modules.
Ver. 3.00.00	Added MU181000B to supported modules	The MU181000B 4-port Synthesizer module has been added to the supported modules.
	Added MU181000A/B Jitter Modulation option	The MU181000A/B-x01 (Jitter Modulation) has been added along with supported remote commands. As a result, Jitter generation is supported.
	Added Jitter Input On/Off to PPG and ED	Along with adding a synthesizer Jitter generation function, both a Jitter Input On/Off function and related remote commands have been added to the PPG and ED. These functions are only enabled when the MU181020A-x30/MU181040A-x30(Data/Clock Delay options) is installed.
	Added FPGA download function for PPG and ED to Setup Utility	An FPGA download function for the PPG and ED has been added to the Setup Utility, supporting FPGA downloads at version upgrades.
Ver. 2.00.00	Mounting of multiple PPG and ED modules supported	Two or more PPG and/or ED modules can be mounted, enabling the Channel Synchronization and 4Ch Combination functions.
Ver. 1.01.03	Added Frequency	The Frequency Coverage Test checks that there are no
Ver. 1.01.02	Coverage Test to	enors in all requency bands at the Self Test.
	Self Test	
Ver. 1.01.01	Added Enhanced (high-speed processing) mode to GPIB interface for remote control	Ine Enhanced (high-speed processing) mode has been added to the GPIB interface for remote control. When GPIB is selected at the Remote Control tab of the Setup Utility, either the Normal mode (previous mode) or Enhanced mode (high-speed processing mode) can be selected. When the Enhanced mode is selected and the Apply button is clicked, the Enhanced mode is enabled when the Application is started, speeding up remote control processing over the GPIB interface.

4 Usage Notes

CORPORA

The precautions for using each version are described below.

4.1 Ver. 1.00.00 and Later

4.1.1 Compatibility of Ver. 1.00.00 and Ver. 0.00.xx Settings Files

Note the following restrictions when using Version 1.00.00 to read settings files saved with Version 0.00.xx of the MX180000A control software version for the MP1800A/MT1810A.

1 When reading settings files saved with Version 0.00.19 and earlier using Version 1.00.00.

	Readable	Remarks
1. Normal Save Setting File		
MU181000A	Yes	
MU181020A	No	
MU181040A	No	
MU181600A	Yes	
MU181601A	Yes	
2. Quick Save Setting File	No	
3. Test Pattern File		The test pattern file is saved from each Pattern Editor screen of the PPG and ED.
Data Pattern	Yes	
Alternate Pattern	Yes	Only PPG
Mixed—Data Pattern	Yes	When Row Length is less than 768 bits, it is changed to 768 bits. In addition, when the difference of Row Length and Data Length is less than 256 bits, Row Length and Data Length are adjusted so that the difference becomes 256 bits.
Mixed—Alternate Pattern	Yes	Only PPG When Row Length is less than 768 bits, it is changed to 768 bits. In addition, when the difference of Row Length and Data Length is less than 256 bits, Row Length and Data Length are adjusted so that the difference becomes 256 bits.
Sequence Pattern	Unsupported	Versions earlier than 1.00.00 do not support the Sequence pattern function.

	Readable	Remarks
1. Normal Save File	—	
MU181000A	Yes	
MU181020A	Yes	1. Note that when upgrading to Version 1.00.00, if an uninstall is executed instead of installing over, it is not possible to read
MU181040A	Yes	 If the difference between the Enable Period and Burst Cycle set in the Burst mode of the Pattern Sequence at the Misc. screen is less than 512 bits, it is changed to 512 bits.
MU181600A	Yes	
MU181601A	Yes	
2. Quick Save File	Yes	 Unable to read if there is not a complete match between modules and options configurations. Note that when upgrading to Version 1.00.00, if an uninstall is executed instead of installing over, it is not possible to read settings files because all files are deleted. If the difference between the Enable Period and Burst Cycle set in the Burst mode of the Pattern Sequence at the Misc. screen is less than 512 bits, it is changed to 512 bits.
3. Test Pattern File		The test pattern file is saved from each Pattern Editor screen of the PPG and ED.
Data Pattern	Yes	
Alternate Pattern	Yes	Only PPG
Mixed – Data Pattern	Yes	When Row Length is less than 768 bits, it is changed to 768 bits. In addition, when the difference of Row Length and Data Length is less than 256 bits, Row Length and Data Length are adjusted so that the difference becomes 256 bits.
Mixed—Alternate Pattern	Yes	Only PPG When Row Length is less than 768 bits, it is changed to 768 bits. In addition, when the difference of Row Length and Data Length is less than 256 bits, Row Length and Data Length are adjusted so that the difference becomes 256 bits.
Sequence Pattern	Unsupported	Versions earlier than 1.00.00 do not support the Sequence pattern function.

2 When reading settings files saved with Version 0.00.20 or later using Version 1.00.00

4.1.2 Precautions when using Q Analysis Measurement Function

When performing Phase vs Q measurement using the Q Analysis function with Auto Search OFF, measurement starts from the center of the area specified by Measurement Range. When measurement starts, the internal processing starts Eye Margin measurement from the first measurement point but if an error exceeding the specified Error Threshold is detected at this measurement point, it is determined as an Eye Measurement failure. If Eye Margin measurement fails, change the Start position at Measurement Range and start the measurement again.

4.1.3 Note on Changing File Names

If the names of setting and pattern files saved by the MP1800A/MT1810A are changed, the files will become unreadable. DO NOT change the names of files.

4.1.4 Note on Disconnecting LAN Cable during Remote Operation

If the LAN cable between the MT1800A and controller PC (or to a hub between them) is unintentionally disconnected while the MP1800A is being remotely controlled over Ethernet, sometimes remote control will be disabled when the cable is reconnected. In this case, press the Remote/Local button on the front panel of the MP1800A and if the connection is not re-established, quit the main application and restart from the Selector screen.

4.1.5 Notes When Connecting Two or More Main Frames via GPIB

When two or more MP1800A units are connected via GPIB, these connected units may not be recognized, depending on the version of the GPIB card used. In this event, change the settings for each MP1800A unit using the following procedure.

- From the Start menu of Windows XP on the MP1800A, select Programs → National Instruments → Measurement & Automation.
- 2) The MAX screen is displayed. On this screen, right-click GPIB1 (AT-GPIB/TNT) in a tree display of Devices and Interfaces, then select [Properties...].
- The GPIB Configuration screen is displayed. On this screen, click GPIB1 from GPIB Board, then click the Configure button.
- The Configure screen is displayed. Click the Software>> button and clear the System Controller checkbox on the screen. Then, click the OK button to close the screen.

4.1.6 Notes When Turning Off MP1800A

When the Power button is pressed to shutdown the MP1800A, normally, Windows should terminate, the screen should go dark and the back-panel fan should stop, but sometimes the front-panel Power button lamp remains lit and the back-panel fan continues turning. When this happens, forcibly stop by pressing the front-panel Power button for more than 4 seconds.

4.1.7 Updating by Downloading FPGA for PPG and ED using Setup Utility

Version 3.00.00 supports downloading of the FPGA for the PPG and ED. When upgrading to Version 3.00.00 from an earlier version, when running the FPGA download for the PPG and ED from Setup Utility, first download MP1800A_Logic.syst to V3.00.00 and when that download is completed, then download the FPGA for the PPG and ED (MU181020A_PPG_MAIN.FPGA; MU181020A_PPG_opt_Delay.FPGA;

MU181040A_ED_MAIN.FPGA; and MU181020A_ED_opt_Delay.FPGA).

Downloading is not possible if the version of MP1800A_Logic.syst is earlier than V3.00.00. Downloading as one object takes about 10 minutes. After downloading the FPGA for the PPG and ED, ALWAYS switch the MP1800A and MT1810A power off and on.

4.1.8 Note on Auto Adjust Function of MU181040A ED

When using the Auto Adjust function of MU181040A 12.5 Gbit/s ED, use it not only according to the specifications given in the operation manual, but also within the following range:

As for Input Format, the number of rising/falling edge ratio relative to Pattern Length is 1:5 or more.

4.1.9 Note on MU181040A ED Settings File and Command Compatibility

From Version 4.01.00, there are two restrictions as follows on the compatibility of MU181040A 12.5 Gbit/s ED settings files and remote commands.

- 1. Settings files (.ED and .CND) created using Version 4.01.00 cannot be read using Version 4.00.xx and earlier. However, settings files created using Version 4.00.xx and earlier can be read using Version Ver.4.01.00.
- 2. The number of digits in the response to a query command has changed for remote commands :INPut:CLOCk:CRFReq? And CFQ?.

4.1.10 Precautions about Remote Control Performance Setting

From Ver. 5.02.08, it is possible to select two modes (Normal and Enhanced) at the GPIB and Ethernet interfaces.

- 1. Select either the Normal or Enhanced mode at the [Remote Control] tab of the Setup Utility. Refer to the MX180000A operation manual for details about each mode.
- 2. When the Enhanced mode is selected, the following command supporting increased speed is enabled at Remote control.

Refer to the MX180000A Remote Command operation manual for details about the command.

:SYSTem:DISPlay:RESult / :SYSTem:DISPlay:RESult?

 When changing the setting between Normal and Enhanced, sometimes it may be necessary to adjust the wait times for each process of customer-created remote scenario programs.

Example: If a remote program that runs without problems in the Normal mode stops in the Enhanced mode, optimize the wait time of the process that occurs before the command that stops.

4.1.11 Notes on MU181020B and MU181040B-003 Option Model Display

The model and name of the MU181020B-003 and MU181040B-003 options are recorded on the front panel of each module. Although the screen displaying the option details using software indicates MU181020B-02 (0.1 to 14 Gbit/s) and MU181040B-02 (0.1 to 14 Gbit/s) the assured operating bit rates are actually 0.1 to 14.05 Gbit/s.

4.1.12 Notes on MU182020A/21A and MU182040A/41A-003 Option Model Display

The model and name of the MU182020A/21A-003 and MU182040A/41A-003 options are recorded on the ejector of each module. Although the screen displaying the option details using software indicates MU182020A/21A-01 (28 Gbit/s Extension) and MU182040A/41A-01 (28 Gbit/s Extension) the assured operating bit rates are actually 8.0 to 28.1 Gbit/s.



4.2 Notes on Ver. 6.02.00 and Later

4.2.1 Precautions when using Windows 7 OS on external controller PC

When installing the MX180000A of the MT1810A control software in a PC running the Windows 7 OS, the onscreen keyboard cannot be used at the first start immediately after the install. This is caused by program compatibility.

Use the program compatibility assistant function (PCA) to optimize the settings and then restart to enable the onscreen keyboard.

4.2.2 Differences in operation between Windows 7 and Windows XP OS on external controller PC

Using the MX180000A with a Windows XP install, the USB driver required to run the module is deleted at the same time as uninstalling the MX180000A using the control panel. However, with Windows 7, the USB driver is not uninstalled simply by uninstalling the MX180000A using the control panel. To manually uninstall the driver, select "Anritsu USB Device Driver" at the control panel.

4.3 Notes on Ver. 7.00.06 and Later

4.3.1 Precautions when 32G PPG/ED and 12.5G/14G PPG/ED installed simultaneously

When using the MU183020A 28G/32G bit/s PPG and MU183040A 28G/32G bit/s ED, note that the MU181020A/B 12.5G/14Gbit/s PPG and MU181040A/B 12.5G/14Gbit/s ED are disabled and cannot be used simultaneously when installed in the same main frame.

4.3.2 Precautions when using MU181020A/B

Customers using MU181020A/B: If you find following label on front panel, software version of proper operation is 7.01.07 or later.

```
CAUTION
This unit is supported with
MX180000A software ver7.01.07
or later.
Refer to the release note.
```

4.4 Ver. 7.04.00 and Newer

4.4.1 Precautions when 32G PPG/ED and 12.5G/14G PPG/ED installed simultaneously

From software Version 7.04.00 and onwards, the MU181020A/B, MU181040A/B, and MU183020A or MU183040A can be installed simultaneously. For more details, refer to section 1.2.4 for the restrictions on simultaneous installation of the PPG and ED, or 32G PPG and ED.

4.5 Ver. 7.05.00 and Newer

4.5.1 Precautions when using MU183020A and MU183040A/B

Customers using MU183020A and MU183040A/B: If you find following label on front panel, software version of proper operation is 7.05.00 or later.

CAUTION This unit is supported with MX18QQQQA software ver7.Q5.QQ or more. Refer to the release note.

39/41

4.6 Ver. 7.06.02 and Newer Versions

CORPO

4.6.1 Warning dialog about ED and DEMUX maximum input rating

When using ED and DEMUX modules with software Version 7.06.02 or later, a warning dialog is displayed when the application starts. This dialog displays a warning message about excessive input and the maximum rating for the target module data input; it is not a module fault.

Target modules and maximum ratings are shown below.

Module Name	Data Input Amplitude Specification
MU181040A	0.9 Vp-p
When Opt-001installed	
MU181040A	2.0 Vp-p
When Opt-002 installed	
MU181040B	2.0 Vp-p
MU182040A/41A	2.0 Vp-p
MU183040A/41A	2.0 Vp-p
MU183040B/41B	1.0 Vp-p
MP1822A	0.5 Vp-p
MP1862A	1.0 Vp-p

ntes] VER input a signal amplitude	exceeding the specification to any module;	
ure to follow this rule risks o	lamaging modules.	
Module Name	Data Input Amplitude Specification (Single ended)	
MU183040B	1.0 Vp-p	

4.7 Ver. 7.09.00 and Newer

4.7.1 Notes on Supported MX181500A Versions

Use the MX181500A Jitter Tolerance Test software Ver. 2.04.00 or later when using MX180000A Ver. 7.09.00 or later. The MX181500A does not operate correctly with other software versions.

4.8 Ver. 7.10.00 and Newer

4.8.1 Notes on Supported MP1800A-x07 Versions

When the MP1800A-x07 option is installed to your MP1800A, make sure to use the MX180000A Signal Quality Analyzer Control Software whose version is V7.10.00 or later.

4.9 Ver. 8.00.02 and Newer

4.9.1 Precautions about re-execute the Multi-Channel Calibration

After Ver.8.00.02 upgrading, it is required to re-execute the Multi-Channel Calibration function of 32G PPG. When you are prompted to execute the Multi-Channel Calibration function, follow the on-screen instructions to execute calibration.

4.10 Ver. 8.02.01 and Newer

4.10.1 Notes on Supported MX183000A Versions

Use the MX18300A High-Speed Serial Data Test Software Ver. 1.00.01 or later when using MX180000A Ver. 8.02.01 or later. The MX183000A does not operate correctly with other software versions.

