

MODEL: CR-180

No. : DP17-0301E

DATE : Oct. 3, 2003

- ? Major quality issues                      ? Quality upgrade / production efficiency
- ? Field quality problems                    | Miscellaneous

### LOCATION

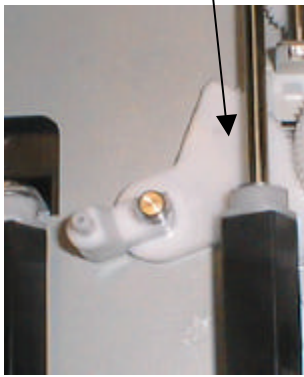
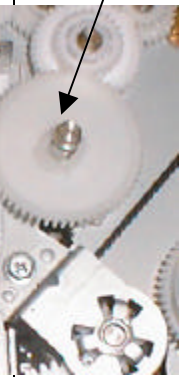
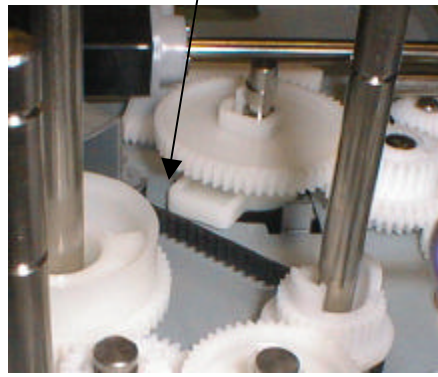
### SUBJECT

Service Manual Supplement (MY8-13A0-000)

### OUTLINE

Supplemental information for the CR-180 Service Manual

### DETAIL

Page	Location	Supplemental Information
1-2	12. Ink Cartridge	Use Hewlett-Packard Company product number C6602R (Red), C6602G (Green) and C6602B (Blue). **Product number C6602x are limited to Red, Green and Blue.
4-5	3. Consumables	
2-25	Table 2-702	“SW103” is for factory/design purposes only, and not for use on the market. Set all switches OFF.
3-7	Note: Top unit placement	Be careful to avoid distorting the lower shaft also.
3-19/20	2&3. Image Sensor Unit Step 2	Remove the cable at the rear side from the cable clamps.
3-24	1. Feed plate Note: During reassembly	<p>The feed plate should be assembled in the state in which gears (A and B) for document presser plate are free. Gear B is in the free state when its projection is moved to the left stopper side.</p> <div style="display: flex; justify-content: space-around; align-items: flex-start;"> <div style="text-align: center;"> <div style="border: 1px solid black; padding: 2px;">Gear A</div>  </div> <div style="text-align: center;"> <div style="border: 1px solid black; padding: 2px;">Gear B</div>  </div> <div style="text-align: center;"> <div style="border: 1px solid black; padding: 2px;">Left stopper</div>  </div> </div> <p>All cables should be pulled out toward the front.</p>

Page	Location	Supplemental Note
5-5	4. All Adjustment	When CR-180 software is installed on a computer, the Imprinter setting should be OFF. Otherwise, printing to paper occurs during “Regist Adjustment”.
5-8	5. Regist Adjustment	
5-11	7. DFD Sensor Adjustment Step 5	Close the maintenance covers and press the “DFD Adj” button.
5-21	V. MICR TROUBLESHOOTING	When using the “Scanning Utility for CR-180”, scanning results can be retained in the log. In this case, characters that could not be read are indicated by an ampersand “@”. Refer to the Help of Scanning Utility for CR-180 for details.

Note: Despite the above, the Service Manual is not being revised.