

**MODEL:** GP 605

**SUBJECT:** Faint / Blank Copies

**Symptom:**


With increasing copy volume the image becomes fainter and eventually blank. This occurs approximately 6cm from the leading edge.

**Cause:**

The washer between the electrode positioning plate and developer sleeve becomes worn over time. The resulting shavings cause a bias leakage which gives the above symptom.

**Solution:**

Remove the offending washer it is not required.

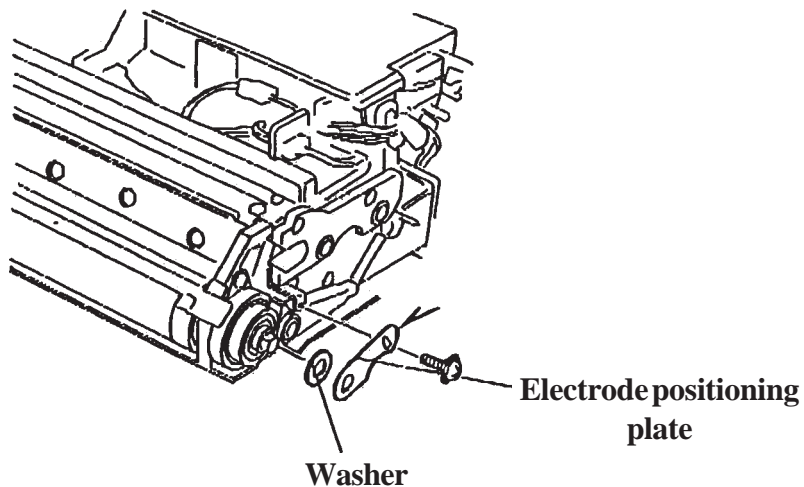

Serial numbers of affected machines QLE00052 ~ QLE00245