

MODEL: **GP 605**

SUBJECT: **Paper Jam Prevention**

Symptom:

Unusual noise is generated from around the pick-up assembly and paper pick-up may fail.

Cause:

There is a tie wrap which secures the wiring of the right front deck pick-up assembly. This tie wrap can become cut when the duplex unit is inserted or withdrawn. It then falls down on to the gears of the right hand deck and causes them to jam. This causes a gear in the paper assembly to fail, reference (Part No. FS6-0096-000 gear P260-14).

Solution:

Remove the tie wrap as indicated.

