

MODEL: **GP 605 / 555**

SUBJECT: **Delivery Jams when Double-Siding**

Symptom:

Paper jamming at exit guide when double siding, mainly on long runs, codes shown include "010C".

Cause:

Incorrect return spring (too strong) fitted to deflector, (*reference figure 351, Item 33*) in parts catalogue

FS6-2885-000



Solution: Replace spring.

Machines affected: DMC00371 - DMC00644
DNC00566 - DNC00700