

Model: GP605 Series

Ref. No. : FF-T01-K1-000079-01

Date : February 14, 2002

© Canon (UK) Limited

Location: ADF Frame Assembly

Subject: Improvement of Durability of ADF Hinge

Reason: Aged ADF hinges may fail to keep the ADF in opened state. To avoid this, the hinges will be changed to the more durable ones used for DADF-J1.

Detail:

<Symptom>

The ADF fails to stay open and falls on the main body.

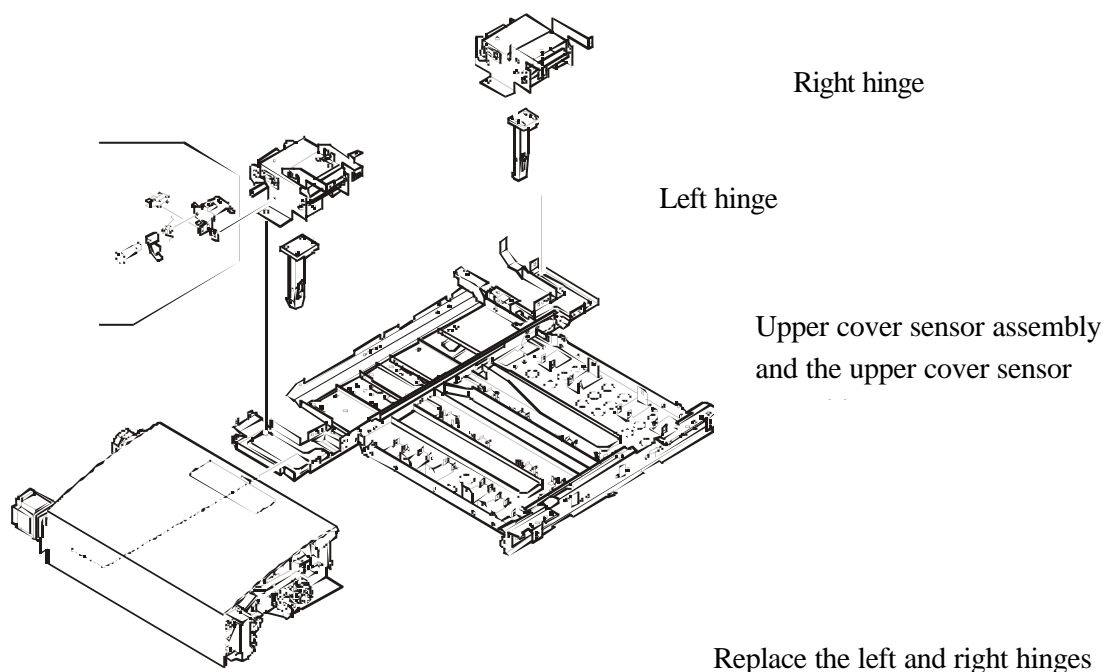
<Cause>

Aging of ADF hinges

<Factory Measure>

The left and right hinges and the upper cover sensor assembly of the ADF will be changed to the ones used for DADF-J1.

Servicing Work:

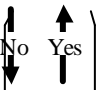
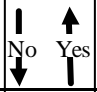
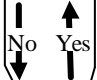


Points to Note When Servicing:

<Notes>

When replacing the GP605 hinges with DADF-J1 hinges, be sure to replace the left and right hinges and the upper cover sensor assembly at the same time. If the GP605 parts and the DADF-J1 parts are mixed, the ADF will not shut properly and causes troubles such as paper jam.

Service Parts:

| No. | Description | | Part number | Q'ty | Stock | Inter-change-ability | PC. Stock date |
|-----|-------------|-----------------------------|--------------|------|-------|---|----------------|
| 1 | Old | HING, LEFT | FB4-8027-000 | 1→0 | *C |  | 11 |
| | New | HINGE, LEFT | FB5-9544-000 | 0→1 | F | | In stock |
| 2 | Old | HING, RIGHT | FB4-8028-030 | 1→0 | C |  | 11 |
| | New | HINGE, RIGHT | FB5-9545-000 | 0→1 | F | | In stock |
| 3 | Old | UPPER COVER SENSOR ASSEMBLY | FG6-2800-000 | 1→0 | C |  | 11 |
| | New | UPPER COVER SENSOR ASSEMBLY | FG6-7727-000 | 0→1 | F | | In stock |

* Interchangeable by replacing all three parts at the same time.

Affected Machines:

Serial Number of ADF

YF28381 and later

GY12572 and later