
Model: Super G3 FAX Board-J1

Ref. No. : FF-T01-B3-000048-01

Date : November 29, 2001

© Canon (UK) Limited

Location: Installation Procedure (F-IM-6049-010)

Subject: Updating the Installation Procedure (F-IM-6049-010)

Reason: Descriptions relating to the cable connection are updated.

Detail: Corrections are made to descriptions related mainly to the cable connection in page 3, step 3-5). The correction of the cable connection is described from page 3, Step 3-5). The installation procedure is packed into 230V Super G3 FAX Board-J1. The updated cable connection is described in the new installation procedure (F-IM-6077-010). See overleaf.

2 Before Starting the Work

Keep the following in mind when installing the G3 FAX Board to its host machine:

- The power plug of the host machine must remain disconnected.
- The screws must be identified by type (length, diameter) and location.
- All screws of the metal covers must be tightened properly. A missing screw can lead to noise and, ultimately, to malfunction.

3 Installation to the Host Machine

- Remove the seven screws [1], and detach the rear cover.

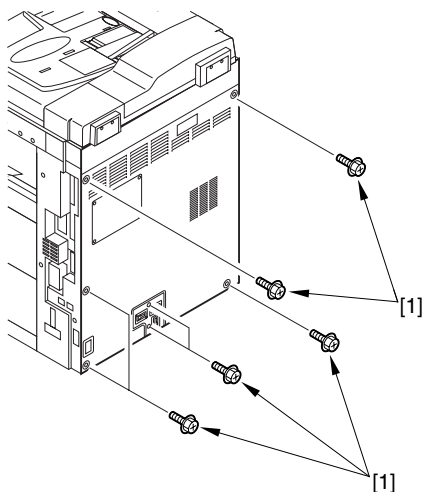


Fig.3-1

- Remove the controller cover [1], and mount the off hook detection unit [3] using the 2 screws [2] that come with the Board. (This step will be necessary for the installation of the Board.)

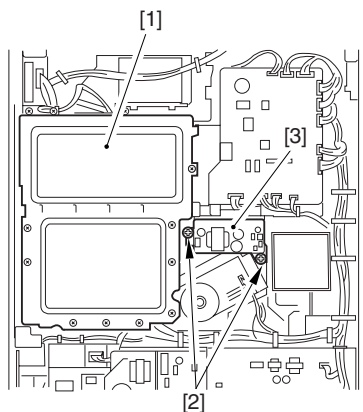


Fig.3-2

- Free the cables [1] needed for the installation of the G3 FAX Board from the cable clip [2]. (3 pc. on the right, 2 pc. at the bottom)

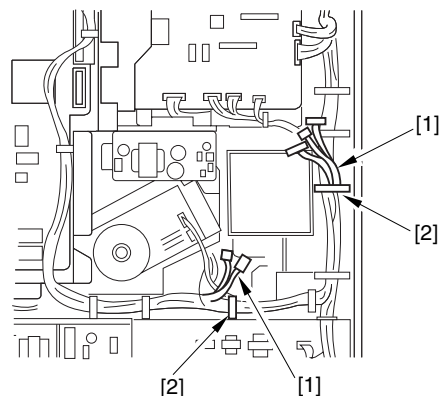


Fig.3-3

- Mount the Board [2] with three screws [1].

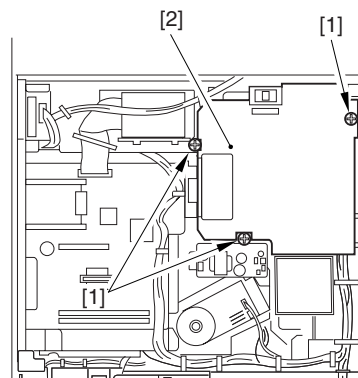


Fig.3-4

- Connect the two cables [1] from the G3 FAX Board to the off hook detection unit.

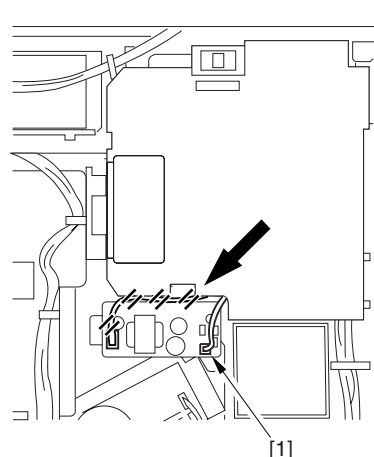


Fig.3-5