

Model : Network Multi PDL Printer Board-D1
Network Printer Board-F1
Network Multi PDL Printer Board-H1

Number: FF-T01-V1-000140-01

Date : December 18, 2001

© Canon (UK) Limited

Location : System Software

Subject : Patch File 1-1W40L Release

Reason :

When LPD printing is commanded from a UNIX machine to Network Multi PDL Printer Board D1, F1, or H1, the controller generates Banner Pages. There have been requests from the field that this LPD Banner function should preferably be turned off. Patch file 1-1W40L.ps is released to disable the LPD Banner function.

Remarks

:

- (1) This patch file is applicable to Network Multi PDL Printer Boards D1 and H1 (v2.1) and Network Printer Board F1 (v2.1).
- (2) This patch is invalid for the (PCL-only) Network Printer Boards E1 and K1, because they do not generate LPD Banner Pages even without the patch. (PS code is used to generate the Banner Pages.)
- (3) To enable the LPD Banner function again after applying this patch, System Software must be re-installed.

Installation Notes :

1. Download this file with Fiery Downloader to the Print or Direct Queue.
2. The server must be rebooted for the patch to take effect.
3. You must wait at least 60 seconds before doing a reboot.
4. After the server has restarted, please wait until the server goes to idle. Print a configuration page to verify that the file has been received.
5. The Update Info should contain the patch number "1-1W40L".