

Model : **Network Multi PDL Printer Board-H1**  
**Network Printer Board-K1**  
 ① ➔ **Network Printer Board-F1**

Number: FF-T01-V1-000060-02  
 (00-OIPD0-B0007-01)

Date : February 7, 2000

REVISED
---------

FF-T01-V1-000060-02: Network Printer Board-F1 information is added.

© Canon (UK) Limited

**Location :** System Software

**Subject :** Patch File 59418.efi Release

**Reason :**

A patch file, 59418.efi will be released which corrected the market claim (raised from Canon Europe and Canon Canada) that a ruled line is printed out of its original position when the PCL data is printed via SAP R/3.

**Detail :**

Like, Figure 1, the claim that a ruled line is printed out of its original position when the PCL data is printed via SAP R/3.

Line Item	Description	Inv Qty	Gross Invoice Sale	Net Qty	Chr
Sales Office: SFC					
00000999	SPECIALTY SALESMAN	2,874	878,536.76	0	
SFC	Sales Office Total	2,874	878,536.76	0	

Sales Office: WEST

(Figure.1)

(Cause)

This error occurs because there was a defect with scaling of font.

(Measures)

After the patch is installed, output will be like Figure.2.

Line Item	Description	Inv Qty	Gross Invoice Sale	Net Qty	Chrgd/Net Billed
Sales Office: SFC					
00000999	SPECIALTY SALESMAN	2,874	878,536.76	0	0.00
SFC	Sales Office Total	2,874	878,536.76	0	0.00

Sales Office: WEST

(Figure.2)

**Installation Notes :**

1. Select "Setup" at Boot Up menu.
2. Install the Software through the parallel port.
3. Download the file 59418.efi with PDL Downloader.
4. Exit Setup and Re-boot.
5. Print the configuration page and check that "59418" is printed out in Update Information on the configuration page.

**Remarks :**

1. This patch file is only available for Network Multi PDL Printer Board-H1/K1 ver2.0.
  - ~~2. This patch will be also available with Network Printer Board F1 v2.0 ; however, its effectiveness is under verification. (to be completed at the end of January)~~
- ① ➡ **2. It was revealed that this patch file is effective for Network Printer Board-F1 v2.0.**