



Service Information

COPIER

HARDWARE

SOFTWARE

Model : Command WorkStation Software for
Network Printer Board-F1

Number : FF-T01-V1-000127-01

Date : March 30, 2001

©Canon (UK) Limited

Location : SYSTEM SOFTWARE

Subject : SYSTEM SOFTWARE V2.1PRO RELEASE
Command WorkStation Software Network Printer Board-F1 Version 2.1Pro was released.

Reason : Version Up

[History of System Versions]

Service. Info. No.	Ver. No.	Description	Date
FF-T01-V1-000127-01	Ver 2.1Pro	Added specifications and modified defects - Port 9100 Support - Plug and Play Support - Field corrective action by System Software version 2.0/2.0Pro	March 30, 2001
FF-T01-V1-000082-01	Ver 2.0 Pro	Command WorkStation Support - Thumbnail/Full Screen Preview (DocBuilder) - Job Merging & Editing (DocBuilder) - Job Archiving - Load Balancing - FreeForm - Queues Window - Downloading - Job Log Windows Mac WebTools Support Supernetting Support PCL Font/Macro Download	April 26, 2000

Details : <Modifications in Ver. 2.1Pro >

No.	Item	Description
1	Port 9100 Support	Improving readiness for Port9100 (Performance is guaranteed only for one-way transmission.) Default value of Port9100 is Direct Queue. (The value can be changed from the copier control panel unit and NetSpot.) In addition, the following are available in the same way as other EFI controller. Port9101=Direct Queue Port9102=Print Queue Port9103=Hold Queue
2	Taking field corrective action to correct the problem 'inability of HPGL command to change the line width.' (Reported by Canon Singapore)	
3	Taking field corrective action to rectify the problem 'erroneous recognition of the paper folding unit in case "Get Device Status" is conducted on the iR600/GP605 with the saddle finisher-D2 and without the paper folding unit-B1.' (Reported by Canon USA)	
4	Taking field corrective action to solve the problem "delivery failure of banner page and the following pages even in case the job is printed with Netware Banner on"	In order to make the function, equivalent to the patch file 1-RN51.ps released for Network Printer Board-F1 version 2.0Pro, effective in the system software version 2.1Pro, the patch file with the same contents is released as 1-ubp.efi. This patch file is stored in the system software CD-ROM. (See the service information No: FF-T01-V1-000089-01 for more information.)
5	Changing MIB "hrDeviceDescr" texts	"canon" is added to MIB "hrDeviceDescr" in order to correspond to HP WebJetAdmin version 6.
6	Packing Windows2000 PostScript Printer Driver and Macintosh Printer Driver based on Adobe PS8.7 in the same box.	See the service information No:FF-T01-V1-000119-01 for more information.

Restrictions : Here are the restrictions in Network Printer Board-F1 v2.1Pro.

No.	Item	Description
1	Separator pages with Windows NT4.0 and Windows2000	You can print separator pages from the PostScript and PCL printer Drivers. When printing with separator pages, please note following: <ul style="list-style-type: none"> - Make sure to select "sysprint.sep" in the PostScript printer driver, and "PCL.sep" in the PCL printer driver. Other alternatives may not print correctly. - Specifying Different for First, (Second), Others and Last for Paper Selection of the Paper Source tab in the PCL printer driver may have no effect.
2	Oficio Paper not supported	Oficio Paper is not supported with Network Printer Board-F1 v2.1Pro.
3	Incorrect paper source resulted from WindowsNT/2000 Separator Page printing	(Detail) When printing with Separator Pages by specifying paper source with Windows NT4.0/2000, paper is not supplied from the specified paper source. (Action) Taking field correction action by using the patch file (The release date is not yet fixed).
4	LPD Banner Page is always output in printing from UNIX.	(Detail) Even when "no banner" is set with UNIX command, Banner Page is always output. (Action) Taking field correction action by using the patch file (The release date is not yet fixed).
5	When Cover Page is printed in Macintosh in setting [After Document], Cover Page is not fed from the designated paper source. (Application : Quark XPress / MS Word)	Under investigating.

Combination of ROMs :

GP605/555/605P & iR600/60	IP	Ver.33.01
GP605/555/605P & iR600/60	MFC	Ver.33.03
Network Printer Board-F1	Boot ROM	Boot Block: 1.4.49 Main Block:1.4.49d
Network Printer Board-F1	System	Ver.2.1Pro
PS Driver for Windows 95/98/Me		Ver.2.0Pro (Adobe PS Driver v4.2.4 based)
PS Driver for Windows NT4.0		Ver.2.0Pro (MS Pscript based)
PS Driver for Windows 2000		Ver.2.0Pro (MS Pscript based / WHQL Certified)
PS Driver for Macintosh		Ver.2.0Pro (Adobe PS 8.7 based)
PCL Printer Driver for Windows 9x/NT4.0/2000		Ver.4.60 or later
NetSpot		v3.2.4 or later

Service Parts :

No.	Description		Part number	Q'ty	Stock	Inter-change-ability	----- EFI P/N
1	Old	CD-ROM System Software v2.0Pro	FE1-5194-000	1→0	C	↓ No ↑ Yes ↓	
	New	CD-ROM System Software v2.1Pro	FE1-5194-010	0→1	D		45021500

* The Media Pack Parts Number, except the US version, is to be informed as soon as the EFI Parts Number is known.