

K2 OWNER'S MANUAL ERRATA

Rev. I-1, February 24, 2014

MAKE THESE CHANGES TO YOUR REV. I MANUAL BEFORE YOU BEGIN ASSEMBLY

1. **Page 25, Left Column:** Underline the following sentence in the note at the top of the column. It is very important to take ESD precautions before handling these i.c.s to avoid electrostatic damage:

Touch a grounded surface before handling each IC.

2. **Page 51, Right Column, Fourth and Fifth Checkbox Steps (Installing Q22):** Replace the steps with the following;

Place the star heat sink onto Q22 (2N5109). You will need to open the gap on the heat sink to allow Q22 to fit. Q22 must be inserted so its shoulder presses against the heat sink. To do this, place the heat sink flat on your work surface in insert a common flat screwdriver in the slot, then twist the screwdriver to pry the slot open so the transistor slips into the center opening until the shoulder on the transistor case is firmly against the heat sink.

Install Q22 in the space marked to the right of the Elecraft label. Be sure Q22 is flat against the pc board and solder it in place.