## **Supplement**

Title: 712 Inst.Sht. Supplement Issue: **1**Part Number: 650280 Issue Date: 3/01
Print Date: August 1997 Page Count: 3


Revision/Date: 1, 12/00

This supplement contains information necessary to ensure the accuracy of the document described above.



### Change #1

Under **Getting Acquainted with the Calibrator**, replace the drawing with the following:

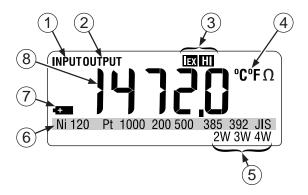

In the **Display Elements** table, replace (4) and (6) with the following:

④ °C, °F, Ω	When an RTD type is selected, one of these is lit to show the selected scale.
6 RTD Types	The RTD type annunciators (example, Ni 120) show the selected RTD type.

In the **Pushbutton Functions** table, replace **Push**, with the following:

FTD	Press to select a different RTD type.
	When you select the $\Omega$ type (ohms), displayed units are ohms, not degrees.
	displayed utilis are offitis, flot degrees.

3/01

Replace the entire section titled **Replacing the Fuse** with:

# Testing and Replacing the Fuses ∧ Warning

To avoid personal injury or damage to the calibrator, use only a 0.125A 250V fast fuse, Littelfuse® 2AG.

Fuse F1 protects the input circuit. Fuse F2 protects the output circuit. Test and replace the fuses using the following procedure:

- Remove the test leads from the calibrator terminals and turn the calibrator off.
- 2. Remove the battery door.
- 3. Remove the three Phillips-head screws from the case bottom and turn the case over.
- Gently lift the top cover from the end nearest the input/output terminals until it unsnaps from the bottom cover.
- Gently remove the fuse from its mounting bracket.
- Measure the resistance of the fuse. An open or high resistance suggests that the fuse is blown.
- Replace a blown fuse with a 0.125 A 250 V fast fuse, Littelfuse® 2AG.
- Fit the top and bottom covers together, engaging the two snaps. Make sure that the keypad and the input/output terminal gasket are properly seated.
- 9. Reinstall the three screws.
- 10. Replace the battery door.

2

#### Under Replacement Parts and Accessories,

Change: ▲ F1 Fuse,125 mA, 250V fast 686527 1

To: ▲ F1,F2 Fuse,125 mA, 250V fast 686527 2

Change: MP92 Battery door 619947 1

To: MP92 Battery door 609930 1

Under **Specifications**, add the following:

#### Note

Specifications on this Instruction Sheet apply to the 712 RTD Calibrators with serial number 7676001 or above.

3/01 3