Manual Supplement

Manual Title:789 CalibrationSupplement Issue:2Part Number:1988891Issue Date:5/04Print Date:September 2002Page Count:2

Revision/Date:

This supplement contains information necessary to ensure the accuracy of the above manual. Enter the corrections in the manual if either one of the following conditions exist:

- 1. The revision letter stamped on the indicated PCA is equal to or higher than that given with each change.
- 2. No revision letter is indicated at the beginning of the change.



789 Calibration Manual Supplement

Change #1

On page 8, add the following to Table 2:

Equipment	Minumum Specifications	Recommended Model
1-kΩ shunt	1 kΩ, 1%, 2 watts, Low TC is preferable	

On page 12, replace the *Loop Power* procedure, and Figure 2 with the following:

- 1. Enable the dc volts autorange function of the HP3458A multimeter.
- 2. Connect the 1-k Ω shunt across the UUT **SOURCE** outputs.
- 3. Turn the rotary knob of the UUT to **LOOP POWER**.
- 4. Measure the open circuit voltage of the UUT and verify it is greater than 29.8 V and less then 32 V.
- 5. Press the blue button on the UUT to enable the 250 Ω HART resistor.
- 6. Repeat step 4.
- 7. Disable the 250 Ω HART resistor by pressing the blue button.
- 8. Connect the 1-k Ω shunt across **SOURCE** + and **SOURCE** of the UUT.
- 9. Measure the loaded down voltage and verify it is greater than 23.8 V and less than 32 V.
- 10. Remove the 1-k Ω shunt.
- 11. Disconnect the UUT from the multimeter and turn the UUT off.
- 12. Select the dc current function on the multimeter and set it to the 1-amp range (a 0.1Ω shunt is used in the 1-amp range).
- 13. Connect the current input terminals of the multimeter to the **SOURCE** + and **SOURCE** terminals of the UUT.
- 14. Repeat step 3.
- 15. Verify the short circuit current is greater than 25 mA and less than 35 mA.

5/04 1

Manual Supplement 789 Calibration

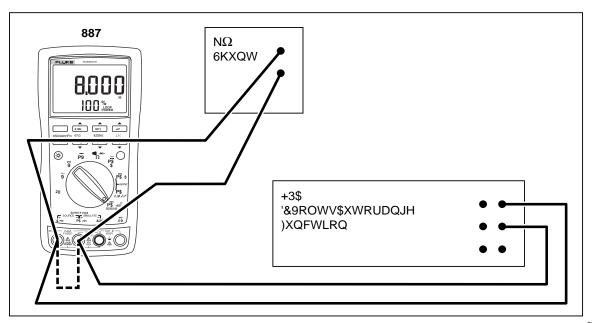


Figure 2. Verifying Loop Power

adm006.eps

2 9/03