


M10. All ranges 0 Ω calibration

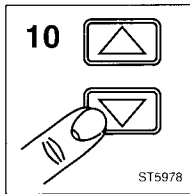


Purpose: calibration of the 0 Ω points in all ranges.

Calibration equipment:
none

Calibration setup:

SHORT CIRCUIT

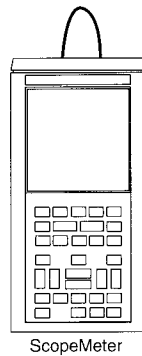


ST6411

Procedure:

- A - Short circuit the banana connectors.
- B - Press the READY softkey.

M11/12/13/14/15/16. Calibration of the Ohm ranges

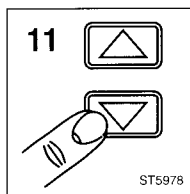

Purpose: calibration of the 300 Ω , 3 k Ω , 30 k Ω , 300 k Ω , 3 M Ω , and 30 M Ω ranges.

Calibration equipment:
Fluke 5100B Calibrator