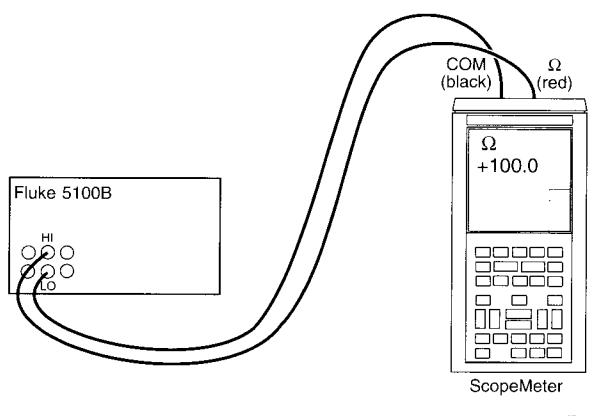


Calibration setup:


ST5998

Procedure:

- A - Connect 100Ω to the banana connectors.
- B - Press the READY softkey.
- C - Change the resistance according to table 5.4. After each calibration press the READY softkey.
Use the adjust/select keys to advance/go back in the list.

Table 5.4 Calibration signals for step M11...M16

Calibration Step Number	Calibration Resistance
M11	100Ω
M12	1 kΩ
M13	10 kΩ
M14	100 kΩ
M15	1 MΩ
M16	10 MΩ

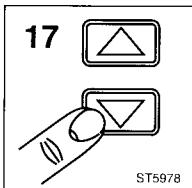M17. Voltage ramp calibration

ST5978

Purpose: calibration of the voltage ramp of the circuit tester.

Calibration equipment:

none