

## Service Information

Product **Colour television receivers with Digi 6 chassis - CUC 1952, 1983, 1984 with built-in SER 150/SER 150 ET Satellite Receiver - e.g. Denver SE 8216/9 Ref./PIP, M 82-269/9 Reference**

**Possible complaint:**

On reception of the channel Premiere via satellite the connected decoder does not operate while this station is decoded perfectly when received via a cable installation.

**Reason:**

The video crossbar IC TDA 6417 is overloaded on satellite reception.

**Cure:**

Change the SMD resistor CR 43209 from 1 M $\Omega$  to 470 k $\Omega$ . It is also possible to connect another 1 M $\Omega$  resistor in parallel when carrying out repairs.

**Workshop:**

The position of the SMD resistor is X=102, Y=187.

**Stores:**

SMD resistor 470 k $\Omega$ 0805	part no. 8706-100-337
SMD resistor 1 M $\Omega$ 0805	part no. 8706-100-145



Serial No 9/97