Service Guide

N5230C

Agilent Technologies 4-Port PNA-L Microwave Network Analyzers (300 kHz–13.5 GHz) (300 kHz–20 GHz)



Part Number N5230-90025 Printed in USA March 2009 Supersedes: February 1, 2009

© Agilent Technologies, Inc. 2008-2009

Warranty Statement

THE MATERIAL CONTAINED IN THIS DOCUMENT IS PROVIDED "AS IS," AND IS SUBJECT TO BEING CHANGED, WITHOUT NOTICE, IN FUTURE EDITIONS. FURTHER, TO THE MAXIMUM EXTENT PERMITTED BY APPLICABLE LAW, AGILENT DISCLAIMS ALL WARRANTIES, EITHER EXPRESS OR IMPLIED WITH REGARD TO THIS MANUAL AND ANY INFORMATION CONTAINED HEREIN, INCLUDING BUT NOT LIMITED TO THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. AGILENT SHALL NOT BE LIABLE FOR ERRORS OR FOR INCIDENTAL OR CONSEQUENTIAL DAMAGES IN CONNECTION WITH THE FURNISHING, USE, OR PERFORMANCE OF THIS DOCUMENT OR ANY INFORMATION CONTAINED HEREIN. SHOULD AGILENT AND THE USER HAVE A SEPARATE WRITTEN AGREEMENT WITH WARRANTY TERMS COVERING THE MATERIAL IN THIS DOCUMENT THAT CONFLICT WITH THESE TERMS, THE WARRANTY TERMS IN THE SEPARATE AGREEMENT WILL CONTROL.

DFARS/Restricted Rights Notice

If software is for use in the performance of a U.S. Government prime contract or subcontract, Software is delivered and licensed as "Commercial computer software" as defined in DFAR 252.227-7014 (June 1995), or as a "commercial item" as defined in FAR 2.101(a) or as "Restricted computer software" as defined in FAR 52.227-19 (June 1987) or any equivalent agency regulation or contract clause. Use, duplication or disclosure of Software is subject to Agilent Technologies' standard commercial license terms, and non-DOD Departments and Agencies of the U.S. Government will receive no greater than Restricted Rights as defined in FAR 52.227-19(c)(1-2) (June 1987). U.S. Government users will receive no greater than Limited Rights as defined in FAR 52.227-14 (June 1987) or DFAR 252.227-7015 (b)(2) (November 1995), as applicable in any technical data.

Certification

Agilent Technologies, Inc. certifies that this product met its published specifications at the time of shipment from the factory. Agilent Technologies, Inc. further certifies that its calibration measurements are traceable to the United States National Institute of Standards and Technology, to the extent allowed by the Institute's calibration facility, and to the calibration facilities of other International Standards Organization members.

Assistance

Product maintenance agreements and other customer assistance agreements are available for Agilent Technologies, Inc. products. For information about these agreements and for other assistance, contact Agilent. Refer to "Contacting Agilent" on page 2-11.

Safety and Regulatory Information

The safety and regulatory information pertaining to this product is located in Chapter 1, "Safety and Regulatory Information."

Safety Notes

The following safety notes are used throughout this manual. Familiarize yourself with each of the notes and its meaning before operating this instrument. All pertinent safety notes for using this product are located in Chapter 1, "Safety and Regulatory Information."

WARNING	Warning denotes a hazard. It calls attention to a procedure which, if not correctly performed or adhered to, could result in injury or loss of life. Do not proceed beyond a warning note until the indicated conditions are fully understood and met.
CAUTION	Caution denotes a hazard. It calls attention to a procedure that, if not correctly performed or adhered to, could result in damage to or destruction of the instrument. Do not proceed beyond a caution sign until the indicated conditions are fully understood and met.

Documentation Map



The online Help files are embedded in the analyzer, offering quick reference to programming and user documentation. From the Help drop-down menu, you can access the Help system in five different languages. Also, you can view the Analyzer Product Overview multimedia presentation and access the analyzer's Web page.



The *Installation and Quick Start Guide* helps you to quickly familiarize yourself with the analyzer. Procedures are provided for installing, configuring, and verifying the operation of the analyzer.

Printing Copies of Documentation from the Web

To print copies of documentation from the Web, download the PDF file from the Agilent web site:

- Go to www.agilent.com.
- Enter the product model number in the search function and click **Search**.
- Click on the Manuals hyperlink.

1 Safety and Regulatory Information

Information in This Chapter
Chapter One at-a-Glance1-2
Safety Symbols1-3
General Safety Considerations1-3
Safety Earth Ground1-3
Before Applying Power1-3
Servicing
Electrostatic Discharge Protection1-6
Regulatory Information1-7
Instrument Markings1-7
Lithium Battery Disposal1-8

2 General Product Information

Information in This Chapter	
Chapter Two at-a-Glance	
Maintenance	
Physical Maintenance	
Electrical Maintenance	
Analyzer Options Available	
Options as Upgrades	
Understanding your Analyzer's Option Numbers	
Option 010, Time Domain.	
Option 014, Configurable Test Set	
Option 080, Frequency Offset Mode	
Option 1CM, Rack Mount Flange Kit for Instruments without Handles	
Option 1CP, Rack Mount Flange Kit for Instruments with Handles	
Option 1E1, Source Attenuator (Extended Power Range)	
Option 897, Built-In Tests for Commercial Calibration	
Option 898 Built-In Tests for Standards Compliant Calibration	
Option F13P04, 13.5 GHz Frequency Range	
Option F20P04, 20 GHz Frequency Range	
Option S02, Second Source	
Analyzer Upgrades Available	
Analyzer Accessories Available	
CD-RW Drive.	
USB Hub	
Required Service Test Equipment	
Agilent Support, Services, and Assistance	
Service and Support Options	
Calibration Options.	
Contacting Agilent	2-11
Shipping Your Analyzer to Agilent for Service or Repair	

3 Tests and Adjustments

Information in This Chapter	3-2
Chapter Three at-a-Glance	3-2
Before You Begin	3-4

	Verify the Operating Environment	3-4
	Protect Against Electrostatic Discharge (ESD)	
	Allow the Analyzer to Warm Up	
	Review the Principles of Connector Care	
	About System Verification and Performance Tests	3-6
	System Specifications.	3-6
	Instrument Specifications	
	System Verification Procedure.	3-7
	Performance Tests	3-7
	Certificate of Calibration	3-7
	ANSI/NCSL Z540–1–1994 Verification	3-8
	Non-ANSI/NCSL Z540–1–1994 Verification	3-9
	Preliminary Checks	. 3-10
	The Operator's Check.	. 3-10
	The Test Port Cable Checks.	. 3-12
	System Verification	. 3-19
	What the System Verification Verifies	
	Measurement Uncertainty.	
	Measurement Traceability	. 3-21
	Performing System Verification.	. 3-22
	Performance Tests (Agilent N7840A Software Package).	
	Source Power Accuracy Test	. 3-28
	Source Maximum Power Output Test	
	Source Power Linearity Test	
	Frequency Accuracy Test	
	Trace Noise Test	. 3-30
	Receiver Compression Test	. 3-31
	Noise Floor Test	. 3-32
	Calibration Coefficients Test	. 3-33
	Dynamic Accuracy Test	. 3-34
	Adjustments	
	10 MHz Frequency Reference Adjustment	
	LO Power Adjustment	
	Source Calibration Adjustment.	. 3-37
	Receiver Calibration Adjustment	. 3-38
4	Troubleshooting	
	Information in This Chapter.	4-2
	Chapter Four at-a-Glance	
	Protect Against Electrostatic Discharge (ESD)	
	Assembly Replacement Sequence.	
	Getting Started with Troubleshooting	
	Check the Basics.	
	Troubleshooting Organization	
	Power Up Troubleshooting	
	Power Supply Check.	
	Front Panel Troubleshooting	
	Front Panel Keypad and RPG Test	
	A2 Display Test.	
	1 0	

Checking the USB Board	
A3 Front Panel Interface Board	
Rear Panel Troubleshooting	
Checking the USB Ports	
Checking the SERIAL (RS-232), PARALLEL (1284-C), or VGA Port	
Checking the GPIB Port	
LAN Troubleshooting	
Measurement System Troubleshooting	
Before you begin—consider: Where do you see a problem?	
Verifying the A, B, C, D, and R Traces (Standard S-Parameter Mode)	
Where to Begin Troubleshooting	
Checking the Source Group	
Checking the Signal Separation Group	
Checking the Receiver Group	
Instrument Block Diagrams Sheet 1	
Microwave PNA, N5230C, Options 140 and 240	
Instrument Block Diagrams Sheet 2	
Microwave PNA, N5230C, Options 145 and 245	
Instrument Block Diagrams Sheet 3	
Microwave PNA, N5230C, Options 146 and 246	
5 Theory of Operation	
Information in This Chapter	
Chapter Five at-a-Glance	
Network Analyzer System Operation	
Functional Groups of the Network Analyzer	
Synthesized Source Group Operation	
Basic Operation	
Frequency Offset Operation (Option 080)	
A7, A9, and A13 (Options 146 and 246) Fractional-N Synthesizer Boards	
A6, A8, and A12 (Options 146 and 246) Multiplier Boards	
A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5)
(MASSQuad)	
A10 Frequency Reference Board	
A16 Test Set Motherboard	
A17 Source 2 ALC and Bias Control (QABC) Board (Options 146 and 246)	
Signal Separation Group Operation	
A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (
(MASSQuad)	
A21, A22, A23, and A24 Test Port Couplers	
A25 (Options 145, 245, 146, and 246) and A26 (Options 146 and 246) 60-dB Sou	ırce Step
Attenuator	
Configurable Test Set (Options 145, 146, 245, and 246)	
Receiver Group Operation	
A20 Mixer Brick	
A5 SPAM Board (Analog Description)	
A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246).	
Digital Processing and Digital Control Group Operation	
Front Panel Subgroup.	

	Data Acquisition and Processing Subgroup
	Power Supply Group Operation
6	Replaceable Parts
	Information in This Chapter
	Chapter Six at-a-Glance
	Ordering Information
	Assembly Replacement Sequence
	Rebuilt-Exchange Assemblies
	Replaceable Parts Listings
	Front Panel Assembly, Front Side, All Options
	Front Panel Assembly, Back Side, All Options
	Top Assemblies, All Options Except 146/246
	Top Cables, All Options Except 146/246
	Top Assemblies, Options 146/246
	Top Cables, Options 146/246 (Top View)
	Top Cables, Options 146/246 (Side View) 6-20
	Bottom Assemblies, Options 140 and 240.
	Bottom Cables, Options 140 and 240
	Bottom Assemblies, Options 145 and 245
	Bottom Cables, Options 145 and 245
	Bottom Assemblies, Options 146 and 246
	Bottom Cables, Options 146 and 246
	Top Hardware and Miscellaneous Parts, All Options
	Bottom Hardware and Miscellaneous Parts, All Options
	Internal Hardware and Miscellaneous Parts, All Options
	External Hardware and Miscellaneous Parts, All Options
	Rear Panel Assembly, All Options
	Hard Disk Drive Assembly, All Options
	Miscellaneous Part Numbers
	Miscenaneous I art Numbers0-40
-	Density and Denla armont Dense dense
7	Repair and Replacement Procedures
	Information in This Chapter
	Chapter Seven at-a-Glance
	Personal Safety Warnings
	Electrostatic Discharge (ESD) Protection
	Assembly Replacement Sequence
	Removal and Replacement Procedures
	Removing the Covers
	Removing and Replacing the Front Panel Assembly
	Removing and Replacing Front Panel Subassemblies
	Removing and Replacing the A4 Power Supply Assembly
	Removing and Replacing the A5 through A10 Boards
	Removing and Replacing the A11 Vertical Motherboard and the Plenum Bracket
	Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards
	7-20
	Removing and Replacing the A14 System Motherboard
	Removing and Replacing the A15 CPU Board7-24

Removing and Replacing the A16 Test Set Motherboard and the USB Hub.	
Removing and Replacing the A17 QABC Board	
Removing and Replacing the A18 MASS 26.5 (MASSQuad)	
Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad	Mounting Block
7-34	-
Removing and Replacing the A20 Mixer Brick (QuintBrick)	
Removing and Replacing the A21, A22, A23, and A24 Test Port Couplers and	d Coupler
Mounting Blocks.	
Removing and Replacing the A25 60-dB Source Step Attenuator	
Removing and Replacing the A26 60-dB Source Step Attenuator	
Removing and Replacing the A29 Reference Switch, Limiter, and DC Block.	
Removing and Replacing the A41 Hard Disk Drive (HDD)	
Removing and Replacing the Midweb and the B1 Fan	
Removing and Replacing the Lithium Battery	
Post-Repair Procedures	

8 General Purpose Maintenance Procedures

Information in This Chapter	8-2
Chapter Eight at-a-Glance	8-2
Error Terms	8-3
Using Error Terms as a Diagnostic Tool	8-3
Performing Measurement Calibration.	8-4
Using Flowgraphs to Identify Error Terms	8-4
Accessing Error Terms	8-8
Error Term Data	.8-10
Option Enable Utility	.8-14
Accessing the Option Enable Utility	.8-14
Enabling or Removing Options	.8-15
Repairing and Recovering Option Data	.8-16
Installing or Changing a Serial Number	
Firmware Upgrades	.8-18
How to Check the Current Firmware Version.	.8-18
Downloading from the Internet	.8-18
Operating System Recovery.	.8-19
Recovering from Hard Disk Drive Problems	
Correction Constants	.8-20
Storing Correction Constants	.8-20

1 Safety and Regulatory Information

Information in This Chapter

This chapter provides safety information that will help protect you and your network analyzer. It also contains information that is required by various government regulatory agencies.

Chapter One at-a-Glance

Section Title	Summary of Content	Start Page
Safety Symbols	Descriptions of CAUTION and WARNING symbols used throughout this manual.	Page 1-3
General Safety Considerations	A list of safety points to consider when servicing your network analyzer.	Page 1-3
Electrostatic Discharge Protection	A discussion of electrostatic discharge (ESD) and related recommendations and requirements for ESD protection.	Page 1-6
Regulatory Information	Definitions of instrument markings. Instructions for disposing of the analyzer's lithium battery.	Page 1-7

Safety Symbols

The following safety symbols are used throughout this manual. Familiarize yourself with each of the symbols and its meaning before operating this instrument.

CAUTION	Caution denotes a hazard. It calls attention to a procedure that, if not correctly performed or adhered to, could result in damage to or destruction of the instrument. Do not proceed beyond a caution note until the indicated conditions are fully understood and met.

WARNING Warning denotes a hazard. It calls attention to a procedure which, if not correctly performed or adhered to, could result in injury or loss of life. Do not proceed beyond a warning note until the indicated conditions are fully understood and met.

General Safety Considerations

Safety Earth Ground

WARNING	This is a Safety Class I product (provided with a protective earthing ground incorporated in the power cord). The mains plug shall only be inserted in a socket outlet provided with a protective earth contact. Any interruption of the protective conductor, inside or outside of the instrument, will make the instrument dangerous. Intentional interruption is prohibited.
CAUTION	Always use the three-prong AC power cord supplied with this product. Failure to ensure adequate grounding by not using this cord may cause product damage.
Before A	Applying Power
WARNING	If this product is not used as specified, the protection provided by the equipment could be impaired. This product must be used in a normal condition (in which all means for protection are intact) only.
WARNING	If an instrument handle is damaged, you should replace it immediately. Damaged handles can break while you are moving or lifting the instrument and cause personal injury or damage to the instrument.

CAUTION	This instrument has autoranging line voltage input. Be sure the supply voltage is within the specified range.
CAUTION	This product is designed for use in Installation Category II and Pollution Degree 2 per IEC 61010-1:2001 and 664 respectively.
CAUTION	Ventilation Requirements: When installing the product in a cabinet, the convection into and out of the product must not be restricted. The ambient temperature (outside the cabinet) must be less than the maximum operating temperature of the instrument by 4 °C for every 100 watts dissipated in the cabinet. If the total power dissipated in the cabinet is greater than 800 watts, then forced convection must be used.
CAUTION	The measuring terminals on this instrument are designed to be used with external signals described in Measurement Category I, but NOT with external signals described in Categories II, III, and IV. The input of this instrument cannot be connected to the mains.
Servicir	ng
WARNING	These servicing instructions are for use by qualified personnel only. To avoid electrical shock, do not perform any servicing unless you are qualified to do so.
WARNING	Danger of explosion if battery is incorrectly replaced. Replace only with the same or equivalent type recommended. Discard used batteries according to local ordinances and/or manufacturer's instructions.
WARNING	Procedures described in this document may be performed with power supplied to the product while protective covers are removed. Energy available at many points may, if contacted, result in personal injury.
WARNING	No operator serviceable parts inside. Refer servicing to qualified personnel. To prevent electrical shock, do not remove covers.
WARNING	The opening of covers or removal of parts may expose dangerous voltages. Disconnect the instrument from all voltage sources while it is being opened.

WARNING	For continued protection against fire hazard, replace line fuse only with same type and rating. The use of other fuses or material is prohibited.
WARNING	The detachable power cord is the instrument disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the instrument. The front panel switch is only a standby switch and is not a LINE switch (disconnecting device).


Electrostatic Discharge Protection

Protection against electrostatic discharge (ESD) is essential while removing assemblies from or connecting cables to the network analyzer. Static electricity can build up on your body and can easily damage sensitive internal circuit elements when discharged. Static discharges too small to be felt can cause permanent damage. To prevent damage to the instrument:

- always have a grounded, conductive table mat in front of your test equipment.
- *always* wear a grounded wrist strap, connected to a grounded conductive table mat, having a 1 M Ω resistor in series with it, when handling components and assemblies or when making connections.
- *always* wear a heel strap when working in an area with a conductive floor. If you are uncertain about the conductivity of your floor, wear a heel strap.
- *always* ground yourself before you clean, inspect, or make a connection to a static-sensitive device or test port. You can, for example, grasp the grounded outer shell of the test port or cable connector briefly.
- *always* ground the center conductor of a test cable before making a connection to the analyzer test port or other static-sensitive device. This can be done as follows:
 - 1. Connect a short (from your calibration kit) to one end of the cable to short the center conductor to the outer conductor.
 - 2. While wearing a grounded wrist strap, grasp the outer shell of the cable connector.
 - 3. Connect the other end of the cable to the test port and remove the short from the cable.

Figure 1-1 shows a typical ESD protection setup using a grounded mat and wrist strap. Refer to "ESD Supplies" on page 6-49 for part numbers.



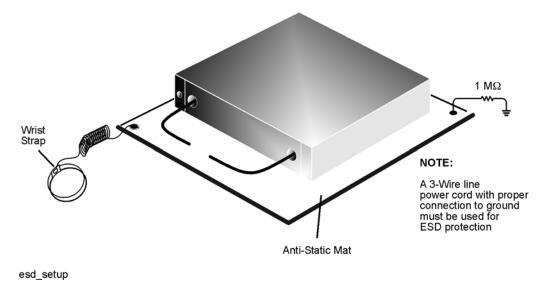

Regulatory Information

This section contains information that is required by various government regulatory agencies.

Instrument Markings



 
The instruction documentation symbol. The product is marked with this symbol when it is necessary for the user to refer to the instructions in the documentation.



The CE mark is a registered trademark of the European Community. (If accompanied by a year, it is when the design was proven.)



The CSA mark is a registered trademark of the Canadian Standards Association.



This is a marking to indicate product compliance with the Canadian Interference-Causing Equipment Standard (ICES-001).



This is a symbol of an Industrial Scientific and Medical Group 1 Class A product.



This is a required mark signifying compliance with an EMC requirement. The C-Tick mark is a registered trademark of the Australian Spectrum Management Agency.

X

This product complies with the WEEE Directive (2002/96/EC) marking requirements. The affixed label indicates that you must not discard this electrical/ electronic product in domestic household waste.

Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as a "Monitoring and Control instrumentation" product.

Do not dispose in domestic household waste.

To return unwanted products, contact your local Agilent office, or see http://www.agilent.com/environment/product/ for more information.



This product complies with the China RoHS regulation. Product manuals will have a *Toxic Substance Table* showing the hazardous substances in the product.

Lithium Battery Disposal

If the battery on the A15 CPU board assembly needs to be disposed of, dispose of it in accordance with your country's requirements. If required, you may return the battery to Agilent Technologies for disposal. Refer to "Contacting Agilent" on page 2-11 for assistance.



DO NOT THROW BATTERIES AWAY BUT COLLECT AS SMALL CHEMICAL WASTE.

For instructions on removing and replacing the battery on the A15 CPU board assembly, refer to "Removing and Replacing the Lithium Battery" on page 7-56.

2 General Product Information

Information in This Chapter

Chapter Two at-a-Glance

Section Title	Summary of Content	Start Page
Maintenance	Cleaning instructions for the external surfaces of your analyzer. Information about electrical maintenance of your analyzer.	Page 2-3
Analyzer Options Available	A list of the options available for the microwave network analyzers.	Page 2-3
Analyzer Upgrades Available	A list of the upgrades available for the microwave network analyzers.	Page 2-6
Analyzer Accessories Available	A list of accessories available for the microwave network analyzers.	Page 2-6
Required Service Test Equipment	A list of service equipment that is required to perform system verification, performance tests, adjustments, and troubleshooting.	Page 2-7
Agilent Support, Services, and Assistance	The Internet address (URL) for on-line assistance. Service and support options available. Calibration options available. Important information about shipping your analyzer to Agilent for service or repair.	Page 2-10

Maintenance

WARNING To prevent electrical shock, disconnect the analyzer from the mains source before cleaning. Use a dry cloth or one slightly dampened with water to clean the external case parts. Do not attempt to clean internally.

Physical Maintenance

Clean the cabinet, including the front panel, using a dry or slightly damp cloth only.

Electrical Maintenance

Refer to "Contacting Agilent" on page 2-11 and to Chapter 3, "Tests and Adjustments."

Analyzer Options Available

Options as Upgrades


The options described in this section can be ordered as upgrades. Refer to "Analyzer Upgrades Available" on page 2-6.

Refer also to "Upgrade Kits" on page 6-49 for a complete list of available upgrade kits.

Understanding your Analyzer's Option Numbers

The option number contains a basic description of your analyzer as shown below. Other options, such as 010 or 080, may be added to extend this description. All options are described in the following paragraphs.

Figure 2-1 Understanding your Analyzer's Option Numbers

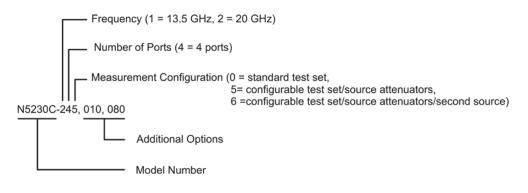

n5230_013_201_new

Option 010, Time Domain

This option can be added to any other option combination.

An Option 010 analyzer can display the time domain response of a network or test device by calculating the inverse Fourier transform of the frequency domain response. This calculation allows the Option 010 analyzer to show the response of a test device as a function of time or distance. In time domain, the magnitude and location of a discontinuity and the characteristics of individual transmission paths of a network or test device can be determined. Time domain operation retains all the accuracy of active error correction.

Option 014, Configurable Test Set

This option is included in Options 145, 146, 245, and 246.

An Option 014 analyzer can be configured to measure high-power devices and devices for high dynamic range.

For a high-power measurement, external amplifiers and high power attenuators or isolators can be added to complete the test setup. Test port output power up to 1 Watt (+30 dBm) can be applied to the device under test (DUT).

Additionally, there is an external reference input that allows the external amplifier's frequency response and drift to be ratioed out.

For high dynamic range measurements, front panel jumpers are moved to reverse the signal path through one of the couplers, allowing for a 15 dB improvement in transmitted signal sensitivity in one direction only. Jumpers are installed on both ports allowing the user to choose a measurement in either the forward or reverse direction.

Option 080, Frequency Offset Mode

This option can be added to any other option combination.

This upgrade enables the additional firmware necessary to make frequency offset measurements.

Option 1CM, Rack Mount Flange Kit for Instruments without Handles

Option 1CM provides a rack mount kit that contains a pair of flanges, rack mount rails, and the necessary hardware to mount the analyzer in an equipment rack with 482.6 mm (19 inches) horizontal spacing.

Additional kits may be ordered from Agilent. Refer to "Rack Mount Kits and Handle Kits" on page 6-49 for the part numbers.

Option 1CP, Rack Mount Flange Kit for Instruments with Handles

Option 1CP provides a rack mount kit that contains a pair of flanges (cut to adapt to handles), rack mount rails, and the necessary hardware to mount the analyzer in an equipment rack with 482.6 mm (19 inches) horizontal spacing.

Additional kits may be ordered from Agilent. Refer to "Rack Mount Kits and Handle Kits" on page 6-49 for the part numbers.

Option 1E1, Source Attenuator (Extended Power Range)

This option is included in Options 145, 146, 245, and 246.

This option adds a single 60-dB step attenuator in the signal path of the measurement ports. This step attenuator is used to adjust the power level (in 10 db steps) to the device under test (DUT) without changing the power in the reference path.

Option 897, Built-In Tests for Commercial Calibration

This option enables performance tests that are built into the analyzer that enable you to perform ISO 9001 commercial calibration of your analyzer. Refer to "Calibration Options" on page 2-10 for a description of the commercial calibration.

Option 898 Built-In Tests for Standards Compliant Calibration

This option enables performance tests that are built into the analyzer that enable you to perform ISO 17025 and ANSI Z540 standards compliant calibration of your analyzer. Refer to "Calibration Options" on page 2-10 for a description of the standards compliant calibrations.

Option F13P04, 13.5 GHz Frequency Range

This is a 4-port network analyzer with an upper frequency limit of 13.5 GHz. This option is included in Options 140, 145, and 146.

Option F20P04, 20 GHz Frequency Range

This is a 4-port network analyzer with an upper frequency limit of 20 GHz. This option is included in Options 240, 245, and 246.

Option S02, Second Source

This options adds a second source output with an internal second 60-dB step attenuator in this second source signal path. This option is included in Options 146 and 246.

Analyzer Upgrades Available

The options described in this chapter can be ordered as upgrades. The following table lists the upgrades that are available for the N5230C analyzer described in this service guide. Refer to the previous section, "Analyzer Options Available" on page 2-3, for a complete description of each option included in the upgrades.

Refer also to Chapter 6, "Replaceable Parts" for a complete list of available upgrade kits and for information on how to order.

Upgrade	Order Number
Time Domain (Option 010)	N5230CU-010
Frequency Offset Mode (Option 080)	N5230CU-080
Add built-in performance test software for Agilent inclusive calibration perpetual license (Option897)	N5230CU-897
Add built-in performance test software for standards compliant calibration perpetual license (Option898)	N5230CU-898
13.5 GHz or 20 GHz Standard Test Set to Configurable Test Set with Extended Power Range (Option 140 to 145 or 240 to 245)	N5230CU-926
Add Second Source to 13.5 GHz Configurable Test Set with Extended Power Range (Option 145 to 146)	N5230CU-928
Add Second Source to 20 GHz Configurable Test Set with Extended Power Range (Option 245 to 246)	N5230CU-927
Frequency Extension, 13.5 to 20 GHz (Option 140 to 240 or 145 to 245)	N5230CU-966

 Table 2-1
 Analyzer Upgrades Available

Analyzer Accessories Available

CD-RW Drive

This accessory is an external read/write CD drive with a USB cable and can be ordered as model number N4688A.

USB Hub

This accessory is a 4-port USB hub for connecting additional USB peripheral devices and can be ordered as model number N4689A.

Equipment	Critical Specifications	Recommended Model or Part Number	Alternate Model or Part Number	Use ^a
	Test Instruments and	l Software		
Frequency counter	Freq: 10 MHz to 10.5 GHz Accuracy : ±0.5 ppm	53151A Opt 001	None	P, A, T
Spectrum analyzer	Min Freq: 1 MHz Max Freq: > 4 GHz Resolution BW: 300 Hz	8565E	856xE	Α, Τ
Power meter	Accuracy: ±0.0068 dB	E4418B/19B	E4418A/19A ^b	P, A, T
Power sensor	Freq: 300 kHz to 3.0 GHz Range: -30 to +20 dBm	8482A	None	P, A, T
Power sensor	Freq: 3.0 GHz to 13. 5 or 20 GHz Range: -30 to +20 dBm	E4413A	None	P, A, T
Dynamic accuracy test set	None specified	Z5623A Opt H01	None	Р
Gain Compression Test Set	None specified	Z5623A K01	None	Р
Digital multi-meter	Voltage and resistance measurement capability Voltage resolution: 10 mV	Any	Any	Т
Printer	N/A	Any printer with Microsoft® Windows® 2000 driverP		Р
Test software ^c	N/A	N7840A	None	Р

Required Service Test Equipment

a. P = Performance tests, A = Adjustments, T = Troubleshooting, V = System verification

b. If an accurate measurement of the dynamic accuracy specification is not required, the E4418A or E4419A can be used.

c. The recommended model or part number for all equipment listed with a "P" in the Use column is required for proper operation of this test software.

Microsoft® and Windows® are U.S. registered trademarks of Microsoft Corporation.

Required Service Test Equipment (Cont'd)

Equipment ^a	Critical Specifications	Recommended Model or Part Number	Alternate Model or Part Number	Use ^b
	Calibration and Verif	fication Kits		
3.5 mm calibration kit	Freq: 10 MHz to 13.5 or 20 GHz	85052B	85052D	P,T
3.5 mm verification kit	Freq: 10 MHz to 13. 5 or 20 GHz	85053B	None	V
	Cables			
BNC cable (2 required)	50Ω, length ≥ 60 cm	8120-1839	None	А
3.5 mm RF cable (2 required)	50Ω, length ≥ 60 cm	85131C	85131E	P,A,V
GPIB cable	N/A	10833A/B/C/D	None	P,A
	Adapters			
3.5 mm (f) to 3.5 mm (f)	Return Loss: ≥ 32 dB	83059B	85052-60012 ^c	P,A,T
3.5 mm (f) to type-N (m)	Return Loss: ≥ 28 dB	1250-1743	None	P,A,T
Attenuators				
3.5 mm (m,f), 10-dB fixed attenuator	Accuracy: ± 0.5 dB Freq: 10 MHz to 13.5 or 20 GHz	8493C Option 010	None	Р
3.5 mm (m,f), 20-dB fixed attenuator	Accuracy: ± 0.5 dB Freq: 10 MHz to 13.5 or 20 GHz	8493C Option 020	None	Р

a. Unless specified otherwise, equipment listed is required for all analyzer models.
b. P = Performance tests, A = Adjustments, T = Troubleshooting, R = Repair, V = System verification
c. Included in the 85052B/D calibration kits.

Equipment ^a	Critical Specifications	Recommended Model or Part Number	Alternate Model Number	Use ^b
	Tools	·	·	·
Extender board	N/A	E8356-60021	None	Т
T-8 TORX driver	0.6 N-m (5 in-lb) setting	N/A	N/A	R
T-10 TORX driver	0.5, 0.8, and 1.0 N-m (4, 7, and 9 in-lb) settings	N/A	N/A	T, R
T-15 TORX driver	1.5 N-m (14 in-lb) setting	N/A	N/A	T, R
T-20 TORX driver	2.4 N-m (21 in-lb) setting	N/A	N/A	T, R
1/4 inch and 5/16 inch open-end wrench	Thin profile	8710-0510	N/A	A, R
5/16 inch, open-end torque wrench (metric equivalent is 8 mm)	1.1 and 2.4 N-m (10 and 21 in-lb) settings (for semi-rigid cables)	N/A	N/A	T, R
1 inch, open-end torque wrench (metric equivalent is 26 mm)	8.1 N-m (72 in-lb) setting (for test port connector nuts)	N/A	N/A	R
20 mm, open-end torque wrench	0.9 N-m (8 in-lb) setting (for test port measurement connections)	8710-1764	N/A	P, A, T
	Static Safety Parts	·	·	
Adjustable antistatic wrist strap	N/A	9300-1367	None	P, A, T
Antistatic wrist strap grounding cord (5 foot)	N/A	9300-0980	None	P, A, T
Static control table mat and earth ground wire	N/A	9300-0797	None	P, A, T
Miscellaneous				
USB flash ROM drive	N/A	Any	None	P, A, R

a. Unless specified otherwise, equipment listed is required for all analyzer models.

b. P = Performance tests, A = Adjustments, T = Troubleshooting, R = Repair, V = System verification

Agilent Support, Services, and Assistance

Information on the following topics is included in this section.

- "Service and Support Options"
- "Calibration Options"
- "Contacting Agilent"
- "Shipping Your Analyzer to Agilent for Service or Repair"

Service and Support Options

The analyzer's standard warranty is a *one-year return to Agilent Technologies* service warranty.

NOTE There are many other repair and calibration options available from the Agilent Technologies support organization. These options cover a range of service agreements with varying response times. Contact Agilent for additional information on available service agreements for this product. Refer to "Contacting Agilent" on page 2-11.

Calibration Options

Option R-50C-001, Commercial Calibration with Data

This option adds a calibration label, a calibration certificate, and the corresponding calibration data on a CD-ROM. This calibration conforms to ISO 9001.

This certificate and data can be obtained by sending your analyzer to Agilent for calibration along with an order for R-50C-001. Refer to "Shipping Your Analyzer to Agilent for Service or Repair".

Option R-50C-002, Standards Compliant Calibration

This option adds calibration label, a calibration certificate, and the corresponding calibration data, measurement uncertainties, and guardbands on all customer specifications on a CD-ROM. This calibration conforms to ISO 17025 and ISO 9001.

This certificate and data can be obtained by sending your analyzer to Agilent for calibration along with an order for R-50C-002. Refer to "Shipping Your Analyzer to Agilent for Service or Repair".

Contacting Agilent

Assistance with test and measurements needs and information on finding a local Agilent office are available on the Web at:

http://www.agilent.com/find/assist

If you do not have access to the Internet, please contact your Agilent field engineer.

NOTE In any correspondence or telephone conversation, refer to the Agilent product by its model number and full serial number. With this information, the Agilent representative can determine whether your product is still within its warranty period.

Shipping Your Analyzer to Agilent for Service or Repair

IMPORTANT Agilent Technologies reserves the right to reformat or replace the internal hard disk drive in your analyzer as part of its repair. This will erase all user information stored on the hard disk. It is imperative, therefore, that you make a backup copy of your critical test data located on the analyzer's hard disk before shipping it to Agilent for repair.

If you wish to send your network analyzer to Agilent Technologies for service or repair:

- Include a complete description of the service requested or of the failure and a description of any failed test and any error message.
- Remove and retain the front handles and all rack mount hardware. The analyzer should be sent to Agilent in the same configuration as it was originally shipped.
- Ship the analyzer using the original or comparable antistatic packaging materials.
- Contact Agilent for instructions on where to ship your analyzer. Refer to "Contacting Agilent" on page 2-11.

3 Tests and Adjustments

Information in This Chapter

This chapter contains procedures to help you check, verify, and adjust your PNA.

- The checks verify the operation of the assemblies in your analyzer.
- The verification compares the operation of your analyzer to a gold standard.
- The adjustments allow you to tune your analyzer for maximum response.

Chapter Three at-a-Glance

Section Title	e Summary of Content		
	Items to consider or procedures to perform before testing is begun:		
	Verify the Operating Environment		
Before You Begin	Protect Against Electrostatic Discharge (ESD)	Page 3-4	
	• Allow the Analyzer to Warm Up		
	Review the Principles of Connector Care		
	Descriptions of:		
	System Specifications		
About System	Instrument Specifications	Page 3-6	
Verification and Performance Tests	System Verification Procedure		
	Performance Tests		
	Certificate of Calibration		
ANSI/NCSL Z540–1–1994 Verification	The ANSI/NCSL Z540-1-1994 process of verifying your analyzer.	Page 3-8	
Non-ANSI/NCSLThe non-ANSI/NCSL Z540-1-1994 process of verifying your analyzer.		Page 3-9	
	Performing the operator's check.		
Preliminary Checks	Checking your test cables.	Page 3-10	
	Perform these checks before performing system verification.	1 450 0 10	

NOTE A description of the performance tests in the Agilent N7840A software package is included in this chapter. The Agilent N7840A software package must be purchased separately.

Section Title	Summary of Content	Start Page
System Verification	What the system verification does. How to perform the verification test. How to interpret the results.	Page 3-19
Performance Tests (Agilent N7840A Software Package) ^a	 A brief summary of each performance test in the Agilent N7840A software package: Source Power Accuracy Test Source Maximum Power Output Test Source Power Linearity Test Frequency Accuracy Test Trace Noise Test Receiver Compression Test Noise Floor Test Calibration Coefficients Test Dynamic Accuracy Test 	Page 3-28
Setups and procedures for adjusting your analyzer:• 10 MHz Frequency Reference Adjustment• LO Power Adjustment• Source Calibration Adjustment• Receiver Calibration Adjustment		Page 3-35

a. The Agilent N7840A software package must be purchased separately.

Before You Begin

Before checking, verifying, or adjusting the analyzer, refer to the following paragraphs to:

- make sure the operating environment is within its requirements
- make sure that proper electrostatic discharge (ESD) protection is provided
- make sure the analyzer has warmed up properly to achieve system stability
- review the principles of connector care

Verify the Operating Environment

Due to their operating specifications, the verification and calibration kit devices determine your operating environment conditions. Open the calibration and verification kits and place all the devices on top of the foam inserts so they will reach room temperature. As the device dimensions change with temperature, their electrical characteristics change as well. It is necessary to keep the environmental levels within the following limits:

• Temperature: +23 °C \pm 3 °C (Error-corrected temperature range)

Once the measurement calibration has been done, the ambient temperature must be maintained to within \pm 1 °C of the calibration temperature.

- Humidity: 5% to 95% at 40 $^{\circ}\mathrm{C}$ maximum
- Altitude: 0 to 4,500 meters (14,760 feet.)

Protect Against Electrostatic Discharge (ESD)

This is important. If not properly protected against, electrostatic discharge can seriously damage your analyzer, resulting in costly repair.

CAUTION To reduce the chance of electrostatic discharge, follow all of the recommendations outlined in "Electrostatic Discharge Protection" on page 1-6, for all of the procedures in this chapter.

Allow the Analyzer to Warm Up

NOTE To achieve the maximum system stability, allow the analyzer to warm up for at least 90 minutes.

Review the Principles of Connector Care

Proper connector care and connection techniques are critical for accurate and repeatable measurements. Refer to Table 3-1 for tips on connector care.

Prior to making connections to your analyzer, carefully review the information about inspecting, cleaning, and gaging connectors. Refer to the calibration kit documentation for detailed connector care information.

For course numbers about additional connector care instruction, contact Agilent Technologies. Refer to "Contacting Agilent" on page 2-11.

	Handling and Storage				
Do	• Keep connectors clean	Do Not	Touch mating-plane surfaces		
	• Extend sleeve or connector nut		• Set connectors contact-end down		
	• Use plastic end-caps during storage		• Store connectors or adapters loose		
	Visual I	nspection			
Do	• Inspect all connectors carefully	Do Not	• Use a damaged connector - ever		
	• Look for metal particles, scratches, and dents				
	Connecto	r Cleanin	g		
Do	• Try compressed air first	Do Not	• Use any abrasives		
	• Use isopropyl alcohol ^a		• Get liquid into plastic support		
	• Clean connector threads		beads		
	Gaging C	onnector	s		
Do	• Clean and zero the gage before use	Do Not	• Use an out-of-specification		
	• Use the correct gage type		connector		
	• Use correct end of calibration block				
	• Gage all connectors before first use				
	Making C	onnection	15		
Do	• Align connectors carefully	Do Not	• Apply bending force to connection		
	• Make preliminary connection contact lightly		• Over tighten preliminary connection		
	• Turn only the connector nut		• Twist or screw any connection		
	• Use a torque wrench for final connection		• Tighten past torque wrench "break" point		

Table 3-1 Connector Care Quick Reference Guide

a. Cleaning connectors with alcohol shall only be done with the instrument's power cord removed, and in a well-ventilated area. Allow all residual alcohol moisture to evaporate, and the fumes to dissipate prior to energizing the instrument.

About System Verification and Performance Tests

The performance of the network analyzer is specified in two ways: system specifications, and instrument specifications. It is the end user's responsibility to determine which set of specifications is applicable to their use of the PNA.

A network analyzer measurement "system" includes the analyzer, calibration kit, test cables, and any necessary adapters. **The system verification software in the PNA is used to verify the system's conformance to the "system" specifications.** A "pass" result demonstrates that the analyzer, test cables, and adapters, perform correctly as a system. It DOES NOT demonstrate that any one component performs according to its individual specifications. A change to any part of this measurement system requires a re-verification of the system.

Instrument specifications specify the network analyzer's uncorrected measurement port characteristics and its output and input behavior. The PNA performance tests are used to verify the analyzer's conformance to "instrument" specifications.

System Specifications

System specifications specify warranted performance of the measurement system when making error-corrected measurements using the same calibration kit and test cables used during the system verification routine. System specifications are applicable only when the measurement system is used to make error-corrected measurements.

The analyzer's system specifications are described in the *Agilent PNA Series Network Analyzer Technical Specifications* and also in the analyzer's on-line help system in the section titled "Corrected System Performance".

System specifications are expressed in two ways:

- residual errors of the measurement system shown as tabular specification values
- graphs of measurement uncertainty versus reflection and transmission coefficients

System specifications are verified in one of the following ways:

- Complete the system verification procedure using a certified verification kit and certified calibration kit that will be used for future measurements, or
- Complete all of the performance tests using a certified calibration kit that will be used for future measurements. This alternative verifies both the system specifications and the instrument specifications for the analyzer.

Instrument Specifications

The analyzer's instrument specifications are described in the *Agilent PNA Series Network Analyzer Technical Specifications* and also in the analyzer's on-line help system in the sections titled "Uncorrected System Performance", "Test Port Output", and "Test Port Input".

These specifications apply when the analyzer is used to make either raw or error-corrected measurements.

System Verification Procedure

The system verification procedure tests the network analyzer measurement "system", as defined previously, against the system specifications. If confirmation is successful, the measurement system is capable of making measurements to the accuracy specified by the graphs of measurement uncertainty.

The procedure consists of calibrating the analyzer with a calibration kit, measureing a set of characterized devices, and comparing the resultant measured data to the data and uncertainty limits supplied with the verification kit. The device data provided with the verification kit has a traceable path to NIST. The total measurement uncertainty limits for the performance verification are the sum of the factory measurement uncertainties and the uncertainties associated with measuring the same devices on the system being verified. The difference between the factory-measured data and the verification-measured data must fall within the total uncertainty limits at all frequencies for the total system uncertainty test to pass.

NOTE

Calibration kits are different from verification kits. Calibration kits are used to determine the systematic errors of a network analyzer measurement system. Verification kits are used to confirm system specifications and are not used to generate error correction.

Performance Tests

Performance tests are used to confirm analyzer performance against the "instrument" specifications. If confirmation is successful, the analyzer meets the instrument specifications.

Performance tests are contained in the N7840A Software Package and are described at "Performance Tests (Agilent N7840A Software Package)" on page 3-28.

An illustrated outline of the performance verification procedure:

- for ANSI/NCSL Z540-1-1994 verification, is shown in Figure 3-1 on page 3-8.
- for non-ANSI/NCSL Z540-1-1994 verification, is shown in Figure 3-2 on page 3-9.

Certificate of Calibration


Agilent Technologies will issue a certificate of calibration upon successful completion of system verification or completion of the performance tests. The certificate of calibration will apply to the "system" (analyzer, calibration kit, test cables, and any necessary adapters) if the system verification procedure is used to confirm the system specifications. If the performance tests are used to confirm instrument specifications, the certificate of calibration will apply to the PNA as an independent instrument. The equipment and measurement standards used for the tests must be certified and must be traceable to recognized standards.

NOTE If you have a measurement application that does not use all of the measurement capabilities of the analyzer, you may ask your local Agilent Technologies service office to verify only a subset of the specifications. However, this "limited calibration" creates the possibility of making inaccurate measurements if you then use the analyzer in an application requiring additional capabilities.

ANSI/NCSL Z540-1-1994 Verification

To meet the criteria for ANSI/NCSL Z540-1-1994, perform the preliminary checks and all performance tests *without stopping to repair or adjust*¹. Refer to Figure 3-1 for test flow. Print data at the completion of all the tests, even if you are aware that the analyzer did not pass. If there is a failure, complete the verification before you troubleshoot, repair, and adjust. After the failure has been corrected, repeat the entire set of performance tests and generate a new set of data.

Figure 3-1 ANSI/NCSL Z540–1–1994 Test Path Verification Flowchart

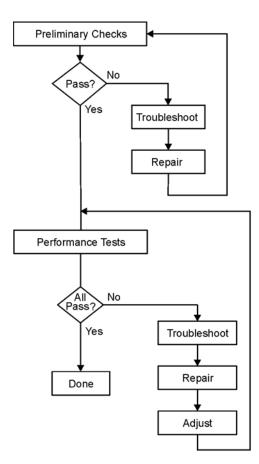


sc870b

^{1.} Stop only in case of a catastrophic failure or cable connector damage

Non-ANSI/NCSL Z540-1-1994 Verification

For non-ANSI/NCSL Z540-1-1994, perform the preliminary checks and performance tests while *stopping to troubleshoot*. Refer to Figure 3-2 for test flow. Troubleshoot and repair the first problem encountered without continuing to other tests. After you troubleshoot, repair, and adjust, repeat the *last failed* portion and generate a new set of data.

Figure 3-2 Non-ANSI/NCSL Z540-1-1994 Test Path Verification Flowchart

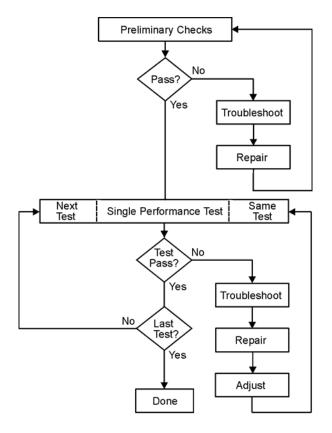

sc869b

Preliminary Checks

Preliminary checks include the following:

• "The Operator's Check" on page 3-10

The operator's check tests the network analyzer's basic functionality of the source, switch, and receivers.

• "The Test Port Cable Checks" on page 3-12

The test port cable checks are not required, but are recommended to verify the performance of the test port cables before performing the verification test.

The Operator's Check

NOTE To achieve the maximum system stability, allow the analyzer to warm up for at least 90 minutes before performing the Operator's Check.

The operator's check is a software driven test that checks the basic operation of the assemblies in the Port 1 and Port 2 signal paths. By performing the operator's check, the following are determined:

- repeatability of the RF test port switch
- attenuation ranges of all installed attenuators
- calibration of the receivers
- frequency response of the receivers
- phase lock and leveling
- noise floor and trace noise

Accessories Used in the Operator's Check

Equipment Type	Part Number	
Female short, 3.5 mm	85052-60007 (from the 85052 calibration kit)	
Female open, 3.5 mm	85052-60009 (from the 85052 calibration kit)	

Performing the Operator's Check

- 1. From the System menu, point to Service, and then click Operator's Check.
- 2. In the **PNA Operator's Check** dialog box (refer to Figure 3-3), under **Configure**, select either **Prompt for attachment of Short/Open**, to pause at each step in the process to allow moving the short/open to the appropriate port, or **Shorts/Opens are attached to ALL ports**, to run through the test without stopping. Shorts and opens can be mixed on the test ports.
- 3. Click Begin.
- 4. If shorts and opens are not connected to all ports, you will be prompted to connect them as they are needed.

5. The result of the operator's check will be shown as a PASS or FAIL next to each test (refer to Figure 3-3). The PNA Operator's Check dialog box will look different for different PNA model numbers and installed options. Some of the tests are performed only if the appropriate options are installed in the PNA.

Operator's Check	_
PNA Operator's Check	Results
	- Phase Lock
Prompt for attachment of Short/Open Shorts/Opens are attached to ALL ports	- <u>Leveling</u>
	<u>Revr Cal</u>
Model: E8364B Serial: US42060008 Rev: A.04.85 Options: 010,080,083,UNL,016,014,081,H11	- <u>Receivers</u>
Connect either a Short or an Open to Port 1.	- Src Atten
To speed testing, and if available, you can connect a Short/Open to ALL ports now and select the proper configuration above.	- Rovr Atten
Make sure the external loop jumpers are connected! Select 'Begin' when ready.	- <u>Noise Floor</u>
E <u>x</u> it	<u>Trace Noise</u>
Legend: Not Tested Pending Pass Pass Fail	

Figure 3-3 Operator's Check Dialog Box

If the Operator's Check Fails

- 1. Clean the test ports, shorts, and adapters. Torque connections to specification. Repeat the check.
- 2. If the check still fails, suspect a faulty component. Refer to "Measurement System Troubleshooting" on page 4-23 to begin troubleshooting to determine the faulty component.

The Test Port Cable Checks

A faulty test port cable can cause a failure in the verification test. The following checks are not required, but are recommended to verify the performance of the test port cable.

- "Cable Return Loss Check" on page 3-13
- "Cable Insertion Loss Check" on page 3-14
- "Cable Magnitude and Phase Stability Check" on page 3-15
- "Cable Connector Repeatability Check" on page 3-17

Accessories Used in the Test Port Cable Checks

Equipment Type	Model or Part Number	Alternate Model or Part Number
Calibration kit, 3.5 mm	85052B	85052D
Test cable, 3.5 mm (f) to 3.5 mm (f)	85131C	85131E

Cable Return Loss Check

- 1. Press Preset.
- 2. Perform a one-port calibration on Port 1, **1-Port Reflection**. Refer to the embedded help in the analyzer if necessary.
- 3. Connect the test port cable to Port 1. Connect a broadband load to the other end of the cable. Tighten to the specified torque for the connector type.

The analyzer now displays the return loss of the cable.

- 4. From the Marker menu, click Marker Search. In the Marker Search dialog box, in the Search Type box, make sure Maximum is selected. Click Execute, and then click OK.
- 5. The marker annotation on the screen indicates the worst case return loss. Refer to the cable manual to see if it meets the return loss specification. For an example of a typical return loss measurement, see Figure 3-4.

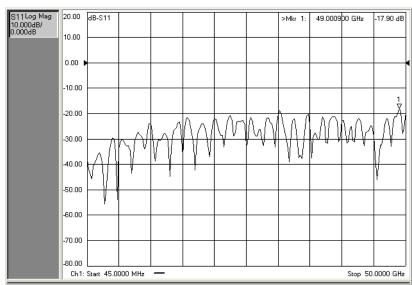


Figure 3-4 Typical Cable Return Loss Response

If the Cable Return Loss Check Fails

- 1. Clean the cable and devices and torque to specification. Repeat the check.
- 2. If the check still fails, the cable should be repaired or replaced.

Cable Insertion Loss Check

- 1. With the test port cable still connected to Port 1, connect a short to the other end of the cable.
- 2. From the Marker menu, click Marker Search. In the Marker Search dialog box, in the Search Type box, select Minimum. Click Execute, and then click OK.
- 3. The displayed response is twice the actual loss. To get the actual worst case insertion loss, divide the value at the marker annotation by two. Refer to the cable manual to see if it meets the insertion loss specification. For an example of a typical insertion loss measurement, see Figure 3-5.

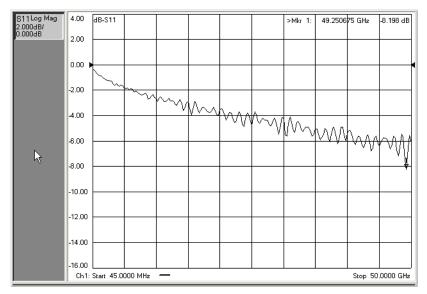


Figure 3-5 Typical Cable Insertion Loss Response

If the Cable Insertion Loss Check Fails

- 1. Clean the cable and devices and torque to specification. Repeat the check.
- 2. If the check still fails, the cable should be repaired or replaced.

Cable Magnitude and Phase Stability Check

- 1. With the test port cable still connected to Port 1, connect a short to the other end of the cable.
- 2. Press Preset.
- 3. On the **Trace** menu, click **New Trace**. In the **New Trace** dialog box, click the **S11** box, and then click **OK**.
- 4. On the **Trace** menu, click **Format**. In the **Format** dialog box, click **Phase**, and then click **OK**.
- 5. On the **Channel** menu, click **Average**. In the **Average** dialog box, click the **Average ON** check box. In the **Average Factor** box, type 50 or click the arrows to select 50, and then click **OK**.
- 6. To provide a good reference, hold the test cable in a straight line perpendicular to the front panel of the network analyzer.
- 7. On the **Channel** menu, click **Restart Avg**.
- 8. Wait for the analyzer to average the measurement 50 times (approximately two seconds).
- 9. To normalize the data trace:
 - a. On the **Trace** menu, click **Math/Memory**.
 - b. In the Math/Memory dialog box, click the Data->Memory button.
 - c. In the Data Math list, select Data/Memory.
 - d. Under Trace View Options, make sure Data Trace is selected.
 - e. Click $\boldsymbol{\mathsf{OK}}$
- 10. Slowly make a 180 degree bend in the middle of the cable and hold it in that position.
- 11. For each trace: On the **Scale** menu, set the **Scale Per Division** for optimum viewing as shown in Figure 3-6.
- 12. Place a marker on the largest deflection that goes above the reference line and is within the cable's specified frequency range. For a typical response of cable magnitude and phase stability, see Figure 3-6.
- 13. Place a marker on the largest deflection that goes below the reference line and is within the cable's specified frequency range.

In this S_{11} measurement, the displayed trace results from energy being propagated down the cable and reflected back from the short. Therefore, the measured deflection value must be divided in half to reach the correct value.

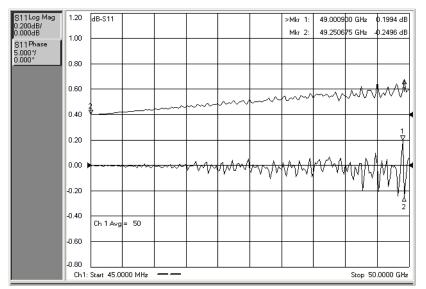


Figure 3-6 Typical Cable Magnitude and Phase Stability Response

If the Cable Magnitude and Phase Stability Check Fails

- 1. Clean the cable and devices and torque to specification. Repeat the check.
- 2. If the check still fails, the cable should be repaired or replaced.

Cable Connector Repeatability Check

NOTE	The connector repeatability measurement should be done at the test port as
	well as at the end of the test port cable.

- 1. With the test port cable still connected to Port 1, connect a broadband load to the other end of the cable.
- 2. Press Preset.
- 3. On the **Channel** menu, click **Average**. In the **Average** dialog box, click the **Average ON** check box. In the **Average Factor** box, type 100 or click the arrows to select 100. Click **OK**.
- 4. Wait for the analyzer to average the measurement 100 times (approximately five seconds).
- 5. To normalize the data trace:
 - a. On the Trace menu, click Math/Memory.
 - b. In the Math/Memory dialog box, click the Data->Memory button.
 - c. In the Data Math list, select Data/Memory.
 - d. Under Trace View Options, make sure Data Trace is selected.
 - e. Click $\boldsymbol{\mathsf{OK}}$
- 6. To adjust the display scale:
 - a. On the Scale menu, click Scale.
 - b. In the Scale Per Division box, click the arrow to select 0.5 dB.
 - c. In the **Level** box under **Reference** click the arrow to select 0 dB.
 - d. Click **OK**.
- 7. Disconnect and then reconnect the cable to the test port. Tighten the connection to the specified torque for the connector type.
- 8. On the Channel menu, click Restart Avg.
- 9. Look at the trace for spikes or modes.
- 10. To re-normalize the data trace of the reconnected cable:
 - a. On the Trace menu, click Math/Memory.
 - b. In the Math/Memory dialog box, click the Data->Memory button.
 - c. Click **OK**.
- 11. Repeat steps 7 through 9 at least three times to look for modes. Modes appear when a harmonic of the source fundamental frequency is able to propagate through the cable or connector. It is helpful to print a plot of the trace each time to compare several connections. If any mode appears each time the cable is connected and reconnected, measurement integrity will be affected.

For a typical response of cable connector repeatability, see Figure 3-7.

12. For the Port 2 Check, connect the cable (with the load attached) to Port 2 and repeat steps 2 through 11.

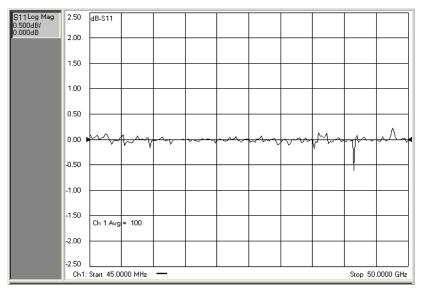


Figure 3-7 Typical Cable Connector Repeatability Response

If the Cable Connector Repeatability Check Fails

- 1. Clean the cable and devices, and torque to specification. Repeat the check.
- 2. If the check still fails, the cable should be repaired or replaced.

System Verification

System verification is used to verify system-level, error-corrected uncertainty limits for network analyzer measurements. The verification procedure is automated and is contained in the firmware of the analyzer.

The device data provided with the verification kit has a traceable path to a national standard. The difference between the supplied traceable data and the measured data must fall within the total uncertainty limits at all frequencies for the system verification to pass.

The total measurement uncertainty limits for the system verification are the sum of the factory measurement uncertainties for the verification devices and the uncertainties associated with the system being verified. You can determine your system measurement uncertainty limits by referring to the analyzer's on-line embedded help.

IMPORTANT Passing this system verification does not guarantee that the analyzer meets all of its performance specifications. However, it does show that the network analyzer being verified measures the same devices with the same results as a factory system which has had all of its specifications verified and its total measurement uncertainty minimized.

What the System Verification Verifies

The system verification procedure verifies proper operation of the:

- network analyzer
- calibration kit
- test port cables (with any necessary adapters)

together as a "system". It DOES NOT verify that any of these components pass their specifications independently. The user is responsible for independently calibrating and verifying the proper operation of the calibration kit and test port cables prior to performing the system verification.

NOTE	Additional equipment or accessories used with the above system are not
	verified by system verification.

Measurement Uncertainty

Measurement uncertainty is defined as the sum of:

- the residual systematic (repeatable) errors, and
- the random (non-repeatable) errors

in the measurement system after calibration.

The systematic errors are:

- directivity,
- source match,
- load match,
- reflection and transmission frequency tracking, and
- isolation (crosstalk).

The random errors include:

- noise,
- drift,
- connector repeatability, and
- test cable stability.

A complete description of system errors and how they affect measurements is provided in the analyzer's on-line embedded help.


Any measurement result is the vector sum of the actual test device response plus all error terms. The precise effect of each error term depends on its magnitude and phase relationship to the actual test device response. When the phase of an error response is not known, phase is assumed to be worst-case (-180° to $+180^{\circ}$). Random errors such as noise and connector repeatability are generally combined in a root-sum-of-the-squares (RSS) manner.

Measurement Traceability

To establish a measurement traceability path to a national standard for a network analyzer system, the overall system performance is verified through the measurement of devices that have a traceable path. This is accomplished by measuring the devices in an Agilent verification kit.

The measurement of the devices in the verification kit has a traceable path because the factory system that measured the devices is calibrated and verified by measuring standards that have a traceable path to the National Institute of Standards and Technology (NIST) (see Figure 3-8). This chain of measurements defines how the verification process brings traceability to the network analyzer system.

Figure 3-8 NIST Traceability Path for Calibration and Verification Standard

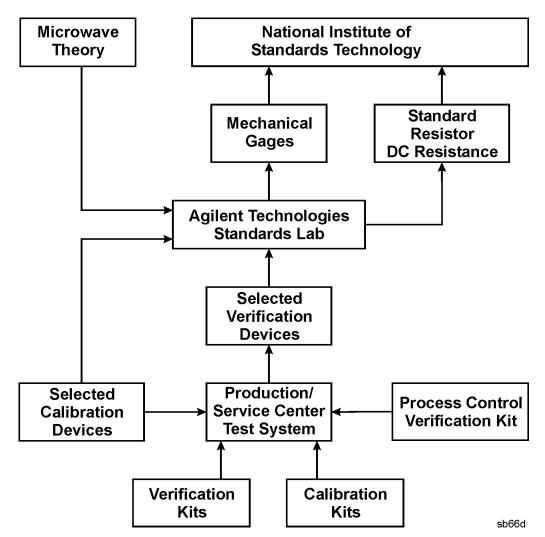

Performing System Verification

The following verification procedure is automated by the analyzer firmware. The process for the verification is:

- connect cables to the analyzer test ports
- perform a calibration or recall a recent calibration
- run the system verification program for the verification devices

To verify all four ports, it is necessary to perform the verification process outlined above twice—once for ports 1 and 2 and once for ports 3 and 4.

Each time through the verification process, you are prompted to make necessary connections and perform or recall a calibration as part of performing the verification. If you select to perform a calibration, you are guided through the calibration procedure. This part of the process can be eliminated if you choose to load an existing recent calibration. If necessary, refer to the analyzer's on-line embedded help for information on storing and recalling calibrations.

For each verification device, the analyzer reads a file from the verification disk and sequentially measures the magnitude and phase for all four S-parameters.

IMPORTANT	For system verification to perform correctly, it is NECESSARY that the verification devices be measured with their female connectors connected to the analyzer's test ports.
NOTE	Although the performance for all S-parameters are measured, the S_{11} , S_{22} , S_{33} , and S_{44} phase uncertainties for the attenuators and airlines are less important for verifying system performance. Therefore, the limit lines will not appear on the printout.

Equipment Used in the System Verification Procedure

Equipment Type	3.5 mm	Type-N
Calibration kit	85052B, C, D N4691A E-cal	85054B/D N4690A E-cal
Verification kit	85053B	85055A
Cables	Single cable: 85131C/E Cable pair: 85131D/F	Single cable: 85132C/E (3.5 mm NMD to 7 mm) Cable pair: 85132D/F (3.5 mm NMD to 7 mm)
Adapters	None required.	With single cable: an 85130C adapter and a 7mm to Type-N adapter from the 85054B calibration kit. With cable pair: Two 7mm to Type-N adapters from the 85054B calibration kit.

Cable Substitution

The test port cables specified for the network analyzer system have been characterized for connector repeatability, magnitude and phase stability with flexing, return loss, insertion loss, and aging rate. Since test port cable performance is a significant contributor to the system performance, cables of lower performance will increase the uncertainty of your measurement. Refer to the plots in the cable tests (earlier in this chapter) that show the performance of good cables. It is highly recommended that the test port cables be regularly tested.

If the system verification is performed with a non-Agilent cable, ensure that the cable meets or exceeds the specifications for the test cable specified in the previous table, "Equipment Used in the System Verification Procedure." Refer to the cable's user's guide for specifications.

Kit Substitution

Non-Agilent calibration kits and verification kits are not recommended nor supported.

System Verification Procedure

- 1. If you desire printed test outputs, connect a printer to the analyzer. For the printer, ensure that the correct driver is loaded and the printer is defined as the default printer. Refer to the embedded help in the analyzer for printer setup. Let the analyzer warm up for at least 90 minutes.
- 2. Insert the verification kit disk into the analyzer disk drive.
- 3. On the System menu, point to Service, and then click System Verification. The System Verification dialog box is displayed; refer to Figure 3-9.

Figure 3-9 System Verification Dialog Box

PNA System Verification -	- Agilent Techno	logies, Inc.	×	
Run Con	figure Ove	erview Help		
PNA System Verification Insert the verification data disk into drive A:, select the calibration kit and cable(s) being used, select the desired printer and file outputs, then click "Run".				
Calibration Kit		Cutputs		
Agilent 85052B (3.5 mm w/	'Sliding Load) 💌	🔲 Print Tabular Data		
Verification Kit (Automat	ically selected)	 Print Graphs File Tabular Data 		
Agilent 85053B 3.5 mm		File Graphs		
Test Cable(s) Single Cable (+ Adap	oters) 🔿 Ca	ble Pair (+Adapters)	_	
Cables: 85131C/E : Adapters: No adapter	3.5mm NMD to 3.5n s.	nm(f) cable.		
	un	E <u>x</u> it		

- 4. In the **Calibration Kit** box, select the calibration kit or electronic calibration module (ECal) that is being used by clicking on it. The corresponding verification kit to use is selected for you and displayed in the **Verification Kit** box. Refer to Figure 3-9.
- 5. Under **Printer Output**, click one of the following options. Refer to Figure 3-9.
 - **Print Tabular Data**: Prints the verification data in tabular form which includes measured data and uncertainty limits. For an example, refer to Figure 3-11 on page 3-26.
 - **Print Graphs**: Prints the verification data in graphical form. The graphical form includes the measured data trace, factory supplied data trace, and uncertainty limits. For an example, refer to Figure 3-12 on page 3-27.
 - File Tabular Data: Writes the tabular data to a text file in the C:\Program Files\Agilent\Network Analyzer\Documents\ directory.
 - File Graphs: Saves a screen image in PNG format in the C:\Program Files\Agilent\Network Analyzer\Documents\ directory.
- **NOTE** For printed output, it is assumed that the printer has been tested and the Windows driver is installed for the printer that is being used. The system verification test prints to the printer that has been designated as the default printer. (On the Windows Desktop display, click on **My Computer, Control Panel**, and then **Printers** to verify the printer setup.)

To modify the number of ports to be verified or to change the number of devices to measure, click on the **Configure** tab and make the desired selections.


- 6. Click Run.
- 7. Follow the instructions on the analyzer for performing a full calibration or recalling an existing recent calibration.
- 8. Follow the instructions on the analyzer for performing the system verification, inserting the verification devices as prompted.

If the System Fails the Verification Test

IMPORTANT Inspect all connections. *Do not* remove the cable from the analyzer test port. This *will invalidate* the calibration that you performed earlier.

- 1. Disconnect and clean the device that failed the verification test.
- 2. Reconnect the device making sure that all connections are torqued to the proper specifications.
- 3. Measure the device again.
- 4. If the analyzer still fails the test, check the measurement calibration by viewing the error terms as described in "Accessing Error Terms" in Chapter 8.
- 5. Refer to Figure 3-10 for additional troubleshooting steps.

Figure 3-10 System Verification Failure Flowchart

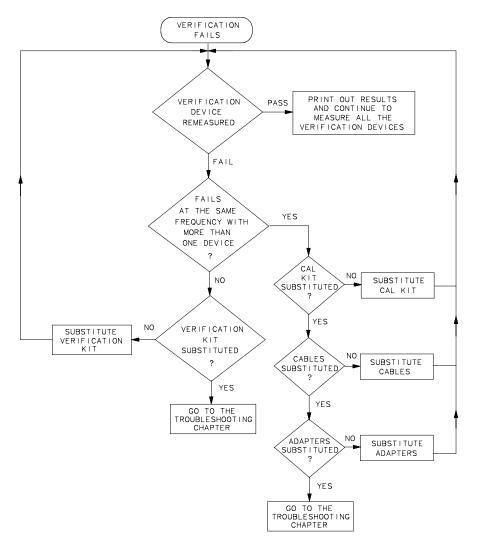

sb69d

Interpreting the Verification Results

Figure 3-11 shows an example of typical verification results with **Print Tabular Data** selected in the **Printer Output** area of the **System Verification** dialog box.

At the top of the printed output is the name of the device, the serial number of the device, and the date tested.

Each S-parameter measurement result is printed with frequency tested, lower and upper limit lines, the measured data, and the result of the test.

Figure 3-11 Example of Printed Tabular Verification Results

Sys Ver -- 20 dB attenuator magnitude results, Serial #00810 -- 6 Sep 2000

S11 Results				
Frequency	Lower Limit	Measured Data	Upper Limit	Result
0.3 MHz	0.0048 Units	0.0090 Units	0.0139 Units	PASS
100	0.0046	0.0091	0.0137	PASS
200	0.0042	0.0092	0.0134	PASS
300	0.0040	0.0091	0.0133	PASS
400	0.0038	0.0089	0.0131	PASS
500	0.0036	0.0087	0.0129	PASS
600	0.0034	0.0085	0.0127	PASS
700	0.0031	0.0082	0.0125	PASS
800	0.0029	0.0080	0.0122	PASS
900	0.0026	0.0079	0.0119	PASS
1000	0.0023	0.0075	0.0117	PASS
1100	0.0020	0.0072	0.0114	PASS
1200	0.0017	0.0068	0.0111	PASS
1300	0.0013	0.0064	0.0107	PASS
1400	-0.0006	0.0059	0.0118	PASS
1500	-0.0011	0.0052	0.0113	PASS
1600	-0.0015	0.0044	0.0108	PASS
1700	-0.0020	0.0038	0.0103	PASS
1800	-0.0026	0.0032	0.0097	PASS
1900	-0.0031	0.0024	0.0091	PASS
2000	-0.0036	0.0019	0.0085	PASS
2100	-0.0045	0.0016	0.0082	PASS
2200	-0.0050	0.0018	0.0077	PASS
2300	-0.0054	0.0023	0.0073	PASS
2400	-0.0052	0.0031	0.0075	PASS
2500	-0.0048	0.0039	0.0080	PASS
2600	-0.0040	0.0050	0.0087	PASS
2700	-0.0032	0.0060	0.0094	PASS
2800	-0.0024	0.0071	0.0103	PASS
2900	-0.0014	0.0082	0.0113	PASS
3000	-0.0004	0.0095	0.0124	PASS

Overall PASS/FAIL result for entire frequency range = PASS

Figure 3-12 shows an example of typical verification results with **Print Graphs** selected in the **Printer Output** area of the **System Verification** dialog box. The printed graphical results show the following:

- the name of the device measured
- the serial number of the device
- the parameters measured
- Results of the measurements. Labeled as A in Figure 3-12.
- Data measured at the factory from the verification kit. Labeled as B in Figure 3-12.
- Upper and lower limit points as defined by the total system uncertainty system. Labeled as C in Figure 3-12.

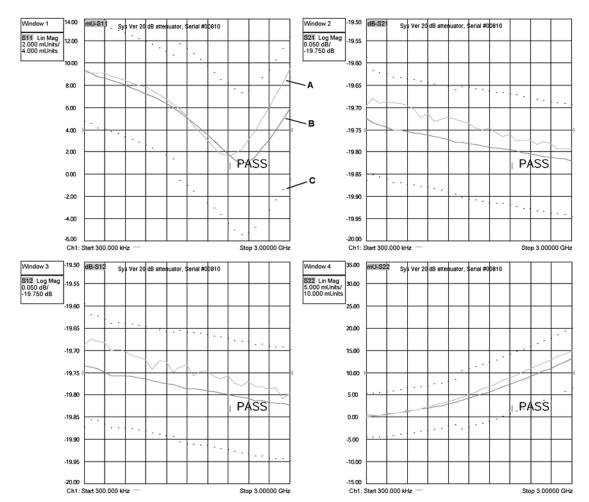


Figure 3-12 Example of Printed Graphical Verification Results

Performance Tests (Agilent N7840A Software Package)

The Agilent N7840A software package verifies the electrical performance of your N5230C microwave PNA. The software automatically configures your analyzer to execute the performance tests. The N7840A software package is not included with the analyzer; it must be ordered separately. The model numbers of the equipment used are specified under "Required Service Test Equipment" on page 2-7.

There are nine tests in the software package:

- Source Power Accuracy Test
- Source Maximum Power Output Test
- Source Power Linearity Test
- Frequency Accuracy Test
- Trace Noise Test
- Receiver Compression Test
- Noise Floor Test
- Calibration Coefficients Test
- Dynamic Accuracy Test

Source Power Accuracy Test

Function of the Test: To confirm the accuracy of the source output power of your network analyzer over its full frequency range.

Specification Tested: Test Port Output-Power Level Accuracy

Equipment Used: A power meter, power sensors, and adapters.

Description of the Test:

- 1. The analyzer's output power level is set to 0 dBm.
- 2. A power sensor is connected to Port 1.
- 3. The output power is measured at hundreds of CW frequencies across the analyzer's frequency range and the values compared to the setting of 0 dBm.

- Perform the "Source Calibration Adjustment" on page 3-37 and repeat this test.
- If the analyzer still fails this test, troubleshoot the source section of the analyzer and then repeat this test. Refer to "Checking the Source Group" on page 4-29.

Source Maximum Power Output Test

Function of the Test: To confirm the maximum source output power of your network analyzer over its full frequency range.

Specification Tested: Test Port Output-Maximum Leveled Power

Equipment Used: A power meter, power sensors, and adapters.

Description of the Test:

- 1. A power sensor is connected to Port 1.
- 2. The analyzer's output is set to hundreds of CW frequencies and, at each frequency, the output power is increased until an "UNLEVELED" error is detected.
- 3. The power level at this point is measured and compared to the maximum output power specification.

If the Analyzer Fails this Test:

• Go to "Checking the Signal through the Signal Separation Path" on page 4-43 for troubleshooting information to determine the faulty assembly.

Source Power Linearity Test

Function of the Test: To verify that the power level is linear over the analyzer's frequency range and to check the linearity of the automatic leveling control (ALC).

Specification Tested: Power Sweep Range and Power Level Linearity

Equipment Used: A test cable. (And a 20 dB attenuator if the analyzer does not have an internal step attenuator.)

Description of the Test:

- 1. The Port 2 receiver is used to test Port 1. The receiver linearity is the standard against which the source linearity is checked.
- 2. A test cable is connected between Port 1 and Port 2 with 20 dB of attenuation in series with the cable. This can be done with an internal step attenuator or an external 20 dB attenuator. This attenuation ensures that the receiver remains in its linear range.
- 3. The analyzer is set to 25 different points across its frequency range.
- 4. At each frequency point, the output power level on Port 2 is set to 0.000 dBm and the power is measured to establish a reference, P_{reference}.
- 5. The source setting is then stepped from -15 to +10 dBm in 1 dB steps and the power is measured, $P_{measured}$, at each setting.
- 6. The non-linearity in dB at each frequency point is calculated as:

(P_{measured} – P_{reference}) – (source setting)

- Perform the "Source Calibration Adjustment" on page 3-37 and repeat this test.
- If the analyzer still fails this test, replace the A19 MASSQuad and then repeat this test. Refer to "Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block" on page 7-34.

Frequency Accuracy Test

Function of the Test: To verify the frequency accuracy and range of the analyzer's source output.

Specification Tested: Test Port Output-CW Accuracy

Equipment Used: A frequency counter, a test cable, and adapters.

Description of the Test:

- 1. Port 1 is connected to a frequency counter.
- 2. A series of frequencies across the band are checked.

If the Analyzer Fails this Test:

• Verify the accuracy of the 10 MHz OCXO by using a frequency counter to measure the rear-panel 10 MHz REF OUT. If the 10 MHz reference is off by more than 10 Hz, perform the "10 MHz Frequency Reference Adjustment" on page 3-35 and then repeat this test.

Trace Noise Test

Function of the Test: To measure the stability of a signal in the internal source and receiver system of your analyzer.

Specification Tested: Test Port Input–Trace Noise Magnitude and Trace Noise Phase

Equipment Used: A test cable.

Description of the Test:

- 1. Port 1 and Port 2 are connected with a test cable.
- 2. The analyzer is set to a series of CW frequencies across its frequency range.
- 3. Magnitude and phase are measured at each frequency at both 1 kHz and 10 kHz IF bandwidths, in both directions.
- 4. Measurements are made at a nominal power level of 0 dBm and 201 points per sweep.

- Repeat this test. It is unlikely for the analyzer to fail this test without a complete failure of the network analyzer system.
- If the analyzer still fails this test, replace the A5 SPAM board and then repeat this test. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.

Receiver Compression Test

Function of the Test: To measure the compression at the analyzer's specified maximum power level for the receivers.

Specification Tested: Test Port Input-Maximum Test Port Input Level

Equipment Used: The compression test set (Z5623A Option K01), a power meter, power sensors, two test cables, and a calibration kit. (And 10-dB and 20-dB pads if the analyzer does not have an internal step attenuator.)

Description of the Test:

- 1. All measurements are made with a 1 kHz IF bandwidth and 201 points per sweep.
- 2. The measurements are made separately on each port.
- 3. The analyzer is set to various CW frequencies across the range of the analyzer.
- 4. A power sensor is connected to the "signal source point" to be used to test the port. The "signal source point" may be either the port connector itself, when a short is used, or the end of the test cable, when the compression test set is used to source the test signal.
- 5. The analyzer source output level is adjusted to create the maximum power level specified for the receiver.
- 6. The power sensor is disconnected and the "signal source point" is connected to the port to be tested.
- 7. The absolute log magnitude value (dBm) for the reference channel is read.
- 8. The log magnitude ratio d measurement using the receiver under test is read: (P_a) .
- 9. The source output level is adjusted to decrease the output by 15 dB.
- 10. The log magnitude ratioed measurement using the receiver under test is read: (P_b) .
- 11. Attenuation of 20 dB is introduced between the source and receiver. This can be done with an internal step attenuator, an external 10 dB pad (if a short is being used to reflect the signal back into the port), or an external 20 dB pad (if the signal source is the compression test set).
- 12. The log magnitude ratioed measurement using the receiver under test is read: (P_c) .
- 13. The source output level is adjusted to produce a reading of Pref (within ± 0.03 dBm) for the reference channel on the source port.
- 14. The log magnitude ratioed measurement using the receiver under test is read: (P_d) .
- 15. The compression in $dB = (P_a P_b) (P_d P_c)$.

- Repeat this test. There are no adjustments that can be made.
- If the analyzer still fails this test, replace the A20 mixer brick then repeat this test. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.

Noise Floor Test

Function of the Test: To measure the absolute power level of the noise floor for the analyzer's receivers.

Specification Tested: Test Port Input-Test Port Noise Floor

Equipment Used: A power meter, power sensor, a calibration kit, and a test cable.

Description of the Test:

- 1. The analyzer is set to various CW frequencies across its frequency range at an IF bandwidth of 1 kHz and 801 points per sweep.
- 2. A test cable is connected to the driving port for the measurement and a power sensor is connected to the other end of the cable.
- 3. The power level at the end of the cable is set to -5.00 dBm.
- 4. The power sensor is disconnected and the cable is connected to the port to be tested.
- 5. The absolute power level in dBm (log magnitude) is read: (P_{log}) .
- 6. The test cable is removed and loads are connected to both ports.
- 7. The analyzer's trace is set to represent the absolute power level (linear magnitude) for the receiver under test and a sweep is taken.
- 8. The mean of the points on the trace, in watts, is read: (P_{lin}) .
- 9. Average power in dBm is calculated: P_{dBm}=10*Log10(P_{lin}*1000).
- 10. Corrected noise floor in dBm for a 10 Hz IF bandwidth = P_{dBm} -19.96 dB-(5.00- P_{log}).

- If the analyzer fails this test, replace the A20 mixer brick and then repeat this test. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.
- If the analyzer still fails this test, replace the A5 SPAM board and then repeat this test. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.

Calibration Coefficients Test

Function of the Test: To verify the uncorrected calibration coefficients of your analyzer. The calibration coefficients are measured in forward and reverse direction. Refer to "Error Terms" in Chapter 8 for error term information relating to the calibration coefficients measured.

Specification Tested: Uncorrected System Performance

Equipment Used: A calibration kit and a test cable.

Description of the Test:

- 1. A series of 2-port calibrations are performed. Two full SOLT 2-port calibrations are performed on each port. Isolation is turned off during each 2-port calibration.
- 2. A test cable is attached to the first port, and a calibration is performed at the end of the cable and at the second port. The cable is moved to the second port and another calibration is performed. Using two calibrations helps to eliminate the unknown characteristics of the through cable.
- 3. Each calibration produces 12 error terms.
- 4. The error terms are used to determine the following characteristics: directivity, source match, load match, reflection tracking, and transmission tracking.

- If the analyzer fails tracking error terms only, perform "Receiver Calibration Adjustment" on page 3-38 and repeat this test.
- Failure of any other error terms indicate a hardware failure. Refer to the appropriate error term discussion in "Error Terms" in Chapter 8 for a typical cause of failure. Refer to Chapter 7, "Repair and Replacement Procedures," for instructions on replacing the suspected faulty component or assembly.

Dynamic Accuracy Test

Function of the Test: To measure the relative power linearity of the analyzer's receivers.

Specification Tested: Test Port Input–Dynamic Accuracy

Equipment Used: The dynamic accuracy test set (Z5623A Option H01), a power meter (E4418B or E4419B), power sensors, and two test cables.

Description of the Test:

- 1. The analyzer's test ports are tested separately at a specific CW frequency and a reference power level of -20 dBm.
- 2. The analyzer's driving port is connected to the dynamic accuracy test set's source port and the analyzer's receiving port is connected to the dynamic accuracy test set's receiver port. A power sensor is connected to the dynamic accuracy test set's power meter port.
- 3. The dynamic accuracy test set is used to input a signal from the driving port on the analyzer. The input signal is routed through step attenuators to both the analyzer and a power sensor.
- 4. The analyzer source and the dynamic accuracy test set create power levels that are "deltas" from the reference power level of -20 dBm. Each delta is measured two ways: by the power sensor and by the analyzer's receiver under test.
- 5. The analyzer's power level into the port under test is set to the -20 dBm reference level.
- 6. The power level is measured with the power sensor: (P_{mr}) .
- 7. The power level is measured using the analyzer's receiver under test: (P_{pr}) .
- 8. The power level into the analyzer's port under test is stepped, in 5 dB steps, over the range of 0 to −120 dBm. Each power level represents a "delta" from the reference power level.
- 9. At each step, the power level is measured using the power meter: (P_{md}) .
- 10. At each step, the power level is measured using the receiver under test: (P_{pd}) .
- 11. The power error in $dB = (P_{mr}-P_{md})-(P_{pr}-P_{pd})$.

- If the analyzer fails this test, replace the A20 mixer brick and then repeat this test. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.
- If the analyzer still fails this test, replace the A5 SPAM board and repeat this test. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.

Adjustments

These adjustments are firmware-driven tests that are used to fine-tune your analyzer.

If multiple adjustments are to be performed, perform them in the order listed.

- "10 MHz Frequency Reference Adjustment" on page 3-35
- "LO Power Adjustment" on page 3-36
- "Source Calibration Adjustment" on page 3-37
- "Receiver Calibration Adjustment" on page 3-38

10 MHz Frequency Reference Adjustment

The 10 MHz frequency adjustment is used to adjust the frequency accuracy of the network analyzer's 10 MHz frequency reference on the A10 frequency reference board assembly.

Equipment Used for the Frequency Adjustment at 10 MHz


Equipment Type	Model or Part Number	Alternate Model or Part Number	
Cable, BNC, 50Ω, 24 inch	8120-1839	Any	
Frequency counter	53151A, Option 001	Any that will measure a signal at 10 MHz.	

Procedure

NOTE	This adjustment typically adjusts to within ± 0.01 ppm.	

1. Connect the equipment as shown in Figure 3-13. Connect a GPIB cable between the network analyzer and the frequency counter.

Figure 3-13 Setup for Adjustment of the 10 MHz Frequency Reference

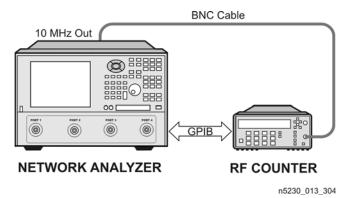

- 2. On the System menu, point to Service, Adjustments, and then click 10 MHz Freq Adjust.
- 3. Ensure the GPIB settings are correct.
- 4. Click **Begin Adj**, and then follow the instructions as they are displayed.

LO Power Adjustment

The LO power adjustment is used to adjust the power level of the LO signal from the A6 multiplier board to the A20 mixer brick.

Equipment used for the LO Power Adjustment

Equipment Type	Model or Part Number	Alternate Model or Part Number
Power meter	E4418B/E4419B	E4418A/E4419A
Power sensor, 3.5 mm	E4413A	8485A
5/16-inch, open-end torque wrench (set to 10 in-lbs)	N/A	N/A

Procedure

- 1. Turn off the network analyzer and remove the power cable and other external cables from the rear panel.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6.
- 3. Place the analyzer on its side to allow access to the bottom of the analyzer.
- 4. Connect a GPIB cable between the analyzer and the power meter.
- With a 5/16 inch open-end wrench, disconnect cable W3 at the A20 mixer brick. Refer to "Bottom Cables, Options 140 and 240" on page 6-24 to determine the location of cable W3.
- 6. Connect the power sensor to the end of cable W3.
- 7. Reconnect the power and USB cables. Turn on the analyzer.
- 8. On the System menu, point to Service, Adjustments, and then click LO Power Adjust.
- 9. Ensure the GPIB settings are correct.
- 10. Click **Begin Adj**, and then follow the instructions as they are displayed.
- 11. Turn off the analyzer, disconnect the power cable, reconnect the semi-rigid cable W3, and replace the cover.

Source Calibration Adjustment

The source calibration is used to adjust your network analyzer for a flat source power across its full frequency range. There are differences between each test port; therefore, an adjustment is required for each port.


Equipment Used for the Source Calibration Adjustment

Equipment Type	Model or Part Number	Alternate Model or Part Number
Power meter	E4418B/E4419B	E4418A/E4419A
Power sensor, 3.5 mm	E4413A	8485A
Adapter, 3.5 mm (f) to 3.5 mm (f)	83059B	85052-60012

Procedure

1. Connect the equipment as shown in Figure 3-14. Connect a GPIB cable between the network analyzer and the power meter.

Figure 3-14 Setup for the Source Calibration Adjustment

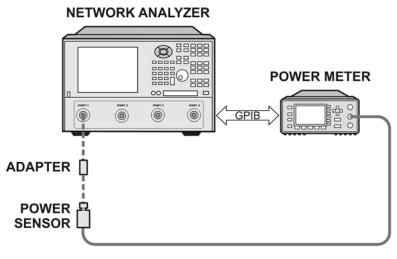

n5230_013_305

- 2. On the System menu, point to Service, Adjustments, and then click Source Calibration.
- 3. Ensure the GPIB settings are correct.
- 4. Click **Calibrate**, and then follow the instructions as they are displayed.

Receiver Calibration Adjustment

The receiver calibration is used to adjust the network analyzer receivers for a flat response across its full frequency range:

- 1. A power meter/sensor is connected to Port 1, as shown in Figure 3-15, to establish a reference for flatness.
- 2. A cable is inserted between the power sensor and the test port, as shown in Figure 3-16, to establish a reference for the cable.
- 3. The same cable is connected between test port 1 and test port 2, as shown in Figure 3-17, and a signal from Port 1 is used to adjust the "B" receiver at Port 2.

The adjustment is repeated using a signal from Port 2 to adjust the "A" receiver at Port 1.

Data obtained during this adjustment are stored in the mxcalfile_pxx files on the hard disk drive. The data are used in subsequent measurements.

If the hard disk drive is replaced, these mxcalfile_pxx files will be lost. Therefore, they should be backed up (saved on a USB drive) so that they can be restored. If using multiple disk drives (e.g. classified and general usage), then these files must be replaced on each individual disk drive.

These files can be recreated by performing another receiver calibration adjustment.


Equipment Used for the Receiver Calibration Adjustment

Equipment Type	Model or Part Number	Alternate Model Part Number
Power meter	E4418B/E4419B	E4418A/E4419A
Power sensor, 3.5 mm	E4413A	8485A
Adapter, 3.5 mm (f) to 3.5 mm (f)	83059B	85052-60012
RF Cable, 3.5 mm (f) to 3.5 mm (f)	85131C	85131E

Procedure

1. Connect the equipment as shown in Figure 3-15. Connect a GPIB cable between the network analyzer and the power meter.


Figure 3-15 Setup 1 for the Receiver Calibration Adjustment

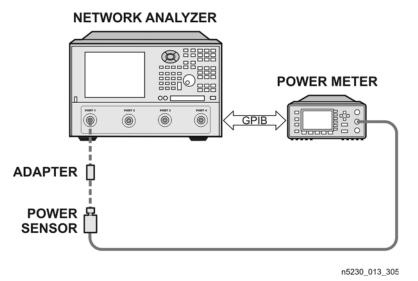

2. On the System menu, point to Service, Adjustments, and then click Receiver Calibration.

- 3. Ensure the GPIB settings are correct.
- 4. Click **Calibrate**, and then follow the instructions as they are displayed.


Figure 3-16 Setup 2 for the Receiver Calibration Adjustment

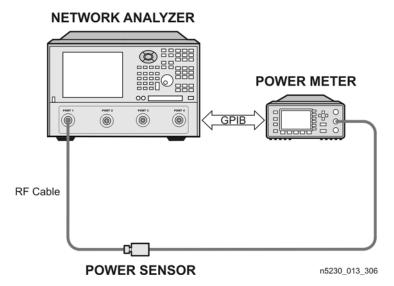

Service Guide N5230-90025

Figure 3-17 Setup 3 for the Receiver Calibration Adjustment

NETWORK ANALYZER

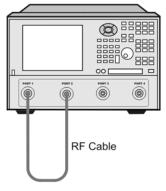

n5230_013_307

4 Troubleshooting

Information in This Chapter

The information in this chapter helps you:

- Identify the portion of the analyzer at fault.
- Locate the specific troubleshooting procedure to identify the assembly or peripheral at fault.

The sections in this chapter are arranged in a logical troubleshooting order. The following table lists the sections and a brief summary of what to look for in that section.

Chapter Four at-a-Glance

Section Title	Summary of Content	Start Page
'Getting Started with Troubleshooting'	A starting point to begin troubleshooting.	Page 4-4
'Power Up Troubleshooting'	 Power-up problems: Power supply problems LCD problems Bootup for the network analyzer interface 	Page 4-6
'Front Panel Troubleshooting'	 Problems occurring after the network analyzer interface is loaded: Does the display color appear correct? Do the front panel keys function properly? Does the front panel USB connector function properly? 	Page 4-12
'Rear Panel Troubleshooting'	Problems associated with the rear panel interconnects. The data found at these rear panel interconnects can be used to troubleshoot the CPU board.	Page 4-17
'Measurement System Troubleshooting'	 Problems with the measurement portion of the analyzer. Checking the A, B, C, D, and R signals. Checking the source group. Checking the signal separation group. Checking the receiver group. 	Page 4-23
Instrument Block Diagrams	Block diagrams for the analyzer including all options.	Page 4-49

Protect Against Electrostatic Discharge (ESD)

This is important. If not properly protected against, electrostatic discharge can seriously damage your analyzer, resulting in costly repair.

CAUTION To reduce the chance of electrostatic discharge, follow all of the recommendations outlined in "Electrostatic Discharge Protection" on page 1-6, for all of the procedures in this chapter.

Assembly Replacement Sequence

After identifying the problem requiring an assembly to be replaced, follow these steps:

- Step 1. Order a replacement assembly. Refer to Chapter 6, "Replaceable Parts."
- **Step 2.** Replace the faulty assembly and determine what adjustments are necessary. Refer to Chapter 7, "Repair and Replacement Procedures."
- Step 3. Perform the necessary adjustments. Refer to Chapter 3, "Tests and Adjustments."
- **Step 4.** Perform the necessary performance tests. Refer to Chapter 3, "Tests and Adjustments."

Getting Started with Troubleshooting

Where you begin troubleshooting depends upon the symptoms of the failure. Start by checking the basics as outlined in the following section. Also review the flowchart in Figure 4-1 on page 4-5. You should then be able to determine where in the troubleshooting procedure to begin, to locate the failed assembly.

Check the Basics

 
A problem can often be solved by repeating the procedure you were following when the problem occurred. Before calling Agilent Technologies or returning the instrument for service, please perform the following checks:


- 1. Is there power at the mains receptacle? If not, correct this situation and proceed.
- 2. Is the instrument turned on? Check to see if the front panel line switch glows. This indicates the power supply is on. If the front panel line switch is on but the power supply does not appear to be on, go to "Power Up Troubleshooting" on page 4-6.
- 3. Is the Windows® operating system running? If not, refer to "Operating System Recovery" in Chapter 8 for instructions.
- 4. If other equipment, cables, and connectors are being used with the instrument, make sure they are clean, connected properly and operating correctly.
- 5. Review the procedure for the measurement being performed when the problem appeared. Are all the settings correct? If not, correct them.
- 6. If the instrument is not functioning as expected, return the unit to a known state by pressing the **Preset** key.
- 7. Is the measurement being performed, and the results that are expected, within the specifications and capabilities of the instrument? Refer to the embedded help in the analyzer for instrument specifications.
- 8. If the problem is thought to be due to firmware, check to see if the instrument has the latest firmware before starting the troubleshooting procedure. Refer to "Firmware Upgrades" in Chapter 8 for instructions.
- 9. If the necessary test equipment is available, perform the operator's check and system verification in Chapter 3, "Tests and Adjustments."

Windows® is a U.S. registered trademark of Microsoft Corporation.

Troubleshooting Organization

Follow the flowgraph in Figure 4-1 to help direct you to the correct section for troubleshooting the analyzer.



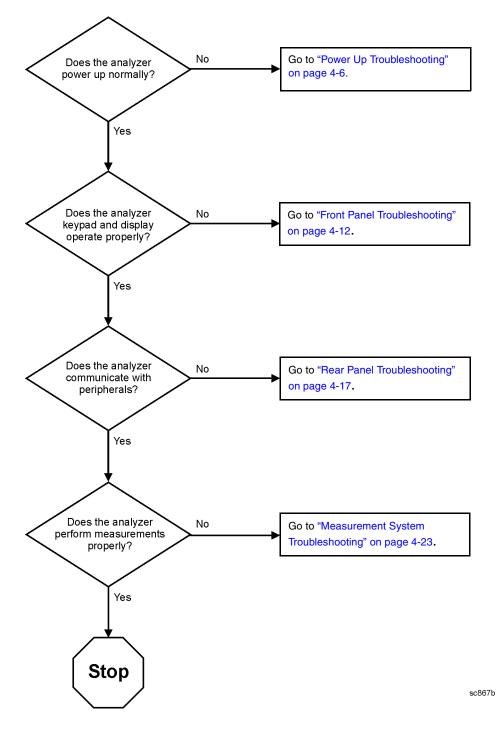

Power Up Troubleshooting

WARNING Immediately unplug the instrument from the ac power line if the unit shows any of the following symptoms:

- Smoke, arcing, or unusual noise from inside the analyzer.
- A circuit breaker or fuse on the main ac power line opens.

Check your network analyzer for evidence that it is powering up correctly. Perform the following steps and make sure that the analyzer is displaying correct behavior as noted in the following steps.

- **Step 1.** Disconnect all peripherals and plug in the network analyzer. Before the analyzer is powered on, the line switch should glow yellow and no other lights should be on.
- **Step 2.** Turn on the network analyzer.
 - The line switch should glow green.
 - The fans should be audible.
 - The display should flash and then show the hardware boot-up sequence. This process checks the RAM and communication with the hard disk drive. These checks return an error message if a problem is detected.
 - The Windows 2000 operating system should start.
 - The network analyzer measurement interface should open with an S_{11} measurement displayed.
- **Step 3.** If the analyzer powers up correctly, continue troubleshooting with "Front Panel Troubleshooting" on page 4-12.
- **Step 4.** If the analyzer does not power up correctly, follow these troubleshooting steps:
 - If the line switch does not glow or the fans are not operating (audible), go to "Power Supply Check" on page 4-7.
 - If you cannot hear the fans operating, go to "If the Fans Are Not Operating" on page 4-11.
 - If the line switch glows green and the fans are operating (audible), but the display remains dark, go to "Front Panel Troubleshooting" on page 4-12.
 - If the instrument appears to abort the network analyzer measurement interface process, contact Agilent. Refer to "Contacting Agilent" on page 2-11.

Power Supply Check

NOTE There are no fuses to replace within the power supply. If you determine that the power supply is the failed assembly, replace the power supply.

A catastrophic failure in the power supply can be determined by observing the line switch:

- 1. Ensure that the instrument is plugged in with the power switch in the standby position (power not switched on). Verify that the line switch glows yellow. A line switch that glows yellow indicates that the +15 VDC line (P15 STB) is providing enough voltage to light the LED. (The actual voltage may not be +15 VDC.)
- 2. Turn on the instrument power and verify that the line switch glows yellow. When the line switch glows, it is an indication that the power supply has received an "ON" command and that the +5.2 VDC supply can supply enough current to light, at least, these lamps.

If all of these supply voltages are missing, it is likely that the problem is either a defective A4 power supply, or another assembly is loading down the A4 power supply. Continue with "If All Supply Voltages Are Missing" on page 4-9, to determine the cause of the problem.

If the line switch is lit correctly the power supply has not suffered a catastrophic failure; however, the power supply could still be at fault. Continue with the next section to measure the individual voltage supplies.

Measure the Individual Voltage Supplies


WARNING The instrument contains potentially hazardous voltages. Refer to the safety symbols provided on the instrument and in "General Safety Considerations" on page 1-3 before operating the unit with the cover removed. Make sure that the safety instructions are strictly followed. Failure to do so can result in personal injury or loss of life.

To measure the power supply voltages, it is necessary to remove the instrument's outer and inner covers. Refer to "Removing the Covers" on page 7-6 for removal procedures. Use the E8356-60021 extender board to measure the individual power supply voltages. Insert the extender board into an empty slot next to the A6 signal processing ADC module (SPAM) board.

NOTE If any one individual voltage supply from the A4 power supply develops an over-voltage or over-current problem, all supplies are affected. The supply goes into a "burp" mode characterized by the supplies cycling on and off at a low voltage level. The cause of the over-voltage or over-current condition can be the A4 power supply itself, or any assembly to which the A4 power supply provides voltage. To isolate the cause of "burp" mode, continue to the assembly removal process as described in the section titled "If All Supply Voltages Are Missing" on page 4-9.

On the extender board, measure the power supply voltages using a digital multi-meter. Refer to Figure 4-2 for the power supply test points on the extender board. Use the point marked "GND" for the ground connection. Refer to Table 4-1 on page 4-9 for the correct voltages.

Figure 4-2 E8356-60021 Synthesizer/Reference Extender Measurement Points

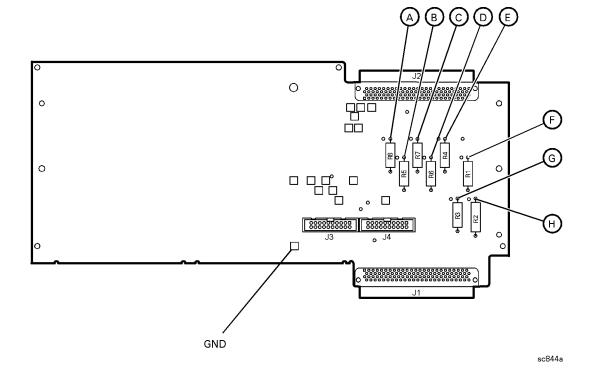

Measurement Location	Signal Description	Test Equipment Used ^a	Expected Level (Vdc)	Approximate Resistance (Ω)
А	+5V power supply	DMM	+5.0	285
В	-15V power supply	DMM	-15.0	12.7 k
С	-5V power supply	DMM	-5.0	7.2 k
D	+9V power supply	DMM	+9.0	4.0 k
Е	+15V power supply	DMM	+15.0	3.0 k
F	+15V power supply	DMM	+15.0	2.8 k
G	+22V power supply	DMM	+22.0	890
Н	+32V power supply	DMM	+32.0	2.6 k

 Table 4-1
 Extender Board Measurement Points

a. DMM = Digital multi-meter

If All Supply Voltages are Present

If all of the supplies have measured within tolerances, and the instrument still is not functioning properly, refer to "Rear Panel Troubleshooting" on page 4-17.

If All Supply Voltages Are Missing

WARNING Disconnect the line-power cord before removing any assembly. Procedures described in this document may be performed with power supplied to the product while protective covers are removed. Energy available at many points may, if contacted, result in personal injury or loss of life.

You must sequentially remove all of the assemblies, taking care to disconnect the line power cord before each removal, and then measure the supply voltages after each removal.

If the missing supply voltages return to a "power on" condition after removal of an assembly, suspect that assembly as being defective.

Remove the network analyzer assemblies in the order specified in the following steps (refer to Chapter 7 for removal instructions).

- 1. Unplug the test set motherboard cable from the A16 test set motherboard (refer to "Removing and Replacing the A16 Test Set Motherboard and the USB Hub" on page 7-28).
- 2. Unplug the front panel interface cable from the A3 front panel interface board (refer to "Replacing the A3 Front Panel Interface Board" on page 7-12).
- 3. Remove the A5 SPAM board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16).
- 4. Remove the A6 multiplier board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16).

- 5. Remove the A7 fractional-N synthesizer board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16).
- 6. Remove the A8 multiplier board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16).
- 7. Remove the A9 fractional-N synthesizer board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16)
- 8. Remove the A10 frequency reference board (refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16).
- 9. Unplug the A41 hard disk drive from the A15 CPU board (refer to "Removing and Replacing the A41 Hard Disk Drive (HDD)" on page 7-46).

The minimum required assemblies to power up the analyzer are:

- A4 power supply
- A14 system motherboard
- A15 CPU board

To further isolate the failure in the three remaining assemblies, measure the resistance on the extender board (with the power turned off) from the power supply test points to "GND". Refer to Figure 4-2 on page 4-8 for the location of the measurement points. The resistances should be as shown in Table 4-1 on page 4-9.

NOTE Make sure that the only assemblies plugged in are the three minimum required assemblies listed above.

Check for shorts (zero Ω) or very low resistance (approximately 1 Ω). If a short or low resistance is measured, isolate each of the remaining three boards in the following order, and recheck the shorted test point after each board is removed. Note that the resistance may be different from that listed in the table, but you should be able to determine if the shorted condition has changed.

Isolate the remaining three assemblies:

- remove the A15 CPU board
- remove the A4 power supply
- This leaves only the A14 system motherboard installed. If the measurements are still incorrect, this is the suspected faulty assembly.

If the Fans Are Not Operating


CAUTION The power supply may be in thermal shutdown if the instrument has been operating without the fans running. Allow the instrument to cool down before troubleshooting.

If all three fans are not operating, suspect a power supply problem or a defective A14 system motherboard. Refer to "Power Supply Check" on page 4-7 to check the individual supplies. If the supplies are within specifications, the most probable cause is a defective A14 system motherboard. Refer to "Removing and Replacing the A14 System Motherboard" on page 7-22.

If only one or two fans are not functioning, and the power supplies are within specifications, suspect the A14 system motherboard or a defective fan. Perform the following procedure.

- 1. Remove the front panel assembly from the instrument. Refer to "Removing and Replacing the Front Panel Assembly" on page 7-8.
- 2. Refer to Figure 4-3. Measure the fan voltages at J1, J3, and J4 on the A14 system motherboard.

Figure 4-3 Fan Voltages

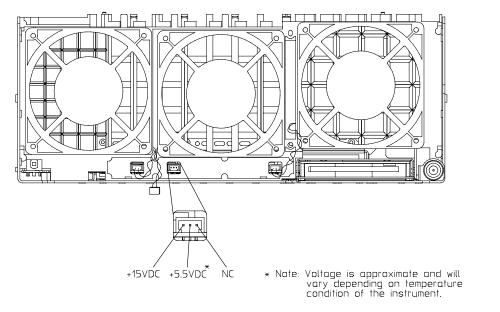

sa867a

3. If the correct voltage is present and the fan connector is in good mechanical condition, suspect a defective fan. Refer to "Removing and Replacing the Midweb and the B1 Fan" on page 7-53.

If the voltage is not present, suspect a defective A14 system motherboard. Refer to "Removing and Replacing the A14 System Motherboard" on page 7-22.

Front Panel Troubleshooting

The front panel assembly consists of the A1 keypad, the A2 display assembly, the A3 front panel interface board, the touchscreen and touchscreen controller board, the inverter board, and the USB board. The following tests verify the operation of the front panel assembly when the analyzer is in the measurement mode. If the instrument fails to power up correctly, or it is difficult to verify due to a faulty display, refer to "Power Up Troubleshooting" on page 4-6.

Refer to the following sections to verify the operation of the noted assemblies.

- "Front Panel Keypad and RPG Test" on page 4-13
- "A2 Display Test" on page 4-15
- "Checking the USB Board" on page 4-16
- "A3 Front Panel Interface Board" on page 4-16

If all assemblies are working correctly, continue troubleshooting with "Rear Panel Troubleshooting" on page 4-17.

Front Panel Keypad and RPG Test

Test the front panel keypad by running the front panel test. To run the front panel test, perform the following:

Press UTILITY System, then Service, then More, then Front Panel Test.

A Front Panel Key Test Utility dialog box will be displayed, as shown in Figure 4-4.

Figure 4-4 Front Panel Key Test Utility Dialog Box

Front Panel Key Test Utility 🛛 🗙						
A.01.02 Key Label						
Channels						
1	164					
Count	Code					
Press any front panel key.						
There are only two ways to exit this program: 1. Press the Preset key THREE times! 2. Wait 2 minutes without pressing any keys.						
Do not press any keys on an external keyboard						

n5242_001_403

Checking the Front Panel Keys

To check the front panel keys, push each key and compare the name in the Key Label box to the name physically labeled on the key cap. These names are also in Table 4-2 below.

- If all the key names are correct, then the front panel keypad is working. If some of the keys are not working, suspect a faulty keypad. To replace the keypad, refer to "Replacing the A1 Keypad Assembly" on page 7-12.
- If none of the keys are working correctly, suspect a faulty A3 front panel interface board. To replace the A3 front panel interface board, refer to "Replacing the A3 Front Panel Interface Board" on page 7-12.

TRACE/CHAN Keys	RESPONSE Keys	ENTRY Keys	ENTRY Keys (Cont'd)
Trace 1	Meas	ОК	k/m
Trace 2	Format	Cancel	Enter Off
Trace 3	Scale	Help	. (decimal point)
Trace 4	Display	Bk Sp	+/-
Traces	Avg	0	STIMULUS Keys
Channel	Cal	1	Freq
Navigation Keys	MARKER/ ANALYSIS Keys	2	Power
←	Marker	3	Sweep
\rightarrow	Search	4	Trigger
1	Memory	5	UTILITY Keys
\downarrow	Analysis	6	Save
Click		7	Print
		8	Macro
		9	Recall
		G/n	System
		M/u	Preset

Table 4-2Front Panel Keyboard Key Names

Checking the RPG (Front Panel Knob)

To check the RPG knob:

- 1. Press the UTILITY Preset key.
- 2. Rotate the knob and check for a fluid movement of numbers on the analyzer display.
- If the movement of numbers is not smooth or no numbers appear at all, suspect a faulty A3 front panel interface board. To replace the A3 front panel interface board, refer to "Replacing the A3 Front Panel Interface Board" on page 7-12.

A2 Display Test

The display should be bright with all annotations and text readable. The display test allows you to check for non-functioning pixels and other problems.

NOTE If the display is dim or dark, refer to "Front Panel Troubleshooting" on page 4-12.

What Is a Damaged Pixel?

A pixel is a picture element that combines to create the image on the display. A pixel is about the size of a small pin point.

A damaged pixel is:

- A pixel that has a constant blue, green, or red appearance that will not change, or
- a pixel that has a constant black appearance that will not change.

How to Run the Display Test

To run the display test, perform the following:

Press UTILITY System, then Service, then More, then Display Test.

A multi-color screen is displayed. Be prepared to look for the symptoms described in "How to Identify a Faulty Display." Follow the instructions on the screen.

How to Identify a Faulty Display

A display is considered faulty if:

- More than 0.002% of the total pixels have a constant blue, green, red, or black appearance that will not change.
- Three or more consecutive pixels have a constant blue, green, red, or black appearance that will not change.
- If the A2 display assembly is determined to be faulty, replace it. Refer to "Replacing the A2 Display Assembly" on page 7-11.

Checking the USB Board

To verify proper operation of the USB board:

- Connect a known good USB device, such as a USB mouse, to a front panel USB port.
- Wait 15 seconds for the analyzer to verify the device connection, and then check the operation of the USB device.
- If the device performs correctly, the USB board is functioning properly.
- If the device does not perform correctly, the USB board is faulty. Refer to "Replacing the USB Connector Board" on page 7-12.

A3 Front Panel Interface Board

This assembly performs the following functions:

- It routes USB signals between the front-panel USB connector and the A15 CPU board.
- The speaker produces the audio output from signals supplied by the A15 CPU board.
- It routes key pad commands from the keypad to the A15 CPU board.
- It routes display signals from the A15 CPU board to the A2 display assembly.

Checking the Speaker

If no audio is heard:

- Verify that the volume is set correctly and the proper sound driver is loaded; do the following:
 - Press UTILITY System, then Configure, then Control Panel.....
- Click on the **Sounds and Audio Devices** entry. Follow the normal Windows procedure to check the sound drivers and volume. If the audio is still not heard, suspect a faulty speaker located on the A3 front panel interface board. Refer to "Replacing the A3 Front Panel Interface Board" on page 7-12.

Checking the Operation of the Key Pad Commands

To verify the key pad functionality, refer to "Front Panel Keypad and RPG Test" on page 4-13.

Checking the Display

To verify the display functionality, refer to "A2 Display Test" on page 4-15.

Rear Panel Troubleshooting

Each rear panel connector is associated with a hardware group in the analyzer. You can use the data at these rear panel connectors to help troubleshoot these hardware groups in addition to testing the connectors.

The connectors discussed in this section are:

- USB
- SERIAL (RS-232)
- PARALLEL (1284-C)
- VGA
- GPIB
- LAN

Checking the USB Ports

NOTE The rear panel contains five USB ports; one "stand-alone USB port" on the CPU board and a "group-of-four" connected to a separate hub.

To verify proper operation of any USB port:

- Connect a known good USB device, such as a USB mouse.
- Wait 15 seconds for the analyzer to verify the device connection, and then check the operation of the USB device.
- If the device performs correctly, the USB port is functioning properly.
- If the device does not perform correctly, remove the non-working USB device, wait 15 seconds, and then reconnect the device to the USB port.
- If the device still does not perform correctly, remove the USB device and connect it to the front panel USB.

NOTE	If the front panel USB port does not work, refer to "A3 Front Panel Interface
	Board" on page 4-16.

- If the USB device has been verified to work on the front panel but *not* on the stand-alone USB port:
 - Then the A15 CPU board is faulty. Refer to "Removing and Replacing the A15 CPU Board" on page 7-24.
- If the USB device has been verified to work on the front panel but not on one of the "group-of-four" USB ports:
 - Then the rear panel hub is faulty. Refer to "Removing and Replacing the A16 Test Set Motherboard and the USB Hub" on page 7-28 for replacing the rear panel hub board.

Checking the SERIAL (RS-232), PARALLEL (1284-C), or VGA Port

To verify the proper operation of the SERIAL, PARALLEL, or VGA port:

- Connect a known good serial, parallel, or VGA peripheral device.
- Wait 15 seconds for the analyzer to verify the device connection, and then check the operation of the peripheral device.
- If the peripheral device performs correctly, the port is functioning properly.
- If the peripheral device does not function properly, the A15 CPU board is faulty. Refer to "Removing and Replacing the A15 CPU Board" on page 7-24.

Checking the GPIB Port

The network analyzer uses a National Instruments 488.2 GPIB controller and associated driver software. This software includes a test utility that scans the GPIB bus and returns the status of all the connected peripherals.

To run the test utility software and check the GPIB status:

- 1. Connect a known good peripheral to the analyzer using a known good GPIB cable.
- 2. On the **System** menu, point to **Configure**, and then click **SCPI/GPIB**. A **SCPI/GPIB** dialog box is displayed.
- 3. In the **GPIB** block, click **System Controller** to establish the analyzer as a controller. Wait for the analyzer to configure, and then click **OK**.
- 4. On the System menu, click Windows Taskbar to open the Start Menu window.
- 5. On the Start Menu window, point to Programs, National Instruments NI-488.2, and then click Explore GPIB to open the Measurement & Automation window.
- 6. On the left side of the Measurement & Automation window under folders:
 - a. Click the plus sign to expand the Measurement & Automation folder.
 - b. Click the plus sign to expand the **Devices and Interfaces** folder.
 - c. Right click GPIB0 (AT-GPIB/TNT) to open a submenu.
- 7. On the submenu, click Scan for Instruments to run the test.
- 8. The state of all the peripherals found on the bus is returned.
- 9. If problems are detected, check the connections of all GPIB cables, and check all the GPIB addresses of the instruments on the bus.

NOTE Address Information

- Each device must have its own unique address.
- The network analyzer's default GPIB address in the controller mode is 21.
- The address set on each device must match the one recognized by the analyzer (and displayed).

Refer to the manual of the peripheral to read or change its address.

Troubleshooting Systems with Controllers

Passing the preceding test indicates that the analyzer's peripheral functions are operating normally. Therefore, if the analyzer has not been operating properly with an external controller, check the following:

- The GPIB interface hardware is incorrectly installed or not operational. (Refer to the embedded help in your analyzer.)
- The programming syntax is incorrect. (Refer to the embedded help in your analyzer.)

LAN Troubleshooting

Problems with the Local Area Network (LAN) can be difficult to solve. Software and protocol problems can make it difficult to determine whether the analyzer's hardware is working properly, or if there is a problem with the LAN or cabling.

The purpose of this section is to determine if the analyzer's hardware is functioning properly. While the turn-on self-test verifies some LAN hardware functionality, it is limited to internal testing only. Incorrect IP addresses will prevent proper operation. Improper subnet masks may allow only one-way communication, while improper gateway addresses may exclude outside LAN access.

Ping Command

The analyzer has the built-in capability of performing a "ping" operation. Ping will request the analyzer to send a few bytes of information to a specific LAN device. That device will then signal the analyzer that it has received the information. The analyzer computes the approximate round trip time of the communication cycle and displays it. For a full test of two-way communications, a ping test should be performed in two directions.

- **First**: you should ping from the analyzer to the local area network.
- Second: you should ping from the local area network to the analyzer.

NOTE In the second case, any other network device capable of sending a ping command could be used, assuming it is connected to the same network. This could be a computer or even another analyzer.

How to Ping from the Analyzer to the Local Area Network (LAN)

Follow the steps below to verify proper LAN operation (assuming you have a functioning LAN). If no network LAN is available, see "Testing Between Two Analyzers" on page 4-21.

- 1. Make sure the IP address on the analyzer is set properly and that it is unique. If unsure how to check the IP address, refer to the embedded help in the analyzer.
- 2. Make sure the subnet mask is 0.0.0.0. If not, note the current setting (to allow setting it back later) and then set it to 0.0.0.0.
- 3. Find and note the IP address of another working LAN device on the same network. Make sure this device is turned on, connected, and is functioning properly.
- 4. To ping the network device:
 - a. On the System menu, click Windows Taskbar.
 - b. On the Windows Taskbar menu, point to Programs, Accessories, and then click Command Prompt.

- c. The command prompt window is displayed.
- d. At the prompt, type ping xxx.xxx.xxx¹ and press **Enter** on the front panel or keyboard. Refer to Step 5 for the results of a successful ping.
- 5. The analyzer attempts four cycles of communications with the indicated LAN device.
 - It displays the time it took to complete each cycle.
 - Each cycle times-out after one second if no communication is established and the message, Request timed out, is displayed.
 - It is common for the first of the four cycles to time-out even though subsequent cycles pass.
 - See below for an example output of a successful ping.

C:>ping 141.121.69.162
Pinging 141.121.69.162 with 32 bytes of data:
Reply from 141.121.69.162: bytes=32 time<10ms TTL=127
Reply from 141.121.69.162: bytes=32 time<10ms TTL=127
Reply from 141.121.69.162: bytes=32 time<10ms TTL=127
Ping statistics for 141.121.69.162:
Packets: Sent = 4, Received = 4, lost = 0 <0% loss>.
Approximate round trip times in milli-seconds:
Minimum = 0ms, Maximum = 0ms, Average = 0ms

- 6. The above message verifies that one way communication from the analyzer to the network has been established
- 7. If the subnet mask was changed in step 2, set it back at this time.

How to Ping from the Local Area Network (LAN) to the Analyzer

Reverse communication should also be verified. Determining this, though, is dependent upon your network setup and software. Generally, you need to issue a ping command using the IP address of the analyzer to be tested. For example, using Windows 95, 98, 2000 and while at a DOS prompt, type in ping $xxx.xxx.xxx^2$. Then press **Enter** on the front panel or keyboard. If full communication can be established, then the computer display shows the cycle time for each of four cycle attempts (similar to that in step 5). Other software may behave somewhat differently, but basically the same.

If the analyzer can talk to the network, but the network can not talk to the analyzer, then the computer or device used from the network may have a subnet mask that excludes communication with the IP address chosen for the analyzer. Any subnet mask other than 0.0.0.0 will exclude operation from some addresses. Changing the subnet mask of a computer or other device should only be attempted by a qualified network administrator. Failure to communicate due to a subnet mask incompatibility does not indicate any failure of the analyzer.

2. The letters x represent the IP address of the analyzer.

^{1.} The letters x represent the IP address of the other device on the network.

If the analyzer fails to ping in either direction, and assuming the subnet masks are set properly, then the fault must be isolated to the analyzer or to the network. Contact a qualified network administrator.

Testing Between Two Analyzers

The ability of the analyzer's LAN to function can be easily tested by connecting two analyzers together using a "crossover cable" (a short length of cable with an RJ-45 connector on each end).

Some network hubs have the capability to make a crossover connection using two normal, or straight-through, cables. If this capability is not available and a crossover cable is not available, a crossover cable can be made by following the directions in "Constructing a Crossover Cable" on page 4-21.

Set the IP addresses on two analyzers. The addresses can be set to anything, but they must be different. Make sure the subnet mask and gateway addresses are set to 0.0.0.0 and that the LAN is active on both analyzers. Connect the two analyzers together using either a crossover cable or a crossover hub.

Now follow the steps in "How to Ping from the Analyzer to the Local Area Network (LAN)" on page 4-19 to have the first analyzer ping the second analyzer. When done, repeat the procedure having the second analyzer ping the first. If both procedures function properly, the LAN circuitry on both analyzers is verified.

If neither function properly:

- One or both IP addresses could be wrong.
- One or both LAN states could be set to off.
- The crossover cable could be miswired.
- One or both analyzers could be defective.

If possible, eliminate the possibility of a defective analyzer by substitution of a known working unit. Once the analyzer has been proven to be working properly, concentration can be placed on the network itself to determine the cause of the failure.

Constructing a Crossover Cable

A crossover cable can be made from a standard LAN cable by connecting pin 1 from each connector to pin 3 of the other connector, and pin 2 from each connector to pin 6 of the other connector.


- 1. Strip away a few inches of the outside jacket insulation from the middle of a standard LAN cable that has an RJ-45 connector on each end.
- **NOTE** Pins 1, 2, 3, and 6 of the connectors must be located to determine which wires to cut in the following steps. Most, but not all, LAN cables use the color coding listed in Table 4-3. If your cable does not use this color scheme, you will have to determine the locations of the appropriate wires before proceeding with this procedure.

Pin Number	Color	Pin Number	Color	
1 (transmit +)	White/orange	5	White/blue	
2 (transmit –)	Orange	6 (receive –)	Green	
3 (receive +)	White/green	7	White/brown	
4	Blue	8	Brown	

 Table 4-3
 LAN Pin Definitions and Wire Color Codes

- 2. Cut the wires going to pins 1, 2, 3, and 6. Strip away a small amount of insulation from each of the eight cut ends.
 - a. Connect the wire from pin 1 on one end of the cable to the wire from pin 3 on the other end of the cable.
 - b. Connect the wire from pin 3 on one end of the cable to the wire from pin 1 on the other end of the cable.
 - c. Connect the wire from pin 2 on one end of the cable to the wire from pin 6 on the other end of the cable.
 - d. Connect the wire from pin 6 on one end of the cable to the wire from pin 2 on the other end of the cable.
- 3. Insulate all exposed wires so that they cannot short together.
- 4. Label this as a crossover cable so that it cannot be confused with a standard cable.

Figure 4-5 Construction of a Crossover Cable

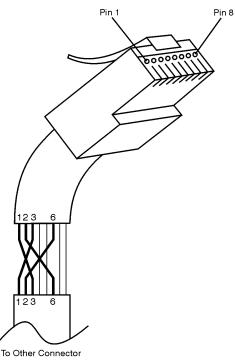

sd623c

Measurement System Troubleshooting

This section provides troubleshooting procedures for the measurement portion of the PNA. In this section, the analyzer is used as a tool to help isolate the suspected faulty functional group. Once the faulty functional group is determined, troubleshooting steps are provided to help you isolate the faulty assembly or part.

Before you begin—consider: Where do you see a problem?

If you are seeing a problem at **Preset**, perform the standard S-parameter test set troubleshooting procedure, starting with: "Verifying the A, B, C, D, and R Traces (Standard S-Parameter Mode)" on page 4-25.

You should also consider the problem indications that are observed and whether the observed condition is a soft failure or a hard failure.

Soft Failure

With a *soft* failure, the network analyzer's performance has degraded to an unacceptable level, yet it continues to operate and displays no error messages. For this type of failure, performance tests must be conducted to isolate the problem. Begin with viewing the error terms as described in "Error Terms" in Chapter 8 This will help to isolate most problems. If additional tests are required, refer to "Performance Tests (Agilent N7840A Software Package)" on page 3-28.

Hard Failure

With a *hard* failure, the PNA does not perform well and displays one or more error messages. To diagnose and repair a hard failure:

- Check "Help About" to verify that the model number and options listed match the actual analyzer model and options.
- Check "EEPROM Headers" to verify that the data there is correct.
- Check error messages. Refer to "Error Messages" and follow the suggestions outlined there for each applicable error message.

Help About

Go to the Help About screen by selecting **Help**, **About Network Analyzer** in the network analyzer application. Verify that the information displayed in this screen is correct for your analyzer. If any of the information is incorrect, contact Agilent Technologies. Refer to "Contacting Agilent" on page 2-11.

EEPROM Headers

The network analyzer application uses the firmware revision information stored in the pc board header EEPROM. If the information stored in any EEPROM is incorrect, the network analyzer may not operate properly.

The following table lists the pc boards in your network analyzer that contain EEPROM headers. The pc boards are listed by name and part number and the correct firmware revision code is given for each.

PC Board Name	PC Board Part Number	Memory ID	Hardware ID	Firmware Revision
A5 SPAM	E8364-63187	3	5	А
A6 and A8 multiplier A12 multiplier (Options 146 and 246)	E8364-63182	3	9	А
A7 and A9 fractional-N synthesizer A13 fractional-N synthesizer (Options 146 and 246)	E8364-63189	3	8	С
A10 frequency reference	E8364-60136	3	10	В
A16 test set motherboard	N5230-63078	3	16	D
A17 QABC board	N5230-63085	3	46	А

To view this EEPROM header information on the network analyzer display, select **System**, **Service**, **Utilities**, **View EEPROM Headers** in the network analyzer application.

If the information is incorrect for any of the pc boards, contact Agilent Technologies. Refer to "Contacting Agilent" on page 2-11.

Error Messages

SOURCE UNLEVELED: The source ALC circuit on the A16 test set motherboard is running open-loop. Check the cable connections for W31 and W32 between the A19 MASSQuad and the A16 test set motherboard.

UNLEVELED, SOURCE 1: (Options 146 and 246) The source ALC circuit on the A16 test set motherboard is running open-loop. Check the cable connections for W31 and W32 between the A19 MASSQuad and the A16 test set motherboard.

UNLEVELED, SOURCE 2: (Options 146 and 246) The source 2 ALC circuit on the A17 QABC board is running open-loop. Check the cable connections for W74 and W75 between the A18 MASSQuad and the A17 QABC board.

Verifying the A, B, C, D, and R Traces (Standard S-Parameter Mode)

NOTE There is no way to view the frequency offset receiver response (Option 080). However, some standard S-parameter receiver trace information is helpful in troubleshooting the frequency offset section of the PNA. It is therefore recommended that you run this test even if you *only* suspect the frequency offset section of malfunctioning.

The first step is to verify that the A, B,C, D, and R traces are present and that they are approximately level:

- On the System menu, point to Service, Utilities, and then click Receiver Display.
- For all analyzers except those with Options 146 and 246, traces A, B, C, D, and R are displayed in five separate data windows as shown in Figure 4-6. Identifying discrepancies of the traces in these windows can help you to isolate the faulty assembly.

_ 🗆 🗙 🚾 agilent-u6jomd3 File View Channel Sweep Calibration Trace Scale Marker System Window Help Start 300.000 kHz 1 Stimulus Start Stop Center Span 9.AB 8:88 0.00 0.01 0.0 8:88 .00 0.00Status CH 1: R.1 No Cor CTL

Figure 4-6 Typical Five Channel Display

• For analyzers with Options 146 and 246, traces A, B, C, D, R1, and R3 are displayed in six separate data windows as shown in Figure 4-7. Identifying discrepancies of the traces in these windows can help you to isolate the faulty assembly.

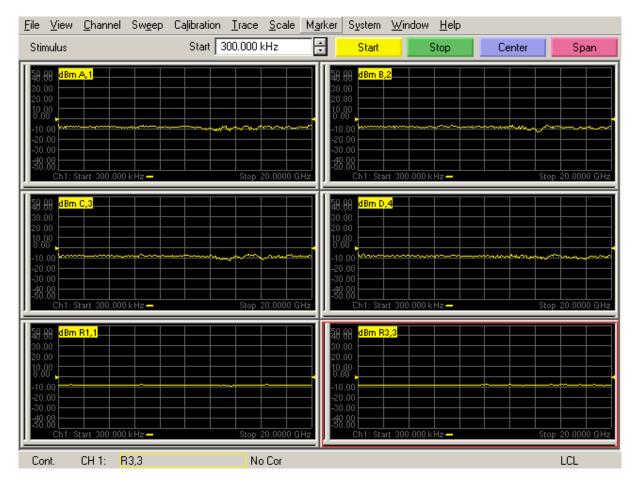


Figure 4-7 Typical Six Channel Display for Options 146 and 246

• If all traces are present and are similar to the traces in Figure 4-6 or Figure 4-7, then there are no major problems with the analyzer's measurement system. There may, however, be a minor failure in the analyzer.

To test further:

- Go to Chapter 3, "Tests and Adjustments" and perform all the tests in that section.
- If a problem still exists, contact Agilent. Refer to "Contacting Agilent" on page 2-11.
- If any of the traces are not present, are noisy or distorted, or are at an incorrect level, then there is a problem with the analyzer's measurement system. Proceed to "Where to Begin Troubleshooting."

Where to Begin Troubleshooting

For the purposes of troubleshooting, the analyzer block diagram is divided into the following functional groups:

- the source group
 - A6, A8, and A12 (Options 146 and 246 only) multipliers
 - A7, A9, and A13 (Options 146 and 246 only) fractional-N synthesizers
 - A10 frequency reference
 - A16 test set motherboard
 - A17 QABC board (Options 146 and 246 only)
 - A18 MASS 26.5 (MASSQuad) (Options 146 and 246 only)
 - A19 MASS 26.5 (MASSQuad)

• the signal separation group

- A18 MASS 26.5 (MASSQuad) (Options 146 and 246 only)
- A19 MASS 26.5 (MASSQuad)
- A21, A22, A23, and A24 test port couplers
- A25 60-dB step attenuator (Options 145, 245, 146, and 246 only)
- A26 60-dB step attenuator (Options 146 and 246 only)
- Port 1, Port 2, Port 3, Port 4, and A, B, C, D, and R ports

• the receiver group

- A5 SPAM board
- A20 mixer brick
- A29 reference channel switch (Options 146 and 246 only)

Use the list on the following pages to help you determine in which analyzer functional group to begin troubleshooting.

This is by no means an exhaustive list of possible symptoms nor possible failures. It is recommended that you view the system block diagram, at the end of this chapter, as you review the entries in this list and perform any of the troubleshooting procedures listed.

Good judgement and established logical troubleshooting techniques must be used to complement the procedures contained in this section.

Refer to Table 4-4 on page 4-37 for a list of the frequencies associated with each of the network analyzer's 13 or 17 bands.

All Traces

- *If all traces are missing in all bands*, the problem is most likely in the source group. However, a missing or disabled DSP driver may exhibit the same or similar symptoms. To verify that this DSP driver is present and enabled:
 - 1. Click My Computer, **Properties**, **Hardware** tab, **Device Manager**. Expand **Network Adapters**. The following entry should be listed: **Agilent Technologies DSP Driver #2** and should be enabled.
 - 2. If the icon to the left of the name is a yellow box containing an exclamation mark (!), use Windows Explorer to verify the presence of the following file: C:\WINNT\system32\drivers\spampnp.sys.
 - 3. If you have verified that the DSP driver is present and enabled, but all traces are still missing in all bands, go to "Checking the Source Group" on page 4-29.
- *If the trace faults are band-related*, the problem is in the source group. Using Table 4-4 on page 4-37, note the frequency bands in which problems are seen. Go to "Source Group Tests" on page 4-34 and perform the band-specific tests that correspond to the bands in which the problems are seen.

R Trace Only

A problem that affects only the R trace is isolated to the A20 mixer brick or the A5 SPAM board. For analyzers with Options 146 or 246, the problem is additionally isolated to the A29 reference channel switch and accompanying limiter and DC block. Go to "Checking the Receiver Group" on page 4-46.

A Trace Only

If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

B Trace Only

If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

C Trace Only

If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

D Trace Only

If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

A, B, and R1 Traces Only (Options 146 and 246)

The problem is in the source (1) group, go to "Checking the Source Group" on page 4-29. If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

C, D, and R3 Traces Only (Options 146 and 246)

The problem is in the source 2 group, go to "Checking the Source Group" on page 4-29. If the trace is missing in all bands, go to "Checking the Signal Separation Group" on page 4-42.

Checking the Source Group

Serial Bus Test

Before performing tests on specific assemblies in the source group, it is recommended that you perform the serial bus test. This may help to isolate the failure to a specific assembly.

Through the front panel, the serial bus test allows you to check signal and voltage levels at 32 points (nodes) distributed across four of the printed circuit board assemblies in the analyzer. With this test you can isolate problem board assemblies in the analyzer. The board assemblies tested and their associated node numbers are as follows:

NOTE This test is written for a PNA as it was originally shipped from the factory. Due to changes in board production, this test may not show accurate pass/fail results if the A6, A7, A8, A9, A10, or A16 board have been replaced with newer board assemblies.

Board Assembly	Node Numbers	
A6 multiplier	1211 to 1218	
A8 multiplier	1111 to 1118	
A10 frequency reference	211 to 218	
A7 fractional-N synthesizer	411 to 418	
A16 test set motherboard, MA	511 to 518	
A16 test set motherboard, MASS	611 to 618	
A16 test set motherboard, AUX 1	711 to 718	
A16 test set motherboard, AUX 2	811 to 818	
A9 fractional-N synthesizer	911 to 918	

Descriptions of each board assembly and node is included in this section. Location of the nodes is indicated with a \blacklozenge symbol on the block diagrams located at the end of this chapter.

Performing the Serial Bus Test

First, this test sequentially checks all 48 nodes at 45 MHz. Next, the test checks all nodes that change values with frequency, at 49 different frequency points. For each node, measured values are copied to an ASCII text file in the service directory on the hard disk drive, C:\Program Files\Agilent\Network Analyzer\Service\. Any measured values that exceed the tolerances are highlighted in the application and the data file.

To run the serial bus test:

- On the System menu, point to Service, and then click Serial Bus Test.
- The dialog box in Figure 4-8 on page 4-30 is displayed. Click **Begin** to start the test.

Figure 4-8 Serial Bus Test Dialog Box

💽 Serial Bus To	est		_ 🗆 ×
<u>A</u> bout <u>H</u> elp			
Current Test Freq. (MHz)	Assembly Nod	e Power (dBm)	 View Results
	Pause on Failure		E <u>x</u> it
		5	
Minimum V.	Results	— Maximum V.	Failures
None			
	Failure 9	Summary	

Node Descriptions, A6 Multiplier Board

- Node 1211 Gnd Node 1211 provides a ground reference for measurements.
- **Node 1213** *ALC Integrator* Node 1213 senses the output of the ALC integrator. The output of the ALC integrator is the combined voltage output of all compensation circuits in the ALC. The voltage level varies with frequency and output power.
- **Node 1214** +5 Vdc Supply Voltage Node 1214 senses the 5 Vdc supply voltage that serves as a measurement reference.
- **Node 1215** *Power DAC* Node 1215 senses the output voltage of the power DAC. This output is input to the ALC integrator.
- **Node 1217** *Multiplier Output Level* Node 1217 senses the average voltage output level of the multiplier board used to adjust the output level.

Node Descriptions, A8 Multiplier Board

- **Node 1111** *Gnd* Node 1111 provides a ground reference for measurements.
- **Node 1113** *ALC Integrator* Node 1113 senses the output of the ALC integrator. The output of the ALC integrator is the combined voltage output of all compensation circuits in the ALC. The voltage level varies with frequency and output power.
- **Node 1114** +5 *Vdc Supply Voltage* Node 1114 senses the 5 Vdc supply voltage that serves as a measurement reference.
- **Node 1115** *Power DAC* Node 1115 senses the output voltage of the power DAC. This output is input to the ALC integrator.
- **Node 1117** *Multiplier Output Level* Node 1117 senses the average voltage output level of the multiplier board used to adjust the output level.

Node Descriptions, A10 Frequency Reference Board

- Node 211100 MHz TuneNode 211 senses the tune voltage that phase locks the
100 MHz VCO. The tune voltage is set by referencing the 100 MHz VCO to
the internal 10 MHz OCXO or to the 10 MHz EXT REF.
- **Node 215** *External Reference Detect* Node 215 senses a TTL signal that is used to set the reference frequency switch. The node registers a low TTL voltage when the internal 10 MHz OCXO signal is used or a high TTL voltage when the external 10 MHz EXT REF is used.

Node Descriptions, A7 Fractional-N Synthesizer Board

- **Node 411** +5 *Vdc Supply Voltage* Node 411 senses the 5 Vdc supply voltage that serves as a measurement reference.
- **Node 412 1.5 to 3.0 GHz VCO Compensation** Node 412 senses the average voltage output level of the 1.5 to 3.0 GHz VCO.
- **Node 413 1.5 to 3.0 GHz VCO Tune Voltage** Node 413 senses the average voltage input level of the 1.5 to 3.0 GHz VCO.
- **Node 414** *Heterodyne Band ALC Level* Node 414 senses the ALC output voltage that is used to level the heterodyne circuit output for band 1.
- Node 415**2.250 GHz VCO Tune Voltage**Node 415 senses the average voltage input
level of the 2.250 GHz VCO.
- **Node 416** *Fundamental and Divide-by-2 Band ALC Level* Node 416 senses the ALC output voltage that is used to level the heterodyne circuit output for bands 2-25.
- **Node 417** 2.250 GHz VCO Compensation Node 417 senses the average voltage output level of the 2.250 GHz VCO.
- **Node 418** *ALC Level Adjust* Node 418 senses the voltage that is used to set the offset on the heterodyne band ALC.

Node Descriptions, A9 Fractional-N Synthesizer Board

- **Node 911** +5 *Vdc Supply Voltage* Node 411 senses the 5 Vdc supply voltage that serves as a measurement reference.
- **Node 912** 1.5 to 3.0 GHz VCO Compensation Node 412 senses the average voltage output level of the 1.5 to 3.0 GHz VCO.
- **Node 913** *1.5 to 3.0 GHz VCO Tune Voltage* Node 413 senses the average voltage input level of the 1.5 to 3.0 GHz VCO.
- **Node 914** *Heterodyne Band ALC Level* Node 414 senses the ALC output voltage that is used to level the heterodyne circuit output for band 1.
- Node 9152.250 GHz VCO Tune VoltageNode 415 senses the average voltage input
level of the 2.250 GHz VCO.
- **Node 916** *Fundamental and Divide-by-2 Band ALC Level* Node 416 senses the ALC output voltage that is used to level the heterodyne circuit output for bands 2-25.

- **Node 917** 2.250 GHz VCO Compensation Node 417 senses the average voltage output level of the 2.250 GHz VCO.
- **Node 918** *ALC Level Adjust* Node 418 senses the voltage that is used to set the offset on the heterodyne band ALC.

Node Descriptions, A16 Test Set Motherboard, MA

- **Node 516** –15 V Reference Node 516 senses the –15 Vdc supply voltage that serves as a measurement reference.
- **Node 517** +9 V Reference Node 517 senses the +9 Vdc supply voltage that serves as a measurement reference.
- **Node 518** +15 V Reference Node 518 senses the +15 Vdc supply voltage that serves as a measurement reference.

Node Descriptions, A16 Test Set Motherboard, MASS

- **Node 611** *Detector Level* Node 611 senses the power level of the internal detector signal from the A22 switch splitter or the power level from the external detector from the rear panel.
- **Node 612** *Level Output* Node 612 senses the output of the detector log amp in the ALC.
- **Node 615** *Temperature Compensation* Node 615 senses the input voltage applied to the temperature compensation amplifier for the source ALC.
- **Node 616** Slope Compensation Node 616 senses the slope compensation.
- **Node 617** Log Amp Collector Voltage Node 617 senses the collector voltage of the source ALC log amp.
- **Node 618** *Power DAC* Node 618 senses the output voltage of the power DAC. This output is summed with other compensation signals to control the source output level. The power DAC has the most influence of the compensation signals.

Node Descriptions, A16 Test Set Motherboard, AUX 1

- **Node 711** Log Amp Breakpoint 1 Voltage Node 711 senses the breakpoint voltage for stage 1 of the source ALC log amp.
- **Node 712** Log Amp Breakpoint 2 Voltage Node 712 senses the breakpoint voltage for stage 2 of the source ALC log amp.
- Node 714Log Amp Offset VoltageNode 714 senses the offset voltage for the source
ALC log amp.
- **Node 715** +10 V Reference Node 715 senses the +10 V supply voltage that serves as a measurement reference.
- **Node 716** Log Amp Emitter Voltage Node 716 senses the emitter voltage of the source ALC log amp.
- **Node 717** *Temperature Compensation* Node 717 senses the output voltage of the temperature compensation amplifier for the source ALC.

Node 718 SOMA 50 Prelevel DAC Node 718 senses the prelevel DAC voltage applied to the output of the source ALC circuitry upon analyzer startup to preset the output level of the SOMA 50.

Node Descriptions, A16 Test Set Motherboard, AUX 2

- **Node 811** –*10 V Reference* Node 811 senses the –10 V supply voltage that serves as a measurement reference.
- **Node 812** +1.78 V Bias Reference Node 812 senses the +1.78 V bias supply voltage that serves as a measurement reference.
- Node 813Phase Lock IF DetectorNode 813 senses the voltage input to the phase
lock IF detector.
- **Node 814** +10 V Reference Node 814 senses the +10 V supply voltage that serves as a measurement reference.
- **Node 815** –1.25 V Bias Reference Node 815 senses the –1.25 V bias supply voltage that serves as a measurement reference.
- **Node 816** +5 *V Reference* Node 816 senses the +5 V supply voltage that serves as a measurement reference.
- **Node 817** *Logger Drive Voltage Output* Node 817 senses the drive voltage applied to the source ALC log amp.
- **Node 818** *Detector Voltage Output* Node 818 senses the output voltage of the phase lock IF detector.

Source Group Tests

Equipment Used for These Tests

Equipment Type	Model or Part Number	Alternate Model or Part Number	
Spectrum analyzer	8565E	None	
Power meter	E4418B/19B	E4418A/19A	
Power sensor, 3.5 mm	8485A	None	
RF cable, 3.5 mm (f) to 3.5 mm (f)	85131C	Any	

Getting Ready to Test

Before checking the assemblies, you must open the analyzer.

CAUTION Use an antistatic work surface and wrist strap to reduce the chance of electrostatic discharge for all of the procedures in this chapter.

- 1. Turn off the analyzer power.
- 2. Unplug the power to the analyzer and disconnect all rear panel connections.

3. Remove the covers from the analyzer. Refer to "Removing the Covers" on page 7-6.

WARNING Procedures described in this document are performed with power supplied to the product while protective covers are removed. Energy available at many points may, if contacted, result in personal injury.

4. With the covers off, plug in the analyzer and turn on the power.

Single vs. Broadband Failure

There are two main types of failures that are related to the source group. The failures are classified as:

- broadband
- single band

Single band failures are indicated by all four channel traces (or A and B or C and D traces for Options 146 and 246) having partial dropouts across the frequency range or intermittent phase lock problems. Troubleshooting information is provided under "If the trace faults are band-related," under "All Traces" on page 4-28.

Broadband failures are indicated by all four channel traces (or A and B or C and D traces for Options 146 and 246) being in the noise floor. Most often this is due to problems in the phase lock signal path and will be characterized by a "PHASE LOCK LOST" error message on the display.

A phase lock problem is due to either:

- faulty RF signal generation (caused by the A10, A9, A8, or A19 board or by the A13, A12, or A18 board for Options 146 and 246)
- faulty LO signal generation (caused by the A10, A7 or A6 board)

RF Signal Troubleshooting

To isolate a broadband RF signal generation failure, check the test port output power:

- 1. Connect a power meter and power sensor to Port 1 of the analyzer.
- 2. On the analyzer, press **Preset**, set the **Center Frequency** to **2 GHz**, and the **Frequency Span** to **0 Hz**. Note the power reading displayed on the power meter.

```
NOTE In the unlocked state, the analyzer will "search" for the reference signal. The output power, as indicated on the power meter, should be at least -8 dBm.
```

- 3. Connect the power sensor, in turn, to Ports 2, 3, and 4 and set trace to measure S_{22} , S_{33} , and S_{44} respectively. Note the power reading displayed on the power meter.
- If the power level is low or high on all test ports, the problem is LO signal related. Continue with "LO Signal Troubleshooting" below.
- If the power level is low or high on only one of the test ports, the problem is in the signal separation group. Go to "Checking the Signal Separation Group" on page 4-42.

LO Signal Troubleshooting

To isolate a broadband LO signal generation failure, refer to the data obtained from the "Serial Bus Test" on page 4-29:

- If the data obtained for the A10 frequency reference board is out of tolerance, confirm the failure with the following checks for the A10 board starting on page 4-35.
- If the data obtained for the A10 frequency reference board is correct but the data for the A7 fractional-N synthesizer board is out of tolerance, confirm the failure with the following checks for the A7 board starting on page 4-38.
- If the data obtained for the A9 fractional-N synthesizer board is correct—and the RF has been checked—but there is still a phase lock problem, confirm the failure with the following checks for the A6 and A20 boards starting on page 4-38.

Checking the A10 5 MHz Reference Output, All Bands

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate flexible cable W30 (W70 for Option 146 or 246), at the A10 frequency reference board.
- 2. Disconnect W30 (W70 for Option 146 or 246) from A10J10.
- 3. Connect the spectrum analyzer to A10J10.
- 4. The spectrum analyzer should measure a signal at 5 MHz.
- 5. If the 5 MHz signal is not present, replace the A10 frequency reference board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.

6. If the 5 MHz signal is present, reconnect cable W30 (W70 for Option 146 or 246), and then continue testing at "Checking the A7 Fractional-N Synthesizer Output, Bands 0 through 3" on page 4-36.

Checking the A7 Fractional-N Synthesizer Output, Bands 0 through 3

Perform this procedure if you observe a problem in bands 0 through in all receivers.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate the flexible cable W2, at the A7 fractional-N synthesizer board.
- 2. Disconnect W2 from A7J101.
- 3. Connect the spectrum analyzer to A7J101.
- 4. Set the network analyzer for a 500 MHz CW frequency and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 507.66 MHz.
- 5. If the signal is not present and the 5 MHz reference signal is present from "Checking the A10 5 MHz Reference Output, All Bands," replace the A7 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, reconnect cable W2, and then continue with "Checking the A7 Fractional-N Synthesizer Output, Band 4" on page 4-36.

Checking the A7 Fractional-N Synthesizer Output, Band 4

Perform this procedure if you observe a problem in band 4 in all receivers.

1. Refer to the block diagram at the back of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate semirigid cable W1, at the A7 fractional-N synthesizer board.

CAUTION Be careful not to damage the center pins of the semirigid cable. Some flexing of the cables is necessary to measure the output. Do not over bend them.

- 2. Using a 5/16 inch torque wrench, disconnect W1 at A7J106.
- 3. Connect the spectrum analyzer to A7J106.
- 4. Set the network analyzer to a CW frequency of 1 GHz.
 - The spectrum analyzer should measure a signal at 1 GHz (plus the 7.66 MHz offset).
- 5. If this signal is not present, replace the A7 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, leave the spectrum analyzer connected to A7J106 and continue with "Checking the A7 Fractional-N Synthesizer Output, Bands 5 through 17" on page 4-37.

Checking the A7 Fractional-N Synthesizer Output, Bands 5 through 17

Perform this procedure if you observe a problem in bands 5 through 17 in all receivers.

- 1. Set the network analyzer to measure a CW frequency of 2 GHz.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 2. If the signal is not present, replace the A7 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 3. If the signal is present, reconnect cable W1, and then continue with "Checking the A6 Multiplier Output, All Bands" on page 4-38.

Options	Band	Network Analyzer Frequency Band of Problem (GHz)	Network Analyzer Source Frequency Setting (GHz)	Expected A7 Output Frequency (GHz)	Expected A6 Output Frequency (GHz)
	0	0.0003 to 0.001	0.0007	0.00836	0.00836
	1	0.001 to 0.010	0.005	0.01266	0.01266
	2	0.010 to 0.040	0.025	0.03266	0.03266
	3	0.040 to 0.748	0.060	0.06766	0.06766
140,	4	0.748 to 1.500	1.100	1.10766	1.10766
145,	5	1.500 to 3.125	2.200	2.20766	2.20766
146, 240,	6	3.125 to 4.167	3.600	1.80383	3.60766
240, 245,	7	4.167 to 5.250	4.600	2.30383	4.60766
or	8	5.250 to 6.250	5.700	2.85383	5.70766
246	9	6.250 to 8.333	6.700	1.67692	6.70766
	10	8.333 to 9.800	9.000	2.25192	9.00766
	11	9.800 to 10.500	10.200	2.55192	10.20766
	12	10.500 to 12.500	11.500	1.91794	3.83588
	13*	12.500 to 13.500	13.000	2.17050	4.34099
	13**	12.500 to 15.000	13.700	2.28461	4.56922
240, 245, or 246	14	15.000 to 15.750	15.400	2.56794	5.13588
	15	15.750 to 16.667	16.200	2.70128	5.40255
	16	16.667 to 18.750	17.700	2.95128	5.90255
	17	18.750 to 20.000	19.300	1.60897	6.43588

Table 4-4LO Path Frequencies

* Applies to 13.5 GHz analyzers only.

** Applies to 20 GHz analyzers only.

Checking the A6 Multiplier Output, All Bands

Perform this procedure if you observe a problem in all bands in all receivers.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate the flexible cable W3, at the A6 multiplier board.
- 2. Disconnect W2 from the A6 board.
- 3. Connect the spectrum analyzer to the open connector.
- 4. Set the network analyzer for a 2 GHz CW frequency and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 5. If the signal is not present and the signals are present from "Checking the A7 Fractional-N Synthesizer Output, Bands 5 through 17," replace the A6 multiplier board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, reconnect cable W3, and then continue with "Checking the A9 Fractional-N Synthesizer Output, Bands 0 through 3" on page 4-38.

Checking the A9 Fractional-N Synthesizer Output, Bands 0 through 3

Perform this procedure if you observe a problem in bands 0 through 3 in all receivers, or in the A and B receivers for Options 146 and 246.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate the flexible cable W5, at the A9 fractional-N synthesizer board.
- 2. Disconnect W5 from A9J101.
- 3. Connect the spectrum analyzer to A9J101.
- 4. Set the network analyzer for a 500 MHz CW frequency and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 507.66 MHz.
- 5. If the signal is not present and the 5 MHz reference signal is present from "Checking the A10 5 MHz Reference Output, All Bands," replace the A9 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, reconnect cable W5, and then continue with "Checking the A9 Fractional-N Synthesizer Output, Band 4" on page 4-38.

Checking the A9 Fractional-N Synthesizer Output, Band 4

Perform this procedure if you observe a problem in band 4 in all receivers, or in the A and B receivers for Options 146 and 246.

1. Refer to the block diagram at the back of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate semirigid cable W4, at the A9 fractional-N synthesizer board.

CAUTION	Be careful not to damage the center pins of the semirigid cable. Some flexing
	of the cables is necessary to measure the output.

- 2. Using a 5/16 inch torque wrench, disconnect W4 at A9J106.
- 3. Connect the spectrum analyzer to A9J106.
- 4. Set the network analyzer to a CW frequency of 1 GHz.
 - The spectrum analyzer should measure a signal at 1 GHz (plus the 7.66 MHz offset).
- 5. If this signal is not present, replace the A9 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, leave the spectrum analyzer connected to A9J106 and continue with "Checking the A9 Fractional-N Synthesizer Output, Bands 5 through 17" on page 4-39.

Checking the A9 Fractional-N Synthesizer Output, Bands 5 through 17

Perform this procedure if you observe a problem in bands 5 through 17 in all receivers, or in the A and B receivers for Options 146 and 246.

- 1. Set the network analyzer to a CW frequency of 2 GHz.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 2. If the signal is not present, replace the A9 fractional-N synthesizer board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 3. If the signal is present, reconnect cable W4, and then continue with "Checking the A8 Multiplier Output, All Bands" on page 4-39.

Checking the A8 Multiplier Output, All Bands

Perform this procedure if you observe a problem in all bands in all receivers, or in the A and B receivers for Options 146 and 246.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, All Options Except 146/246" on page 6-14. Locate the flexible cable W6, at the A8 multiplier board.
- 2. Disconnect W6 from the A8 board.
- 3. Connect the spectrum analyzer to the open connector.
- 4. Set the network analyzer for a 2 GHz CW frequency and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 5. If the signal is not present and the signals are present from "Checking the A9 Fractional-N Synthesizer Output, Bands 5 through 17," replace the A8 multiplier board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. If the signal is present, reconnect cable W6, and then continue with "Checking the Signal Separation Group" on page 4-42.

Checking the A13 Fractional-N Synthesizer Output, Bands 0 through 3 (Options 146 and 246)

Perform this procedure if you observe a problem in bands 0 through 3 in the C and D receivers.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, Options 146/246 (Side View)" on page 6-20. Locate the flexible cable W62, at the A13 fractional-N synthesizer board.
- 2. Disconnect W62 from A13J101.
- 3. Connect the spectrum analyzer to A13J101.
- 4. Set the network analyzer for an S_{33} measurement at a CW frequency if 500 MHz and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 507.66 MHz.
- 5. If the signal is not present and the 5 MHz reference signal is present from "Checking the A10 5 MHz Reference Output, All Bands," replace the A13 fractional-N synthesizer board. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 6. If the signal is present, reconnect cable W62, and then continue with "Checking the A13 Fractional-N Synthesizer Output, Band 4 (Options 146 and 246)" on page 4-40.

Checking the A13 Fractional-N Synthesizer Output, Band 4 (Options 146 and 246)

Perform this procedure if you observe a problem in band 4 in the C and D receivers.

1. Refer to the block diagram at the back of this chapter and to "Top Cables, Options 146/246 (Side View)" on page 6-20. Locate semirigid cable W61, at the A13 fractional-N synthesizer board.

CAUTION Be careful not to damage the center pins of the semirigid cable. Some flexing of the cables is necessary to measure the output.

- 2. Using a 5/16 inch torque wrench, disconnect W61 at A13J106.
- 3. Connect the spectrum analyzer to A13J106.
- 4. Set the network analyzer to an S_{33} measurement at a CW frequency of 1 GHz.
 - The spectrum analyzer should measure a signal at 1 GHz (plus the 7.66 MHz offset).
- 5. If this signal is not present, replace the A13 fractional-N synthesizer board. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 6. If the signal is present, leave the spectrum analyzer connected to A13J106 and continue with "Checking the A13 Fractional-N Synthesizer Output, Bands 5 through 17 (Options 146 and 246)" on page 4-41.

Checking the A13 Fractional-N Synthesizer Output, Bands 5 through 17 (Options 146 and 246)

Perform this procedure if you observe a problem in bands 5 through 17 in the C and D receivers.

- 1. Set the network analyzer for an S_{33} measurement at a CW frequency of 2 GHz.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 2. If the signal is not present, replace the A13 fractional-N synthesizer board. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 3. If the signal is present, reconnect cable W61, and then continue with "Checking the A12 Multiplier Output, All Bands (Options 146 and 246)" on page 4-41.

Checking the A12 Multiplier Output, All Bands (Options 146 and 246)

Perform this procedure if you observe a problem in all bands in the C and D receivers.

- 1. Refer to the block diagram at the end of this chapter and to "Top Cables, Options 146/246 (Side View)" on page 6-20. Locate the flexible cable W63, at the A12 multiplier board.
- 2. Disconnect W63 from the A12 board.
- 3. Connect the spectrum analyzer to the open connector.
- 4. Set the network analyzer for an S_{33} measurement at a CW frequency of 2 GHz and observe the spectrum analyzer measurement.
 - The spectrum analyzer should measure a signal at 2 GHz (plus the 7.66 MHz offset).
- 5. If the signal is not present and the signals are present from "Checking the A13 Fractional-N Synthesizer Output, Bands 5 through 17 (Options 146 and 246)," replace the A12 multiplier board. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 6. If the signal is present, reconnect cable W63, and then continue with "Checking the Signal Separation Group" on page 4-42.

Checking the Signal Separation Group

Before checking the signal separation group, perform the following procedures:

• "Getting Ready to Test" on page 4-34

Checking the Output Power of the A, B, C, and D Signals

Using a power meter, you can measure the outputs of the A, B, C, and D signals from the front panel. The measurement results will help you isolate a faulty assembly. The output of the R channel cannot be measured because it would necessitate breaking the phase lock loop, causing all of the signals to be lost.

Equipment Used for These Tests

Equipment Type	Model or Part Number	Alternate Model or Part Number
Power meter	E4418B/E441B	E4418A/E4419A
Power sensor, 3.5 mm	E8485A	None
Adapter, 3.5 mm (f) to 3.5 mm (f)	83059B	85052-60012

Equipment Setup

- 1. Before starting these checks, zero and calibrate the power meter. (See the power meter user's guide for instructions on setting the calibration factor.)
- 2. If the **Receiver Display** (Figure 4-6 or Figure 4-7) is not on the analyzer screen, perform the following: On the **System** menu, point to **Service**, **Utilities**, and then click **Receiver Display**.
- 3. Set the sweep speed for a 10 second sweep: On the Sweep menu, click Sweep Time and set the time to 10.000 seconds in the Sweep Time box.

Checking Port 1, 2, 3, or 4 Power Outputs (A, B, C, or D Signals)

The object of this check is to verify the power of the output signal across the entire frequency range. Perform this test if there is an observed problem only with one channel trace. The ten second sweep is slow enough to allow you to observe the output power on the power meter as the sweep occurs.

- 1. Connect the power sensor to the suspect port.
- 2. Observe the power reading on the power meter as the sweep occurs on the analyzer.
- 3. The measured output power on the power meter should be at least -8 dBm over the entire frequency range.
 - If the measured power is correct, go to "Checking the Receiver Group" on page 4-46.
 - If the measured power is not correct, go to "Checking the Signal through the Signal Separation Path" on page 4-43.

Checking the Signal through the Signal Separation Path

For all of the following checks, refer to the block diagrams at the end of this chapter and to:

- "Bottom Assemblies, Options 140 and 240" on page 6-22
- "Bottom Assemblies, Options 146 and 246" on page 6-30

Trace loss in the signal separation group is due to one or more of the following assemblies being defective:

- A18 MASSQuad (Options 146 and 246 only)
- A19 MASSQuad
- A25 source step attenuator (Options 145, 245, 146, and 246 only)
- A26 source step attenuator (Options 146 and 246 only)
- A21, A22, A23, or A24 test port coupler

Equipment Used for These Tests

Equipment Type	Model or Part Number	Alternate Model or Part Number
Spectrum analyzer	8565E	856xE ^a

a. Must be capable of measuring a signal at 1 GHz.

To determine which assembly is defective, check the signal at each available measurement point in the signal path from the switch splitter in the A19 MASSQuad (and A18 MASSQuad for Options 146 and 246) to the output port.

For Port 1 measurements, set the network analyzer for an S_{11} measurement with a CW frequency of 1 GHz.

For Port 2, 3, and 4 measurements, set the network analyzer for an S_{22} , S_{33} , or S_{44} , measurement with a CW frequency of 1 GHz.

Perform the following checks in the order presented.

Checking the A19 MASSQuad A18 MASSQuad and the A21–A24 Test Port Couplers

- 1. Locate the following semirigid cable at the appropriate output of the either the A19 or A18 MASSQuad:
 - Analyzers with Options 140 and 240
 - Port 1; W8 of A19
 - Port 2; W9 of A19
 - Port 3; W10 of A19
 - Port 4; W11 or A19

- Analyzers with Options 145 and 245
 - Port; W40 of A19
 - Port 2; W41 of A19
 - Port 3; W42 of A19
 - Port 4; W43 of A19
- Analyzers with Options 146 and 246
 - Port 1; W40 of A19
 - Port 2; W41 of A19
 - Port 3; W64 of A18
 - Port 4; W65 of A18
- 2. Using a 5/16-inch torque wrench, disconnect the semirigid cable at the MASSQuad.
- 3. Connect the spectrum analyzer to the open connector. Set the spectrum analyzer to measure a signal at 1 GHz.
- 4. If the 1 GHz signal is not present and the analyzer has a source step attenuator, reconnect the cable to the MASSQuad and continue testing at "Checking the A25 60-dB Source Step Attenuator (Options 145, 245, 146, and 246)" on page 4-44 or "Checking the A26 60-dB Source Step Attenuator (Options 146 and 246)" on page 4-45, whichever is appropriate.
- 5. If the 1 GHz signal is not present and the analyzer does not have a source step attenuator, replace the MASSQuad Refer to "Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block" on page 7-34 or "Removing and Replacing the A18 MASS 26.5 (MASSQuad)" on page 7-32, whichever is appropriate.
- 6. If the 1 GHz signal is present, reconnect the cable to the MASSQuad and replace the appropriate test port coupler. Refer to "Removing and Replacing the A21, A22, A23, and A24 Test Port Couplers and Coupler Mounting Blocks" on page 7-38.

Checking the A25 60-dB Source Step Attenuator (Options 145, 245, 146, and 246)

- 1. Locate semirigid cable W59 at the output of the A25 source step attenuator.
- 2. Using a 5/16-inch torque wrench, disconnect the semirigid cable at the A25 step attenuator.
- 3. Connect the spectrum analyzer to the A25 step attenuator connector. Set the spectrum analyzer to measure a signal at 1 GHz.
- 4. If the 1 GHz signal is not present, continue troubleshooting at "Checking the Output of the A19 MASSQuad to the A25 Source Step Attenuator (Options 145, 245, 146, and 246)" on page 4-45.
- 5. If the 1 GHz signal is present, replace the A19 MASSQuad. Refer to "Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block" on page 7-34.

Checking the Output of the A19 MASSQuad to the A25 Source Step Attenuator (Options 145, 245, 146, and 246)

- 1. Locate semirigid cable W58 at the output of the A19 MASSQuad that goes to the input of the A25 source step attenuator.
- 2. Using a 5/16-inch torque wrench, disconnect the semirigid cable at the A19 MASSQuad.
- 3. Connect the spectrum analyzer to the A19 MASSQuad connector. Set the spectrum analyzer to measure a signal at 1 GHz.
- 4. If the 1 GHz signal is not present, replace the A19 MASSQuad. Refer to "Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block" on page 7-34.
- 5. If the 1 GHz signal is present, replace the A25 step attenuator. Refer to. "Removing and Replacing the A25 60-dB Source Step Attenuator" on page 7-40.

Checking the A26 60-dB Source Step Attenuator (Options 146 and 246)

- 1. Locate semirigid cable W79 at the output of the A26 source step attenuator.
- 2. Using a 5/16-inch torque wrench, disconnect the semirigid cable at the A26 step attenuator.
- 3. Connect the spectrum analyzer to the A26 step attenuator connector. Set the spectrum analyzer to measure a signal at 1 GHz. Set the network analyzer for an S_{33} measurement.
- 4. If the 1 GHz signal is not present, continue troubleshooting at "Checking the Output of the A18 MASSQuad to the A26 Source Step Attenuator (Options 146 and 246)" on page 4-45.
- 5. If the 1 GHz signal is present, replace the A18 MASSQuad. Refer to "Removing and Replacing the A18 MASS 26.5 (MASSQuad)" on page 7-32.

Checking the Output of the A18 MASSQuad to the A26 Source Step Attenuator (Options 146 and 246)

- 1. Locate semirigid cable W78 at the output of the A18 MASSQuad that goes to the input of the A26 source step attenuator.
- 2. Using a 5/16-inch torque wrench, disconnect the semirigid cable at the A18 MASSQuad.
- 3. Connect the spectrum analyzer to the A18 MASSQuad connector. Set the spectrum analyzer to measure a signal at 1 GHz. Set the network analyzer for an $\rm S_{33}$ measurement.
- 4. If the 1 GHz signal is not present, replace the A18 MASSQuad. Refer to "Removing and Replacing the A18 MASS 26.5 (MASSQuad)" on page 7-32.
- 5. If the 1 GHz signal is present, replace the A26 step attenuator. Refer to. "Removing and Replacing the A26 60-dB Source Step Attenuator" on page 7-42.

Checking the Receiver Group

Equipment Used for These Tests

Equipment Type	Model or Part Number	Alternate Model or Part Number
Spectrum analyzer	8565E	856xE ^a

a. Must be capable of measuring a signal at 7.66 MHz.

Getting Ready to Test

Before checking the assemblies, you must open the analyzer.

CAUTION Use an antistatic work surface and wrist strap to reduce the chance of electrostatic discharge for all of the procedures in this chapter.

- 1. Turn off the analyzer power.
- 2. Unplug the power to the analyzer and disconnect all rear panel connections.
- 3. Remove the covers from the analyzer. Refer to "Removing the Covers" on page 7-6.
- 4. With the covers off, plug in the analyzer and turn on the power.
- 5. For Port 1 measurements, set the network analyzer for an S_{11} measurement with a CW frequency of 1 GHz.

For Port 2, 3, or 4 measurements, set the network analyzer for an S_{22} , S_{33} , or S_{44} measurement with a CW frequency of 1 GHz.

Checking the A20 Mixer Brick Receiver Outputs

Perform this procedure if a problem appears to be in one of the receiver channels.


- 1. Refer to the block diagram at the end of this chapter and to "Bottom Assemblies, Options 140 and 240" on page 6-22. Locate the flexible cables W21, W22, W23, W24, and W25 at each receiver channel IF output, A, B, C, D, and R respectively.
- 2. Disconnect the flexible cable at the suspect channel.
- 3. Connect the spectrum analyzer to the suspect channel connector.
- 4. Make sure that the analyzer's spur avoidance feature is OFF and that all front-panel jumpers are installed. The measured signal on the spectrum analyzer should be at 7.66 MHz.
 - If the measured signal is present, replace the A5 SPAM board. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 5. If the measured signal is not present on the R channel and the analyzer is equipped with Option 146 or 246, continue troubleshooting at "Checking the A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246 Only)" on page 4-47.


If the measured signal is not present on the A, B, C, or D channels and the analyzer is equipped with Option 146 or 246, replace the A20 mixer brick. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.


If the measured signal is not present on any of the channels and the analyzer is not equipped with Option 146 or 246, replace the A20 mixer brick. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.

Checking the A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246 Only)

- 1. Set the network analyzer for an S_{11} measurement with a CW frequency of 1 GHz.
- 2. Connect a spectrum analyzer to the front-panel Reference Source Out connector.
- 3. If the measured signal is present, continue with step 5.
- 4. If the measured signal is not present replace the A29 reference channel switch, the limiter, or the DC block. Refer to "Removing and Replacing the A29 Reference Switch, Limiter, and DC Block" on page 7-44.
- 5. Set the network analyzer for an S_{33} measurement.
- 6. If the measured signal is present, replace the A20 mixer brick. Refer to "Removing and Replacing the A20 Mixer Brick (QuintBrick)" on page 7-36.
- 7. If the measured signal is not present replace the A29 reference channel switch, the limiter, or the DC block. Refer to "Removing and Replacing the A29 Reference Switch, Limiter, and DC Block" on page 7-44.

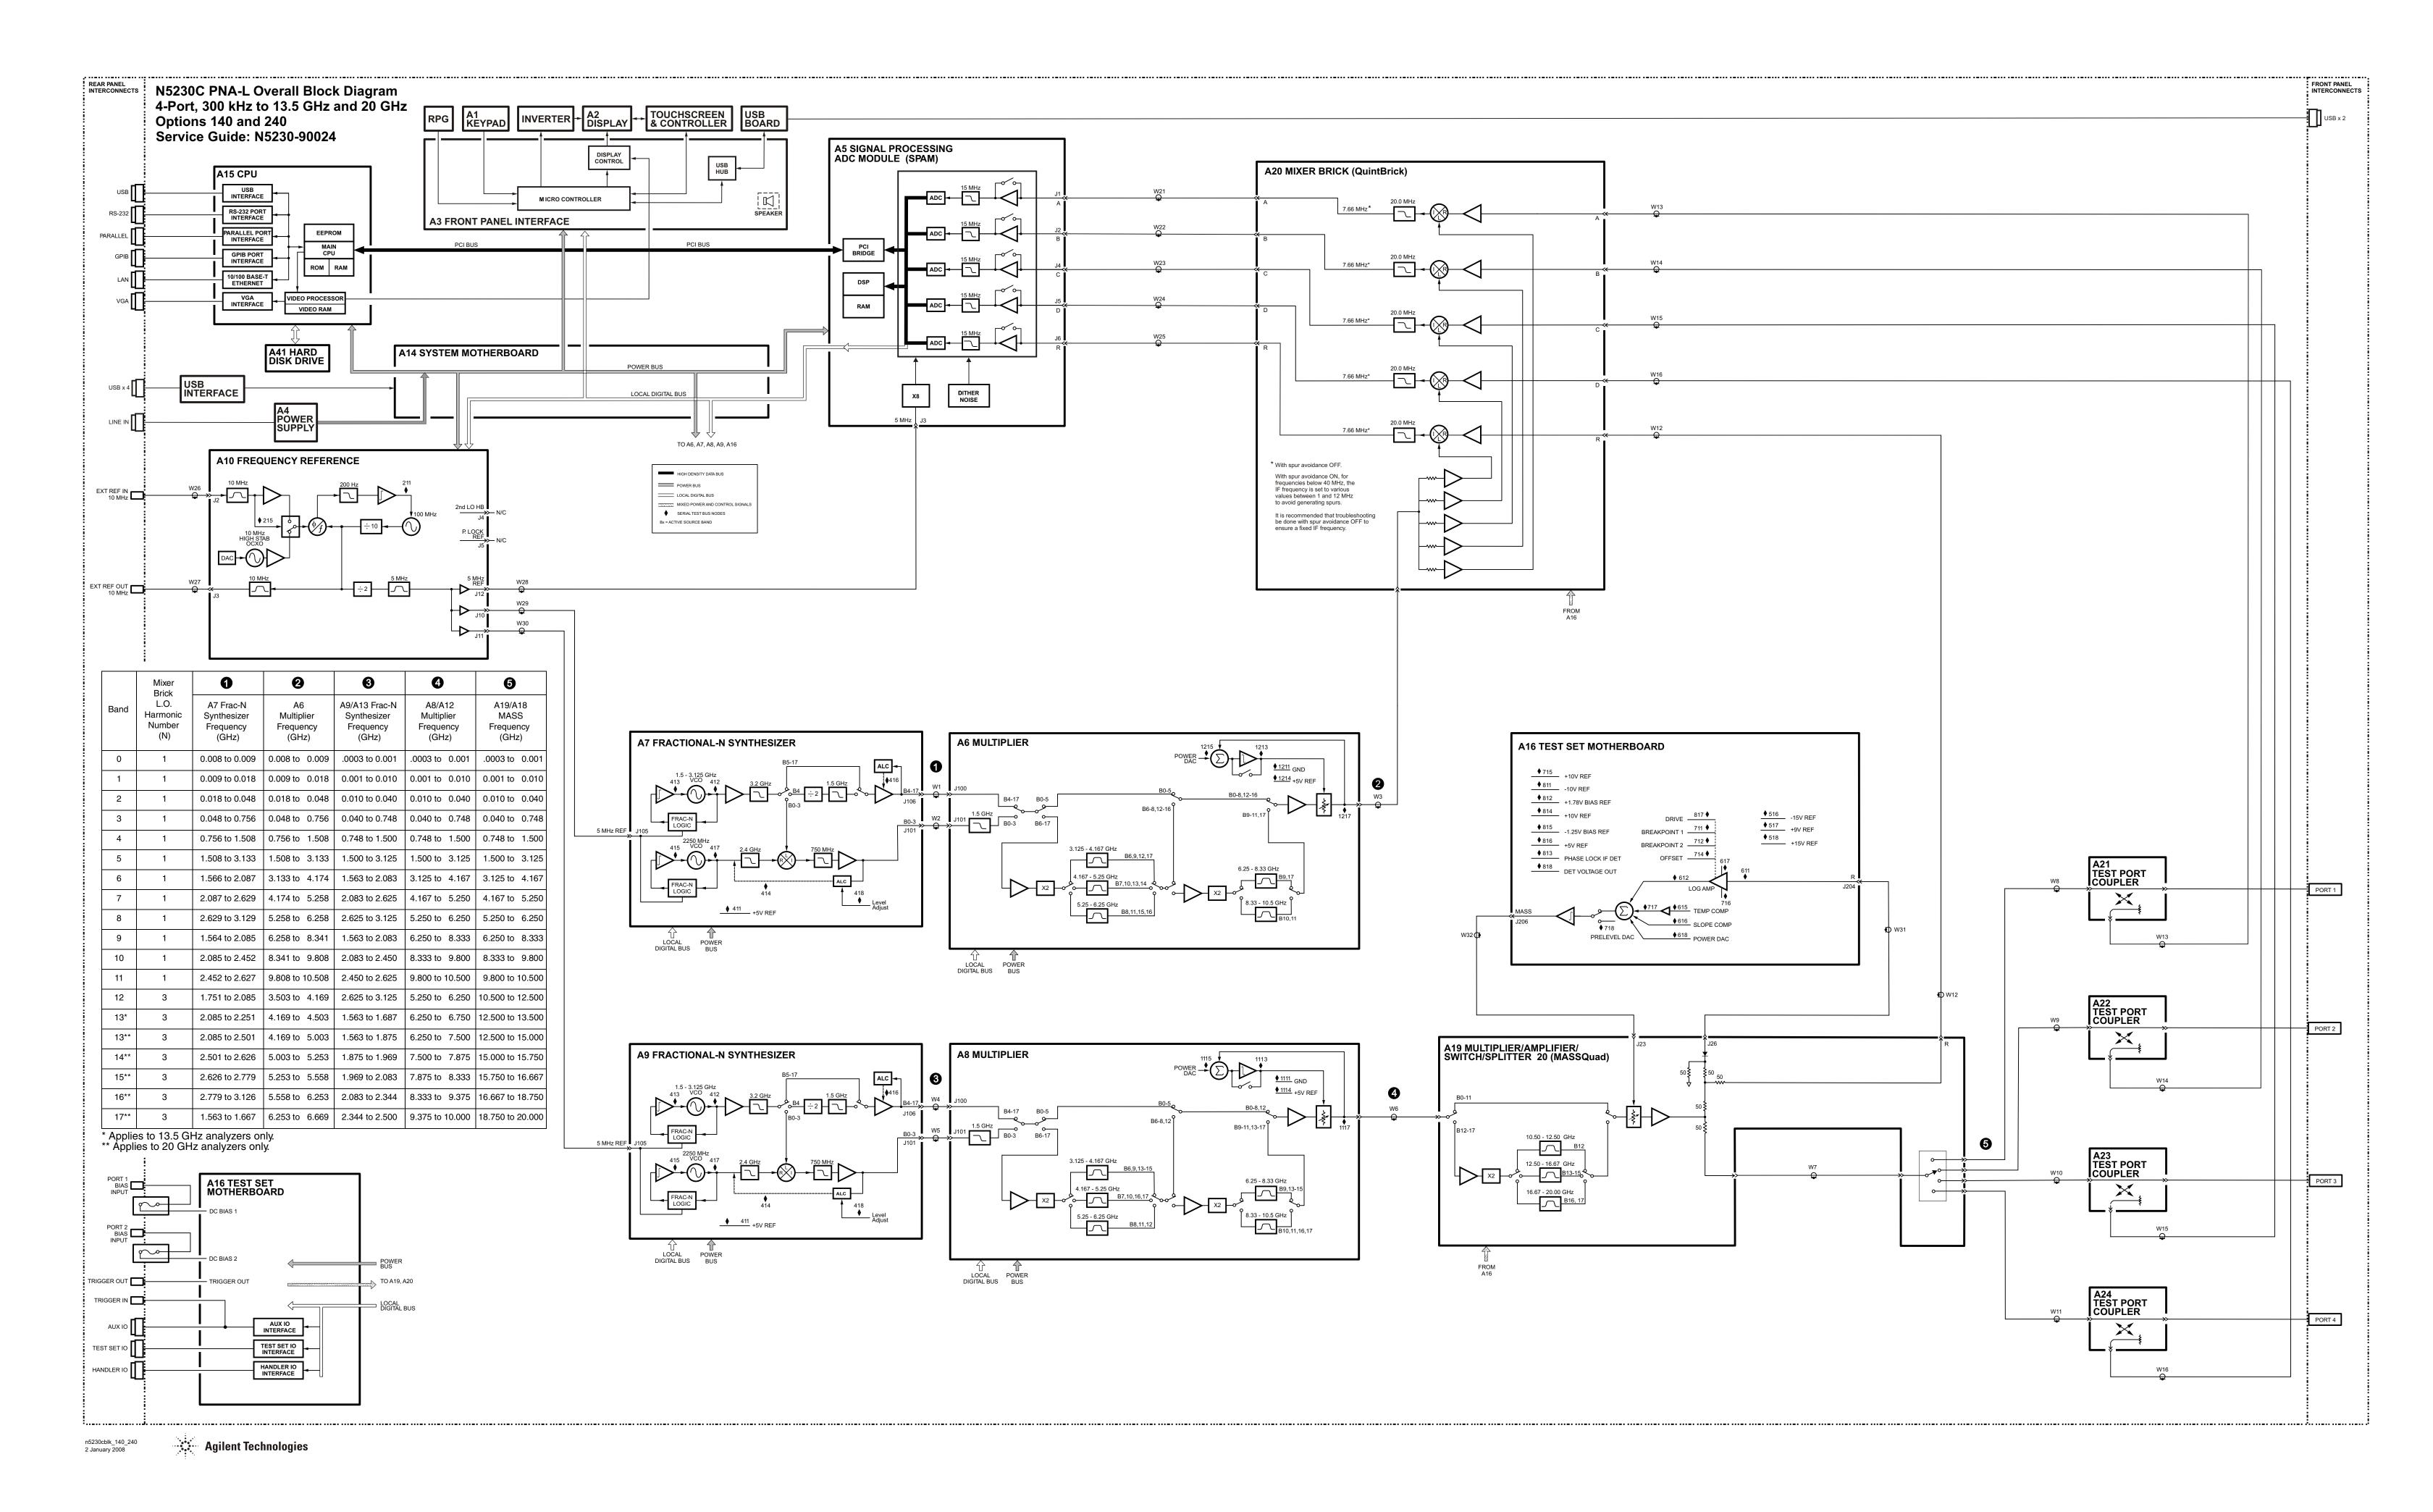

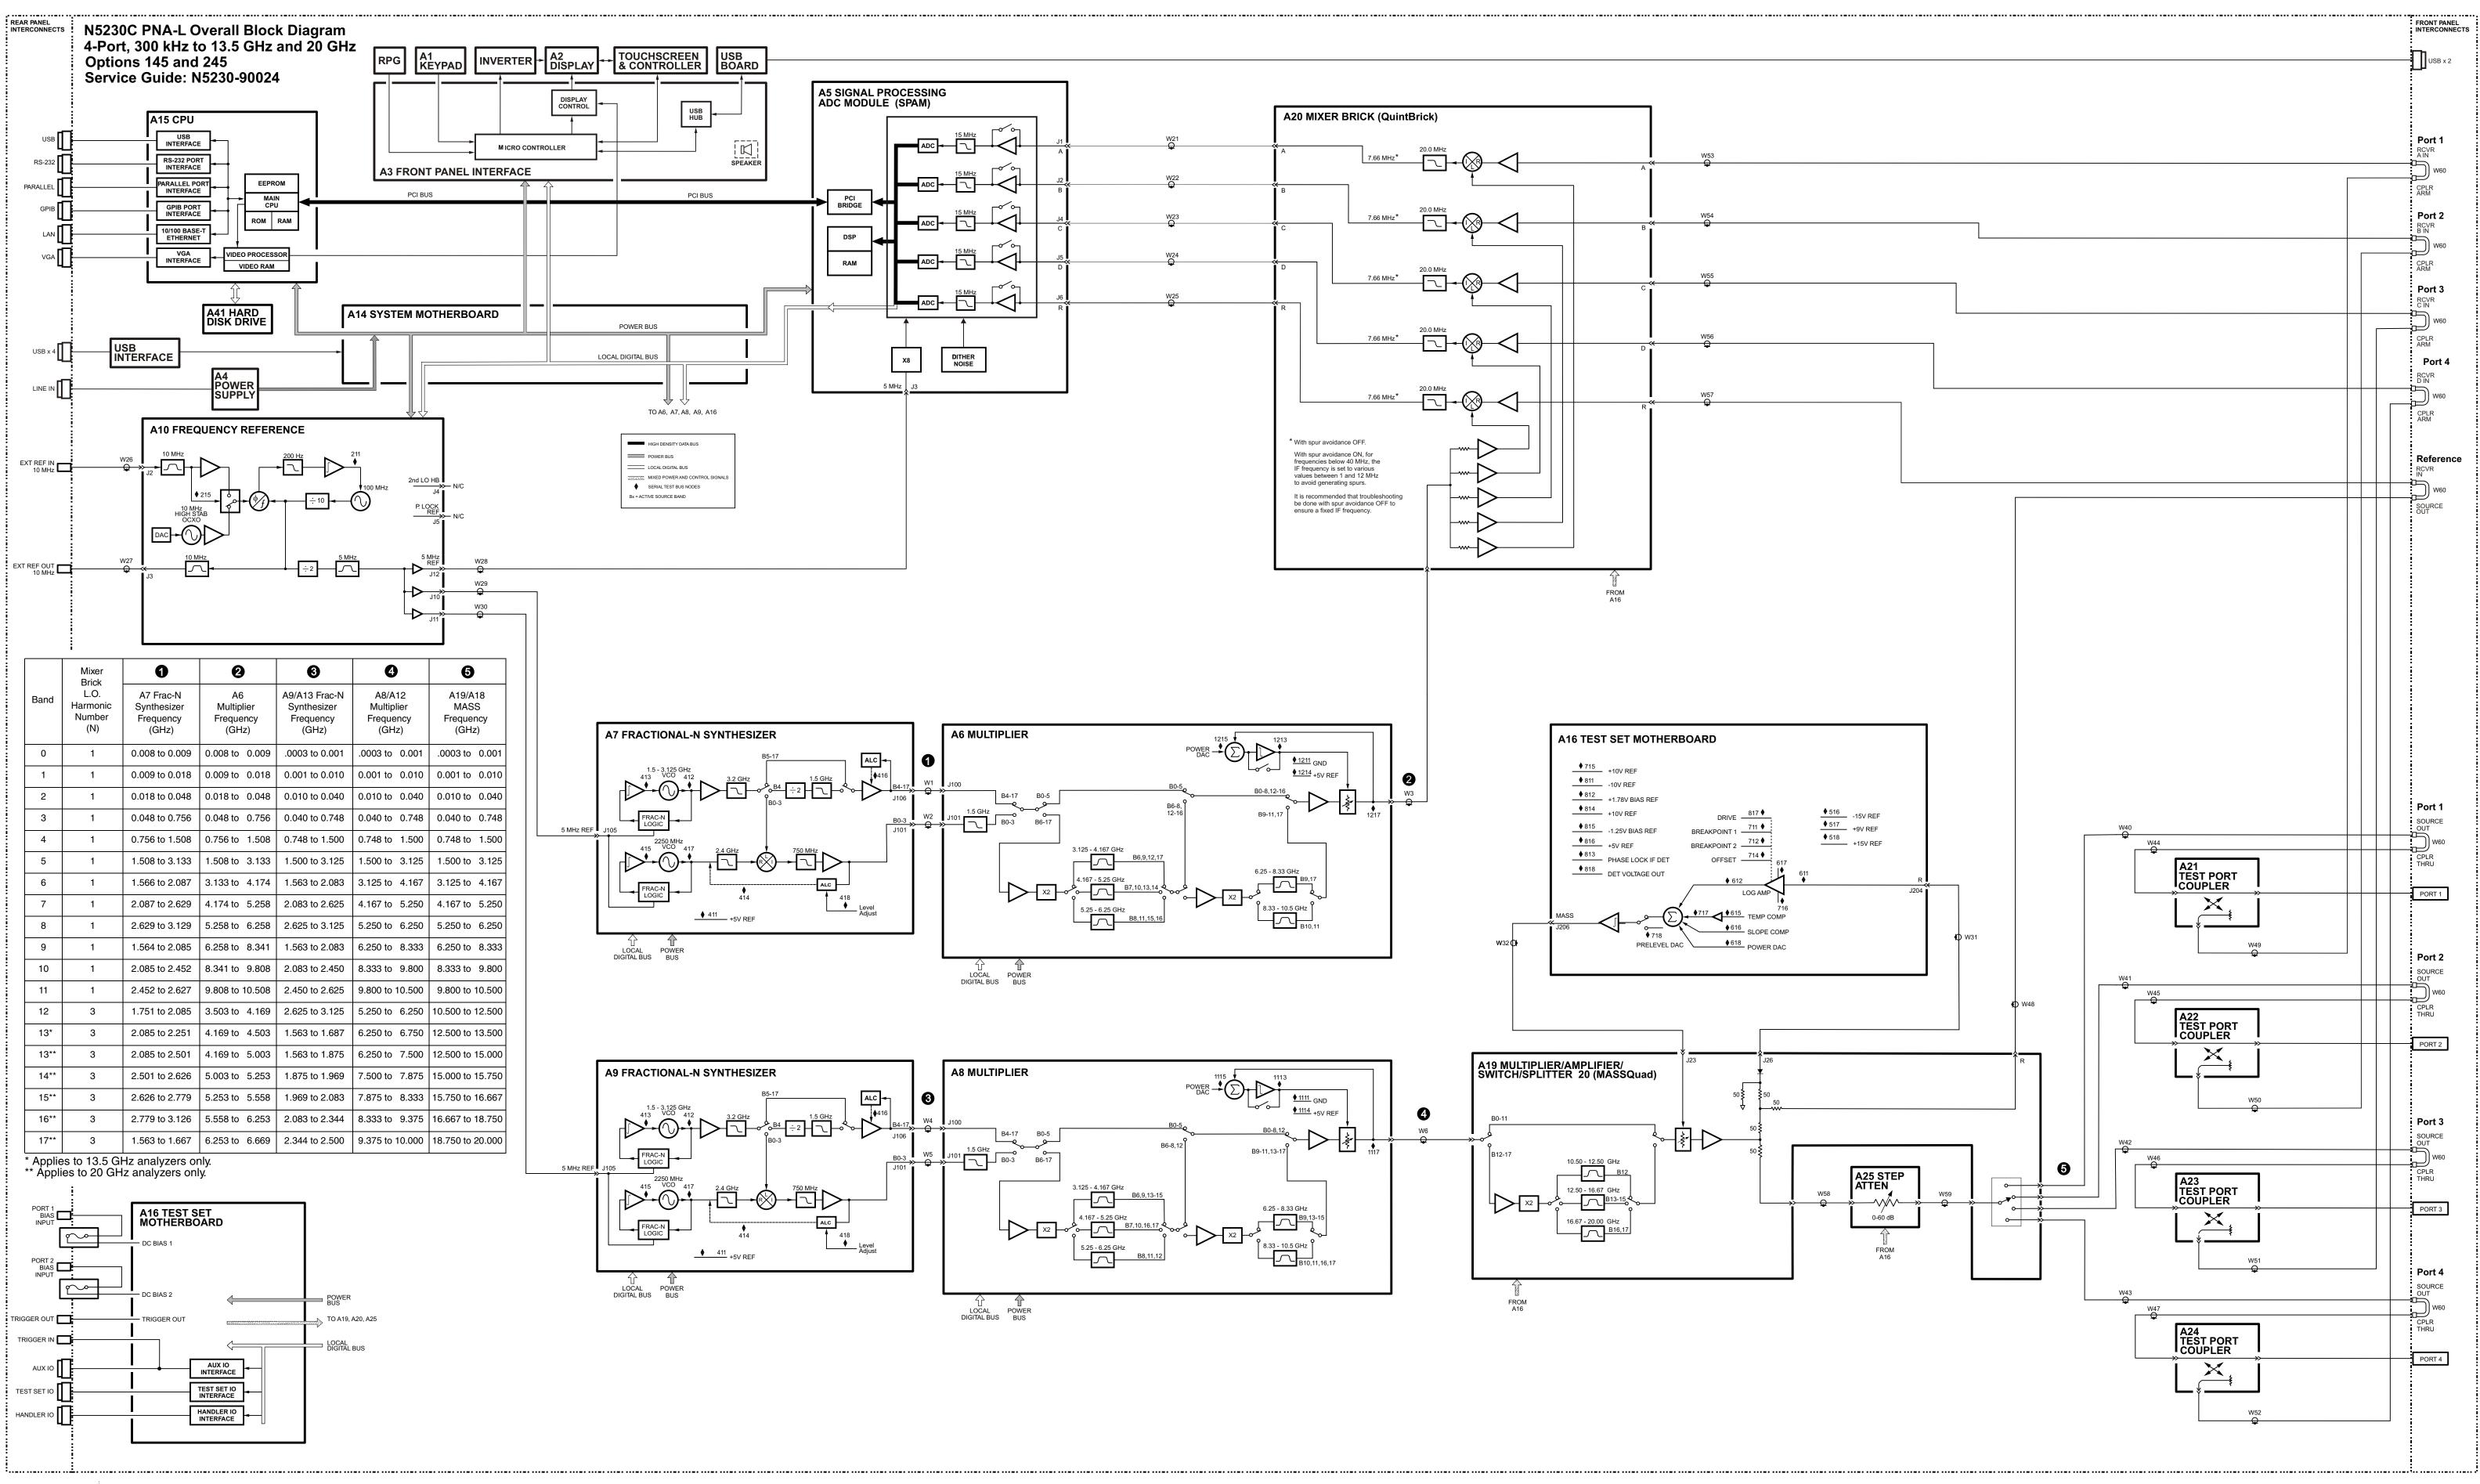

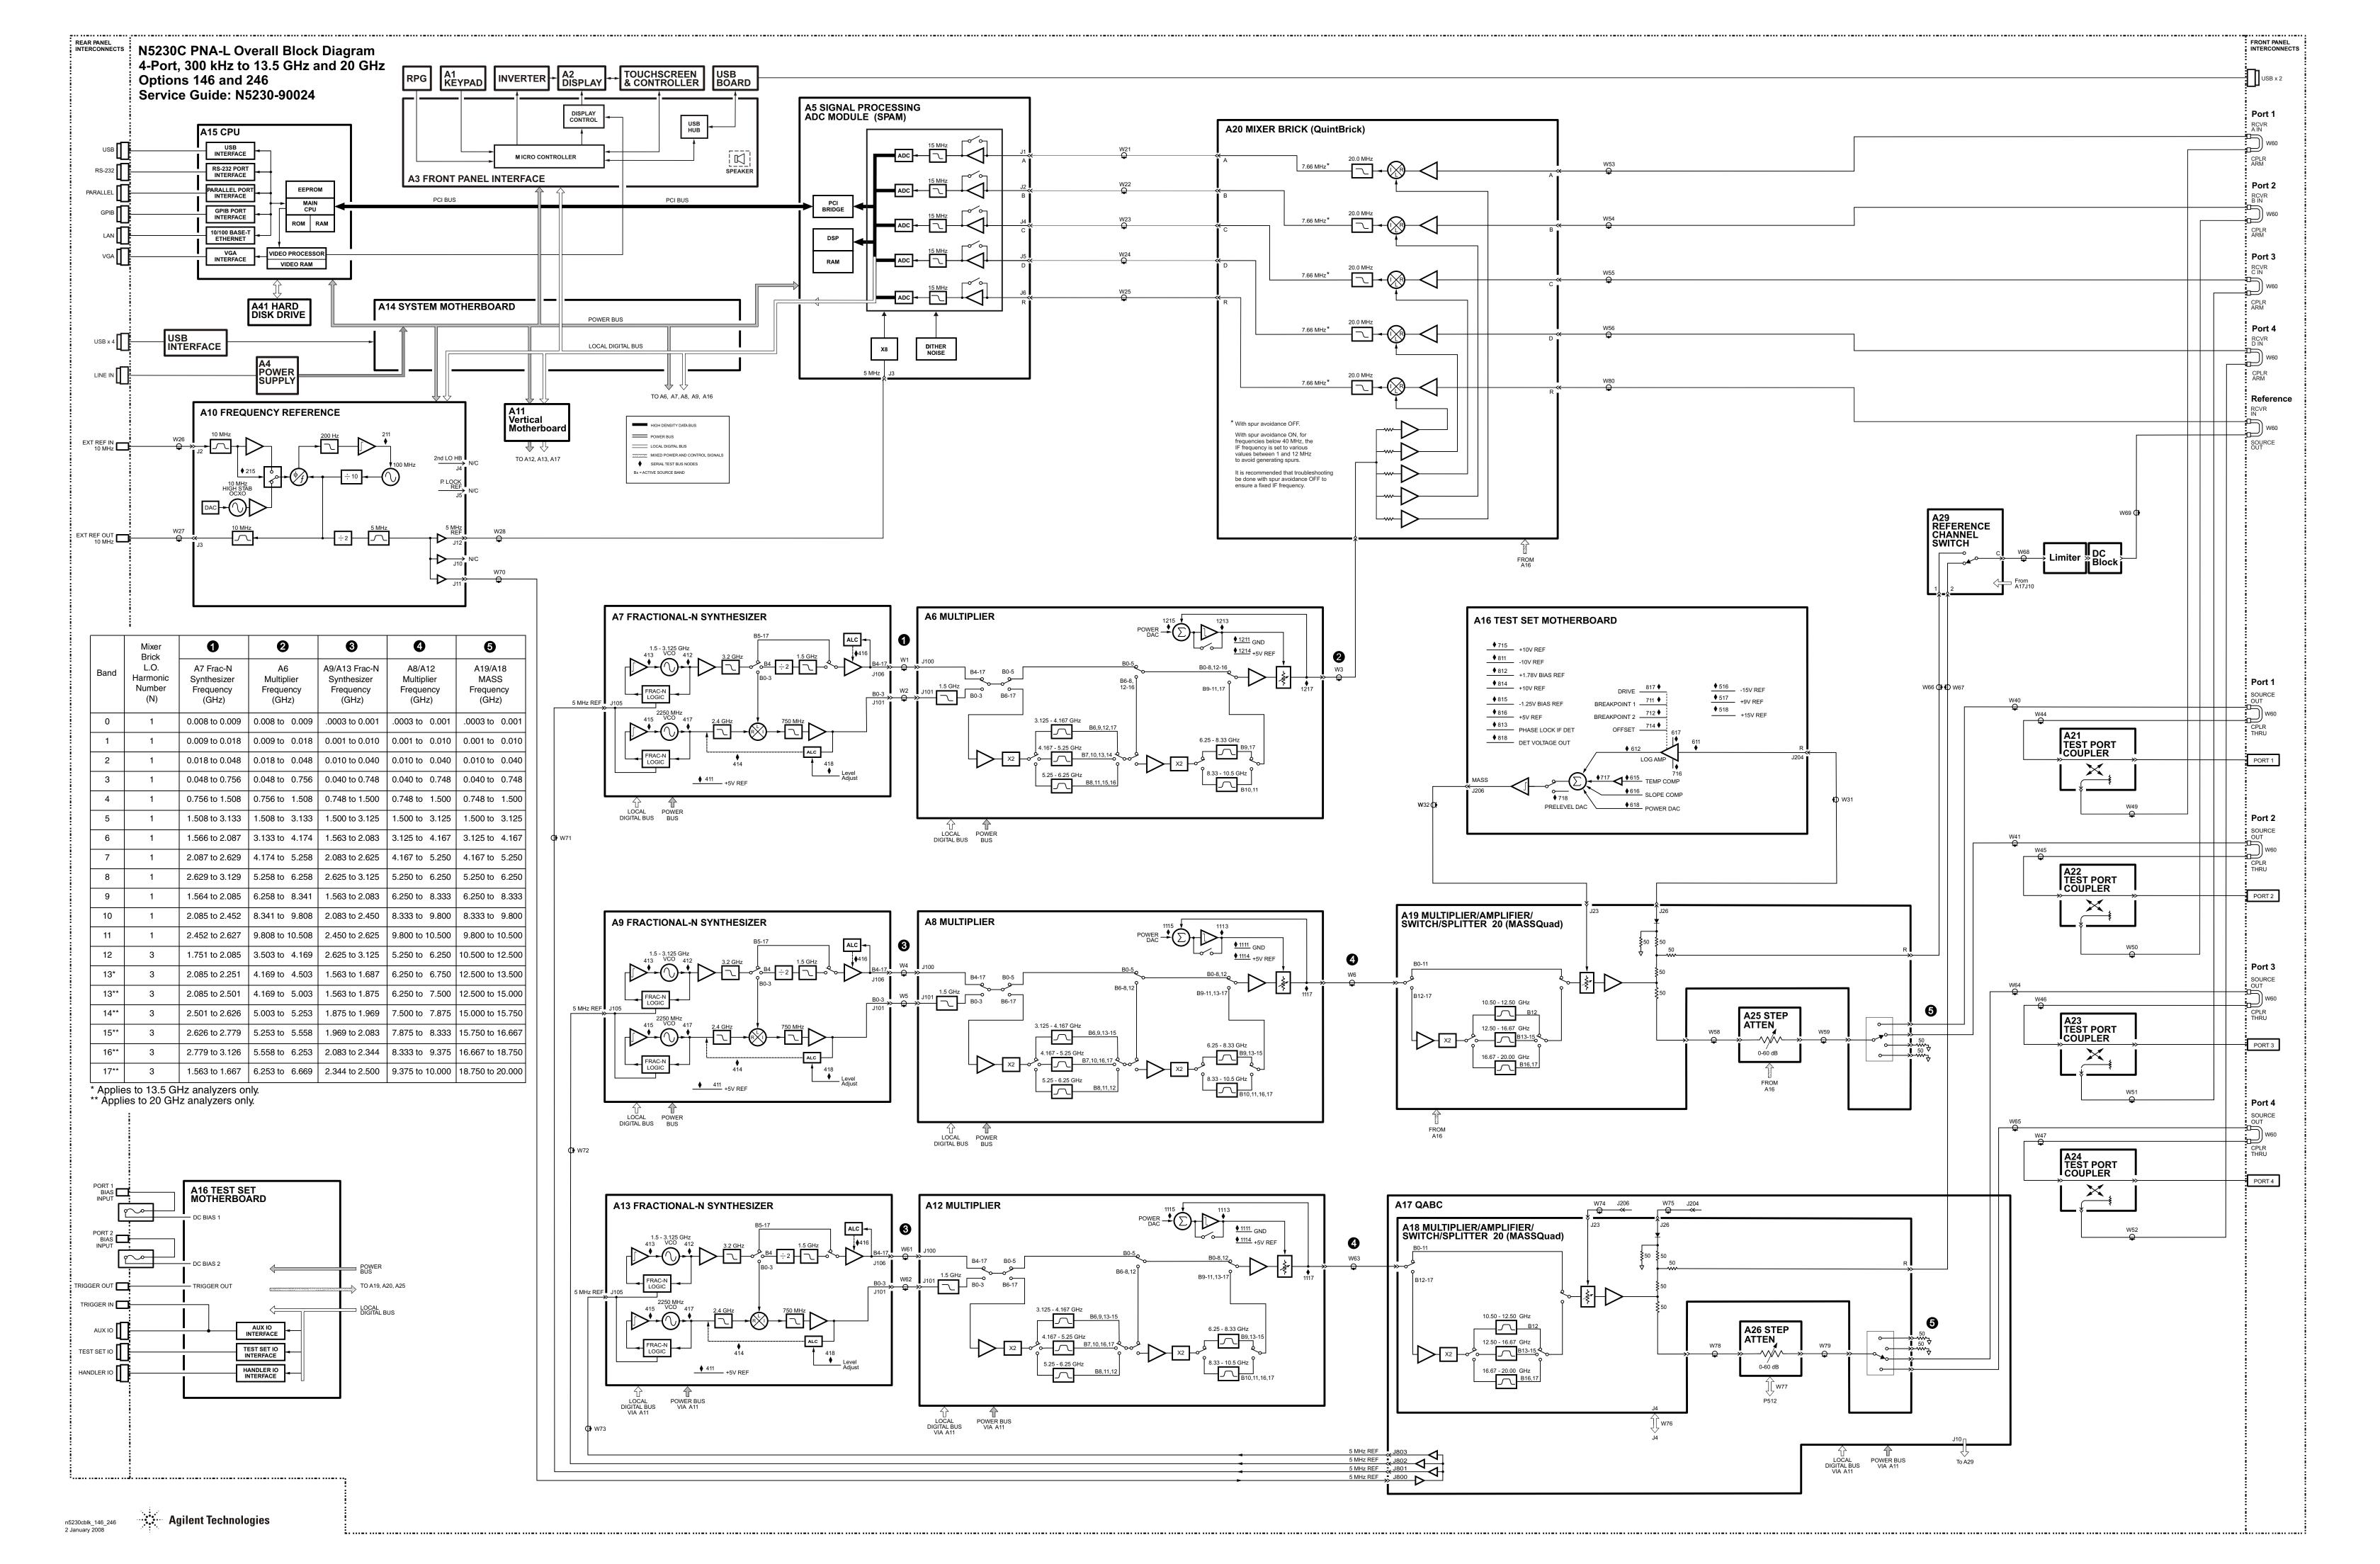

5 Theory of Operation

Information in This Chapter

This chapter provides a general description of the operating theory of the N5230C 4-port PNA-L microwave network analyzer.

- Theory of operation is explained to the assembly level only.
- Component-level circuit theory is not provided.
- Simplified block diagrams are included for each functional group.
- More detailed block diagrams are located at the end of Chapter 4, "Troubleshooting."

Section Title	Summary of Content	Start Page
Network Analyzer System Operation	A summary of the theory of operation for the analyzer.	Page 5-3
	A summary of the operation of the major functional groups of the analyzer.	
Synthesized Source Group Operation	Operation of the assemblies associated with the source group, including Option 080, frequency offset mode.	Page 5-6
Signal Separation Group Operation	Operation of the assemblies associated with signal separation, including the operation of Option 014, configurable test set, and Option 1E1, source step attenuators.	Page 5-16
Receiver Group Operation	Operation of the assemblies associated with the receiver group.	Page 5-22
Digital Processing and Digital Control Group Operation	Operation of the assemblies associated with digital processing and control.	Page 5-25
Power Supply Group Operation	Operation of the power supply assembly group.	Page 5-30

Chapter Five at-a-Glance

IMPORTANT Although simplified block diagrams are included within the description of each functional group, it is recommended that the more detailed block diagrams, located at the end of Chapter 4, be unfolded and available for reference, as you read the information in this chapter.

Network Analyzer System Operation

The PNA-L network analyzer generates a phase-locked incident signal and an LO signal from the internal synthesized source. By means of signal separation, the incident signal is divided into a reference signal and a test signal.

The reference signal is applied to the receiver group, while the test signal is applied to the device under test (DUT) and then to the receiver group. The LO signal is applied directly to the receiver group where it is mixed with the test and reference signals to produce IF signals for each of the four channels. These IF signals are downconverted and then sampled and digitally processed. Figure 5-1 is a simplified block diagram of the network analyzer system.

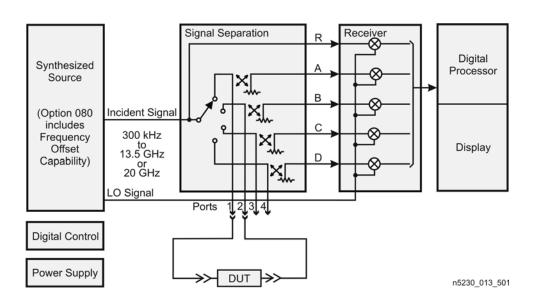


Figure 5-1 System Simplified Block Diagram (One Source)

Functional Groups of the Network Analyzer

The operation of the network analyzer can be separated into major functional groups. Each group consists of assemblies that perform a distinct function in the instrument. Some of the assemblies are related to more than one group, and all of the groups, to some extent, are interrelated and affect each other's performance. The major functional groups are:

- Synthesized Source Group
- Signal Separation Group
- Receiver Group
- Digital Processor and Digital Control Group
- Power Supply Group

Synthesized Source Group

The built-in synthesized source generates a swept, stepped, or continuous wave (CW) signal in the frequency ranges as listed in Table 5-1. The source group provides two signals: an LO signal and an incident signal. These two signals are normally at the same frequency (except for a 7.66 MHz offset) except for Option 080, frequency offset mode, where they can be set to different frequencies.

The LO signal is sent directly to the mixers in the receiver group. The incident signal is routed to the front panel test ports and then to the device under test (DUT) as the test signal. A portion of the incident signal is either split or coupled off (in the signal separation group) and sent to the mixers in the receiver group as reference signals. These reference signals are compared (mixed) with the LO signal in the receiver group.

The incident signal output power is leveled by an internal automatic leveling control (ALC) circuit. The maximum output power level of the network analyzer at the test ports is shown in Table 5-1.

Options 146 and 246 add a second source to the synthesized source group. The primary source (source 1) is routed to ports 1 and 2 while the secondary source (source 2) is routed to ports 3 and 4. The source 2 signal path is either functionally the same as or similar to the source 1 signal path. The maximum output power level for an analyzer with Option 146 or 246 is shown in Table 5-1.

Refer to "Synthesized Source Group Operation" on page 5-6.

	Nominal Output			Maximum	Leveled Ou	tput Power		
Options	Power at Instrument Preset	300 kHz to 10 MHz ^a	10 MHz to 4 GHz	4 GHz to 6 GHz	6 GHz to 10.5 GHz	10.5 GHz to 13.5 GHz	13.5 GHz to 15 GHz	15 GHz to 20 GHz
140, 240 ^b	−5 dBm	+5 dBm	+8 dBm	+6 dBm	+3 dBm	0 dBm	0 dBm	−3 dBm
145, 245 ^b	–8 dBm	+5 dBm	+8 dBm	+6 dBm	+1 dBm	-2 dBm	–2 dBm	–8 dBm
146, 246 ^{c}	–8 dBm	+5 dBm	+8 dBm	+6 dBm	+1 dBm	-2 dBm	–2 dBm	-8 dBm

 Table 5-1
 Frequency Range and Maximum Output Power Level

a. Values for 300 kHz to 10 MHz are typical.

b. Specifications are for Port 1 only; the values shown are typical characteristics for Ports 2, 3, and 4.

c. Specifications are for Ports 1 and 3 only; the values shown are typical characteristics for Ports 2 and 4.

Signal Separation Group

The incident signal from the source group is separated into a reference path and a test path. The reference signal is transmitted to the receiver group. The test signal is transmitted through—and reflected from—the DUT and is then transmitted to the receiver group.

The signal separation group also provides:

- RF path switching to allow forward and reverse measurements
- external connections for the DUT (Option 014)
- a step attenuator in the source path to reduce power to the DUT (Option 1E1)

Refer to "Signal Separation Group Operation" on page 5-16.

Receiver Group

The receiver converts the test and reference signals to 7.66 MHz intermediate frequency (IF) signals for signal processing, retaining both magnitude and phase characteristics. The IF signals are converted to digital information by the digital processing group.

Options 146 and 246 add a reference channel switch to the output of source 1 and source 2, to switch the reference signal to the reference receiver between the two sources as required for measurements.

Refer to "Receiver Group Operation" on page 5-22.

Digital Processor and Digital Control Group

The digital processor and digital control group are divided into a front panel group and a data acquisition and processing group. The front panel group provides communication to the network analyzer. The data acquisition and processing group provides the output to the display, in addition to signal processing and analyzer control.

Refer to "Digital Processing and Digital Control Group Operation" on page 5-25.

Power Supply Group

The power supply functional group provides power for the other assemblies in the instrument.

Refer to "Power Supply Group Operation" on page 5-30.

Synthesized Source Group Operation

The source group produces a stable output signal by phase locking a synthesized voltage-controlled oscillator (VCO). Refer to Table 5-2 on page 5-8 for the full frequency range of the source. The outputs at the front panel test ports are swept, stepped or CW signals. Maximum leveled output powers are listed in Table 5-1 on page 5-4. For a simple block diagram of the source group, refer to Figure 5-2.

In this section the following are described:

- Basic Operation
- Frequency Offset Operation (Option 080)
- A7, A9, and A13 (Options 146 and 246) Fractional-N Synthesizer Boards
- A6, A8, and A12 (Options 146 and 246) Multiplier Boards
- A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5) (MASSQuad)
- A10 Frequency Reference Board (including rear-panel interconnects)
- A16 Test Set Motherboard (including rear-panel interconnects)
- A17 Source 2 ALC and Bias Control (QABC) Board (Options 146 and 246)

Basic Operation

Table 5-2 on page 5-8 lists the L.O. harmonic number, the synthesizer frequencies (A7, A9, and A13), and the main source frequency (A19 and A18) within the analyzer for each band. This table is referred to throughout this chapter and also appears on the overall block diagram at the end of Chapter 4, "Troubleshooting."


The A10 frequency reference board produces a constant phase locked reference signal of 5 MHz that is sent to the A7, A9, and A13 fractional-N synthesizer boards.

The A7 fractional-N synthesizer board produces an LO signal that is sent through the A6 multiplier to the A20 mixer brick. The frequency is synthesized such that the mixing product of this LO signal with the test signal output is a constant 7.66 MHz when the spur avoidance function is OFF. With the spur avoidance function ON, this IF signal is set to various values between 1 and 12 MHz, at source frequencies below 40 MHz, to avoid generating spurious responses. This IF signal is sent to the A5 SPAM board for digital processing.

The A9 and A13 fractional-N synthesizer boards produce an incident signal that is sent through the A8 or A12 multiplier board and then the A19 or A18 MASSQuad to the front panel outputs. A portion of this signal is either split (R channel) or coupled (A, B, C, D channels) off and sent to the A20 mixer brick where it is mixed with the LO signal from the A6 multiplier board to produce the 7.66 MHz IF signal.

The A7, A9, and A13 fractional-N synthesizer boards each contain their own phase lock circuitry. The A7 board is used to phase lock the LO signal while the A9 and A13 boards are used to phase lock the test signals (the A9 for source 1 and the A13 for source 2). This makes it possible for the LO signal to be tuned to a different frequency than the test signal, which is necessary since the LO signal is normally 7.66 MHz higher than the test signal.

Since the A7, A9, and A13 fractional-N synthesizer boards each receive their 5 MHz input reference signal from the exact same source, their outputs remain in-phase even though they are at different frequencies.

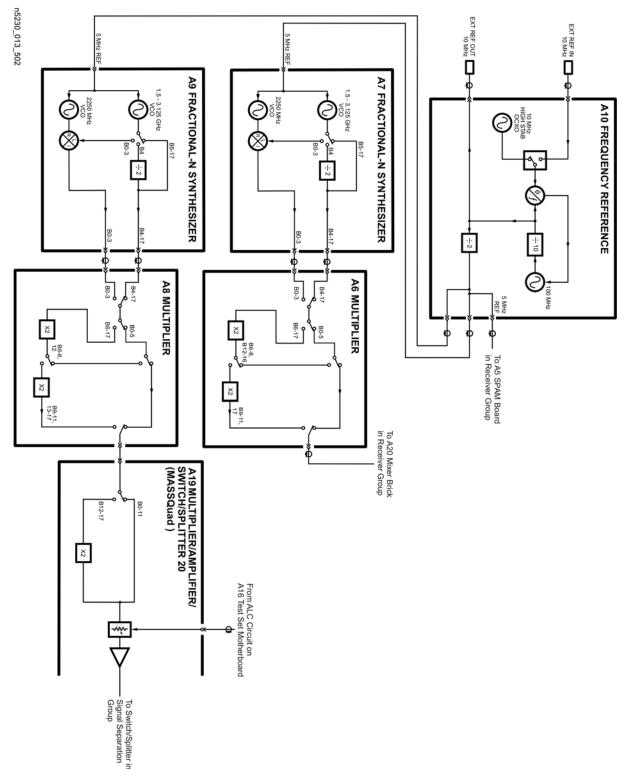



Options	Band	A20 Mixer Brick L.O. Harmonic	A7 Frac-N Synthesizer Frequency (GHz)	A6 Multiplier Frequency (GHz)	A9/A13 Frac-N Synthesizer Frequency (GHz)	A8 Multiplier Frequency (GHz)	A19/A18 MASSQuad Frequency (GHz)
	0	1	0.008 to 0.009	0.008 to 0.009	.0003 to 0.001	.0003 to 0.001	.0003 to 0.001
	1	1	0.009 to 0.018	0.009 to 0.018	0.001 to 0.010	0.001 to 0.010	0.001 to 0.010
	2	1	0.018 to 0.048	0.018 to 0.048	0.010 to 0.040	0.010 to 0.040	0.010 to 0.040
246	3	1	0.048 to 0.756	0.048 to 0.756	0.040 to 0.748	0.040 to 0.748	0.040 to 0.748
	4	1	0.756 to 1.508	0.756 to 1.508	0.748 to 1.500	0.748 to 1.500	0.748 to 1.500
245,	5	1	1.508 to 3.133	1.508 to 3.133	1.500 to 3.125	1.500 to 3.125	1.500 to 3.125
240, 245, or	6	1	1.566 to 2.087	3.133 to 4.174	1.563 to 2.083	3.125 to 4.167	3.125 to 4.167
	7	1	2.087 to 2.629	4.174 to 5.258	2.083 to 2.625	4.167 to 5.250	4.167 to 5.250
$5, 1_{2}$	8	1	2.629 to 3.129	5.258 to 6.258	2.625 to 3.125	5.250 to 6.250	5.250 to 6.250
140, 145, 146,	9	1	1.564 to 2.085	6.258 to 8.341	1.563 to 2.083	6.250 to 8.333	6.250 to 8.333
14	10	1	2.085 to 2.452	8.341 to 9.808	2.083 to 2.450	8.333 to 9.800	8.333 to 9.800
	11	1	2.452 to 2.627	9.808 to 10.508	2.450 to 2.625	9.800 to 10.500	9.800 to 10.500
	12	3	1.751 to 2.085	3.503 to 4.169	2.625 to 3.125	5.250 to 6.250	10.500 to 12.500
	13*	3	2.085 to 2.251	4.169 to 4.503	1.563 to 1.687	6.250 to 6.750	12.500 to 13.500
.0	13**	3	2.085 to 2.501	4.169 to 5.003	1.563 to 1.875	6.250 to 7.500	12.500 to 15.000
r 246	14	3	2.501 to 2.626	5.003 to 5.253	1.875 to 1.969	7.500 to 7.875	15.000 to 15.750
245, or	15	3	2.626 to 2.779	5.253 to 5.558	1.969 to 2.083	7.875 to 8.333	15.750 to 16.667
$240, 2^{-1}$	16	3	2.779 to 3.126	5.558 to 6.253	2.083 to 2.344	8.333 to 9.375	16.667 to 18.750
24	17	3	1.563 to 1.667	6.253 to 6.669	2.344 to 2.500	9.375 to 10.000	18.750 to 20.000

Table 3-2 Subsweep Frequencies	Table 5-2	Subsweep	o Freq	uencies
--------------------------------	-----------	----------	--------	---------

* Applies to 13.5 GHz analyzers only. ** Applies to 20 GHz analyzers only.

Frequency Offset Operation (Option 080)

Since the A7, A9 and A13 fractional-N synthesizer boards each contain their own phase lock circuitry, they can be phase locked independently to different output frequencies. Normally the LO signal is automatically tuned to a frequency 7.66 MHz higher than that of the test signal to create the 7.66 MHz difference frequency (IF) in the A20 mixer brick.

In frequency offset mode (Option 080), the LO signal can be independently tuned to any frequency (within its tuning range) to allow for frequency offset measurements needed when testing devices such as mixers and converters.

A7, A9, and A13 (Options 146 and 246) Fractional-N Synthesizer Boards

The A7, A9, and A13 fractional-N synthesizer boards use the 5 MHz reference signal from the A10 frequency reference board to tune two VCO circuits: one that sweeps from 1500 to 3125 MHz and one that is set to a CW frequency of 2250 MHz.

In bands 0–3, these signals are mixed to produce the output frequencies listed in Table 5-2. In band 4, the output of the swept VCO is passed through a divide-by-2 circuit to produce the output frequencies listed in Table 5-2. In all other bands, the swept VCO signal is sent directly to the synthesizer output.

At the output, an ALC circuit maintains the power level at -5 dBm for bands 0-3 or 0 dBm for bands 4-17. In all bands, the output is sent to either the A6, A8, or A12 multiplier board.

The output of the A7 fractional-N synthesizer board is 7.66 MHz higher than the output of the A9 and A13 fractional-N synthesizer boards. This is because the output of the A7 fractional-N synthesizer board is routed through the A6 multiplier board to the A20 mixer brick where it is mixed with the test signal to produce a 7.66 MHz IF signal for each of five channels. Refer to "A20 Mixer Brick" on page 5-22 for a more complete description.

A6, A8, and A12 (Options 146 and 246) Multiplier Boards

In bands 0–5, the input signal from the A7 A9, or A13 fractional-N synthesizer board is passed through the multiplier board unchanged. For all other bands, the signals are doubled, filtered, and amplified. In the A6 board, in bands 9–11 and 17, the signals are again doubled, filtered, and amplified. In the A8 and A12 boards, in bands 9– 11 and 13–17, the signals are again doubled, filtered, and amplified, and amplified. Together these signals create the full output frequency range of 300 kHz to 10.508 GHz for the A6 board or 300 kHz to 10.5 GHz for the A8 and A12 boards.

A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5) (MASSQuad)

In bands 0–11, the 300 kHz to 10.5 GHz inputs are filtered, amplified, and passed through the MASSQuad. In bands 12–17, they are doubled, filtered, and amplified.

Together, these signal paths create the full output frequency range of 300 kHz to 20 GHz that is sent to the splitter where a portion of the signal is used for the R channel reference signal and another portion for the ALC circuit on either the A16 test set motherboard (for the A19) or the A17 QABC board (for the A18).

A10 Frequency Reference Board

This assembly provides stable reference frequencies to the rest of the instrument. A high stability 10 MHz oven-controlled crystal oscillator (OCXO) normally provides the frequency standard. However, if a 10 MHz external reference signal is detected at the 10 MHz EXT REF IN port on the rear panel, it is used as the frequency reference instead.

The 10 MHz reference signal is used to phase lock a 100 MHz VCO. The output of this VCO is then divided by ten to produce the 10 MHz EXT REF OUT rear panel signal. This 10 MHz signal is divided by two to produce 5 MHz reference signals for the A5 signal processing ADC module (SPAM) board, the A7 fractional-N synthesizer board, and the A9 fractional-N synthesizer board.

Rear-Panel Interconnects

10 MHz REF. INPUT	A BNC connector that allows an external frequency reference signal to be used to phase lock the analyzer for increased frequency accuracy. The analyzer automatically enables the external frequency reference feature when a signal is connected to this input. When the signal is removed, the analyzer automatically switches back to its internal frequency reference.
10 MHz REF. OUTPUT	A BNC connector that allows a 10 MHz reference signal, produced by the A10 frequency reference board, to be output for use in phase locking external test equipment.

A16 Test Set Motherboard

The A16 test set motherboard serves these functions:

- to act as an interface between the A15 CPU board and the auxiliary rear panel interconnects.
- to provide ALC signals to the A19 MASSQuad.
- to route control signals to the signal separation group. Refer to "Signal Separation Group Operation" on page 5-16 for more information.

Rear Panel Interconnects

The A16 test set motherboard includes the following rear panel interconnects.

A DB-25 female connector that is used to control external test sets. The external test set bus consists of 13 multiplexed address and data lines, three control lines, and an open-collector interrupt line. Pin assignments are listed in Table 5-3 on page 5-12.
Up to 16 test sets may be "daisy-chained" on the bus at one time.
The Test Set I/O is not compatible with 8753 network analyzer test sets.
A rectangular 36-pin, female connector providing four independent parallel input/output ports, nine control signal lines, one ground, and a power supply line. This connector has Type 2 output pin assignments as listed in Table 5-4 on page 5-13.
All signals are TTL-compatible. Data input/output ports consist of two 8-bit output ports (Port A and Port B) and two 4-bit bidirectional ports (Port C and Port D).
Connector settings can be changed using SCPI and COM commands. The settings are not accessible from the front panel.
A DB-25 male connector that provides a variety of both analog and digital input and output signals as described in Table 5-5 on page 5-14.
A BNC connector for input of an external trigger. The analyzer can be triggered by an external device using this input. This is the same signal that appears on AUX I/O pin 19 as described in Table 5-5 on page 5-14.
A BNC connector for output of a trigger signal. This trigger signal can be used to trigger external devices used in the measurement setup, such as signal generators.

Image: Connector Image: Connector Image: Connector Image: Connector				
Pin Numbers	Name	Function		
1	SEL0	TTL out, test set select bit 0, tied to 0 V		
2	Sweep Holdoff In	TTL in, low level holds off sweep		
3-6	AD12–AD8	TTL I/O, address and latched data		
7	GND	0 V, ground reference		
8	LAS	TTL out, active low address strobe (1 μs min)		
9–11	AD4–AD2	TTL I/O, address and latched data		
12	GND	0 V, ground reference		
13	Interrupt In	TTL in, low level (10 μ s min) aborts sweep		
14	+22 V	+22 Vdc, 100 mA max.		
15–16	SEL1-2	TTL out, test set select bits 1-2, tied to 0 V		
17	AD11	TTL I/O, address and latched data		
18	SEL3	TTL out, test set select bit 3, tied to 0 V		
19–21	AD7–5	TTL I/O, address and latched data		
22–23	AD0-1	TTL I/O, address and latched data		
24	LDS	TTL out, active low data strobe $(1 \ \mu s \ min)$		
25	RLW	TTL out, high = read, low = write		

Table 5-3 TEST SET I/O Connector Pin Assignments

O 192021222324252627282930313233343536 123456789101112131415161718 sz346a Rectangular 36-Pin Female Connector			
Pin Numbers	Name	Function	
1	GND	0 V, ground reference	
2	INPUT1	TTL in, negative pulse (1 μs min) latches OUTPUT1-2	
3-4	OUTPUT1–2	TTL out, latched	
5-12	Port A0–7 Out	TTL out, latched	
13–20	Port B0–7 Out	TTL out, latched	
21–24	Port C I/O	TTL I/O, latched	
25–28	Port D I/O	TTL I/O, latched	
29	Port C Status	TTL out, low = input mode, high = output mode	
30	Port D Status	TTL out, low = input mode, high = output mode	
31	Output Strobe Write Strobe	TTL out, active low data write strobe (1 μs min)	
32	No connect	Not used	
33	Pass Fail	TTL out, latched, indicates pass fail (programmable polarity)	
34	+5 V	+5 Vdc, 100 mA max.	
35	Sweep End	TTL out, active low (10 μs min) indicates sweep done	
36	Pass/Fail Write Strobe	TTL out, active low pass/fail write strobe (1 μs min)	

Table 5-4 HANDLER I/O Connector Key Pin Assignments

٦

Image: Constraint of the state of the s		
Pin Numbers	Name	Function
1	ACOM	0 V, ground reference for analog signals
2–3	Analog Out 2–1	-10 to $+10$ Vdc output, 10 mA max, Ro = 100 Ω
4	No connect	For future enhancements
5	DCOM	0 V, ground reference for digital signals
6-8	Pulse Out 3–1	TTL out, programmable pulse (for future use)
9	+5 V	+5 Vdc output, 100 mA max.
10	Pass/Fail Write Strobe	TTL out, active low (1 μs min) indicates pass/fail line is valid
11	Sweep End	TTL out, active low (10 μs min) indicates sweep is done
12	Pass/Fail	TTL out, latched, indicates pass or fail (programmable polarity)
13	Output Port Write Strobe	TTL out, active low (10 μs min) writes I/O port data
14	Analog In	-10 to $+10$ Vdc input, Ri = 100 k Ω
15	ACOM	0 V, ground reference for analog signals
16	Power Button In	Open-collector input, active low replicates a power button press
17	DCOM	0 V, ground reference for digital signals
18	Ready for Trigger	TTL out, low indicates ready for external trigger
19	External Trigger In	TTL in, level trigger (width >1 μs), programmable polarity
20	Footswitch In	TTL in, active low (width >1 µs), triggers a programmable event
21	+22 V	+22 Vdc output, 100 mA max.
22–25	In/Out Port C0–3	TTL I/O, general purpose

Table 5-5 AUX I/O Connector Pin Assignments

A17 Source 2 ALC and Bias Control (QABC) Board (Options 146 and 246)

The A17 QABC board serves the following functions:

- Provides ALC and control signals to the A18 source 2 MASSQuad.
- Routes control signals to the A26 source 2 step attenuator.
- Routes control signals to the A29 reference channel switch.
- Provides distribution for the 5 MHz reference signal from the A10 frequency reference board to the A7, A9, and A13 fractional-N synthesizer boards.

Signal Separation Group Operation


The signal separation group divides the source incident signal into a reference path and a test path. Refer to Figure 5-3 on page 5-16.

- The reference signal is transmitted to the receiver group as the R input.
- The test signal is transmitted through—and reflected from—the device under test (DUT) and then is transmitted to the receiver group as the A, B, C, and D inputs.
- Control lines to this group are routed from the A16 test set motherboard.

In this section, the following assemblies are described:

- A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5) (MASSQuad)
- A21, A22, A23, and A24 Test Port Couplers
- A25 (Options 145, 245, 146, and 246) and A26 (Options 146 and 246) 60-dB Source Step Attenuator
- Front Panel Jumpers—Configurable Test Set (Options 145, 146, 245, and 246)

Figure 5-3 Standard Test Set Configuration (One Source)

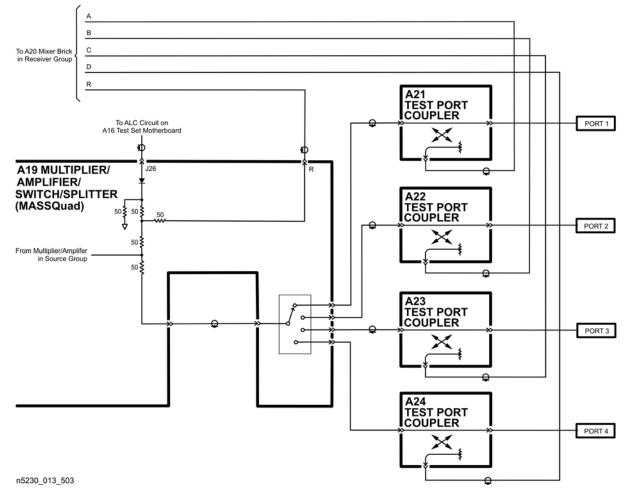

A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5) (MASSQuad)

After the source signal has been amplified, filtered, and multiplied, it is sent to the splitter where a portion of the signal is split off to provide the R channel reference signal.

Options 146 and 246 include a reference channel switch (A29), a limiter, and a DC block in the reference channel path to provide the capability to select either source 1 or source 2 as the reference signal. See "A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246)" on page 5-22 for additional information.

Another portion of the source signal is split off and sent to the ALC circuitry, (located on the A16 test set motherboard for the A19 and on the A17 QABC board for the A18), to provide leveling control.

The remaining signal is sent to a switch (through a step attenuator for Options 145, 146, 245, and 246) where it is switched to the test port couplers.

- For Options 145 and 245, the signal from the A19 MASSQuad is sent through the A25 source step attenuator back to a switch on the A19 MASSQuad where it is switched to one of the four test port couplers, A21–A24.
- For Options 146 and 246, the signal from the A19 source 1 MASSQuad is sent through the A25 source step attenuator back to a switch on the A19 MASSQuad where it is switched to either the A21 or A22 test port coupler.

The signal from the A18 source 2 MASSQuad is sent through the A26 source step attenuator back to a switch on the A18 MASSQuad where it switched to either the A23 or A24 test port coupler.

Refer also to "A19 and A18 (Options 146 and 246) Multiplier/Amplifier/Switch/Splitter 26.5 (MASS 26.5) (MASSQuad)" on page 5-9.

A21, A22, A23, and A24 Test Port Couplers

The test port signal goes into the through-line arm of the couplers, and from there to the test ports and the DUT. The coupled arm of the couplers carries the signal reflected from or transmitted through the DUT, to the receiver (through a front panel jumper for Options 146, 146, 245 and 246) for measurement. The coupling coefficient of the directional couplers is nominally 15 dB over the full frequency range.

A25 (Options 145, 245, 146, and 246) and A26 (Options 146 and 246) 60-dB Source Step Attenuator

The 60-dB step attenuator provides coarse power control for the test port signals. It is an electro-mechanical step attenuator that provides 0 to 60 dB of attenuation in 10-dB steps. It adjusts the power level to the DUT without changing the level of the incident power in the reference path. This attenuator is controlled by the A15 CPU board.

Configurable Test Set (Options 145, 146, 245, and 246)

The Option 145, 146, 245, or 246 analyzer allows you to measure devices with higher power and higher dynamic range limits than the standard analyzer. The theory of operation is the same as for the standard analyzer except that there are nine front panel SMA jumpers.

As shown in Figure 5-4 on page 5-19 and in Figure 5-5 on page 5-20, these nine jumpers are installed between the assemblies listed below.

Four jumpers for all options:

- the A21 test port 1 coupler and the A20 mixer brick channel A
- the A22 test port 2 coupler and the A20 mixer brick channel B
- the A23 test port 3 coupler and the A20 mixer brick channel C
- the A24 test port 4 coupler and the A20 mixer brick channel D

Five additional jumpers for Options 145 and 245:

- the A19 MASSQuad and the A21 test port 1 coupler
- the A19 MASSQuad and the A22 test port 2 coupler
- the A19 MASSQuad and the A23 test port 3 coupler
- the A19 MASSQuad and the A24 test port 4 coupler
- the A19 MASSQuad and the A20 mixer brick channel R

Five additional jumpers for Options 146 and 246:

- the A19 MASSQuad and the A21 test port 1 coupler
- the A19 MASSQuad and the A22 test port 2 coupler
- the A18 MASSQuad and the A23 test port 3 coupler
- the A18 MASSQuad and the A24 test port 4 coupler
- the A29 reference channel switch, limiter, and DC block and the A20 mixer brick channel ${\rm R}$

Normal Configurable Test Set Configuration

The normal configurable test set configuration (configurable test set and source step attenuator) is shown in Figure 5-4 for Options 145 and 245 and in Figure 5-5 for Options 146 and 246.

Options 146 and 246 add a second source, a second attenuator, and a reference channel switch. The A29 reference channel switch provides the capability to select either source 1 or source 2 as the reference signal. See "A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246)" on page 5-22 for additional information.

With this configuration and inclusion of an external amplifier and accessories, you can calibrate the analyzer and test devices at power levels up to +30 dBm. You can make measurements in the forward, reverse or both directions and still achieve these high power levels. For more information on higher power measurements, search for "Option 014" in the embedded help index in the analyzer.

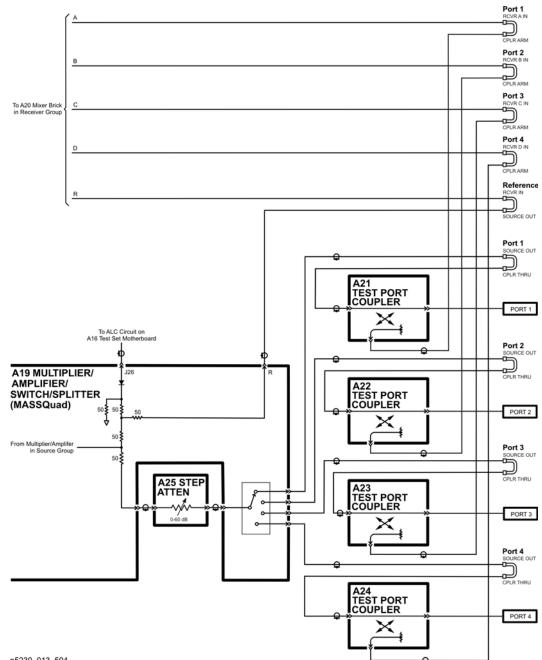


Figure 5-4 Normal Configurable Test Set Configuration (One Source)

n5230 013 504

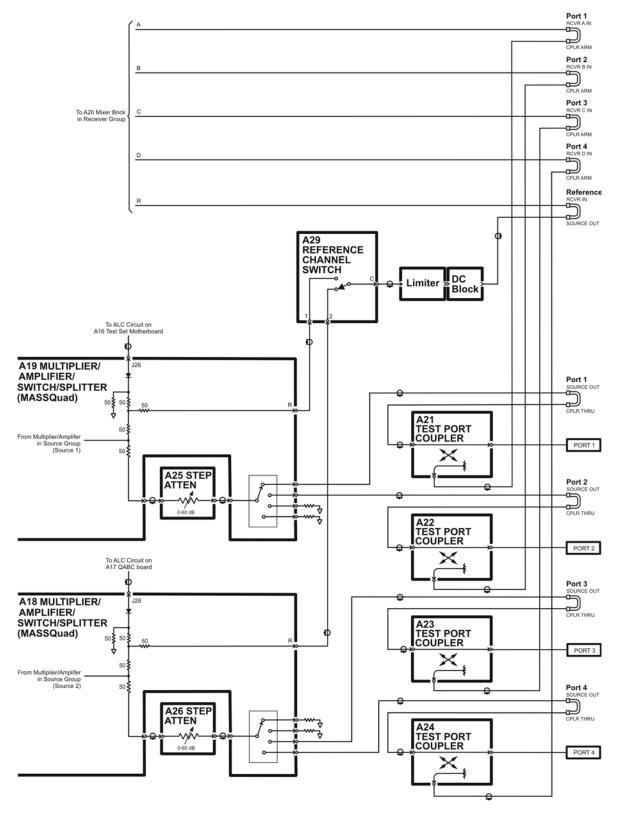


Figure 5-5 Normal Configurable Test Set Configuration (Two Sources)

n5230_013_508


High Dynamic Range Configurable Test Set Configuration

With a few jumper changes, you can configure the configurable test set configuration for higher dynamic range measurements. By swapping the front panel jumpers for one port, signal flow through the corresponding coupler is reversed, increasing the test signal sensitivity by 15 dB.

In the forward direction, as shown in Figure 5-6, the signal flow through the test port 2 coupler (A22) is reversed by arranging the front panel jumpers such that RCVR B IN connects to CPLR THRU and CPLR ARM connects to SOURCE OUT. The configuration of the front panel jumpers is the same for both single source and two source analyzers.

Search for "Option 014" in the embedded help index in the analyzer for more information.

Figure 5-6 High Dynamic Range Configurable Test Set Configuration (One Source)

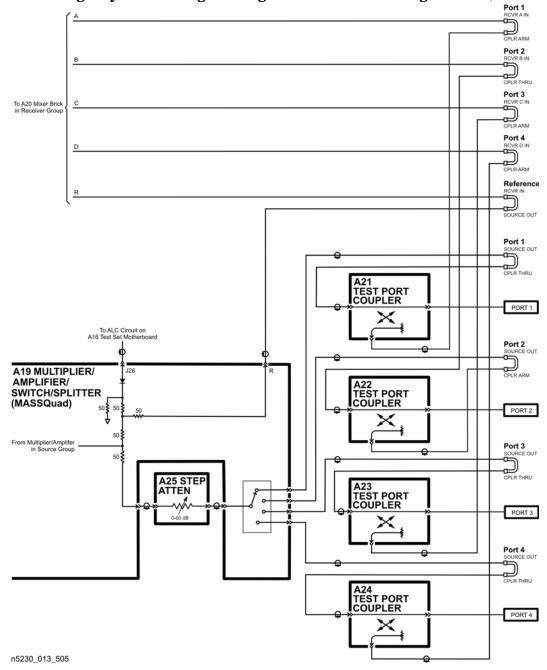

Receiver Group Operation

The receiver group measures and processes the input signals into digital information for processing and eventual display. Figure 5-7 on page 5-23 is a simplified block diagram of the receiver functional group.

In this section the following assemblies are described:

- A20 Mixer Brick
- A5 SPAM Board (Analog Description)
- A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246)

A20 Mixer Brick

This assembly contains five identical amplifiers, mixers, and filters. With the spur avoidance function OFF, the test signals (channels A, B, C, and D) and the reference signal (channel R) are mixed with a synthesized source signal that is 7.66 MHz higher than the source incident signal to produce a 7.66 MHz IF signal.

With the spur avoidance function ON, at frequencies below 40 MHz, the IF is set to various values between 1 and 12 MHz to avoid spurious responses that could interfere with the measurement. Because of this, the spur avoidance function should be OFF when troubleshooting the PNA.

The analog IF signal is sent to the A5 SPAM board where it is converted to digital information.

A5 SPAM Board (Analog Description)

The A5 SPAM board contains digital and analog circuitry. For digital descriptions, refer to "A5 SPAM Board (Digital Description)" on page 5-28.

In this assembly, the IF signals from the A, B, C, D, and R mixers go through a gain stage where small signals are amplified to ensure that they can be detected by the analog-to-digital converter (ADC).

All five signals are sampled simultaneously by the ADCs, where they are converted to digital form. The ADC conversions are triggered by timing signals from the digital signal processor (DSP) in response to commands from the central processing unit (CPU). The digitized data is processed into magnitude and phase data by the DSP and sent to the CPU random access memory (RAM) by way of the peripheral component interconnect (PCI) bus.


The processed and formatted data is finally routed to the display, and to the general-purpose interface bus (GPIB) for remote operation. Refer to "Digital Processing and Digital Control Group Operation" on page 5-25 for more information on signal processing.


A29 Reference Channel Switch, Limiter, and DC Block (Options 146 and 246)


In these assemblies, the reference signals from the A19 source 1 MASSQuad and the A18 source 2 MASSQuad are switched into the reference receiver mixer in the A20 mixer brick. See Figure 5-8 on page 5-24. The reference signal comes from the synthesized source, passes through the A29 reference channel switch, goes through the limiter and DC block, through a front-panel jumper, and then to the receiver reference input of the A20 mixer brick.

The limiter and DC block protect the A29 reference channel switch from possible damage caused by signals that may be input into the front-panel Reference SOURCE OUT connector.

 Figure 5-7 Receiver Group (One Source)

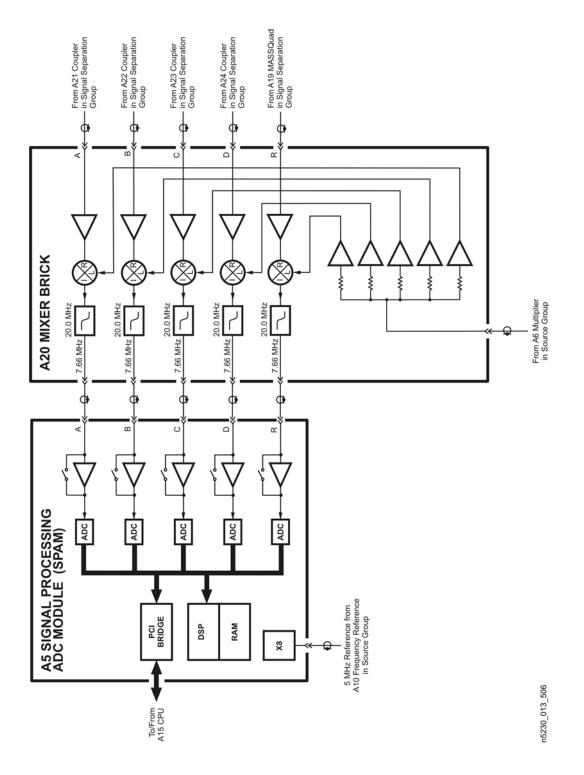



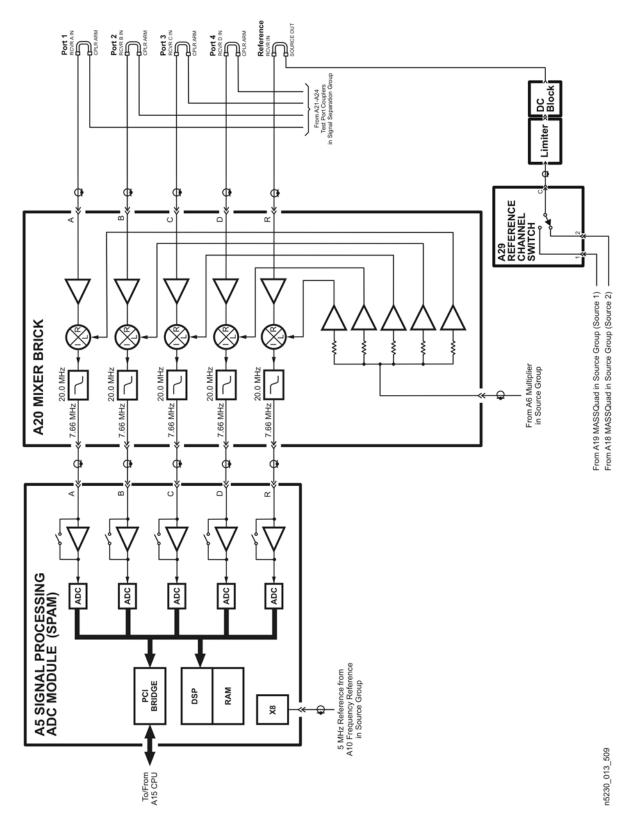

Digital Processing and Digital Control Group Operation


The digital processor and control group provides digital control for the entire analyzer. It provides:


- front panel operation,
- output to the display,
- math processing functions, and
- communications between the analyzer and an external controller or peripherals.

A block diagram of the digital control functional group is shown in Figure 5-9 on page 5-26.

The digital control functional group consists of two subgroups:

 - Front Panel Subgroup
 - A1 Keypad Assembly
 - A2 Display Assembly
 - A3 Front Panel Interface Board
 - A14 system motherboard
 - A11 vertical motherboard (Options 146 and 246)
- Data Acquisition and Processing Subgroup
 - A5 SPAM Board (Digital Description)
 - A15 CPU Board
 - A41 Hard Disk Drive
 - USB Hub

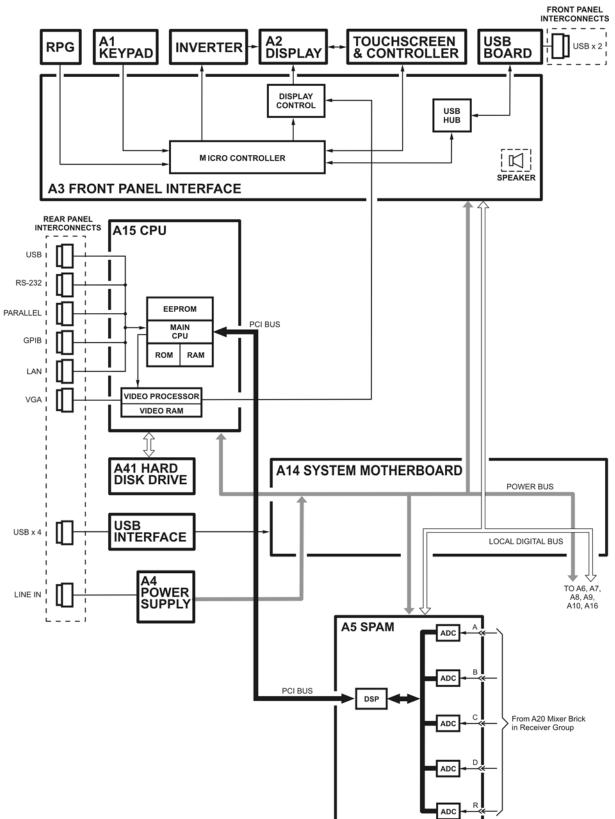



n5230_013_507_new

Front Panel Subgroup

The front panel subgroup contains the following assemblies:

- A1 Keypad Assembly
- A2 Display Assembly
- A3 Front Panel Interface Board

A1 Keypad Assembly

The A1 keypad assembly provides user interface to the analyzer. The front panel rotary pulse generator (RPG) knob is not electrically connected to the keypad, but rather provides user inputs directly to the front panel processor.

A2 Display Assembly

The A2 display assembly contains an 8.4 inch LCD with associated drive circuitry and backlight inverter. Two cables between the A2 display assembly and the A3 front panel interface board provide all necessary power and data for normal operation. The two cables are:

- 1. A cable to the inverter that supplies buffered power.
- 2. A cable to the display circuitry that supplies decoded data from the video processor on the A15 CPU board and the necessary drive circuit power. The video data received from the A15 CPU board includes the following:
 - digital TTL horizontal sync digital TTL blue video
 - digital TTL vertical sync blanking
 - digital TTL red video data clock
 - digital TTL green video

A3 Front Panel Interface Board

The A3 front panel interface board detects and decodes user inputs from the A1 keypad assembly and front panel knob, and transmits them to the A15 CPU board by way of the A14 system motherboard. It also decodes video data from the video processor on the A15 CPU board and supplies this to the A2 display assembly. Power from the power bus on the A14 system motherboard is buffered and routed to the A1 keypad assembly and the A2 display assembly. All data and power signals are routed through a single cable connector to the A14 system motherboard.

USB	Two universal serial bus (USB) jacks (industry standard 4-pin connectors) mounted on a separate USB connector board that connects directly to the A3 front panel interface board.
Speaker	A speaker that emits the audio signals received from the A15 CPU board.

The A3 front panel interface board also includes the following items:

Data Acquisition and Processing Subgroup

The data acquisition and processing subgroup contain the following assemblies. See Figure 5-9 on page 5-26.

- A5 SPAM Board (Digital Description)
- A15 CPU Board (including rear-panel interconnects)
- A41 Hard Disk Drive
- USB Hub

A5 SPAM Board (Digital Description)

The A5 SPAM board contains digital and analog circuitry. For analog descriptions, refer to "A5 SPAM Board (Analog Description)" on page 5-22.

The digital signal processor (DSP) receives digitized data from the digital circuitry of the A5 SPAM board. It computes discrete Fourier transforms to extract the complex phase and magnitude data from the analog IF signal. The resulting raw data is written into the main random access memory (RAM). The data taking sequence is triggered either externally from the rear panel or by firmware on the A15 CPU board.

A15 CPU Board

The A15 CPU board contains the circuitry to control the operation of the analyzer. Some of the components include the central processing unit (CPU), memory (EEPROM, ROM, RAM), bus lines to other board assemblies, and connections to the rear panel. Some of the main components are described next:

- CPU
- Main RAM
- Rear Panel Interconnects

CPU The central processing unit (CPU) is a microprocessor that maintains digital control over the entire instrument through the instrument bus. The CPU receives external control information from the keypad, any USB device, LAN or GPIB, and performs processing and formatting operations on the raw data in the main RAM. It controls the DSP, the video processor, and the interconnect port interfaces. In addition, when the analyzer is in the system controller mode, the CPU controls peripheral devices through the peripheral port interfaces.

Front panel settings are stored in SRAM, with a battery providing at least five years of backup storage when external power is off.

Main RAM The main random access memory (RAM) is shared memory for the CPU and the DSP. It stores the raw data received from the DSP while additional calculations are performed on it by the CPU. The CPU reads the resulting formatted data from the main RAM, converts it to a user-definable display format, and writes this to the video processor for display.

USB	A universal serial bus (USB) jack (an industry standard 4-pin connector).			
GPIB	A 24-pin, female, type D-24 connector that meets IEEE-488 standards.			
Serial	A 9-pin, male, RS-232 compatible, D-sub connector.			
Parallel	A 36-pin, mini-D, 1284-C connector that provides connection to printers or any other parallel port peripheral.			
LAN	A standard 8-pin, 10/100BaseT, Ethernet connection. It auto selects between the two data rates.			
Display (VGA)	A 15-pin, female, D-sub connector that provides a video output of the analyzer display that can be viewed on an external VGA monitor.			

Rear Panel Interconnects The rear panel includes the following interfaces:

A41 Hard Disk Drive

The hard disk drive assembly (HDDA) is an integrated development environment (IDE) data storage device which is connected directly to the A15 CPU board. The full operating system and firmware for the network analyzer is stored on the A41 hard disk drive.

USB Hub

The rear-panel mounted, internal USB hub provides four additional USB ports for connection of external USB compatible devices.

Power Supply Group Operation

The A4 power supply assembly is a switching power supply operating at 103 kHz switching frequency. The input power ranges for the power supply are 90 to 132 Vac or 195 to 250 Vac. The power supply automatically senses the input voltage and switches between these two ranges.

The dc output voltages are:

- +5.2 V
- -5.2 V
- +9 V
- +15 V
- +15 V standby (always on)
- -15 V
- +22 V
- VCC (5.2 V for the A15 CPU board)
- VDL (3.3 V to the A15 CPU board)

The +15 V standby line remains on continuously whenever the power supply is plugged in. This line is used to provide power to front panel LEDs and CPU components when the analyzer is turned off.

An additional +32 V supply line is generated on the A14 system motherboard from the +22 V supply line.

NOTE If the power supply senses an over-voltage or over-current condition on any of the supply lines, the power supply will cycle on and off at a low voltage level (burp mode).

6 Replaceable Parts

Information in This Chapter

This chapter:

- identifies the replaceable parts for the Agilent PNA series microwave network analyzer.
- includes several tables and illustrations to assist you in identifying the correct part for your analyzer.
- contains ordering information for new assemblies and rebuilt-exchange assemblies.

Chapter Six at-a-Glance

Section Title	Summary of Content	Start Page
Ordering Information	How to order a replaceable part from Agilent Technologies.	Page 6-3
Assembly Replacement Sequence	The correct sequence for replacing a defective assembly.	Page 6-4
	The definition of a rebuilt-exchange assembly.	
Rebuilt-Exchange Assemblies	The procedure for replacing and returning a defective assembly to Agilent Technologies.	Page 6-5
	A table that provides the location of the assemblies in your analyzer by reference designator.	Page 6-6
Replaceable Parts Listings	A table that provides the location of the replaceable parts in your analyzer by type of part:	
	• Assemblies (front panel, top, and bottom)	Page 6-7
	Cables (top and bottom)	
	• Hardware (internal, hard disk drive, rear panel, and external)	
	Miscellaneous replaceable parts	

Ordering Information

To order a part listed in the replaceable parts lists:

- include the part number
- indicate the quantity required
- Contact Agilent Technologies for instructions on where to send the order. Refer to "Contacting Agilent" on page 2-11.

To order a part that is not listed in the replaceable parts lists:

- include the instrument model number and complete instrument serial number
- include the description and function of the part
- indicate the quantity required
- Contact Agilent Technologies for instructions on where to send the order. Refer to "Contacting Agilent" on page 2-11.

Assembly Replacement Sequence

The following steps describe how to replace an assembly in the network analyzer.

- **Step 1.** Identify the faulty group. Begin with Chapter 4, "Troubleshooting." Follow up with the appropriate troubleshooting chapter that identifies the faulty assembly.
- Step 2. Order a replacement assembly. Refer to this chapter.
- **Step 3.** Replace the faulty assembly and determine what adjustments are necessary. Refer to Chapter 7, "Repair and Replacement Procedures."
- Step 4. Perform the necessary adjustments. Refer to Chapter 3, "Tests and Adjustments."
- **Step 5.** Perform the necessary performance tests. Refer to Chapter 3, "Tests and Adjustments."


Rebuilt-Exchange Assemblies

Under the rebuilt-exchange assembly program:

- Certain factory-repaired and tested assemblies are available on a trade-in basis.
- Exchange assemblies are offered for lower cost than a new assembly, but meet all factory specifications required of a new assembly.
- The defective assembly must be returned for credit under the terms of the rebuilt-exchange assembly program.
- Spare assembly stock desired should be ordered using the new assembly part number. •

Figure 6-1 Module Exchange Procedure

The module exchange program described here is a fast, efficient, economical method of keeping your instrument in service.

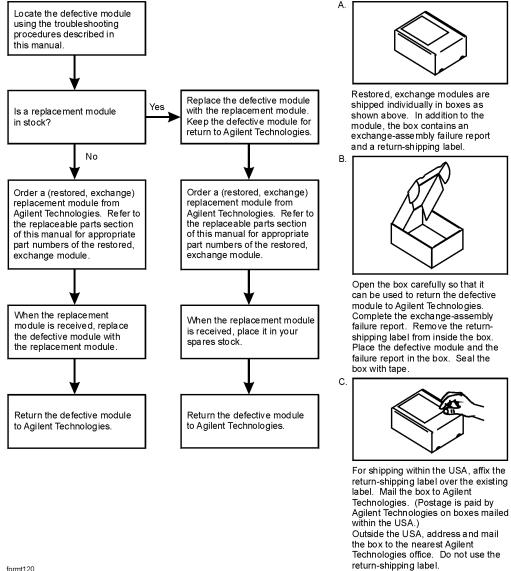

formt120

Replaceable Parts Listings

This section contains the replacement part numbers and their descriptions for your Agilent microwave PNA. You can find the locations of replaceable parts in this section:

- listed by reference designator in Table 6-1, or
- listed by the type of part in Table 6-2.

 Table 6-1
 Part Number Location by Reference Designator

Reference				
Designator	Description	Location		
A1	Keypad assembly	"Front Panel Assembly, Back Side, All Options" on		
A2	Display assembly	page 6-10		
A3	Front panel interface board	page 0-10		
A4	Power supply assembly			
A5	Signal processing ADC module (SPAM) board	"Top Assemblies, All Options Except 146/246" on		
A6	Multiplier board	page 6-12		
A7	Fractional-N synthesizer board	"Top Assemblies, Options 146/246" on page 6-16		
A8	Multiplier board	Top Assemblies, Options 140/240° on page 0-10		
A9	Fractional-N synthesizer board			
A10	Frequency reference board			
A11	Vertical motherboard (Options 146/246)			
A12	Multiplier board (Options 146/246)	"Ton Assemblies Ontions 146/246" on page 6 16		
A13	Fractional-N synthesizer board (Options 146/246)	"Top Assemblies, Options 146/246" on page 6-16		
A14	System motherboard	"Top Assemblies, All Options Except 146/246" on		
A15	CPU board	page 6-12		
		"Top Assemblies, Options 146/246" on page 6-16		
		"Bottom Assemblies, Options 140 and 240" on page 6-22		
A16	Test set motherboard	"Bottom Assemblies, Options 145 and 245" on page 6-26		
117		"Bottom Assemblies, Options 146 and 246" on page 6-30		
A17	QABC board (Options 146/246)			
A18	MASSQuad 26.5—on A17 QABC board (Options 146246)	"Top Assemblies, Options 146/246" on page 6-16		
A19	MASSQuad 26.5			
A20	Mixer brick	"Bottom Assemblies, Options 140 and 240" on page 6-22		
A21	Test port 1 coupler	"Bottom Assemblies, Options 146 and 245" on page 6-26		
A22	Test port 2 coupler	"Bottom Assemblies, Options 146 and 246" on page 6-30		
A23	Test port 3 coupler	Dottom rassemenes, options rio and 215 on page 0 50		
A24	Test port 4 coupler			
A25	Source 60-dB step attenuator	"Bottom Assemblies, Options 145 and 245" on page 6-26		
	(Options 145/146/245/246)	"Bottom Assemblies, Options 146 and 246" on page 6-30		
A26	Step attenuator—on A17 QABC board (Options 146/246)	"Top Assemblies, Options 146/246" on page 6-16		
A29	Reference switch—with wiring harness (Options 146246)	"Bottom Assemblies, Options 146 and 246" on page 6-30		
A40	Not used.			
A41	Hard disk drive assembly	"Hard Disk Drive Assembly, All Options" on		
	Thata ansk arrive assembly	page 6-44		

Type of Part	Location						
Assemblies	 "Front Panel Assembly, Back Side, All Options" on page 6-10 "Top Assemblies, All Options Except 146/246" on page 6-12 "Top Assemblies, Options 146/246" on page 6-16 "Bottom Assemblies, Options 140 and 240" on page 6-22 "Bottom Assemblies, Options 145 and 245" on page 6-26 "Bottom Assemblies, Options 146 and 246" on page 6-30 "Hard Disk Drive Assembly, All Options" on page 6-42 						
Cables	 "Top Cables, All Options Except 146/246" on page 6-14 "Top Cables, Options 146/246 (Top View)" on page 6-18 "Top Cables, Options 146/246 (Side View)" on page 6-20 "Bottom Cables, Options 140 and 240" on page 6-24 "Bottom Cables, Options 145 and 245" on page 6-28 "Bottom Cables, Options 146 and 246" on page 6-32 						
Hardware	 "Top Hardware and Miscellaneous Parts, All Options" on page 6-34 "Bottom Hardware and Miscellaneous Parts, All Options" on page 6-36 "Internal Hardware and Miscellaneous Parts, All Options" on page 6-38 "External Hardware and Miscellaneous Parts, All Options" on page 6-40 "Hard Disk Drive Assembly, All Options" on page 6-44 "Rear Panel Assembly, All Options" on page 6-42 						
Miscellaneous	 Front Panel Assembly, Front Side, All Options on page 6-8 Service Tools on page 6-48 Documentation on page 6-48 Protective Caps for Connectors on page 6-48 GPIB Cables/GPIB Adapter on page 6-48 Battery on page 6-48 Fuses on page 6-48 ESD Supplies on page 6-49 EMI/RFI Shielding Accessories on page 6-49 Memory Modules on page 6-49 Upgrade Kits on page 6-49 Touch-up Paint on page 6-49 USB Accessories on page 6-49 Rack Mount Kits and Handle Kits on page 6-49 						

 Table 6-2
 Part Number Location by Type of Part

Reference Designator	Part Number	Qty	Description	
(1)a	N5230-20225 Was N5230-20125	1	Front frame	
2	N5230-80028 Was N5230-80018 ^b	1	Keypad overlay	
(3)c	5041-9183	2	With handles—front handle side trim	
	5041-9174	2	Without handles—trim strip, filler	
(4)	N5230-00015	1	Lower front dress panel	
5	N5230-80006	1	Front panel overlay (all standard test set analyzers)	
9	N5230-80007	1	Front panel overlay (all configurable test set analyzers)	
6	0515-4791	10	Machine screw, M3.0 x 4 flat head	
7	W1312-40017	1	Front knob	
8	N5230-80020	1	Nameplate, N5230C 300 kHz to 13.5 GHz	
U	N5230-80021	1	Nameplate, N5230C 300 kHz to 20 GHz	

Front Panel Assembly, Front Side, All Options

a. When ordering a replacement front frame assembly, you must also order items (2), (5), and (8).

b. Use keyboard overlay part number N5230-80018 with the following models and serial numbers:

* E8362C: MY48120116 and below; SG48120102 and below.

 \ast E8362CH85: MY48150106 and below; SG48150101 and below.

 \ast E8363C: MY48130162 and below; SG48130102 and below.

* E8363CH85: MY48150101.

* E8364C: MY48140153.

* E8364CH85: MY48150101.

c. For part numbers of rack mount kits and handle kits, refer to "Rack Mount Kits and Handle Kits" on page 6-49.

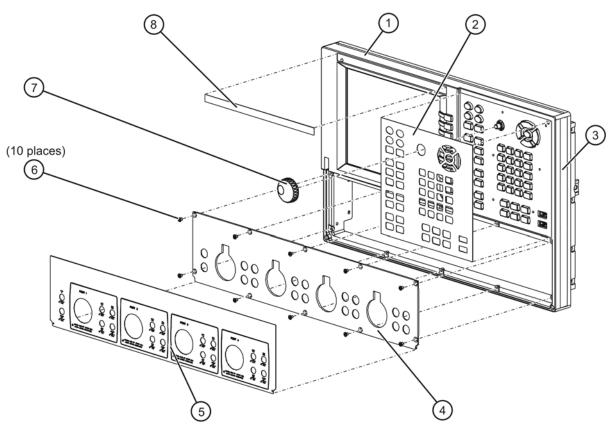


Figure 6-2 Front Panel Assembly, Front Side, All Options

4pfp_front_exploded

Reference Designator	Part Number	Qty	Description	
A1	N5230-40002	1	Keypad assembly	
A2	N5230-60045	1	Display assembly (Includes the following parts; not separately orderable.)	
			O-LCD display, 8.4-inch, 1024 x 768 pixels	
			❷–Machine screw, M2.5 x 8 pan head	
			3 –Display ribbon cable	
			O -Cable clamp (for display ribbon cable)	
			O -Cable clamp (for inverter cable)	
			O –Display bracket	
			•Cable clamp (for display cables and touchscreen cable)	
A3	N5230-60132	1	Front panel interface board	
1	N5230-20225 Was N5230-20125	1	Front frame	
2	8160-0660	1	RFI gasket	
3	N5230-40003	1	Touch screen rubber boot	
4	E6601-61028	1	Inverter cable	
5	2090-0959	1	Touch screen display, 8.4-inch, 4096 x 4096 pixels	
6	0515-0430	13	Machine screw, M3.0 x 6 pan head	
7	0950-4482	1	Inverter board	
8	0515-0372	8	Machine screw, M3.0 x 8 pan head	
9	N5230-00017 Was N5230-00013	1	Inverter board shield	
10	0515-1974	2	Machine screw, M2.5 x 4 pan head	
(1)	0960-2796	1	Touch screen controller board	
(12)	N5230-61002	1	Touch screen controller cable	
(13)	N5230-60131	1	USB connector board	
14	8160-1731	1	EMI gasket, D-shape, urethane, 4 mm W x 154 mm L	
(15)	0400-0996	2	Grommet, oval, neoprene	

Front Panel Assembly, Back Side, All Options


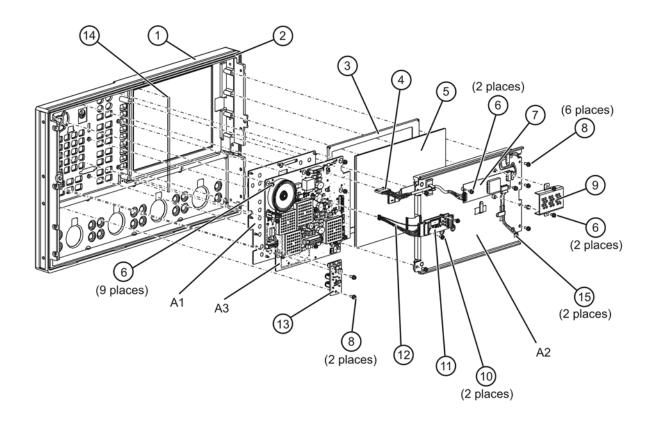


Figure 6-3 Front Panel Assembly, Back Side, All Options

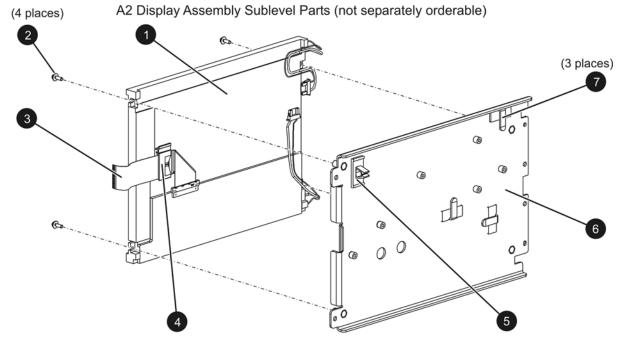

4pfp_rear_exploded

Reference Designator	Part Number	Qty	Description
A4	0950-4599	1	Power supply assembly
A5	E8364-60187	1	Signal processing ADC module (SPAM) board
A6, A8	E8364-60182	2	Multiplier board
A7, A9	E8364-60189	2	Fractional-N synthesizer board
A10	E8364-60136	1	Frequency reference board
A14	N5230-60086	1	System motherboard
A15	E8364-60026	1	1.1 GHz CPU Replacement Kit
B1	Fans		Refer to "Internal Hardware and Miscellaneous Parts, All Options" on page 6-38.

Top Assemblies, All Options Except 146/246

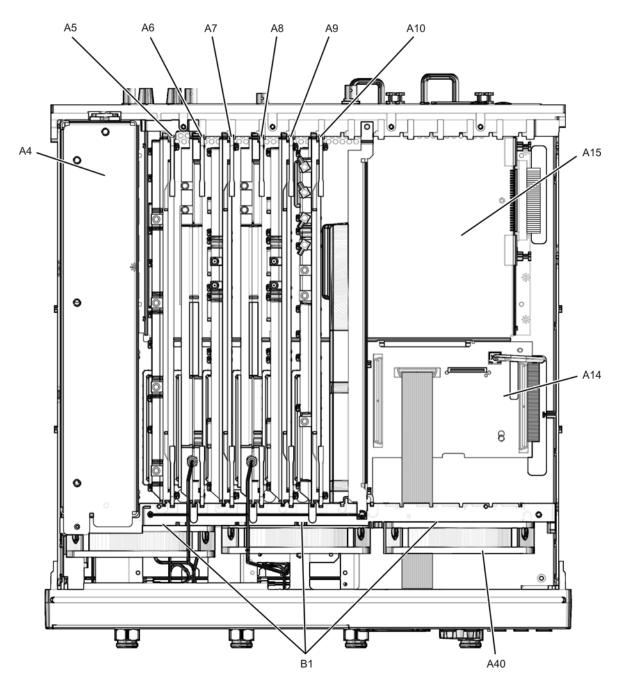


Figure 6-4 Top Assemblies, All Options Except 146/246

n5230_013_601_new

Reference Designator	Type ^a	Part Number	Qty	Description
W1	SR	N5230-20041	2	A7 fractional-N synthesizer board J106 to A6 multiplier board J100
W2	SK	115250-20041	2	A7 fractional-N synthesizer board J101 to A6 multiplier board J101
W3	SR	N5230-20051	1	A6 multiplier board to A20 mixer brick
W4	SR	N5230-20041	2	A9 fractional-N synthesizer board J106 to A8 multiplier board J100
W5	ы	113230-20041	2	A9 fractional-N synthesizer board J101 to A8 multiplier board J101
W6	SR	N5230-20077	1	A8 multiplier board to A19 MASSQuad
W21	F	N5230-60016	1	A20 mixer brick (A) to A5 SPAM board J1
W22	F	N5230-60019	1	A20 mixer brick (B) to A5 SPAM board J2
W23	F	N5230-60020	1	A20 mixer brick (C) to A5 SPAM board J4
W24	F	N5230-60021	1	A20 mixer brick (D) to A5 SPAM board J5
W25	F	N5230-60022	1	A20 mixer brick (R) to A5 SPAM board J6
W26	F	8120-5055		Rear-panel 10 MHz REF. IN to A10 frequency reference board J2
W27	Г	8120-3033	2	A10 frequency reference board J3 to rear-panel 10 MHz REF. OUT
W28	F	N5230-60024	1	A10 frequency reference board J10 to A5 SPAM board J3
W29	F	N5230-60010	1	A10 frequency reference board J12 to A7 fractional-N synthesizer board J105
W30	F	N5230-60011	1	A10 frequency reference board J11 to A9 fractional-N synthesizer board J105
1	40R	8121-0116	1	A3 front panel interface board J7 to A14 system motherboard J1
2	100R	8121-0118	1	A14 system motherboard to A16 test set motherboard
3	50R	8121-0817	1	A41 hard disk drive assembly to A15 CPU board

Top Cables, All Options Except 146/246

a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a \underline{r} ibbon (flat) cable; nW = n wires in a \underline{w} rapped cable

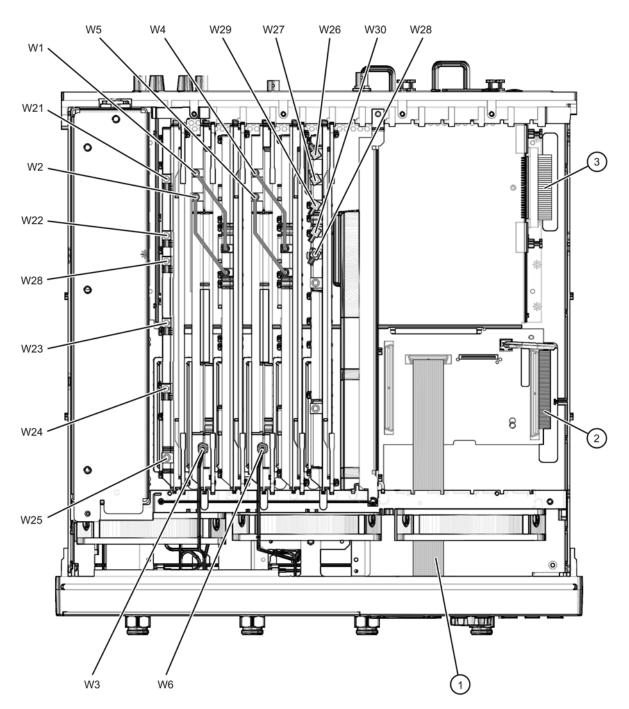



Figure 6-5 Top Cables, All Options Except 146/246

n5230_013_602_new

Reference Designator	Part Number	Qty	Description
A4	0950-4599	1	Power supply assembly
A5	E8364-60187	1	Signal processing ADC module (SPAM) board
A6, A8	E8364-60182	2	Multiplier board
A7, A9	E8364-60189	2	Fractional-N synthesizer board
A10	E8364-60136	1	Frequency reference board
A11	N5230-60084	1	Vertical motherboard
A12	N5230-60098	1	Multiplier board
A13	N5230-60097	1	Fractional-N synthesizer board
A14	N5230-60086 1		System motherboard
A15	E8364-60026	1	1.1 GHz CPU Replacement Kit
A17	N5230-60085	1	QABC board
A18	5087-7294	1	MASS 26.5 (MASSQuad) (mounted on A17 QABC board)
A26	33321-60065	1	60-dB source step attenuator (mounted on A17 QABC board)
B1	Fans		Refer to "Internal Hardware and Miscellaneous Parts, All Options" on page 6-38.

Top Assemblies, Options 146/246

Figure 6-6 Top Assemblies, Options 146/246 (Side View)

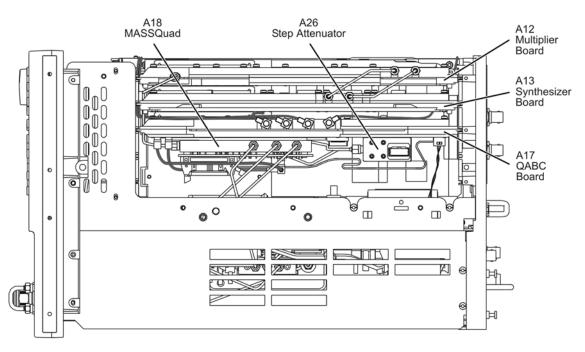

n5230_013_612_new

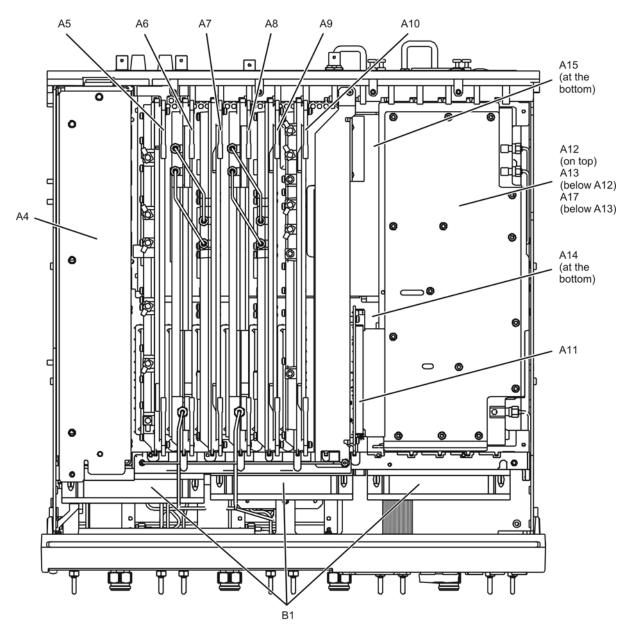


Figure 6-7 Top Assemblies, Options 146/246 (Top View)

n5230_013_614_new

Reference Designator	Type ^a	Part Number	Qty	Description
W1	SR	N5230-20041	2	A7 fractional-N synthesizer board J106 to A6 multiplier board J100
W2	SK	N5230-20041	2	A7 fractional-N synthesizer board J101 to A6 multiplier board J101
W3	SR	N5230-20051	1	A6 multiplier board to A20 mixer brick
W4	SR	NI5220 20041	2	A9 fractional-N synthesizer board J106 to A8 multiplier board J100
W5	л	N5230-20041	2	A9 fractional-N synthesizer board J101 to A8 multiplier board J101
W6	SR	N5230-20077	1	A8 multiplier board to A19 MASSQuad
W21	F	N5230-60016	1	A20 mixer brick (A) to A5 SPAM board J1
W22	F	N5230-60019	1	A20 mixer brick (B) to A5 SPAM board J2
W23	F	N5230-60020	1	A20 mixer brick (C) to A5 SPAM board J4
W24	F	N5230-60021	1	A20 mixer brick (D) to A5 SPAM board J5
W25	F	N5230-60022	1	A20 mixer brick (R) to A5 SPAM board J6
W26	F	8120-5055	2	Rear-panel 10 MHz REF. IN to A10 frequency reference board J2
W27	Г	8120-3033		A10 frequency reference board J3 to rear-panel 10 MHz REF. OUT
W28	F	N5230-60024	1	A10 frequency reference board J10 to A5 SPAM board J3
W70	F	N5230-60039	1	A10 frequency reference board J11 to A17 QABC board J800
1	40R	8121-0116	1	A3 front panel interface board J7 to A14 system motherboard J1

a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a <u>r</u>ibbon (flat) cable; nW = n wires in a <u>w</u>rapped cable

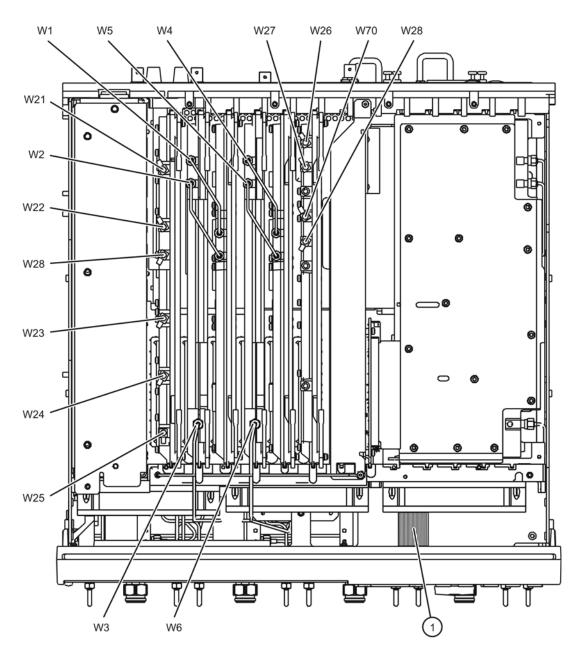


Figure 6-8 Top Cables, Options 146/246 (Top View)

n5230_013_618_new

Top Cables, Options 146/246 (Side View)

Reference Designator	Type ^a	Part Number	Qty	Description	
W61	SD	NI5220 20041	2	A13 fractional-N synthesizer board J106 to A12 multiplier board J100	
W62 SR	N5230-20041	2	A13 fractional-N synthesizer board J101 to A12 multiplier board J101		
W63	SR	N5230-20096	1	A12 multiplier board to A18 MASSQuad	
W64	SR	N5230-20091	1	A18 MASSQuad to front panel PORT 3 SOURCE OUT	
W65	SR	N5230-20092	1	A18 MASSQuad to front panel PORT 4 SOURCE OUT	
W67	SR	N5230-20095	1	A18 MASSQuad to A29 reference switch Port 2	
W70	F	N5230-60039	1	A10 frequency reference J11 to A17 QABC board J800	
W71	F	N5230-60040	1	A17 QABC board J801 to A7 fractional-N synthesizer J105	
W72	F	N5230-60041	1	A17 QABC board J802 to A9 fractional-N synthesizer J105	
W73	F	N5230-60042	1	A17 QABC board J803 to A13 fractional-N synthesizer J105	
W74	F	N5230-60038	1	A17 QABC board J206 to A18 MASSQuad J23	
W75	F	N5230-60037	1	A17 QABC board J204 to A18 MASSQuad J26	
W76	10R	8121-0819	1	A17 QABC board P512 to A26 step attenuator	
W77	26R	N5230-60027	1	A17 QABC board J4 to A18 MASSQuad J4	
W78	SR	N5230-20089	1	A18 MASSQuad to A26 step attenuator	
W79	SR	N5230-20090	1	A26 step attenuator to A18 MASSQuad	
1	40R	8121-0116	1	A3 front panel interface board J7 to A14 system motherboard J1 (Not visible in illustration; see page 6-15.)	
2	100R	8121-0118	1	A14 system motherboard to A16 test set motherboard (See page 6-15 for more detailed illustration.)	
4	50R	8121-0817	1	A41 hard disk drive assembly to A15 CPU board (See page 6-15 for more detailed illustration.)	
5	NA	1252-2219	1	Retainer clip for W77 A17J4 connection	
6	NA	1252-2216	1	Retainer clip for W76 A17P512 connection	
\bigcirc	NA	1810-0118	2	50-ohm load (for unused A18 MASSQuad ports)	
8	NA	0515-0372	3	Machine screw M3.0 x 8 pan head	
9	NA	0515-2693	2	Machine screw M3.0 x 22 pan head	

a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a <u>ribbon</u> (flat) cable; nW = n wires in a <u>w</u>rapped cable


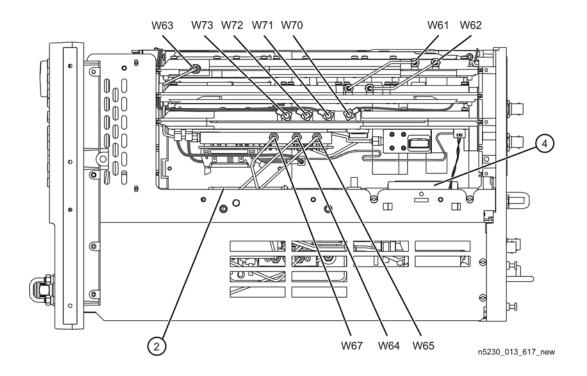


Figure 6-9 Top Cables, Options 146/246 (Side View)

Figure 6-10 Top Cables, Options 146/246 (QABC Board)

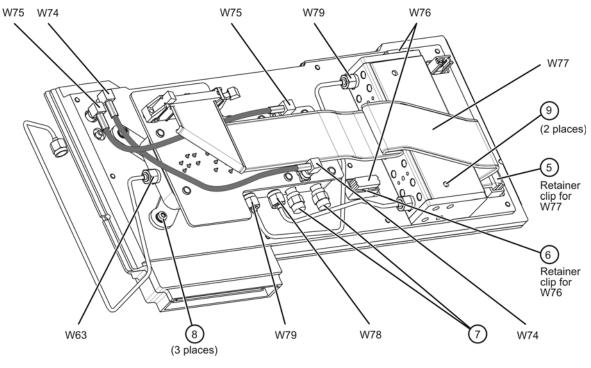



n5230_013_613

Reference Designator	Part Number ^a	Qty	Description	
A16	N5230-60078	1	Test set motherboard	
A19	5087-7294 5087-6294	1	MASS 26.5 (MASSQuad)	
A20	5087-7299 5087-6299	1	Mixer brick (QuintBrick)	
A21 A22 A23 A24	5087-7301	4	Test port 1 coupler Test port 2 coupler Test port 3 coupler Test port 4 coupler	
A41	Hard disk drive. Refer to "Hard Disk Drive Assembly, All Options" on page 6-44.			
1	E8361-60059 1		USB hub board	

Bottom Assemblies, Options 140 and 240

 a. Part numbers in *italic* typeface are for rebuilt exchange assemblies. Refer to "Rebuilt-Exchange Assemblies" on page 6-5.



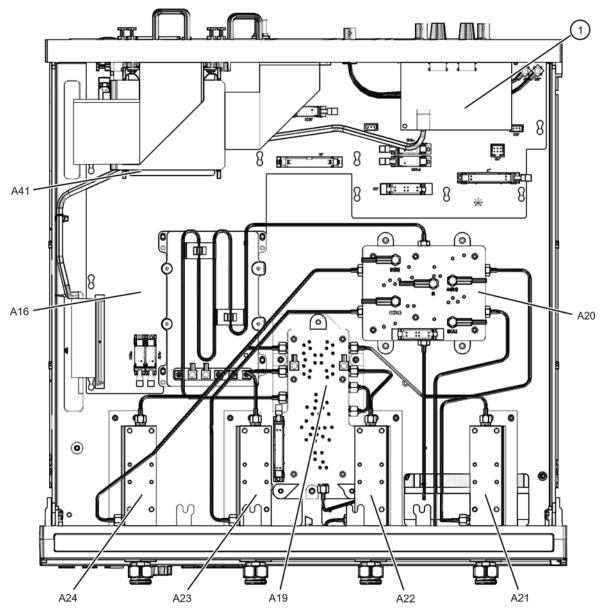

n5230_013_603

Reference Designator	Type ^a	Part Number	Qty	Description		
W3, W6	SR	Refer to "Top Cables, All Options Except 146/246" on page 6-14.				
W7	SR	08753-20183	1	Jumper cable (A19 MASSQuad to A19 MASSQuad)		
W8	SR	N5230-20054	1	A19 MASSQuad to A21 test port 1 coupler		
W9	SR	N5230-20056	1	A19 MASSQuad to A22 test port 2 coupler		
W10	SR	N5230-20058	1	A19 MASSQuad to A23 test port 3 coupler		
W11	SR	N5230-20060	1	A19 MASSQuad to A24 test port 4 coupler		
W12	SR	N5230-20062	1	A19 MASSQuad to A20 mixer brick (R)		
W13	SR	N5230-20055	1	A21 test port 1 coupler to A20 mixer brick (A)		
W14	SR	N5230-20057	1	A22 test port 2 coupler to A20 mixer brick (B)		
W15	SR	N5230-20059	1	A23 test port 3 coupler to A20 mixer brick (C)		
W16	SR	N5230-20061	1	A24 test port 4 coupler to A20 mixer brick (D)		
W21-W25	F	Refer to "Top Ca	ables, A	ll Options Except 146/246" on page 6-14.		
W31	F	N5230-60025	1	A19 MASSQuad J26 to A16 test set motherboard J204 (R)		
W32	F	N5230-60026	1	A19 MASSQuad J23 to A16 test set motherboard J206 (MASS)		
1	100R	8121-0118	1	A14 system motherboard to A16 test set motherboard		
2	50R	8121-0817	1	A41 hard disk drive to A15 CPU board		
3	4W	N5320-60028	1	Front panel LED board J1 to A16 test set motherboard J501		
4	6W	N5230-60015	1	USB hub board J3 to A14 system motherboard J20		
5	26R	N5230-60027	1	A19 MASSQuad J4 to A16 test set motherboard J4		
6	16R	N5230-60013	1	A20 mixer brick J1 to A16 test set motherboard J12		

Bottom Cables, Options 140 and 240

a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a <u>ribbon</u> (flat) cable; nW = n wires in a <u>wrapped</u> cable

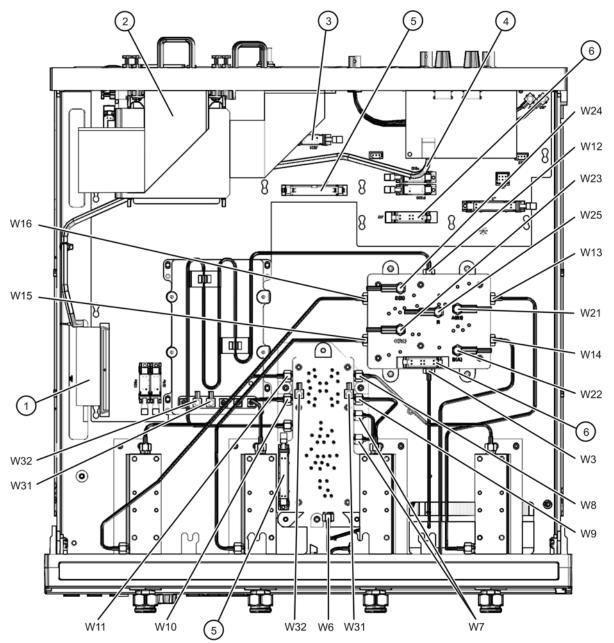



Figure 6-12 Bottom Cables, Options 140 and 240


n5230_013_604

Reference Designator	Part Number ^a	Qty	Description
A16	N5230-60078	1	Test set motherboard
A19	5087-7294 5087-6294	1	MASS 26.5 (MASSQuad)
A20	5087-7299 5087-6299	1	Mixer brick (QuintBrick)
A21 A22 A23 A24	5087-7301	4	Test port 1 coupler Test port 2 coupler Test port 3 coupler Test port 4 coupler
A25	33321-60065	1	Source 60-dB step attenuator
A41	Hard disk drive. Refer to "Hard Disk Drive Assembly, All Options" on page 6-44.		
1	E8361-60059 1 USB hub board		

Bottom Assemblies, Options 145 and 245

 a. Part numbers in *italic* typeface are for rebuilt exchange assemblies. Refer to "Rebuilt-Exchange Assemblies" on page 6-5.



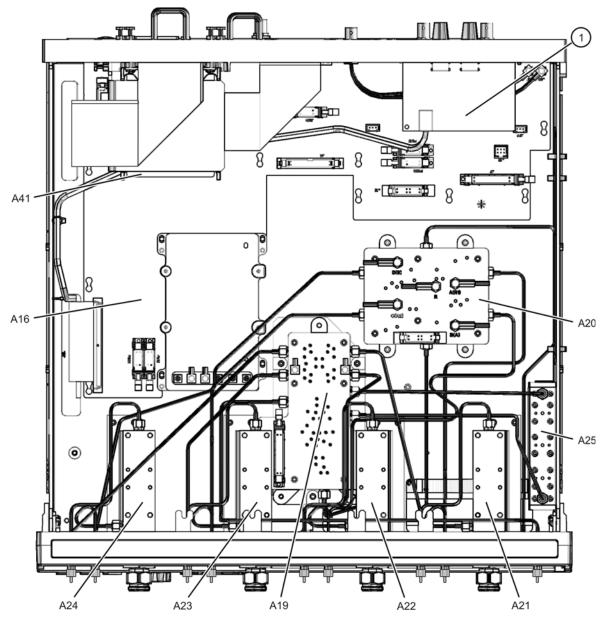



n5230_013_605

Reference Designator	Type ^a	Part Number	Qty	Description	
W3, W6	SR	Refer to "Top Cables, All Options Except 146/246" on page 6-14.			
W21-W25	F	Refer to "Top Cables, All Options Except 146/246" on page 6-14.			
W31	F	N5230-60025	1	A19 MASSQuad J26 to A16 test set motherboard J204 (R)	
W32	F	N5230-60026	1	A19 MASSQuad J23 to A16 test set motherboard J206 (MASS)	
W40	SR	N5230-20064	1	A19 MASSQuad to PORT 1 SOURCE OUT	
W41	SR	N5230-20067	1	A19 MASSQuad to PORT 2 SOURCE OUT	
W42	SR	N5230-20069	1	A19 MASSQuad to PORT 3 SOURCE OUT	
W43	SR	N5230-20071	1	A19 MASSQuad to PORT 4 SOURCE OUT	
W44				PORT 1 CPLR THRU to A21 test port 1 coupler	
W45	SR	N5230-20063	4	PORT 2 CPLR THRU to A22 test port 2 coupler	
W46	SK	N3230-20003	4	PORT 3 CPLR THRU to A23 test port 3 coupler	
W47				PORT 4 CPLR THRU to A24 test port 4 coupler	
W48	SR	N5230-20075	1	A19 MASSQuad (R) to REFERENCE SOURCE OUT	
W49				A21 test port 1 coupler to PORT 1 CPLR ARM	
W50	CD	N5230-20065	4	A22 test port 2 coupler to PORT 2 CPLR ARM	
W51	SR			A23 test port 3 coupler to PORT 3 CPLR ARM	
W52				A24 test port 4 coupler to PORT 4 CPLR ARM	
W53	SR	N5230-20066	1	PORT 1 RCVR A IN to A20 mixer brick (A)	
W54	SR	N5230-20068	1	PORT 2 RCVR B IN to A20 mixer brick (B)	
W55	SR	N5230-20070	1	PORT 3 RCVR C IN to A20 mixer brick (C)	
W56	SR	N5230-20072	1	PORT 4 RCVR D IN to A20 mixer brick (D)	
W57	SR	N5230-20076	1	REFERENCE RCVR IN to A20 mixer brick (R)	
W58	SR	N5230-20073	1	A19 MASSQuad (ATTN) to A25 step attenuator	
W59	SR	N5230-20074	1	A25 step attenuator to A19 MASSQuad (ATTN)	
W60	SR	E8356-20072	9	Front panel jumper	
1	100R	8121-0118	1	A14 system motherboard J8 to A16 test set motherboard J1	
2	50R	8121-0817	1	A41 hard disk drive to A15 CPU board	
3	4W	N5320-60028	1	Front panel LED board J1 to A16 test set motherboard J501	
(4)	6W	N5230-60015	1	USB hub board J3 to A14 system motherboard J20	
5	26R	N5230-60027	1	A19 MASSQuad J4 to A16 test set motherboard J4	
6	16R	N5230-60013	1	A20 mixer brick J1 to A16 test set motherboard J12	
\overline{O}	10R	8121-0819	1	A25 step attenuator to A16 test set motherboard P510 (ATTN)	

Bottom Cables, Options 145 and 245

 a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a <u>ribbon</u> (flat) cable; nW = n wires in a <u>wrapped</u> cable

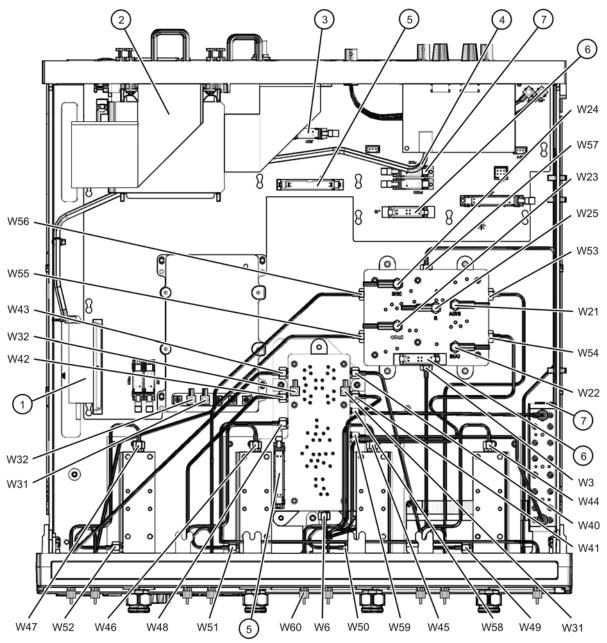





n5230_013_606

Reference Designator	Part Number ^a	Qty	Description	
A16	N5230-60078	1	Test set motherboard	
A17	Refer to "Top As	ssembli	es, Options 146/246" on page 6-16.	
A18	Refer to "Top As	sembli	es, Options 146/246" on page 6-16.	
A19	5087-7294 5087-6294	1	MASS 26.5 (MASSQuad)	
A20	5087-7299 5087-6299	1	Mixer brick (QuintBrick)	
A21 A22 A23 A24	5087-7301	4	Test port 1 coupler Test port 2 coupler Test port 3 coupler Test port 4 coupler	
A25	33321-60065	1	Source 60-dB step attenuator	
A26	Refer to "Top Assemblies, Options 146/246" on page 6-16.			
A29	5087-7714	1	Reference switch—with wiring harness	
A41	Hard disk drive. Refer to "Hard Disk Drive Assembly, All Options" on page 6-44.			
1	E8361-60059	1	USB hub board	
2	N9356-60001	1	Limiter	
3	1250-3478	1	DC block	
4	1810-0118	2	50-ohm load (for unused A19 MASSQuad ports)	

Bottom Assemblies, Options 146 and 246

 a. Part numbers in *italic* typeface are for rebuilt exchange assemblies. Refer to "Rebuilt-Exchange Assemblies" on page 6-5.

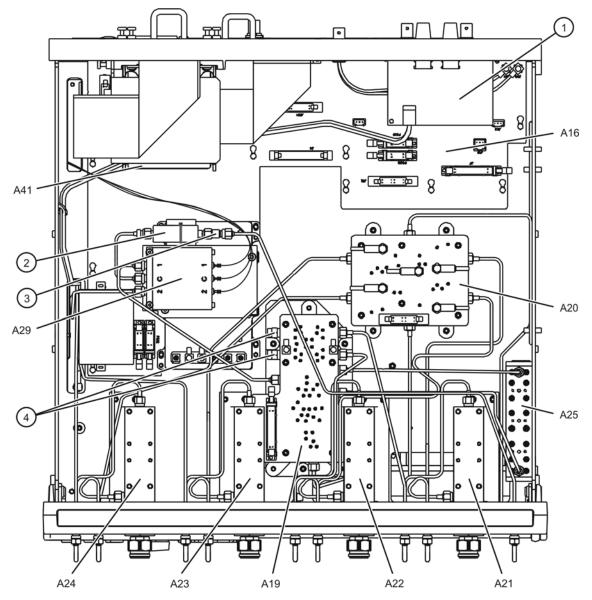



n5230_013_615


Reference Designator	Type ^a	Part Number	Qty	Description	
W3, W6	SR	Refer to "Top Cables, Options 146/246 (Top View)" on page 6-18.			
W21-W25	F	Refer to "Top Ca	ables, (Options 146/246 (Top View)" on page 6-18.	
W31	F	N5230-60025	1	A19 MASSQuad J26 to A16 test set motherboard J204 (R)	
W32	F	N5230-60026	1	A19 MASSQuad J23 to A16 test set motherboard J206 (MASS)	
W40	SR	N5230-20064	1	A19 MASSQuad to PORT 1 SOURCE OUT	
W41	SR	N5230-20067	1	A19 MASSQuad to PORT 2 SOURCE OUT	
W42	SR	N5230-20069	1	A19 MASSQuad to PORT 3 SOURCE OUT	
W43	SR	N5230-20071	1	A19 MASSQuad to PORT 4 SOURCE OUT	
W44				PORT 1 CPLR THRU to A21 test port 1 coupler	
W45	SR	N5230-20063	4	PORT 2 CPLR THRU to A22 test port 2 coupler	
W46	SK	N3230-20003	4	PORT 3 CPLR THRU to A23 test port 3 coupler	
W47				PORT 4 CPLR THRU to A24 test port 4 coupler	
W48	SR	N5230-20075	1	A19 MASSQuad (R) to REFERENCE SOURCE OUT	
W49				A21 test port 1 coupler to PORT 1 CPLR ARM	
W50	SR	N5230-20065	4	A22 test port 2 coupler to PORT 2 CPLR ARM	
W51	SK	N3230-20003	4	A23 test port 3 coupler to PORT 3 CPLR ARM	
W52				A24 test port 4 coupler to PORT 4 CPLR ARM	
W53	SR	N5230-20066	1	PORT 1 RCVR A IN to A20 mixer brick (A)	
W54	SR	N5230-20068	1	PORT 2 RCVR B IN to A20 mixer brick (B)	
W55	SR	N5230-20070	1	PORT 3 RCVR C IN to A20 mixer brick (C)	
W56	SR	N5230-20072	1	PORT 4 RCVR D IN to A20 mixer brick (D)	
W58	SR	N5230-20073	1	A19 MASSQuad (ATTN) to A25 step attenuator	
W59	SR	N5230-20074	1	A25 step attenuator to A19 MASSQuad (ATTN)	
W60	SR	E8356-20072	9	Front panel jumper	
W64	SR	N5230-20091	1	A18 MASSQuad to PORT 3 SOURCE OUT	
W65	SR	N5230-20092	1	A18 MASSQuad to PORT 4 SOURCE OUT	
W66	SR	N5230-20094	1	A19 MASSQuad to A29 reference switch port 1	
W67	SR	N5230-20095	1	A19 MASSQuad to A29 reference switch port 2	
W68	SR	N5230-20100	1	A29 reference switch center port to limiter	
W69	SR	N5230-20093	1	DC block to front panel REFERENCE SOURCE OUT	
W80	SR	N5230-20097	1	REFERENCE RCVR IN to A20 mixer brick (R)	
1	100R	8121-0118	1	A14 system motherboard J8 to A16 test set motherboard J1	
2	50R	8121-0817	1	A41 hard disk drive to A15 CPU board	
3	4W	N5320-60028	1	Front panel LED board J1 to A16 test set motherboard J501	
4	6W	N5230-60015	1	USB hub board J3 to A14 system motherboard J20	

Bottom Cables, Options 146 and 246

Reference Designator	Type ^a	Part Number	Qty	Description
5	26R	N5230-60027	1	A19 MASSQuad J4 to A16 test set motherboard J4
6	16R	N5230-60013	1	A20 mixer brick J1 to A16 test set motherboard J12
7	10R	8121-0819	1	A25 step attenuator to A16 test set motherboard P510 (ATTN)

a. $SR = \underline{semirigid}$ coaxial cable; $F = \underline{f}$ lexible coaxial cable; nR = n wires in a <u>ribbon</u> (flat) cable; nW = n wires in a <u>wrapped</u> cable


Figure 6-16 Bottom Cables, Options 146 and 246

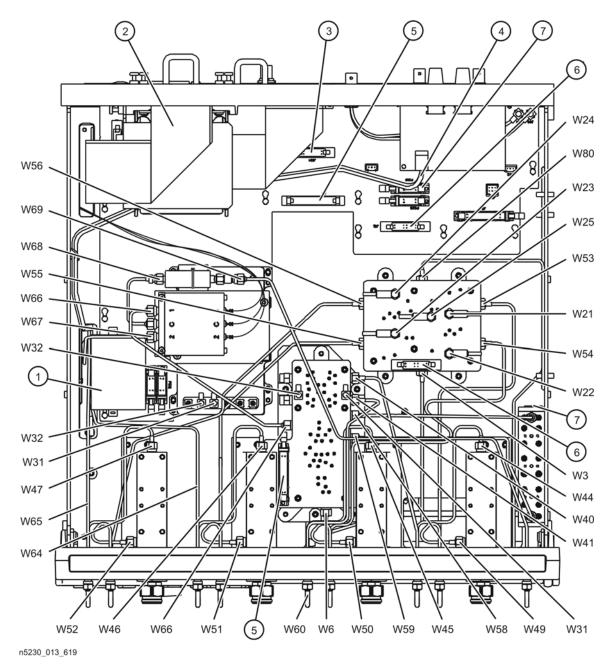


Reference Designator	Part Number	Qty	Description
B1	Fans		Refer to "Internal Hardware and Miscellaneous Parts, All Options" on page 6-38.
1	5022-6134	1	Cable hold down wire
2	N5230-20040	1	Ejector block
3	0515-0374	6	Machine screw, M3.0 x 10, pan head (2 for ejector block ② and four for A14 system motherboard)
4	E8356-40001	1	Air flow plenum
5	0515-0372	16	Machine screw, M3.0 x 6, pan head (5 for A4 power supply, 3 for plenum ④, 6 for A11 vertical motherboard, and 2 for plenum bracket ⑥ and cable hold down wire ① (except Option 246))
6	E8356-00033	1	Plenum bracket
7	1440-0421	2	U-handle, finger grip (1 for hard disk drive, 1 for CPU board)
8	0515-1753	2	Machine screw, with patch lock, M3.0 x 8, pan head (for cable hold down wire ① and plenum bracket ⑥) (Options 146 and 246 only)
9	3050-0891	2	Washer, flat (for patch lock screw (8)) (Options 146 and 246 only)


Top Hardware and Miscellaneous Parts, All Options

Figure 6-17 Top Hardware and Miscellaneous Parts, All Options (Side View)

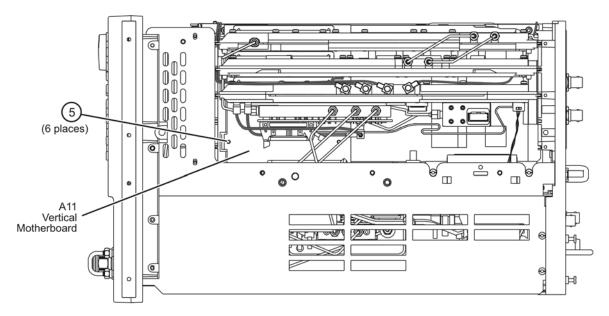

n5230_013_620-1_new

 


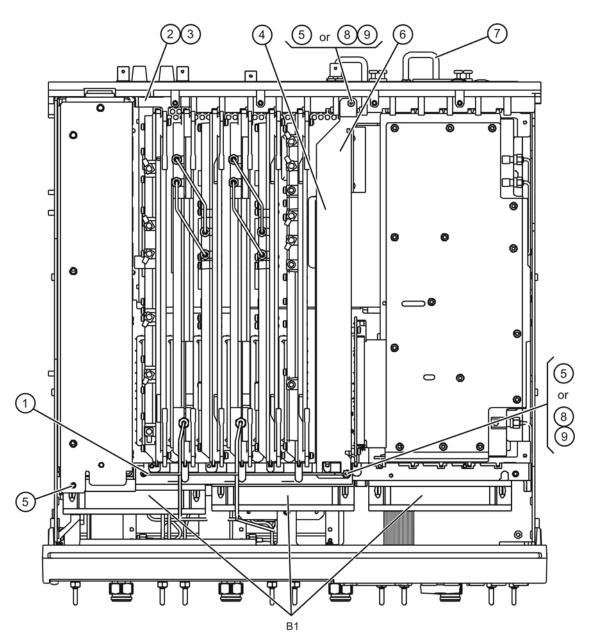


n5230_013_620-2_246

Reference Designator	Part Number	Qty	Description
1	E8361-60059	1	USB hub board
2	0515-1934	2	Machine screw M2.5 x 6 (for mounting USB hub board ①)
3	0515-0430	6	Machine screw M3.0 x 6 pan head (2 for front panel LED board 7 and 4 for A20 mixer brick)
(4)	0515-0372	22	Machine screw M3.0 x 8 pan head (3 for A19 MASSQuad, 3 for MASSQuad block (9), and 4 each for coupler blocks (8))
5	0515-0374	2	Machine screw M3.0 x 10 pan head (for mounting A25 step attenuator)
6	N5230-20080	4	Coupler blocks (for mounting A21–A24 couplers)
7	0515-2012	16	Machine screw M3.5 x 25 pan head (4 each for A21–A24 couplers)
8	N5230-60079	1	Front-panel LED board
9	N5230-20053	1	MASSQuad block (for mounting A19 MASSQuad)
10	N5230-00007	1	Reference switch mounting bracket
(1)	0515-1227	3	Machine screw M3.0 x 6 flat head (for mounting reference switch mounting bracket)
(12)	0515-1992	2	Machine screw M2.5 x 20 pan head (for mounting reference switch)
(13)	1400-0249	1	Cable tie (to attach limiter to cable tie mount)
(14)	1400-1626	1	Cable tie mount (for mounting the limiter)
(15)	0515-0664	4	Machine screw M3.0 x 12 pan head (for A16 test set motherboard)
(16)	E8364-00007	1	Hard disk drive shield, stationary bracket

 Bottom Hardware and Miscellaneous Parts, All Options

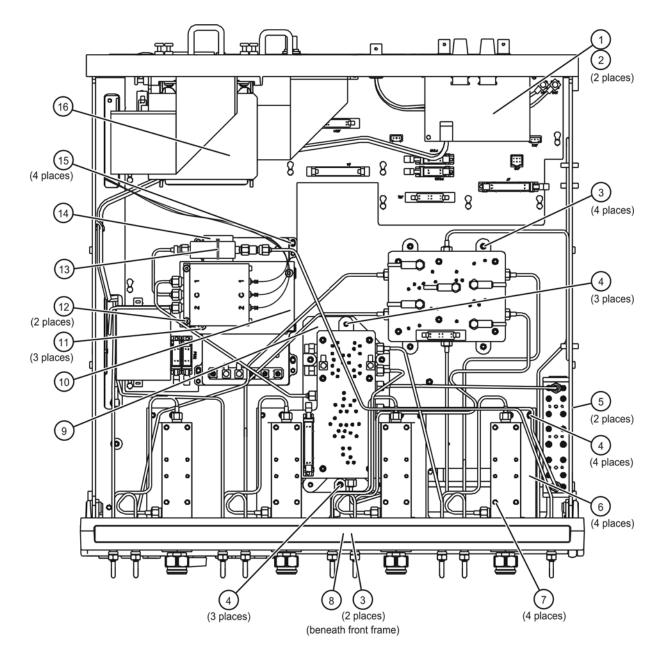




n5230_013_621


Reference Designator	Part Number	Qty	Description
B1	3160-1085	3	Fan
1	E8356-00014	1	Hard disk drive cable interface board bracket
2	E8356-60024	1	Hard disk drive cable interface board
3	0515-1227	10	Machine screw, M3.0 x 6 flat head (2 to attach ② to ①, 8 to attach ⑧ to ⑥)
4	0515-0372	6	Machine screw, M3.0 x 8, pan head (2 to attach ① to CPU board cover, 4 to attach ① to ⑤)
5	E8356-00027	1	Chassis assembly
6	N5230-00003	1	Test set deck
7	N5230-20081	4	Test port coupler dress nut
8	N5230-00004	1	Test set deck front panel
9	P/O RF cable	18	3.5 mm (f) bulkhead connectors
10	P/O RF cable	18	Washer (for bulkhead connectors, (9))
(1)	P/O RF cable	18	Hex nut (for bulkhead connectors, (9)
(12)	E8356-40004	1	Line switch button
(13)	1460-2632	1	Line switch spring
(14)	N5230-60043	1	Midweb assembly (includes three fans, B1)
(15)	E8364-00021	1	Clamp, ribbon cable
(16)	0515-0374	1	Machine screw M3.0 x 10, pan head (for cable clamp, (15))


Figure 6-20 Internal Hardware and Miscellaneous Parts, All Options

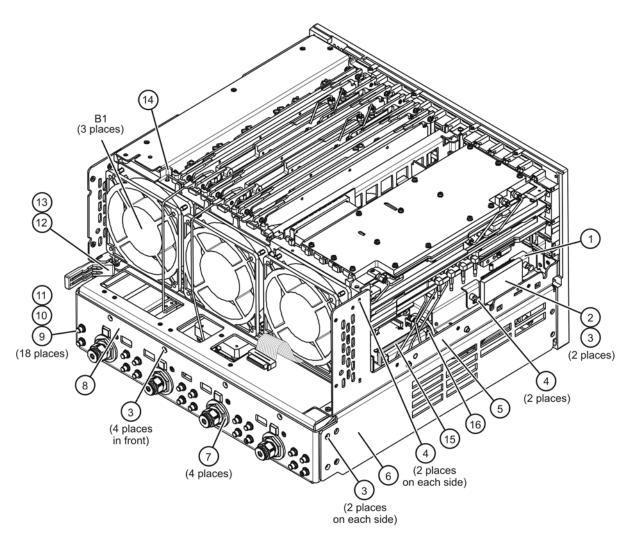

n5230_013_616_new

Reference Designator	Part Number	Qty	Description
1	N5230-00018	1	Inner cover
2	N5230-40001	3	Retainer block (foam pad) on inside of inner cover (Options 146 and 246 only)
3	0515-1227	4 or 5	Machine screw M3.0 x 6, flat head
4	N5230-00011	1	Outer cover
5	5041-9611	4	Rear feet
6	0515-1619	4	Machine screw M4.0 x 25, pan head
\overline{O}	E4400-60026	2	Strap handle assembly (includes item (8))
8	0515-0372	7	Machine screw M3.0 x 8,pan head
9	0515-0710	4	Machine screw M5.0 x 18, flat head
10	5041-9167	4	Bottom feet
(11)	5041-9183	2	With handles—front handle side trim
	5041-9174	2	Without handles—trim strip, filler
(12)	5063-9205	2	Front handle
(13)	E8361-20067	2	Clip, retainer (Options 146 and 246 only)
(14)	0515-1644	2	Machine screw M3.0 x 12, flat head (for retainer clip, item (3))

 

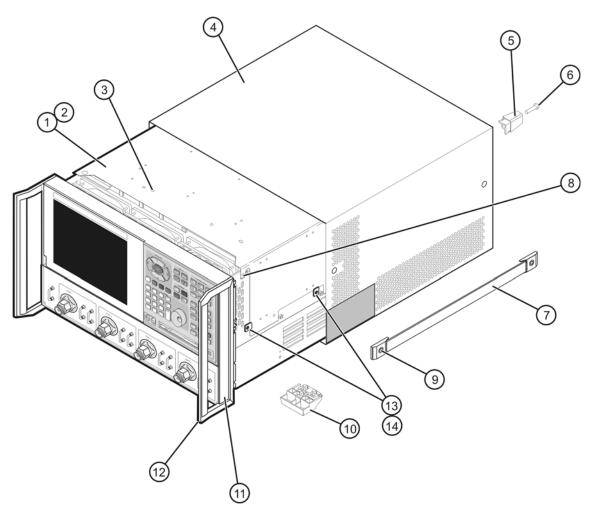


n5230_013_610_new

Item Number	Part Number	Qty	Description
1	E8364-60023	1	Rear frame assembly (includes items $(2)_{-}(7)$)
2	E8356-00023	1	Cover plate, large
3	6960-0149	5	Hole plug
4	0515-0372	33	Machine screw, M3.0 x 8, pan head
5	8120-5055	2	BNC cable assembly
6	2950-0035	4	Hex nut (for BNC connector, (5) and (8))
7	2190-0102	4	Lock washer (for BNC connector, (5) and (8))
8	8120-5027	2	BNC cable assembly
9	E8356-00022	1	Cover plate, digital section
10	0515-0374	9	Machine screw, M3.0 x 10, pan head (to secure item (1))
11	N5230-00002	1	Test set motherboard rear panel (P/O A16)
(12)	85047-60005	2	Fuse holder (includes wire harness, nut, and washer) ^a
(13)	1400-0112	2	Fuse holder cap
(14)	E8364-60095	1	Hard disk drive stationary board with mating connector
(15)	1440-0421	2	U-handle, finger grip (1 for hard disk drive and 1 for CPU board)
16	0515-1227	4	Machine screw, M3.0 x 6, flat head (for U-handles, (16))
17	0515-1410	2	Machine screw, M3.0 x 20, pan head (to secure item (14))

a. See page 6-48 for the part number of the fuses.



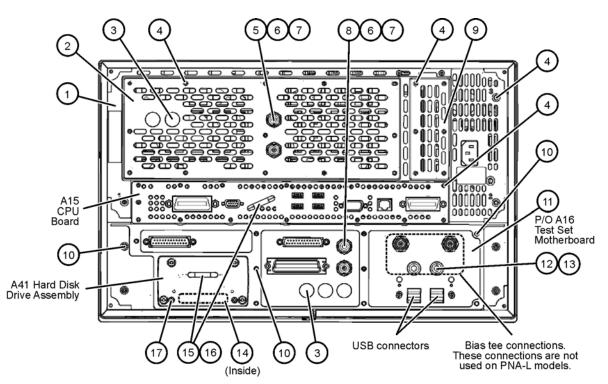

n5230_013_611

Hard Disk Drive Assembly, All Options

Parallel ATA Interface

Every PNA shipped prior to January 2009 contains the parallel ATA interface for the hard disk drive (HDD). Starting January 2009, every PNA shipped contains the serial ATA interface for the HDD. The table below lists the contents of the HDD with the parallel ATA interface.

Ref. Desig.	Part Number	Qty	Description
	N8982A ^a Kit (for 1.1 GHz CPU board)		Hard disk drive assembly kit with programmed hard disk drive (HDD) (Includes A41 and items ① through ⑦, pre-assembled.)
A41	N5230-60048	1	Programmed hard disk drive
1	E8364-20118	1	Hard disk drive bracket
2	0515-0664	4	Machine screw, M3.0 x 12 pan head
3	0515-0372	2	Machine screw, M3.0 x 8 pan head
4	0340-1525	8	Bushing
5	E8364-60094	1	Hard disk drive board
6	1440-0421	1	U-handle, finger grip
\overline{O}	0515-1227	2	Machine screw, M3.0 x 6 flathead (for U-handle)

a. All new N8982A assemblies will be shipped with serial ATA hard drives and associated hardware.

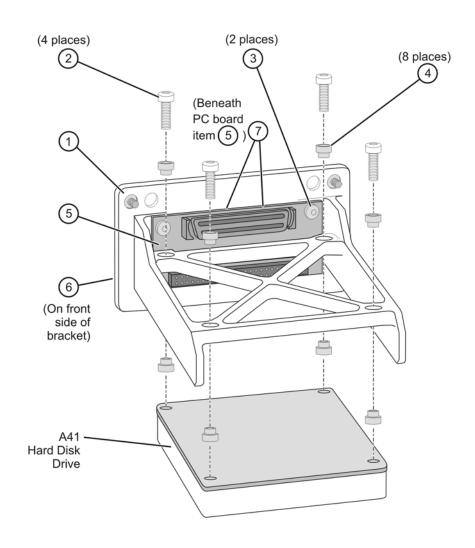


Figure 6-23. Hard Disk Drive Assembly (Parallel ATA Interface)

Note: The N8982A hard disk drive kit includes the A41 hard disk drive and items 1 through 7, pre-assembled.

st532a_new

Serial ATA Interface

Every PNA shipped prior to January 2009 contains the parallel ATA interface for the hard disk drive (HDD). Starting January 2009, every PNA shipped contains the serial ATA interface for the hard disk drive (HDD). The table below lists the contents of the HDD with the serial ATA interface.

Ref. Desig.	Part Number	Qty	Description
	N8982A Kit (for 1.1 GHz CPU board)		Hard disk drive assembly kit with programmed hard disk drive (HDD) (Includes A41 and items ① through ⑧, pre-assembled.)
A41	N5230-60050	1	Programmed hard disk drive
1	E8364-20118	1	Hard disk drive bracket
2	0515-0664	4	Machine screw, M3.0 x 12 pan head
3	0515-0372	2	Machine screw, M3.0 x 8 pan head
4	E8361-20069	4	Bushing
5	E8361-63125	1	Hard disk drive board
6	1440-0421	1	U-handle, finger grip
(7)	0515-1227	2	Machine screw, M3.0 x 6 flathead (for U-handle)
8	E8361-20068	1	Nylon spacer

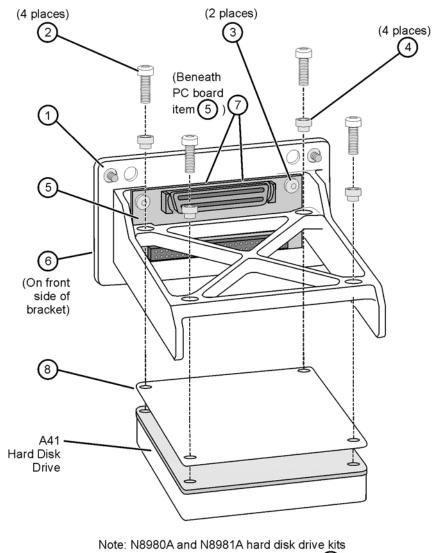


Figure 6-24 Hard Disk Drive Assembly (Serial ATA Interface)

include the A41 hard disk drive and items 1 through 8, pre-assembled.

St532a1

Miscellaneous Part Numbers

Table 6-3 Part Numbers for Miscellaneous Parts and Accessories

Description	Model or Part Number
Service Tools	
Extender board, synthesizer/reference	E8356-60021
1/4 inch and 5/16 inch open-end wrench, thin profile	8710-0510
5/16 inch (8 mm), open-end torque wrench; 0.9 N-m (8 in-lb)	8710-1765
20 mm open-end torque wrench; 0.9 N-m (8 in-lb)	8710-1764
Spanner wrench	08513-20014
Documentation	
Installation and Quick Start Guide (for all PNA analyzers) (Cannot be ordered. Part number is for reference only. Must be printed from the Agilent Web site. Refer to "Printing Copies of Documentation from the Web" on page iv.)	E8356-90001
Service Guide. (Not available in printed form. Part number is for reference only. Must be printed from the Agilent Web site. Refer to "Printing Copies of Documentation from the Web" on page iv.)	N5230-90024
Protective Caps for Connectors	
Protective cap for GPIB connector	1252-5007
Protective cap for Test Set I/O connector	1252-1935
Protective cap for Aux I/O connector	1252-4691
Protective cap for Handler I/O connector	1253-5320
Protective cap for Display (VGA) connector	1252-0220
Protective cap for Serial (RS-232) connector	1252-3422
Protective cap for Parallel (1284-C) connector	1252-1935
GPIB Cables/GPIB Adapter	
GPIB cable, 0.5 meter (1.6 feet)	10833D
GPIB cable, 1 meter (3.3 feet)	10833A
GPIB cable, 2 meter (6.6 feet)	10833B
GPIB cable, 4 meter (13.2 feet)	10833C
GPIB cable to GPIB cable adapter	10834A
Battery	
Battery, lithium, 3V, 0.22A-HR (located on the A15 CPU board)	1420-0356
Fuses	1
Rear Panel Bias Input Fuse Port 1, Port 2 (0.5 A, 125 V) (Option UNL)	2110-0046

Description	Model or Part Number
ESD Supplies	
Adjustable antistatic wrist strap	9300-1367
Antistatic wrist strap grounding cord (5 foot length)	9300-0980
Static control table mat and earth ground wire	9300-0797
ESD heel strap	9300-1126
EMI/RFI Shielding Accessories	1
7 mm ferrite bead for serial cable	9170-1793
9 mm ferrite bead for parallel port	9170-1702
Memory Modules	
256 MB module, 32 M x 64, PC100, 144-pin, SO DIMM	1818-8825
Upgrade Kits	L
Time Domain (Option 010)	N5230CU-010
Frequency Offset Mode (Option 080)	N5230CU-080
Add built-in performance test software for Agilent inclusive calibration perpetual license (Option897)	N5230CU-897
Add built-in performance test software for standards compliant calibration perpetual license (Option898)	N5230CU-898
13.5 GHz or 20 GHz Standard Test Set to Configurable Test Set with Extended Power Range (Option 140 to 145 or 240 to 245)	N5230CU-926
Add Second Source to 13.5 GHz Configurable Test Set with Extended Power Range (Option 145 to 146)	N5230CU-928
Add Second Source to 20 GHz Configurable Test Set with Extended Power Range (Option 245 to 246)	N5230CU-927
Frequency Extension, 13.5 to 20 GHz (Option 140 to 240 or 145 to 245)	N5230CU-966
USB Accessories	
Mouse	1150-7799
Keyboard (U.S. style)	1150-7896
Read/write CD-ROM	N4688A
Rack Mount Kits and Handle Kits	•
Rack mount kit for use with standard supplied front handles (Option 1CP)	5063-9237
Rack mount flange for use with front handles (two included in 5063-9237)	5022-2809
Rack mount kit for use without front handles (Option 1CM)	5063-9217
Rack mount flange for use without front handles (two included in 5063-9217)	5022-2802
Front handle kit (two handles and hardware)	5063-9230
Front handle (two included in 5063-9230)	5063-9205
Rack mount rail set	E3663AC

Table 6-3 Part Numbers for Miscellaneous Parts and Accessories (Continued)

Description	Model or Part Number
Touch-up Paint	
Dove gray (for use on frame around front panel and painted portion of handles)	6010-1146
French gray (for use on cover)	6010-1147
Parchment white (for use on rack mount flanges, rack support flanges, and front panels)	6010-1148

Table 6-3 Part Numbers for Miscellaneous Parts and Accessories (Continued)

7 Repair and Replacement Procedures

Information in This Chapter

This chapter contains procedures for removing and replacing the major assemblies of your Agilent Technologies PNA series microwave network analyzer.

Chapter Seven at-a-Glance

Section Title	Summary of Content	Start Page
Personal Safety Warnings	Warnings and cautions pertaining to personal safety.	Page 7-3
Electrostatic Discharge (ESD) Protection	Information pertaining to ESD protection.	Page 7-3
Assembly Replacement Sequence	The proper assembly replacement sequence for your analyzer.	Page 7-4
Table of Removal and Replacement Procedures	1	
Removal and Replacement Procedures	The actual procedures for removing and replacing the major assemblies in your analyzer. The procedures occur in assembly reference designator numerical order.	See Table 7-1 on page 7-4 for specific procedures.
Post-Repair Procedures	A table for the proper tests, verifications, and adjustments to perform on your analyzer after repair.	Page 7-58

Personal Safety Warnings

WARNING	These servicing instructions are for use by qualified personnel only. To avoid electrical shock, do not perform any servicing unless you are qualified to do so.
WARNING	The opening of covers or removal of parts is likely to expose dangerous voltages. Disconnect the analyzer from all voltage sources while it is being opened.
WARNING	Procedures described in this document may be performed with power supplied to the product while protective covers are removed. Energy available at many points may, if contacted, result in personal injury.
WARNING	The power cord is connected to internal capacitors that may remain live for 10 seconds after disconnecting the plug from its power supply assembly. Wait at least 10 seconds, after disconnecting the plug, before removing the covers.
WARNING	The detachable power cord is the instrument disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the instrument. The front panel switch is only a standby switch and is not a LINE switch (disconnecting device).
WARNING	Danger of explosion if battery is incorrectly replaced. Replace only with the same or equivalent type recommended. Discard used batteries according to manufacturer's instructions.

Electrostatic Discharge (ESD) Protection

CAUTION	Many of the assemblies in this instrument are very susceptible to damage from electrostatic discharge (ESD). Perform the following procedures only at a static-safe workstation and wear a grounded wrist strap.
	This is important. If not properly protected against, electrostatic discharge can seriously damage your analyzer, resulting in costly repair.
	To reduce the chance of electrostatic discharge, follow all of the recommendations outlined in "Electrostatic Discharge Protection" on page 1-6, for all of the procedures in this chapter.

Assembly Replacement Sequence

The following steps show the sequence that you should follow to replace an assembly in the network analyzer.

- Step 1. Identify the faulty group. Begin with Chapter 4, "Troubleshooting."
- Step 2. Order a replacement assembly. Refer to Chapter 6, "Replaceable Parts."
- **Step 3.** Replace the faulty assembly and determine what adjustments are necessary. Refer to "Post-Repair Procedures" in this chapter.
- Step 4. Perform the necessary adjustments. Refer to Chapter 3, "Tests and Adjustments."
- **Step 5.** Perform the necessary performance tests. Refer to Chapter 3, "Tests and Adjustments."

Removal and Replacement Procedures

Reference Designator	Assembly Description	Location
None	Battery	Page 7-56
None	Covers, outer and inner	Page 7-6
None	Front panel USB connector board	Page 7-12
None	Touchscreen controller board	Page 7-10
None	Touchscreen display assembly	Page 7-13
None	Display inverter board	Page 7-10
None	DC block (Options 146 and 246)	Page 7-44
None	Front panel assembly	Page 7-8
None	Limiter (Options 146 and 246)	Page 7-44
None	Midweb and fans	Page 7-53
None	Plenum bracket	Page 7-16
None	USB hub board (part of A16 test set motherboard procedure)	Page 7-28
A1 A2 A3	Keypad assembly Display assembly Front panel interface board	Page 7-10
A4	Power supply assembly	Page 7-14
A5 A6, A8 A7, A9 A10	SPAM board Multiplier boards Fractional-N synthesizer boards Frequency reference board	Page 7-16
A11	Vertical motherboard (Options 146 and 246)	Page 7-18

Table 7-1List of Procedures

Reference Designator	Assembly Description	Location
A12 A13	Multiplier board (Options 146 and 246) Fractional-N synthesizer board (Options 146 and 246)	Page 7-20
A14	System motherboard	Page 7-22
A15	CPU board	Page 7-24
A16	Test set motherboard	Page 7-28
A17	QABC board (Options 146 and 246)	Page 7-30
A18	MASS 26.5 (MASSQuad) (Options 146 and 246)	Page 7-32
A19	MASS 26.5 (MASSQuad)	Page 7-34
A20	Mixer brick (QuintBrick)	Page 7-36
A21 A22 A23 A24	Test port 1 coupler Test port 2 coupler Test port 3 coupler Test port 4 coupler	Page 7-38
A25	60-dB source step attenuator (Option 1E1)	Page 7-40
A26	60-dB source step attenuator (Options 146 and 246)	Page 7-42
A29	Reference switch (Options 146 and 246)	Page 7-44
A40	Not used.	
A41	Hard disk drive	Page 7-46

Table 7-1	List of Procedures	(Continued)
-----------	--------------------	-------------

Removing the Covers

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)

Removing the Outer Cover

CAUTION This procedure is best performed with the analyzer resting on its front handles in the vertical position. *Do not place the analyzer on its front panel without the handles.* This will damage the front panel assemblies.

Refer to Figure 7-1. for this procedure.

- 1. Disconnect the power cord.
- 2. With a T-20 TORX driver, remove the strap handles (item ①) by loosening the screws (item ②) on both ends until the handle is free of the analyzer.
- 3. With a T-20 TORX driver, remove the four rear panel feet (item ③) by removing the center screws (item ④).
- 4. Slide the four bottom feet (item (5)) off the cover.
- 5. Slide the cover off of the frame.

Removing the Inner Cover

 
Refer to Figure 7-1. for this procedure.


- 1. With a T-10 TORX driver, remove the cover attachment screws (item [®]). Some of these screws are flat head and some are pan head. Note the locations of each type for reinstallation.
- 2. Options 146 and 246 only: With a T-10 TORX driver, loosen the screws on the two retainer clips (item ⑦).
- 3. Lift off the cover.

Replacement Procedure

Reverse the order of the removal procedures.

For Options 146 and 246: Be sure that the cover is located behind the two retainer clips (item \overline{O}) before installing the cover screws (item \underline{O}). Remember to tighten the retainer clips screws. The retainer clips may rotate slightly when the screws are tightened; this is normal and acceptable.



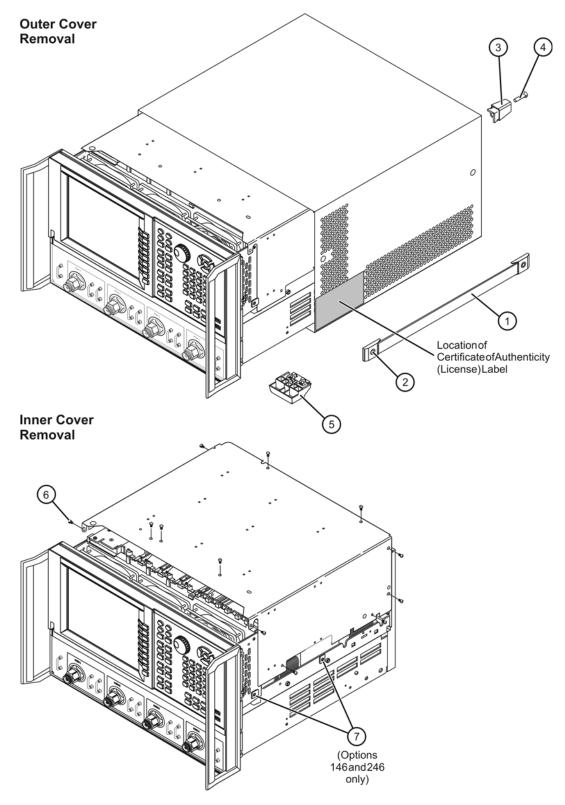

n5230_013_718_new

Removing and Replacing the Front Panel Assembly

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-2 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6.
- 3. With a 5/16 inch torque wrench, remove all the semirigid jumpers (item (1)) from the front panel (Option 014 only).
- 4. With a T-10 TORX driver, remove the eight screws (item ⁽²⁾) from the sides of the frame.

CAUTION	Before removing the front panel from the analyzer, lift and support the front
	of the analyzer frame.

- 5. Slide the front panel over the test port connectors.
- 6. Disconnect the front panel interface ribbon cable (item ③).

The front panel is now free from the analyzer.

Replacement Procedure

CAUTION When replacing the front panel, be sure to align the power switch to its corresponding front panel cutout.


IMPORTANT When reconnecting semirigid cables, torque the cable connectors to 10 in-lb.

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.

2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Figure 7-2 Front Panel Assembly Removal

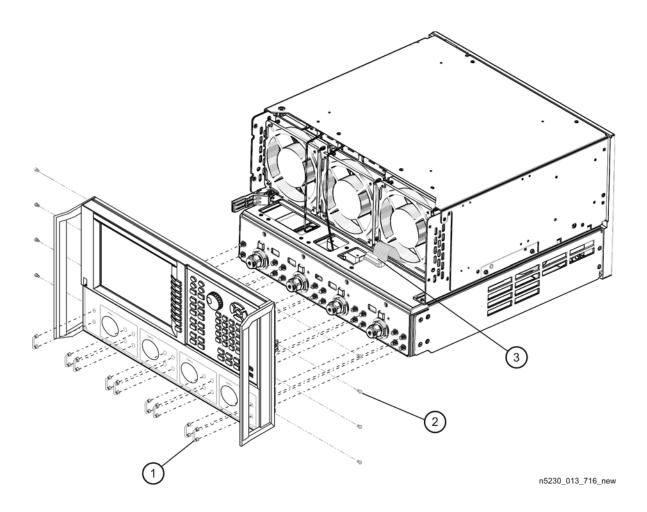

Removing and Replacing Front Panel Subassemblies

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Refer to Figure 7-3 for the following procedures.

Pre-replacement Procedure

- 1. Disconnect the power cord.
- 2. Remove the front panel assembly. Refer to "Removing and Replacing the Front Panel Assembly" on page 7-8.

Replacing the Inverter Board

- 1. Remove the inverter board shield by removing the two retaining screws (item ①).
- 2. Disconnect the two A2 display cables (item 2) from the inverter board.
- 3. Disconnect the inverter cable (item (3)) from the inverter board.
- 4. Remove the two retaining screws (item ④) from the inverter board.
- 5. Remove the inverter board from the front panel assembly.
- 6. Install the new inverter board by reversing the removal instructions.
- 7. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.


Replacing the Touch Screen Controller Board

- 1. Disconnect the touch screen display cable (item 5) from the touch screen controller board.
- 2. Disconnect the touch screen controller cable (item [®]) from the touch screen controller board. NOTE THAT THE CABLE CONNECTS TO THE UPPER FIVE PINS ON THE CONTROLLER BOARD CONNECTOR. THIS IS IMPORTANT FOR RE-INSTALLATION. Refer to Figure 7-4 on page 7-13 for an illustration of the cable and connector.
- 3. Remove the two retaining screws (item $(\overline{2})$) from the touch screen controller board.
- 4. Remove the touch screen controller board from the front panel assembly.
- 5. Install the new touch screen controller board by reversing the removal instructions.
- 6. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.

Replacing the A2 Display Assembly

- 1. Remove the inverter board. Refer to procedure on page 7-10. Remove the inverter cable from the cable clamp (item (8)).
- 1. Remove the touch screen controller board. Refer to above procedure.
- 2. Remove the six retaining screws (item (9)) from the A2 display assembly.
- 3. Remove the A2 display assembly from the front panel assembly.
- 4. Install the new A2 display assembly by reversing the removal instructions.
- 5. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.

Figure 7-3 Front Panel Subassemblies Removal

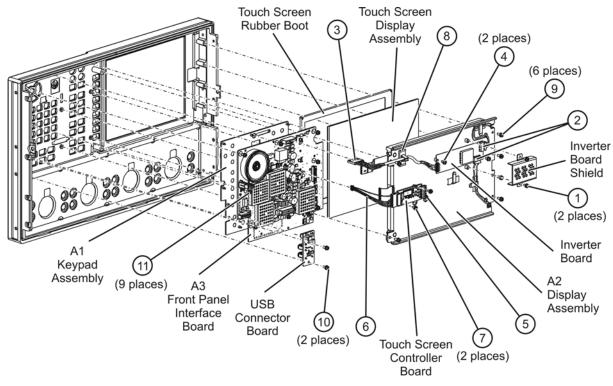

n5230_024_701

Replacing the USB Connector Board

- 1. Remove the two retaining screws (item 0) from the USB connector board.
- 2. Carefully unplug the USB connector board from the A3 front panel interface board and remove it from the front panel assembly
- 3. Install the new USB controller board by reversing the removal instructions.
- 4. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.

Replacing the A3 Front Panel Interface Board

- 1. Remove the round knob (RPG) from the front panel by gently pulling the knob forward.
- 2. Disconnect the inverter cable (item 3) from the A3 front panel interface board.
- 3. Disconnect the touch screen controller cable (item ⁽⁶⁾) from the A3 front panel interface board.
- 4. Remove the USB connector board. Refer to previous procedure.
- 5. Remove the nine retaining screws (item ①) from the A3 front panel interface board.
- 6. Remove the A3 front panel interface board from the front panel assembly.
- 7. Note how the A1 keypad assembly is attached to the A3 front panel interface board to aid in installing it on the new A3 front panel interface board.
- 8. Carefully remove the A1 keypad assembly from the A3 front panel interface board.
- 9. Install the A1 keypad assembly on the new A3 front panel interface board.
- 10.Reinstall the A3 front panel interface board by removing the removal instructions.
- 11.Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.


Replacing the A1 Keypad Assembly

- 1. Remove the A3 front panel interface board as instructed above.
- 2. Note how the A1 keypad assembly is attached to the A3 front panel interface board to aid in installing the new one.
- 3. Carefully remove the A1 keypad assembly from the A3 front panel interface board.
- 4. Install the new A1 keypad assembly on the A3 front panel interface board.
- 5. Reinstall the A3 front panel interface board by reversing the removal instructions.
- 6. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.

Replacing the Touch Screen Display Assembly

- 1. Refer to Figure 7-3 and Figure 7-4 for this procedure.
- 2. Remove the A2 display assembly. Refer to the procedure on page 7-11.
- 3. Note the orientation of the touch screen display in the front panel frame. THIS IS VERY IMPORTANT. THE NEW ONE MUST BE INSTALLED IN EXACTLY THE SAME ORIENTATION. Refer to Figure 7-4.
- 4. Carefully lift the touch screen display and remove it from the front panel assembly.
- 5. Note the orientation of the rubber boot surrounding the touch screen display. THIS IS VERY IMPORTANT. THE BOOT MUST BE REINSTALLED EXACTLY AS IT WAS.
- 6. Remove the protective cover from the new touch screen then remove the rubber boot from the old touch screen and install it on the new touch screen. Refer to Figure 7-4.
- 7. Install the new touch screen display and the A2 display by reversing the removal instructions. Refer to Figure 7-4. REMEMBER, THE TOUCHSCREEN CONTROLLER CABLE CONNECTS TO THE UPPER FIVE PINS ON THE CONTROLLER BOARD CONNECTOR.
- 8. Perform the post-repair adjustments, verifications, and performance tests that pertain to this replacement procedure. Refer to Table 7-2 on page 7-58.

Figure 7-4 Touch Screen Display and Rubber Boot Installation

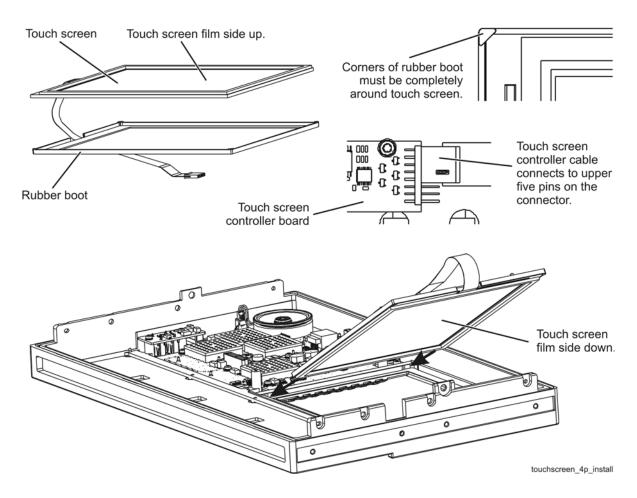

Removing and Replacing the A4 Power Supply Assembly

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-5 for this procedure.


- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. With a T-10 TORX driver, remove the five screws (item 1) from the power supply assembly.
- 4. Lift out and remove the A4 power supply assembly.

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.

Figure 7-5 A4 Power Supply Assembly Removal

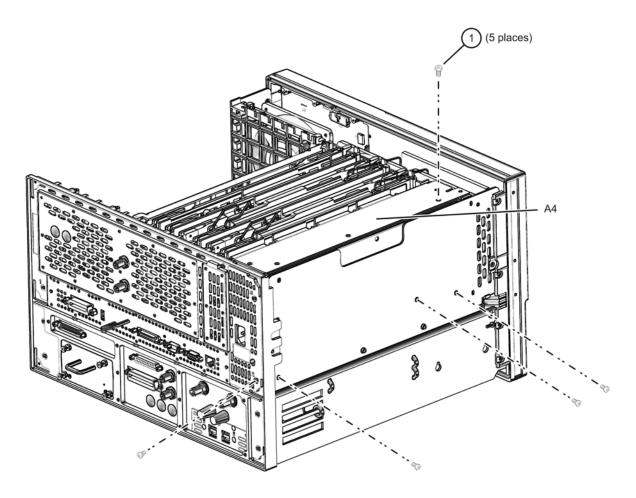

n5230_013_701

Removing and Replacing the A5 through A10 Boards

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-6 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. With a T-10 TORX driver, remove the cable hold down wire that secures cables to the top of the midweb by removing the attachment screw (item (1)).
- 4. Remove any or all of the A5 through A10 boards:
 - a. Identify the board you want to remove and disconnect any cables that are attached to it.

NOTE	Before removing the board completely, check the bottom of the board for any
	attached cables and disconnect them.

b. While holding onto the extractors (item (2)), slide the board out of the slot and remove it from the analyzer.

Replacement Procedure

1. Reverse the order of the removal procedure. When reinstalling the cable hold down wire, be sure that all cables are positioned so that they will not be pinched.

Use the tools specified for all cable connections and mounting screws.

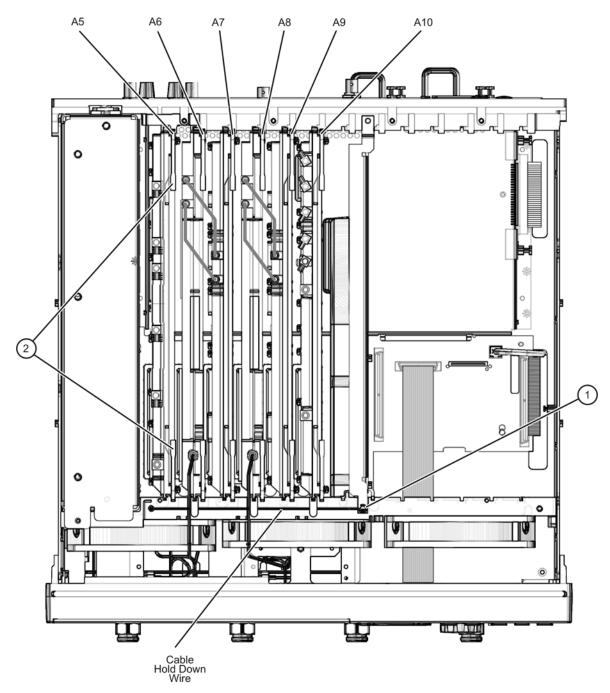


Figure 7-6 A5 through A10 Board Assemblies Removal

n5230_013_702_new

Removing and Replacing the A11 Vertical Motherboard and the Plenum Bracket

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-7 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the A12 multiplier and A13 fractional-N synthesizer boards. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 4. Remove the A17 QABC board. Refer to "Removing and Replacing the A17 QABC Board" on page 7-30.
- 5. Remove the A11 vertical motherboard:
 - a. Remove the six mounting screws (item 1) from the A11 vertical motherboard.
 - b. Lift the A11 vertical motherboard out of the A14 system motherboard connector and remove it from the analyzer.
- 6. Remove the plenum bracket:
 - a. Remove the two screws (item (2)) holding the plenum bracket in place.
 - b. Remove the plenum bracket from the analyzer.

Replacement Procedure

1. Reverse the order of the removal procedure. If the plenum bracket was removed, reinstall it first and leave the attachment screws loose until the A11 vertical motherboard has been securely fastened.

Use the tools specified for all mounting screws.

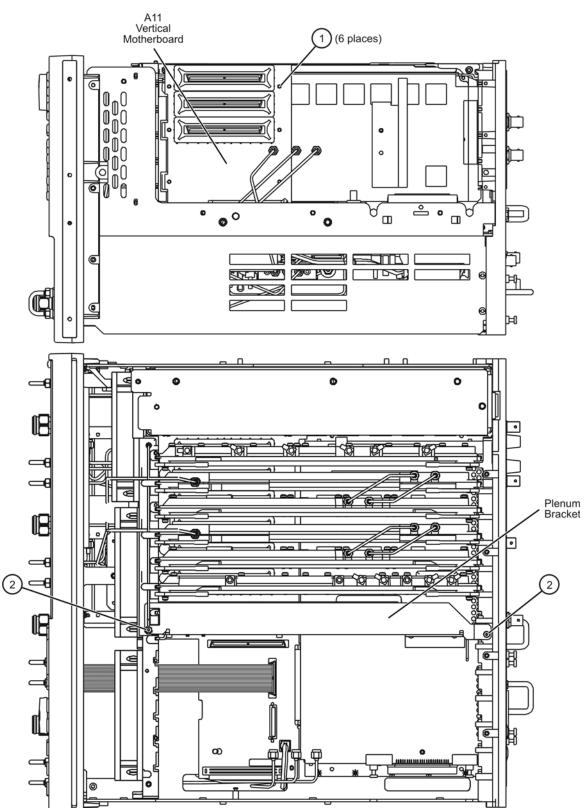


Figure 7-7 A11 Vertical Motherboard and Plenum Bracket Removal

n5230_013_725_new

Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

 
Refer to Figure 7-8 for this procedure.


- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. The A13 fractional-N synthesizer board must be removed before the A12 multiplier board can be removed.
- 4. Remove the A13 fractional-N synthesizer board:
 - a. Disconnect cable W73 from the A17 QABC board. This cable is attached to the bottom of the A13 fractional-N synthesizer board.
 - b. Remove jumper cables W61 and W62 and slide the A13 fractional-N synthesizer board out of the analyzer being careful not to damage any adjacent components.
- 5. Remove the A12 multiplier board:
 - a. Disconnect cable W63 and, while holding this cable out of the way, slide the A12 multiplier board out of the analyzer. Be careful not to over bend the W63 cable.

Replacement Procedure

1. Reverse the order of the removal procedure. Be especially careful not to damage cable W63.

Use the tools specified for all cable connections and mounting screws.



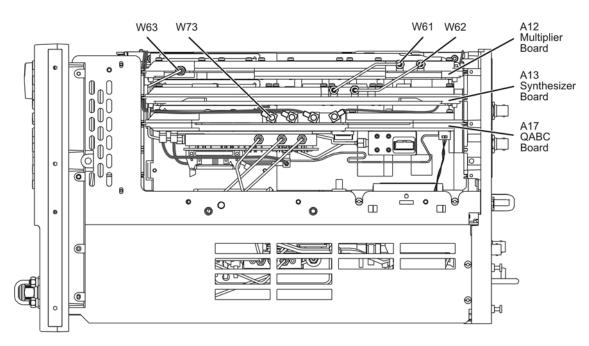

n5230_013_724_new

Removing and Replacing the A14 System Motherboard

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-9 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the front panel assembly. Refer to "Removing and Replacing the Front Panel Assembly" on page 7-8.
- 4. Remove the A4 power supply assembly. Refer to "Removing and Replacing the A4 Power Supply Assembly" on page 7-14.
- 5. Remove the A5 through A10 boards and the plenum bracket. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 6. Remove the A12 multiplier and A13 fractional-N synthesizer boards. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 7. Remove the A17 QABC board. Refer to "Removing and Replacing the A17 QABC Board" on page 7-30.
- 8. Remove the A11 vertical motherboard. Refer to "Removing and Replacing the A11 Vertical Motherboard and the Plenum Bracket" on page 7-18.
- 9. Remove the A15 CPU board. Refer to "Removing and Replacing the A15 CPU Board" on page 7-24.
- 10. Remove the Midweb. Refer to "Removing and Replacing the Midweb and the B1 Fan" on page 7-53.
- 11. Remove the ribbon cable clamp (item (())) by removing the attachment screw (item ()). Set the cable clamp aside for reinstallation later.
- Disconnect the front panel ribbon cable (item ①), the USB hub assembly cable (item ②), and the test set motherboard ribbon cable (item ③) from the A14 system motherboard.
- 13. Remove the remaining three screws (item 4) that secure the A14 system motherboard.
- 14. Remove the power switch push button (item (5)) and spring (item (6)).
- 15. Slide the A14 system motherboard toward the front of the analyzer to release the hold-down pins (item $\overline{7}$) and lift the motherboard out of the analyzer.


Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.

2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Figure 7-9 A14 System Motherboard Removal

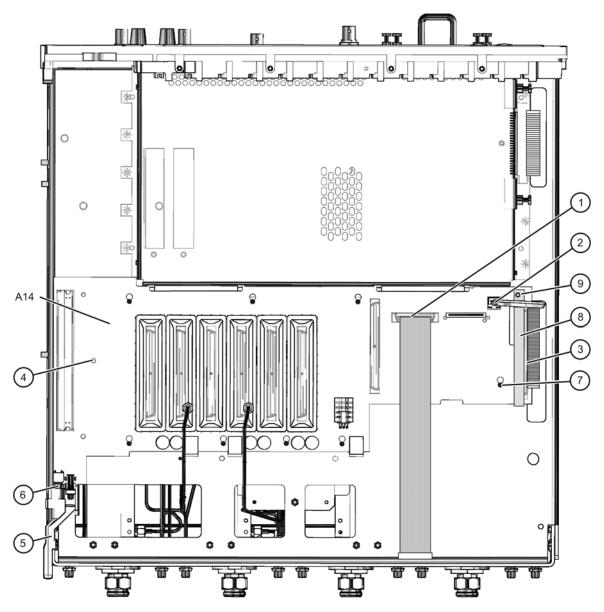

n5230_013_715_new

Removing and Replacing the A15 CPU Board

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-10 for this procedure.


- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Disconnect the hard disk drive assembly (HDDA) ribbon cable and interface board from the A15 CPU board by removing the two screws (item ①).
- 4. Disengage the A5 SPAM board from the A15 CPU board by performing the following steps.
 - a. Lift the two extractors located at each end of the board.
 - b. While holding onto the extractors, lift the board halfway out of the slot.
 - c. Let the extractors drop to their normal position.
 - d. Lower the board into the slot.

The board should now rest above its normal seated position.

- 5. With a T-10 TORX driver, remove the 14 screws (item ⁽²⁾) from the rear panel of the A15 CPU board.
- 6. Gently pull on the finger grip (item (3)) to disengage the A15 CPU board from the analyzer.
- 7. Slide the A15 CPU board out of the analyzer.

Replacement Procedure

NOTE: If not already done, install a jumper between pins 9 and 10 on connector J11. See the following illustration for the J11 pin configuration. There should already be a jumper between pins 5 and 6.

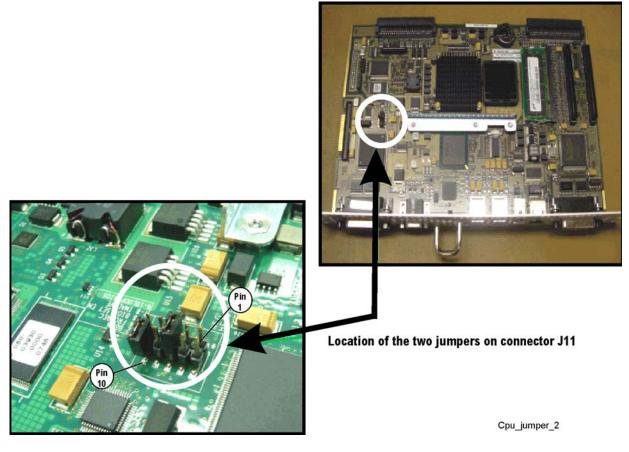


1. Reverse the order of the removal procedure.

Use the tools specified for all mounting screws.

- 2. If a new Certificate of Authenticity (license) label is supplied with your new A15 CPU board, adhere it to the outer cover in the location specified in Figure 7-1. on page 7-7.
- 3. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Figure 7-10 A15 CPU Board Removal

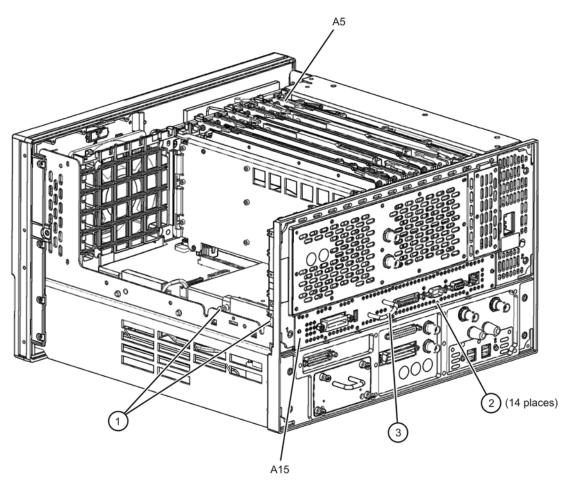

5230_002_703_new

Removing and Replacing the A16 Test Set Motherboard and the USB Hub

Tools Required

- T-8 TORX driver (set to 5 in-lb)
- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-11 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6. Position the analyzer bottom side up.
- 3. Remove the A41 hard disk drive. Refer to "Removing and Replacing the A41 Hard Disk Drive (HDD)" on page 7-46.
- 4. If your analyzer is an Option 146 or Option 246, the A29 reference switch (with its mounting bracket), DC block, and limiter must be removed and reinstalled on the new A16 test set motherboard. Refer to "Removing and Replacing the A29 Reference Switch, Limiter, and DC Block" on page 7-44.
- Remove the hard disk drive shield (item 1) by loosening two attachment screws (item 2), using a T-10 TORX driver. These screws are accessible through holes in the side of the chassis.
- 6. Disconnect the ribbon cables (item (3)) from the A16 test set motherboard:
- 7. Disconnect the wrapped-wire and flexible RF cables (item ④) from the A16 test set motherboard:
- 8. With a T-10 TORX driver, remove nine screws (item (5)) from the rear panel and four screws (item (6)) from the A16 test set motherboard.
- 9. Slide the A16 test set motherboard toward the front of the instrument to release the locking pins (item ⑦), then lift the motherboard and remove it from the analyzer.
- 10. To remove the USB hub, remove two screws (item [®]), using a T-8 TORX driver.

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all mounting screws.

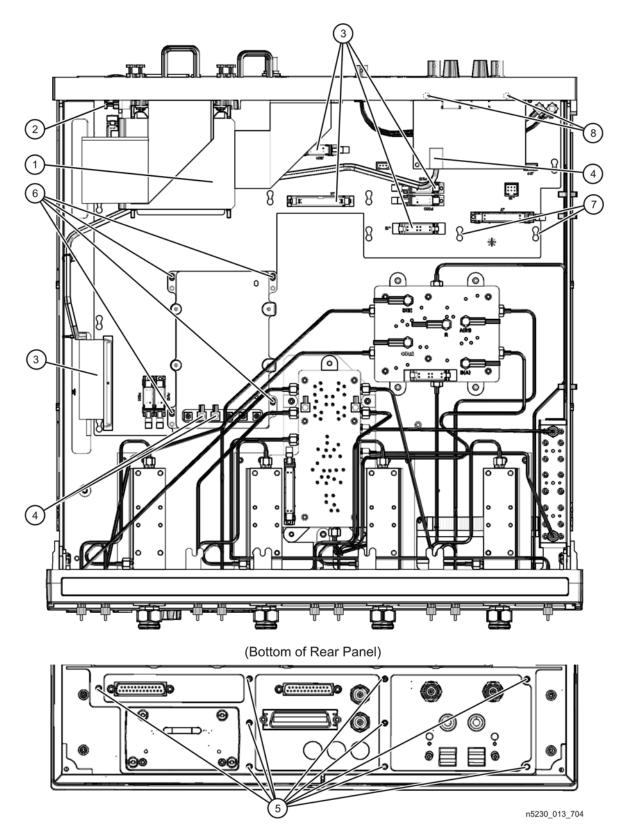


Figure 7-11 A16 Test Set Motherboard Removal

Removing and Replacing the A17 QABC Board

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-12 for this procedure.


- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the A12 multiplier board and the A13 fractional-N synthesizer board. Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.
- 4. Remove the A17 QABC board:
 - a. Disconnect cables W64, W65, W67. It may be necessary to loosen each of these cables at the other end to move them out of the way to remove the A17 QABC board.
 - b. Disconnect flexible cables W70, W71, W72, and W73.
 - c. Disconnect the A29 reference switch cable at A17J10.
 - d. While holding cables W64, W65, and W67 out of the way, remove the A17 QABC board from the analyzer. Be careful not to damage cables W64, W65, and W67.
- 5. Remove the assemblies and cables from the A17 QABC board:
 - a. Remove the A18 MASSQuad from the A17 QABC board. Refer to "Removing and Replacing the A18 MASS 26.5 (MASSQuad)" on page 7-32.
 - b. Remove the A26 step attenuator from the A17 QABC board. Refer to "Removing and Replacing the A26 60-dB Source Step Attenuator" on page 7-42.
 - c. Remove cables W74 and W75 from the A17 QABC board.
 - d. Remove the retainer clips from cables W76 and W77 and remove cables W76 and W77 from the A17 QABC board.

Replacement Procedure


1. Reverse the order of the removal procedure, installing the assemblies and cables removed from the old A17 QABC board onto the new A17 QABC board. Be sure to reinstall the retainer clips on cables W76 and W77 in the locations indicated.

Use the tools specified for all cable connections and mounting screws.



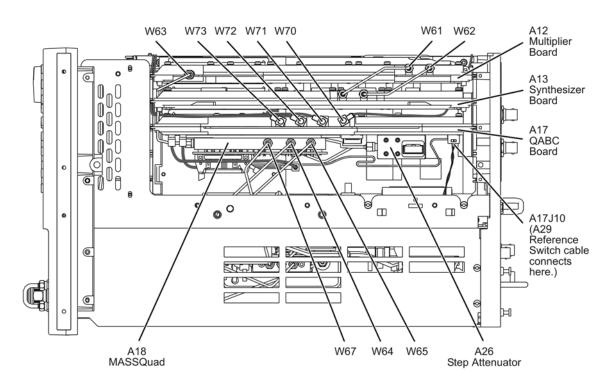

A17 QABC Board

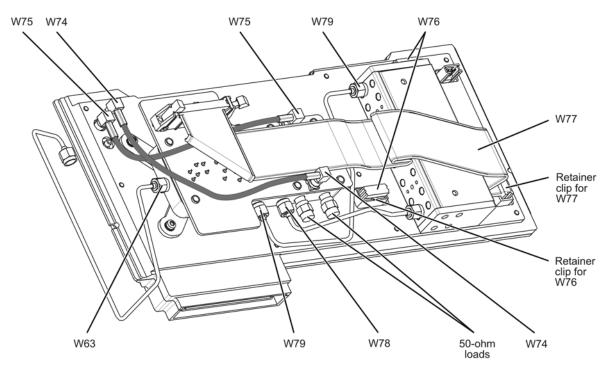

n5230_013_721_new

Removing and Replacing the A18 MASS 26.5 (MASSQuad)

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-13 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the A17 QABC board. Refer to "Removing and Replacing the A17 QABC Board" on page 7-30.
- 4. Remove the A18 MASSQuad from the A17 QABC board:
 - a. Disconnect cables W63, W74, W75, W77, W78, and W79 from the A18 MASSQuad.
 - b. Remove the three mounting screws (item 1) and remove the A18 MASSQuad from the A17 QABC board.

Replacement Procedure

1. Reverse the order of the removal procedure. Before installing the new A18 MASSQuad, remove the two 50-ohm loads from the old A18 MASSQuad and install them on the new A18 MASSQuad.

Use the tools specified for all cable connections and mounting screws.


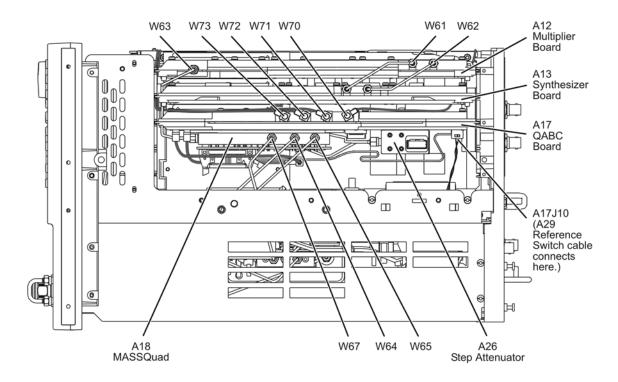


Figure 7-13 A18 MASSQuad Removal

A17 QABC Board

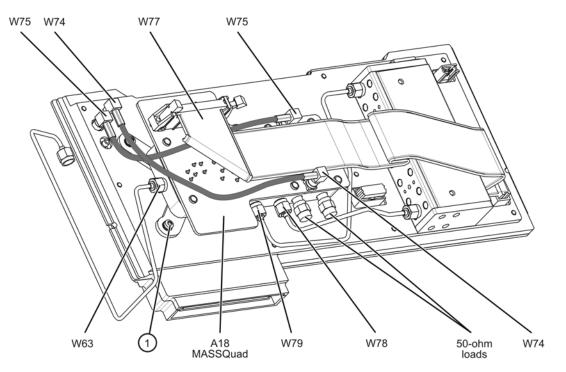

n5230_013_722_new

Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-14 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6. Position the analyzer bottom side up.
- 3. With a 5/16 inch wrench, disconnect the semirigid cables (item ①) from the A19 MASSQuad.
- 4. Disconnect the flexible cables (item 2), and the ribbon cable (item 3) from the A19 MASSQuad.
- 5. With a T-10 TORX driver, remove the mounting screws (item ④) from the A19 MASSQuad.

CAUTION	Be careful not to damage the center pins of the semirigid cables. Some flexing
	of the cables is necessary to remove the assembly. Do not over bend the
	semirigid cables.


- 6. Remove the A19 MASSQuad from the analyzer. Observe the CAUTION above.
- 7. The MASSQuad mounting block can now be removed by removing the attachment screws (item (5)). It is not necessary to remove the mounting block to replace the MASSQuad.

Replacement Procedure

1. Reverse the order of the removal procedure. If your analyzer contains the second source option (Options 146/246), there will be two 50-ohm loads attached to unused ports on the old A19 MASSQuad. Remove these loads and install them on the new A19 MASSQuad before installing it in the analyzer.

Use the tools specified for all cable connections and mounting screws.



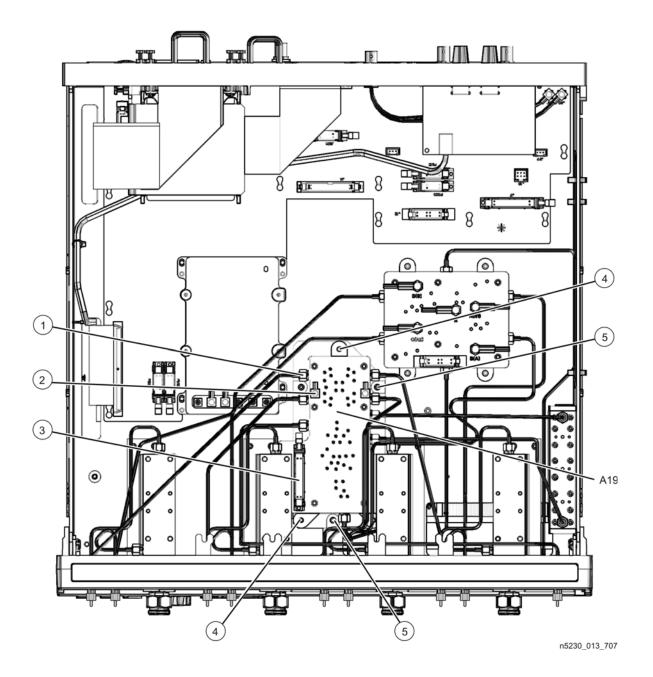

Removing and Replacing the A20 Mixer Brick (QuintBrick)

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-15 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6. Position the analyzer bottom side up.
- 3. With a 5/16 inch wrench, disconnect the semirigid cables (item (1)) from the A20 QuintBrick.
- 4. Disconnect the flexible cables (item 2) and the ribbon cable (item 3) from the A20 QuintBrick.
- 5. With a T-10 TORX driver, remove the mounting screws (item ④) from the A20 QuintBrick.

 
CAUTION Be careful not to damage the center pins of the semirigid cables. Some flexing of the cables is necessary to remove the assembly. Do not over bend them.


6. Remove the A20 QuintBrick from the analyzer. Observe the CAUTION above.

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.



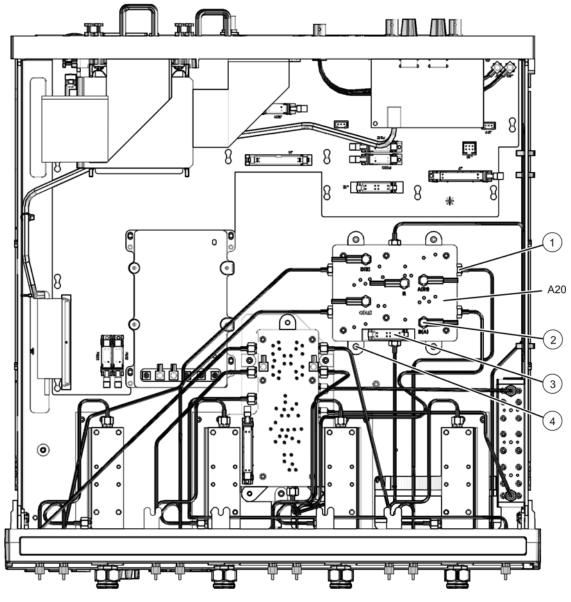

n5230_013_708

Removing and Replacing the A21, A22, A23, and A24 Test Port Couplers and Coupler Mounting Blocks

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-15 TORX driver (set to 14 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- 1 inch open-end torque wrench (set to 72 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-16 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6. Position the analyzer bottom side up.
- 3. Identify the test port coupler to be removed.
- 4. With a 5/16 inch wrench, disconnect the semirigid cables (item (1)) from the test port coupler.
- 5. With a T-15 TORX driver, remove the mounting screws (item (2)) from the test port coupler.
- 6. With a 1 inch wrench, remove the test port coupler dress nut (item ③) from the front panel. Be careful not to scratch the front panel.

CAUTION	Be careful not to damage the center pins of the semirigid cables. Some flexing
	of the cables is necessary to remove the assembly. Do not over bend them.


- 7. Remove the test port coupler from the analyzer. Observe the **CAUTION** above.
- 8. The test port coupler mounting block can now be removed by removing the attachment screws (item ④). It is not necessary to remove the mounting block to replace the coupler.

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.

Figure 7-16 A21, A22, A23, and A24 Test Port Couplers Removal

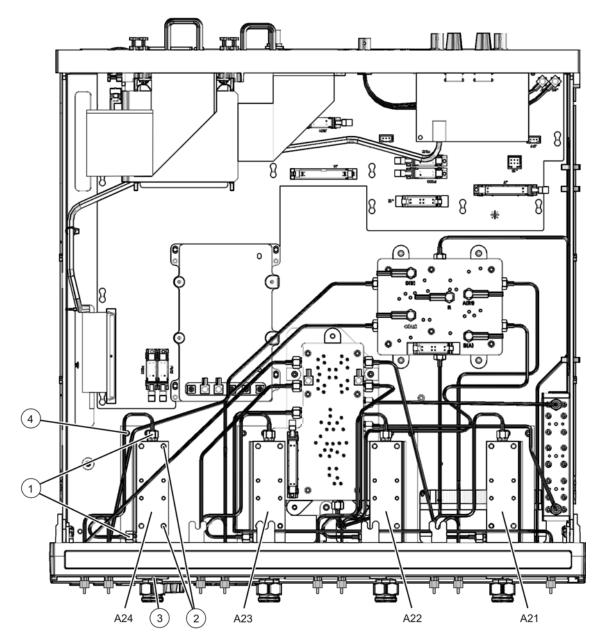

n5230_013_709

Removing and Replacing the A25 60-dB Source Step Attenuator

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16-inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-17 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer cover. Refer to "Removing the Covers" on page 7-6. Position the analyzer bottom side up.
- 3. Disconnect the ribbon cable (item 1) from the A25 step attenuator.
- 4. Using a 5/16-inch wrench, disconnect the semi-rigid cables (item (2)) from the A25 step attenuator.
- 5. With a T-10 TORX driver, loosen the mounting screws (item ③) in the analyzer side frame. It is not necessary to completely remove the mounting screws.

 
CAUTION Be careful not to damage the center pins of the semirigid cables. Some flexing of the cables is necessary to remove the assembly. Do not over bend them.


6. Slide the attenuator upward to release the mounting screws and remove the A25 step attenuator from the analyzer. Observe the **CAUTION** above.

Replacement Procedure

- 1. Remove the mounting screws from the old attenuator and insert them loosely into the new attenuator.
- 2. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.



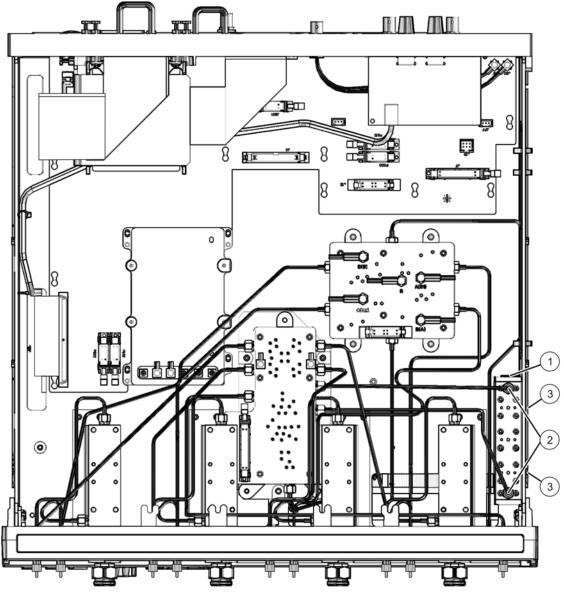

n5230_013_710

Removing and Replacing the A26 60-dB Source Step Attenuator

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

Refer to Figure 7-18 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the A17 QABC board. Refer to "Removing and Replacing the A17 QABC Board" on page 7-30.
- 4. Remove the A26 step attenuator from the A17 QABC board:
 - a. Disconnect cables W76, W78, and W79 from the A26 step attenuator.
 - b. Remove the two mounting screws, located on the other side of the A17 QABC board, and remove the A26 step attenuator from the A17 QABC board.

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all cable connections and mounting screws.

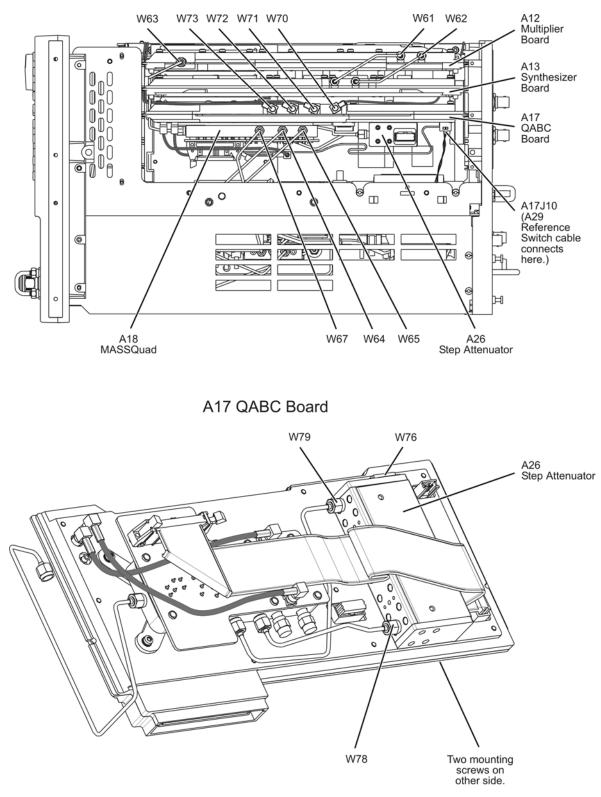


Figure 7-18 A26 60-dB Source Step Attenuator Removal

n5230_013_723_new

Removing and Replacing the A29 Reference Switch, Limiter, and DC Block

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- 1/4 inch open-end wrench
- 5/16 inch open-end wrench
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

 
Removal Procedure


Refer to Figure 7-19 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 3. Remove the A29 reference switch (and bracket if necessary):
 - a. Disconnect the A29 reference switch cable from the A17 QABC board at A17J10. This connector can be accessed from the right side of the analyzer. Refer to Figure 7-12 on page 7-31 for location of this cable connector.
 - b. Disconnect cables W66, W67, and W68.
 - c. Remove two screws (item 1) and remove the A29 reference switch.
 - d. To remove the A29 reference switch bracket, remove three screws (item 2).
- 4. Remove the DC block and limiter:
 - a. Disconnect cable W69 from the DC block.
 - a. While holding the hex nut on cable W68 with a 1/4-in wrench, use a 5/16-in wrench to disconnect this cable from the limiter.
 - b. Cut the cable tie used to secure the limiter and remove the DC block and limiter from the analyzer.
 - c. Using a 5/16-in wrench to hold the hex nut on the limiter, use another 5/16-in wrench to loosen the DC block connector and remove the DC block from the limiter.

Replacement Procedure

- 1. Reverse the order of the removal procedure using the tools specified. Be sure to install a new cable tie to secure the limiter.
- 2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.



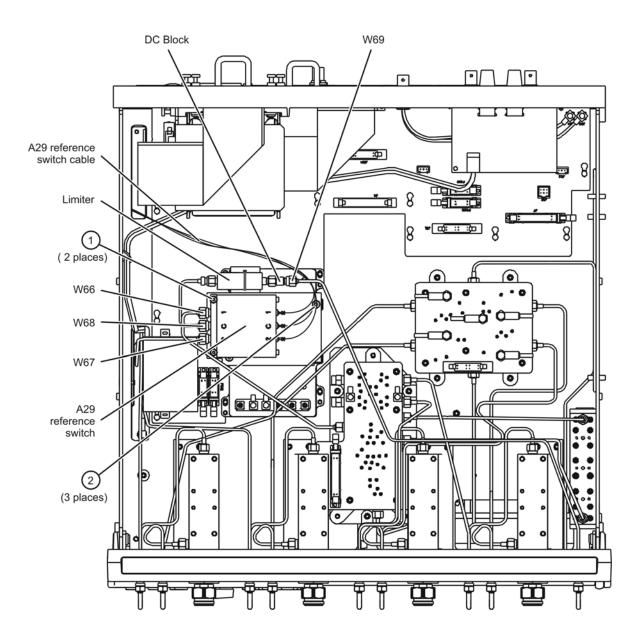

n5230_013_720

Removing and Replacing the A41 Hard Disk Drive (HDD)

Certain unique files exist on the hard disk drive that are necessary for proper operation of your analyzer. These files must be copied to another location to allow them to be installed onto the new HDD after it has been installed.

If you are replacing the HDD, not just removing the hard disk drive assembly (HDDA) to allow access to other assemblies, the following procedure must be performed first.

If you are not replacing the actual HDD, proceed to "Tools Required," on this page.

Copy Unique Files from the Hard Disk

- 1. Insert a USB flash memory drive into a USB port.
- 2. Open Windows Explorer.
- 3. Navigate to C:\Program Files\Agilent\Network Analyzer.
- 4. Copy each of the following files from the hard disk drive to the USB drive:
 - gen.lic
 - user_calkitfile
 - All files prefixed with mxcalfile_.
 - Any personal user files that you wish to preserve.
- 5. Remove the USB drive from the USB port.
- 6. Exit *Windows Explorer*.

Tools Required

- T-10 TORX driver (set to 7 in-lb; for hard disk drive replacement)
- T-10 TORX driver (set to 9 in-lb; for all other T-10 applications)
- ESD grounding wrist strap


Removal Procedure

1. Disconnect the analyzer power cord.

Refer to Figure 7-20 for the remainder of this procedure.

- 2. With a T-10 TORX driver, loosen the four HDDA mounting screws (item 1) on the rear panel.
- 3. Remove the HDDA from the analyzer by pulling on the finger grip (item ⁽²⁾). The HDDA interconnects with a connector inside the analyzer rear panel so moderate force may be necessary to disengage this connector.

Figure 7-20 Hard Disk Drive Assembly Removal

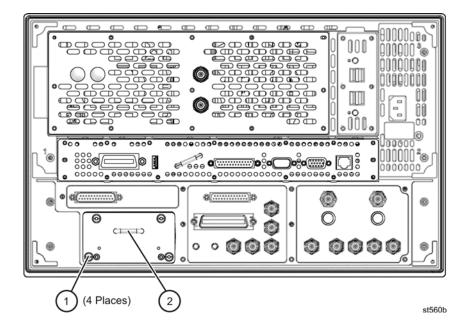

Disassembling the HDDA

NOTE If the HDD is being replaced by the HDDA (N8980A or N8981A), it is not necessary to perform these steps.

Refer to Figure 7-21.

- 1. Remove the HDDA from the analyzer. Refer to "Removal Procedure" on page 7-46.
- 2. With a T-10 TORX driver, remove the following items that mount the HDD (item 4), to the bracket:
 - a. The four screws (item ①).
 - b. If the HDD is equipped with the serial ATA interface:
 - the four bushings (item ⁽²⁾)
 - the nylon spacer (item ⑤)
 - c. If the HDD is equipped with the paralled ATA interface:
 - the eight bushings (item (2))
- 3. Disconnect the HDD (item 4) from the interface board (item 3).

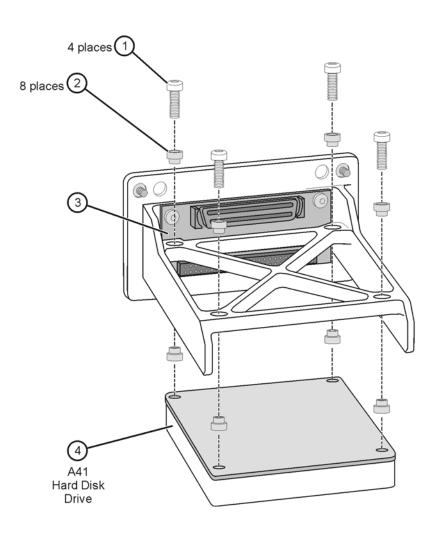


Figure 7-21 Hard Disk Drive Assembly with Parallel ATA Interface (Exploded View)

st561a

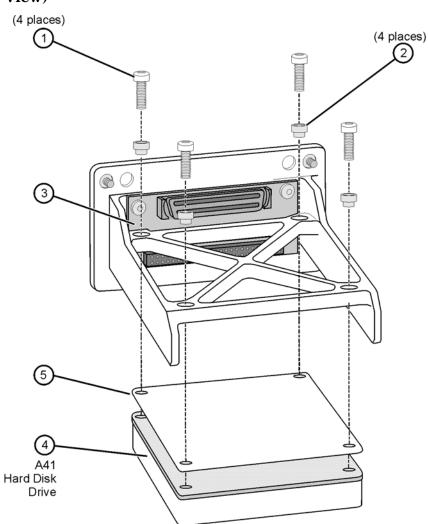


Figure 7-22 Hard Disk Drive Assembly with Serial ATA Interface (Exploded View)

St561a1

Reassembly Procedure

NOTE If the HDD is being replaced by the HDDA (N8980A or N8981A), it is not necessary to perform these steps.

If the HDD is equipped with a parallel ATA interface, follow the step below.

• With the disk drive bracket right-side up (it is shown upside down in Figure 7-21 on page 7-48), insert four bushings (item ⁽²⁾) into the four holes in the bracket.

If the HDD is equipped with a serial ATA interface, follow the step below.

• With the disk drive bracket right-side up (it is shown upside down in Figure 7-22 on page 7-49), place the nylon spacer (item ⑤) on the bracket.

Regardless of which ATA interface the HDD is equipped with, follow the steps below.

- 1. Connect the new HDD (item ④) to the interface board (item ③) by pushing it firmly into the connector on the interface board. Take special care to align the connector pins. Applying power to a misaligned connection can permanently damage the HDD.
- 2. While holding the HDD in place, turn the bracket over and insert the other four bushings (item 2), into the other side of the same four holes specified in step 1.
- 3. Install the four screws (item ①), finger tight, through the four bushings (item ②), to attach the HDD to the bracket.

With a T-10 TORX driver, snug-tighten the four screws in a Z-pattern, and then torque them, in the same pattern, to 7 in-lb.

Reinstalling the HDDA

- 1. Reinstall the HDDA into the analyzer:
 - a. Slide the HDDA into the slot in the rear panel and push it firmly into place to engage the connector. Refer to Figure 7-20 on page 7-47.
 - b. With a T-10 TORX driver, tighten the four HDDA mounting screws (item ①).

Initialize the Windows Operating System

- 1. Connect a mouse and keyboard to the analyzer.
- 2. Turn on power to the analyzer.
- 3. The operating system initialization process will run automatically. Part way through the process, you will be prompted to accept the Windows licensing agreement. The entire process takes approximately six minutes, during which the analyzer will reboot up to three times.
- 4. After the PNA application screen is displayed, there may be a display to remind you to upgrade the firmware. If so, click **OK** to continue.

Set Up the Agilent Administrator Password

After an HDD replacement, it is necessary to set up the Agilent administrator password for the analyzer. If this procedure is being performed by non-Agilent personnel, contact Agilent for a password before beginning this procedure. Refer to "Contacting Agilent" on page 2-11.

The network analyzer must be powered up and operating for this procedure.

- 1. On the Windows Desktop, right-click on My Computer, and then click Manage.
- 2. In the Computer Management window, navigate to System Tools, Local Users and Groups, Users.
- 3. Right-click on Agilent, click on Set Password, and complete these steps in the window:
 - a. Type the password obtained from Agilent as the **Password**. Refer to "Set Up the Agilent Administrator Password" on page 7-51 for information if you have not yet obtained this password.
 - b. Type the password again in the **Confirm password** block.
 - c. Click OK.
- 4. Right-click on **Agilent**, click on **Properties**, and complete these steps in the window:
 - a. Unselect User must change password at next logon (if not already unselected).
 - b. Unselect User cannot change password (if not already unselected).
 - c. Select **Password never expires** (if not already selected).
 - d. Click **OK**.
- 5. Close the **Computer Management** window.

Install Backup Files onto the New Hard Disk Drive

The files that were previously saved onto a USB memory drive must now be installed onto the new HDD. The network analyzer must be powered up and operating.

- 1. Insert the USB memory drive into a USB port.
- 2. Click on START. (It may be necessary to exit the Network Analyzer application.)
- 3. Point to Programs, Accessories, and then open Windows Explorer.

- 4. Navigate to C:\Program Files\Agilent\Network Analyzer.
- 5. Copy each of the backup files from the USB memory drive to the HDD.
- 6. Navigate to D:\CalFiles\.
- 7. Copy the backup files prefixed with ${\tt mxcalfile}_$ from the USB memory drive to the HDD.
- 8. After all files have been copied, remove the USB memory drive from the USB port.
- 9. Exit Windows Explorer.

Post-Repair Procedures

- 1. Adhere the new Certificate of Authenticity (license) label to the outer cover in the location specified in Figure 7-1. on page 7-7.
- 2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Removing and Replacing the Midweb and the B1 Fan

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- Pozidriv screw driver
- 5/16 inch open-end torque wrench (set to 10 in-lb)
- ESD grounding wrist strap

Removal Procedure

- 1. Disconnect the power cord.
- 2. Remove the front panel assembly. Refer to "Removing and Replacing the Front Panel Assembly" on page 7-8.
- 3. Remove the outer and inner covers. Refer to "Removing the Covers" on page 7-6.
- 4. Remove the A22 test port coupler. This is necessary to gain access to one of the midweb mounting screws. Refer to "Removing and Replacing the A21, A22, A23, and A24 Test Port Couplers and Coupler Mounting Blocks" on page 7-38.
- 5. Remove the A19 MASSQuad and the MASS mounting block. This is necessary to gain access to one of the midweb mounting screws. Refer to "Removing and Replacing the A19 MASS 26.5 (MASSQuad) and MASSQuad Mounting Block" on page 7-34.
- 6. Remove the A4 power supply assembly. Refer to "Removing and Replacing the A4 Power Supply Assembly" on page 7-14.
- 7. Remove the card cage boards (A5 through A10) and plenum bracket. Refer to "Removing and Replacing the A5 through A10 Boards" on page 7-16.
- 8. Remove the second source boards (A11, A12, A13, and A17). Refer to "Removing and Replacing the A12 Multiplier and the A13 Fractional-N Synthesizer Boards" on page 7-20.


NOTE This procedure has two parts: removing the midweb and removing the fan from the midweb. You must remove the midweb before removing the fan.

Removing the Midweb

Refer to Figure 7-23.

- 1. Disconnect the power cable (item 1) for each of the three fans from the A14 system motherboard.
- 2. With a T-10 TORX driver, remove the seven midweb mounting screws (item 2). Three of the mounting screws are located on the bottom of the chassis. The analyzer must be placed on its side to access these three screws.
- 3. Lift out the midweb being careful not to damage any adjacent components.

Figure 7-23 Midweb Removal

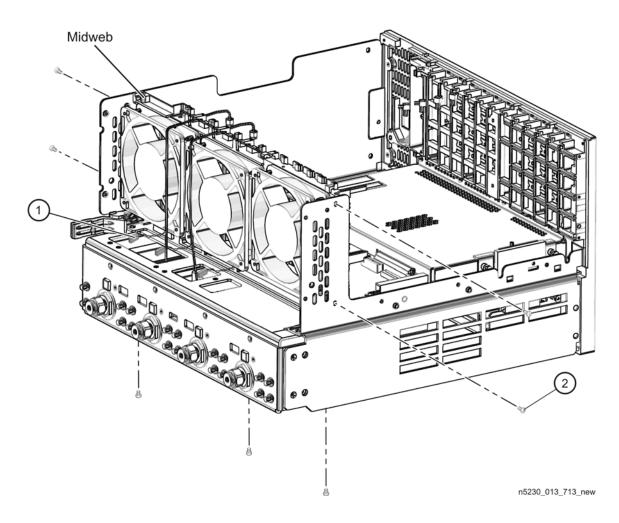


Removing the Fan

Refer to Figure 7-24.

1. To remove the fan, it is necessary to remove the four nylon rivets that attach it to the midweb. To do this, use the Pozidriv screwdriver on the nylon screw (item ①) and a small blade screwdriver to stabilize the rivet. Turn and push the rivet out of the rivet hole. Once the four rivets are out, remove the fan.

Figure 7-24 B1 Fan Removal

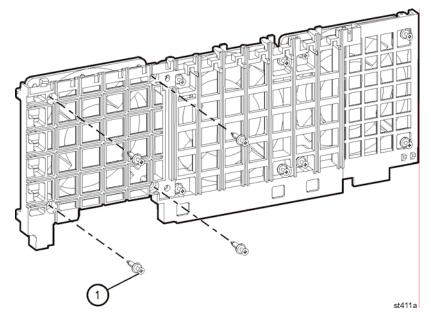

Replacement Procedure

1. Reverse the order of the removal procedure.

Use the tools specified for all mounting screws.

2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Removing and Replacing the Lithium Battery

Tools Required

- T-10 TORX driver (set to 9 in-lb)
- T-20 TORX driver (set to 21 in-lb)
- ESD grounding wrist strap

Removal Procedure


Refer to Figure 7-25 for this procedure.

- 1. Disconnect the power cord.
- 2. Remove the A15 CPU board. Refer to "Removing and Replacing the A15 CPU Board" on page 7-24.
- Lift the battery (item ①) just enough to free it from its holder and slide it from under the battery clip (item ②). Be careful not to over bend the battery clip as it can be damaged or broken.
- 4. DO NOT THROW AWAY THE BATTERY. COLLECT IT AS SMALL CHEMICAL WASTE. Refer to "Lithium Battery Disposal" on page 1-8 for additional information on battery disposal.

Replacement Procedure

- 1. Reverse the order of the removal procedure following all instructions included with the new battery.
- 2. Perform the post-repair adjustments, verifications, and performance tests that pertain to this removal procedure. Refer to Table 7-2 on page 7-58.

Figure 7-25 Lithium Battery Removal

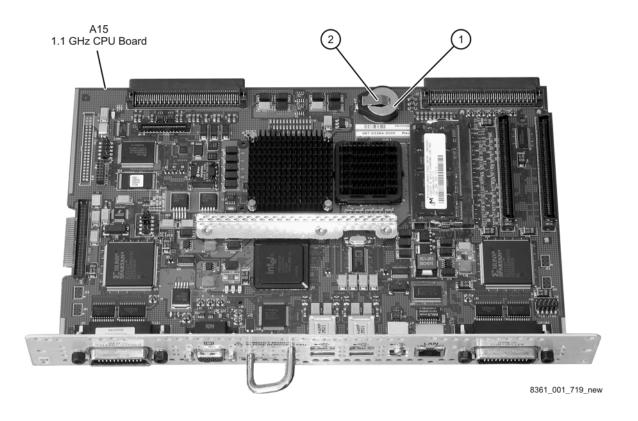

Post-Repair Procedures

After the replacement of an assembly, you must perform the service procedures in the order listed in Table 7-2.

Procedures referenced in this table are located in Chapter 3, "Tests and Adjustments," unless specified otherwise.

Replaced Assembly	Adjustments and Other Procedures	Verification, Performance, and Other Tests and Procedures	
A1 keypad assembly	No adjustment needed	Front Panel Keypad and RPG Test in Chapter 4	
A2 display assembly	No adjustment needed	A2 Display Test in Chapter 4	
A3 front panel interface board	No adjustment needed	Front Panel Keypad and RPG Test and A2 Display Test in Chapter 4	
A4 power supply assembly	No adjustment needed	None needed	
A5 SPAM board	No adjustment needed	Noise Floor Test Trace Noise Test	
A6 multiplier board	No adjustment needed	The Operator's Check	
A7 fractional-N synthesizer board	No adjustment needed	The Operator's Check	
A8 or A12 ^a multiplier board	Source Calibration Adjustment Receiver Calibration Adjustment	Frequency Accuracy Test Source Power Accuracy Test Source Maximum Power Output Test Source Power Linearity Test The Operator's Check	
A9 or A13 ^a fractional-N synthesizer board	Source Calibration Adjustment Receiver Calibration Adjustment	Frequency Accuracy Test Source Power Accuracy Test Source Maximum Power Output Test Source Power Linearity Test The Operator's Check	
A10 frequency reference board	10 MHz Frequency Reference Adjustment Restore option data (Refer to "Repairing and Recovering Option Data" in Chapter 8.)	Frequency Accuracy Test	
A11 vertical motherboard	No adjustment needed	The Operator's Check	
A14 system motherboard	No adjustment needed	Front Panel Keypad and RPG Test and A2 Display Test in Chapter 4 The Operator's Check	
A15 CPU board	No adjustment needed	The Operator's Check	

 Table 7-2
 Related Service Procedures

Replaced Assembly	Adjustments and Other Procedures	Verification, Performance, and Other Tests and Procedures	
	Reinstall the serial number. (Refer to "Installing or Changing a Serial Number" in Chapter 8.)		
A16 test set motherboard	Re-enable all hardware options. (Refer to "Enabling or Removing Options" in Chapter 8.)	The Operator's Check	
A17 ^a QABC board	Source Calibration Adjustment Receiver Calibration Adjustment	Frequency Accuracy Test Source Maximum Power Output Test The Operator's Check	
A19 or A18 ^a MASS 26.5 (MASSQuad)	Source Calibration Adjustment Receiver Calibration Adjustment	Frequency Accuracy Test Source Power Accuracy Test Source Maximum Power Output Test Source Power Linearity Test The Operator's Check	
A20 mixer brick (QuintBrick)	Receiver Calibration Adjustment	Receiver Compression Test Noise Floor Test Calibration Coefficients Test Dynamic Accuracy Test	
A21, A22, A23 and A24 test port couplers	Source Calibration Adjustment Receiver Calibration Adjustment	Source Maximum Power Output Test Calibration Coefficients Test	
A25 or A26 ^a 60-dB source step attenuator	Source Calibration Adjustment Receiver Calibration Adjustment	Source Maximum Power Output Test Calibration Coefficients Test	
A29 reference switch	No adjustment needed	The Operator's Check	
A41 hard disk drive	Restore previously saved receiver calibration data ^b (or perform Receiver Calibration Adjustment)	Read and write to the drive	
B1 fan	No adjustment needed	Check for fan operation	
Limiter, DC block	No adjustment needed	The Operator's Check	
USB hub	No adjustment needed	Check for proper operation	
Battery	No adjustment needed	None	

 Table 7-2
 Related Service Procedures (Continued)

a. When testing this assembly, the tests are performed on Port 3 for the second source path.

b. If a backup copy of receiver calibration data from the faulty disk drive is available, it can be copied to the new disk drive. If not, new data must be generated by performing the "Receiver Calibration Adjustment."

8 General Purpose Maintenance Procedures

Information in This Chapter

Chapter Eight at-a-Glance

Section Title	Summary of Content	Start Page
Error Terms	How to use error terms as a preventive maintenance and troubleshooting tool.	page 8-3
Option Enable Utility	How to use the option enable utility to:	page 8-14
	• enable options that have been added to your analyzer,	
	• repair lost or damaged option data,	
	• install or change a serial number.	
Firmware Upgrades	How to check your analyzer's current firmware revision and where to locate firmware upgrades.	page 8-18
Operating System Recovery	Where to find the information on recovering from a damaged operating system.	page 8-19
Correction Constants	How to store correction constants after making adjustments to your analyzer.	page 8-20

Error Terms

Using Error Terms as a Diagnostic Tool

By examining error terms, you can monitor system performance for preventive maintenance and troubleshooting purposes.

The magnitude and shape of the error terms are affected by:

- calibration kit devices
- cables
- adapters and accessories
- the assemblies from the signal separation group of the analyzer

Calibration kit devices, cables, and adapters and accessories are the most common cause of error term anomalies. Make sure of the following:

- Connectors must be clean, gaged, and within specification.
- Use proper connection technique during measurement and calibration. For information on connection technique and on cleaning and gaging connectors, refer to "Review the Principles of Connector Care" on page 3-5 or to the calibration kit's user's and service guide.

Preventive Maintenance

If you print or plot the error terms at set intervals (weekly, monthly and so forth), you can compare current error terms to these records. A stable system should generate repeatable error terms over long intervals, (for example, six months). Look for the following:

- A long-term trend often reflects drift, connector and cable wear, or gradual degradation, indicating the need for further investigation and preventive maintenance. Yet, the system may still conform to specifications. The cure is often as simple as cleaning and gaging connectors and cables.
- A sudden shift in error terms may indicate the need for troubleshooting.

Troubleshooting

You can use the error terms as a tool to isolate faulty assemblies in the signal separation group of your analyzer. You can compare the current values to preventive maintenance records or to the typical values listed in Table 8-1 on page 8-10.

To find assemblies related to error term failures, refer to error term descriptions in "Error Term Data" on page 8-10. Each plot description lists common assemblies related to each error term. Identify the assembly and refer to Chapter 4, "Troubleshooting".

NOTE Always suspect calibration devices, cables, or improper connector maintenance as the primary cause of an error term anomaly.

Performing Measurement Calibration

A calibration must be performed to allow the analyzer to calculate the error terms before they can be used as a tool:


CAUTION	Perform the following procedure only at a static-safe workstation, and wear a grounded wrist strap.
	This is important. If not properly protected against, electrostatic discharge can seriously damage your analyzer, resulting in costly repair.
	To reduce the chance of electrostatic discharge, follow all of the recommendations outlined in "Electrostatic Discharge Protection" on page 1-6, when performing the following calibration.

- 1. Connect a test cable to Port 2.
- 2. Perform a full 2-port calibration, **FULL SOLT 2-Port**. Refer to embedded help in the analyzer if necessary.

Using Flowgraphs to Identify Error Terms

Flowgraphs are a graphical representation of signal flow through the measurement path. The flowgraphs in Figure 8-1, Figure 8-2, Figure 8-3, and Figure 8-4 illustrate the error terms associated with measurement calibration for 1-port, 2-port, 3-port, and 4-port configurations respectively.

Figure 8-1 Flowgraph of One-Port Error Terms for Port 1

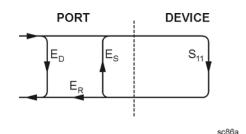


where:

E = Error term

Subscript: D = Directivity S = Source Match R = Reflection Tracking

The error terms are the same for a one port measurement on Port 2 (S_{22}).

Figure 8-2 Flowgraph of Two-Port Error Terms

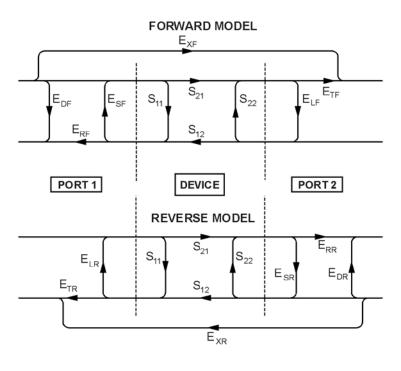

sc87a.cdr

where:

E = error term

1st Subscript:

- D = Directivity
- S = Source Match
- R = Reflection Tracking
- X = Crosstalk (Isolation)
- L = Load Match
- T = Transmission Tracking

2nd Subscript:

- F = forward measurement (Port 1 to Port 2)
- R = reverse measurement (Port 2 to Port 1)

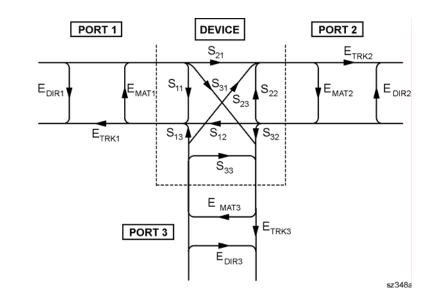


Figure 8-3 Flowgraph of Three-Port Error Terms

where:

E = error term DIR = Directivity MAT = Forward Source Match and Reverse Load Match TRK = Forward Reflection Tracking and Reverse Transmission Tracking

For the case of a full 3-port calibration, port 1 has three Match error terms: S11 source match S12 load match S13 load match and three Tracking error terms: S11 reflection tracking S12 transmission tracking S13 transmission tracking

There are six isolation terms not shown.

PORT 4 E_{DIR4} E_{TRK4} E_{MAT4} DEVICE S_{44} S₄₁ S₂₄ PORT 1 S₄₂ E_{TRK2} S S₂₃ S₄₃ S₁₁ S₂₂ E I MAT2 S₃₄ E JIR1 E A S E_{TRK1} S_{12} S₁₃ S₂ PORT 2 S₃₂ S₃₃ E_{MAT3} E_{TRK3} E_{DIR3} PORT 3 4Pcal.cdr

Figure 8-4 Flowgraph of Four-Port Error Terms

where:

E = error term DIR = Directivity MAT = Forward Source Match and Reverse Load Match TRK = Forward Reflection Tracking and Reverse Transmission Tracking

For the case of a full 4-port calibration, port 1 has four Match error terms: S11 source match S12 load match S13 load match S14 load match and four Tracking error terms: S11 reflection tracking S12 transmission tracking S13 transmission tracking S12 transmission tracking

There are eight isolation (crosstalk) terms not shown.

Accessing Error Terms

Error terms can be accessed either manually or programmatically:

Manually

• "Front Panel Access to Error Terms" on page 8-8

Programmatically

- "GPIB Access to Error Terms" on page 8-9
- "COM/DCOM Access to Error Terms" on page 8-9

Manual Access to Error Terms

Front Panel Access to Error Terms

NOTE Ensure the calibration correction is active by making sure that Correction on/OFF has a check-mark in the Calibration menu.

To access the error terms from the front panel, perform the following steps:

1. In the System menu, point to Service, Utilities, and then click Cal Set Viewer.

The **Cal Set Viewer** toolbar appears directly above the trace window.

- 2. In the **Cal Set** list, select the desired cal set.
- 3. Click the **Standards/ETerms** button to toggle between viewing the raw measurement data from the standard or the corrected error term data. Note that the title of the center box in the tool bar will toggle between **Standard** and **Error Term**.
- 4. In the **Standard** or **Error Term** list, select the standard or error term to view. Click the **View** check box.
- 5. Compare the displayed measurement trace to the equivalent data trace plots that start in "Error Term Data" on page 8-10, to previously measured data, or to the uncorrected performance specifications listed in Table 8-1 on page 8-10.
- 6. Print numerical data or print a plot of the measurement results.

Programmatic Access to Error Terms

GPIB Access to Error Terms

You can access error terms by way of GPIB with Standard Commands for Programmable Instruments (SCPI).

For more information on GPIB and SCPI, refer to the embedded help in the analyzer. Type in keyword "errors, systematic" in the index.

COM/DCOM Access to Error Terms

You can access error terms by way of Component Object Model (COM) or Distributed Component Object Model (DCOM) software architecture.

For more information on COM and DCOM, refer to the embedded help in the analyzer. Type in keyword "errors, systematic" in the index.

Error Term Data

The error term descriptions in this section include the following information:

- a table of the error terms
- description and significance of each error term
- measurements affected by each error term
- typical cause of failure for each error term

The same description applies to both the forward (F) and reverse (R) terms.

IMPORTANT Data are listed here as a convenience only. Detailed instrument specifications are listed in the embedded help in the network analyzer.

	Frequency Range								
Parameter	300 kHz to 10 MHz ^b	10 MHz to 1 GHz	1 GHz to 3 GHz	3 GHz to 5 GHz	5 GHz to 10.5 GHz	10.5 GHz to 11.5 GHz	11.5 GHz to 13.5 GHz	13.5 GHz to 16 GHz	16 GHz to 20 GHz
Directivity	-23 dB	-28dB	-25dB	-20dB	-17dB			-15dB	
Source Match	8 dB	-12dB	-12dB	-12dB	-12dB	-10dB	-8dB		
Load Match	-9dB	-20dB	-20dB	-18dB	-120	iB	-7 dB -7.5dB		-7.5dB
Parameter	300 kHz to 5 MHz	5 MHz to 10 MHz	10 MHz to 45 MHz	45 MHz to 4 GHz	4 GHz to 6 GHz	6 GHz to 10.5 GHz	10.5 GHz to 13.5 GHz	13.5 GHz to 15 GHz	15 GHz to 20 GHz
Crosstalk ^c	-70dB	-100dB	-110dB	-122dB	-123dB	-120dB	-115	dB	-110dB

Table 8-1Error Term Data^a

a. The data in this table are uncorrected system performance. The values apply over an environmental temperature range of 25 °C ±5 °C, with less than 1 °C deviation from the calibration temperature.

b. All values for 300 kHz to 10 MHz are typical.

c. All crosstalk values are typical. Measurement conditions: normalized to a thru, measured with two shorts, 10 Hz IF bandwidth, averaging factor of 8, alternate mode, source power set to the lesser of the maximum power out or the maximum receiver power.

If Error Terms Seem Worse than Expected

To verify that the system still conforms to specifications, perform a system verification. Refer to Chapter 3, "Tests and Adjustments".

Directivity (E_{DF} and E_{DR})

 E_{DF} and E_{DR} are the uncorrected forward and reverse directivity error terms of the system. The directivity error of the test port is determined by measuring the S_{11} and S_{22} reflection of the calibration kit load. The load has a much better return loss specification than does the uncorrected test port. Therefore, any power detected from this measurement is assumed to be from directivity error.

The measurements most affected by directivity errors are measurements of low reflection devices.

Typical Cause of Failure The *calibration kit load* is the most common cause of directivity specification failure.

If the load has been gaged and its performance independently verified, suspect the analyzer *test port coupler*.

To troubleshoot, refer to "Checking the Signal Separation Group" on page 4-42.

Source Match (E_{SF} and E_{SR})

 E_{SF} and E_{SR} are the forward and reverse uncorrected source match terms of the driven port. They are obtained by measuring the reflection (S₁₁, S₂₂) of an open, and a short that are connected directly to the ports. Source match is a measure of the match of the coupler, as well as the match between all components from the source to the output port.

The measurements most affected by source match errors are reflection and transmission measurements of highly reflective DUTs.

Typical Cause of Failure The *calibration kit open or short* is the most common cause of source match specification failure.

If the open or short performance has been independently verified, then suspect the analyzer *switch splitter*, *step attenuator*, *or coupler*.

To troubleshoot, refer to "Checking the Signal Separation Group" on page 4-42.

Load Match (E_{LF} and E_{LR})

Load match is a measure of the impedance match of the test port that terminates the output of a 2-port device. The match of test port cables is included in this response. Load match error terms are characterized by measuring the S_{11} and S_{22} responses of a "thru" configuration during the calibration procedure.

The measurements most affected by load match errors are all transmission measurements, and reflection measurements of a low insertion loss two-port device, such as an airline.

Typical Cause of Failure The *calibration kit load or a bad "thru" cable* is the most common cause of load match specification failure.

If the load and cable performance are independently verified, then suspect the analyzer *test port coupler, step attenuator, or the test receiver* at the bad port.

To troubleshoot, refer to "Checking the Receiver Group" on page 4-46 or to "Checking the Signal Separation Group" on page 4-42.

Reflection Tracking (E_{RF} and E_{RR})

Reflection tracking is the difference between the frequency response of the reference path (R1 or R2path) and the frequency response of the reflection test path (A or B input path). These error terms are characterized by measuring the reflection (S_{11}, S_{22}) of the open and the short during the measurement calibration.

All reflection measurements are affected by the reflection tracking errors.

Typical Cause of Failure The *calibration kit open or short* is the most common cause of reflection tracking specification failure.

If the open or short performance has been independently verified, suspect the following:

- If both E_{RF} and E_{RR} fail
 - suspect the analyzer *switch splitter*
- If one of the track term specification fails
 - suspect the coupler, step attenuator, or the test receiver of the failed port

To troubleshoot, refer to "Checking the Receiver Group" on page 4-46 or to "Checking the Signal Separation Group" on page 4-42.

Transmission Tracking (E_{TF} and E_{TR})

Transmission tracking is the difference between the frequency response of the reference path (including the R input) and the frequency response of the transmission test path (including the A or B input) while measuring transmission. The response of the test port cables is included. These terms are characterized by measuring the transmission (S_{21} , S_{12}) of the "thru" configuration during the measurement calibration.

All transmission measurements are affected by transmission tracking errors.

Typical Cause of Failure The *test port cable* is the most common cause of transmission tracking specification failure.

If the test port cable performance has been independently verified, suspect the following:

- If both E_{TF} and E_{TR} fail
 - suspect the analyzer *switch splitter*
- If one of the track term specification fails
 - suspect the coupler, step attenuator, or the test receiver of the failed port

To troubleshoot, refer to "Checking the Receiver Group" on page 4-46 or to "Checking the Signal Separation Group" on page 4-42.

Isolation (E_{XF} and E_{XR})

Isolation, or crosstalk, is the uncorrected forward and reverse isolation error terms that represent leakage between the test ports and the signal paths. The isolation error terms are characterized by measuring transmission (S_{21}, S_{12}) with loads attached to both ports during the measurement calibration.isolation errors affect transmission measurements primarily where the measured signal level is very low.

The measurements most affected by isolation error terms are DUTs with large insertion loss. Since these terms are low in magnitude, they are usually noisy (not very repeatable).

Typical Cause of Failure A *loose cable connection or leakage between components* in the test set are the most likely cause of isolation problems.

After verifying the cable and its connections, suspect the analyzer *switch splitter*, *step attenuator*, *coupler*, *or receivers*, *and associated cabling*.

To troubleshoot, refer to "Checking the Receiver Group" on page 4-46 or to "Checking the Signal Separation Group" on page 4-42.

Option Enable Utility

Accessing the Option Enable Utility

To start the option enable utility:

- On the System menu, point to Service, and then click Option Enable.
- The dialog box illustrated in Figure 8-5 is displayed.

Figure 8-5 Option Enable Dialog Box

🆀 Option En	nable				×
Change Serial	l <u>R</u> epair <u>A</u> bou	t <u>H</u> elp			
	E8361A US40210	0005	*	Agilent	
Host ID:	36A78F1B	Installed Options:	010, 080		
	Select Desi	red Option		<u>E</u> nable	
Option 1 © Perma © Iemp	anent			Re <u>m</u> ove	
dd-Mmm-				<u>Exit</u>	

Option Entitlement Certificate

If you have received an "Option Entitlement Certificate", follow the instructions on the certificate, under "HOW TO USE THIS CERTIFICATE:", to obtain license key(s) for the option(s) listed on the certificate. See the important note below.

NOTE When upgrading from one model number to another, a new option entitlement certificate will be issued. When this certificate is redeemed for a license key, the automated system will ask for the instrument's Host ID. Be sure to use the new Host ID that is associated with the new model number. Using the current Host ID will cause a license to be generated that will not work with the instrument. To determine the new Host ID, use the utility at the below listed web site with the new model number.

http://na.tm.agilent.com/pna/upgrades.html

Enabling or Removing Options

There are two types of options:

•	Hardware:	Hardware options involve adding additional hardware to the analyzer. After the proper hardware has been installed in the analyzer, the option can be enabled using the option enable utility.
		It is necessary to re-enable all hardware options if the test set motherboard is replaced.
•	Software:	Software options add features or functionality to the analyzer without the need for additional hardware. These options are enabled using a special keyword. They are enabled using the option enable utility.
		It is necessary to backup all installed software options if the frequency reference board is replaced.
NC	DTE S	ome applications require a license key that is provided by Agilent. If you do
		ot have the required license key, contact Agilent for assistance. Refer to
	"(Contacting Agilent" on page 2-11.

To enable or remove an option:

- 1. Start the option enable utility. Refer to "Accessing the Option Enable Utility" on page 8-14.
- 2. Click the arrow in the **Select Desired Option** box. A list of available options, similar to the list below, will appear.
 - 010 Time Domain
 - UNL Bias Tees w/Atten
 - 014 Configurable Test Set
 - 016 Receiver Attenuators
 - 080 Frequency Offset Mode
 - 081 Reference Transfer Switch
 - 083 Mixer Measurement Appl
 - ??? Enter Unlisted Option
- 3. Click on the option that you wish to either enable or remove, and then click **Enable** or **Remove**, whichever is appropriate.
- 4. If the desired option is not available in the list, select **Enter Unlisted Option**. A dialog box appears that will allow you to enter the option number. Enter the option number and follow the instructions on the display.

Repairing and Recovering Option Data

License, option, and model number data are stored in an EEPROM on the frequency reference board and written into the gen.lic file on the hard disk drive. If the data stored in either of these items is lost, it can be recovered from the other item.

NOTE If the data on both the hard disk drive and the frequency reference board is lost, it can not be recovered. Contact Agilent for assistance. Refer to "Contacting Agilent" on page 2-11.

Recovery of Data After Repair

- If the frequency reference board is replaced, use the **Repair** selection to recover data that has been lost as a result of the repair:
 - 1. Select Repair from the Option Enable menu bar (see Figure 8-5 on page 8-14).
 - 2. Click the Freq Ref board has been replaced check box.
 - 3. Click Begin Repair. The data is written from the gen.lic file into the EEPROM.
- If the hard disk drive is replaced, a new gen.lic file is automatically created when the Network Analyzer application starts, by retrieving the data from the EEPROM.

Recovery of Data if Option or Model Numbers are Incorrect

If the analyzer option or model numbers are not listed correctly on the analyzer display, in either the Option Enable Dialog Box or the About Network Analyzer display, you should regenerate the options license file, gen.lic:

- 1. Exit the Network Analyzer application.
- 2. Remove (or rename) the existing gen.lic file:
 - a. Open Windows Explorer and navigate to C:\Program Files\Agilent\Network Analyzer.
 - b. Delete (or rename) gen.lic.
- 3. Exit the Windows Explorer application.
- 4. Open the Network Analyzer application. The application will generate a new gen.lic file when it starts.
- 5. Check the option listing:
 - a. On the System menu, point to Service, and then click Option Enable, or
 - b. On the Help menu, click About Network Analyzer.
- **NOTE** If the options are still not listed correctly, contact Agilent for assistance. Refer to "Contacting Agilent" on page 2-11.

Installing or Changing a Serial Number

It is necessary to reinstall the instrument serial number if the test set motherboard is replaced.

IMPORTANT	Use extreme care when entering the serial number, as only one attempt is allowed.
Figure 8	e a serial number, select Change Serial from the Option Enable menu bar (see -5 on page 8-14). The current serial number is displayed. If no serial number iously been entered, the word "NONE" will be displayed.
2. VERY C. Change.	AREFULLY, type the new serial number into the space provided and then click
	or is made in entering the serial number, obtain a clear code from Agilent, enter code in the space provided, and then click Clear . The correct serial number can entered.

NOTE To change an incorrect serial number, a clear-code password is required. Contact Agilent to obtain the clear-code. Refer to "Contacting Agilent" on page 2-11.

Firmware Upgrades

How to Check the Current Firmware Version

1. With the Network Analyzer application running, click Help, About Network Analyzer.

A dialog box showing the current installed Application Code Version is displayed.

2. To determine if a firmware update is available, proceed to "Downloading from the Internet."

Downloading from the Internet

If your network analyzer is connected to the Internet, there are two methods available for checking the availability of, and downloading, new firmware:

- Download directly from: http://www.agilent.com/find/pna. (Select your analyzer's model number in this website to view available upgrades.)
- On the **System** menu, point to **Service**, and then click **AgileUpdate**. **AgileUpdate** compares the firmware revision currently installed in your network analyzer to the latest version available and assists you in downloading and installing the most recent version.

Operating System Recovery

Recovering from Hard Disk Drive Problems

If you suspect that you have a hard disk drive problem, go to the "Hard Drive Recovery" link on the Agilent PNA Series: Service & Support Home Page on the Internet.

The URL for the Agilent PNA Series: Service & Support Home Page is: http://na.tm.agilent.com/pna/

The URL for the Hard Drive Recovery page is:

http://na.tm.agilent.com/pna/hdrecovery.html

Correction Constants

The analyzer stores many correction constants in non-volatile EEPROM memory. These constants enable the analyzer to produce accurate, leveled source signals and receive clean test signals.

Storing Correction Constants

After performing any adjustment listed on page 3-35 in this manual, store the correction constants to a backup file on the analyzer hard disk drive by performing these steps:

- Navigate to the EEPROM Backup Utility, located at: C:\Program Files\Agilent\Network Analyzer\Service\eebackup.exe
- **Run** the program.
- Click Backup EEPROM.
- Click **Exit** when the program has finished.

Numerics

010, time domain option, 2-4 014, configurable test set option, 080, frequency offset mode option, 2-4 1284-C port rear panel connector, 5-29 troubleshooting, 4-18 13.5 GHz frequency range, **Option F13.** 2-5 1CP, rack mount with handles option, 2-41E1, source attenuator option, 20 GHz frequency range, **Option F20**, 2-5 50-ohm load illustration, 6-21, 6-31 part number, 6-20, 6-30 60-dB source step attenuator illustration, 6-27, 6-31 operation, 5-17 part number, 6-26, 6-30 removal and replacement, 7-40 60-dB source step attenuator, second source illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-42 897, option built-in tests for commercial calibration, 2-5 898, option built-in tests for standards compliant calibration, 2-5

Α

A channel troubleshooting, 4-25 typical power output, 4-42 A trace troubleshooting, 4-25, 4-28 A, B, and R1 traces troubleshooting, 4-28 A1 keypad assembly illustrated, 6-11 operation, 5-27 part number, 6-10 removal and replacement illustrated, 7-11 procedure, 7-12 troubleshooting, 4-12 A10 frequency reference board illustration, 6-13, 6-16, 6-17 operation, 5-10 part number, 6-12, 6-16 removal and replacement, 7-16

test nodes, 4-31 troubleshooting, 4-35 A11 vertical motherboard illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-18 A12 multiplier board illustration, 6-16, 6-17 operation, 5-9 part number, 6-16 removal and replacement, 7-20 troubleshooting all bands, 4-41 A13 fractional-N synthesizer board illustration, 6-16, 6-17 operation, 5-9 part number, 6-16 removal and replacement, 7-20 troubleshooting band 4, 4-40 bands 0-3, 4-40 bands 5-17, 4-41 A14 system motherboard illustration, 6-13, 6-16, 6-17 operation, 5-27, 5-30 part number, 6-12, 6-16 removal and replacement, 7-22 troubleshooting, 4-9, 4-11 voltage checks, 4-8 A15 CPU board illustration, 6-13, 6-16, 6-17 operation, 5-28 part numbers, 6-12, 6-16 removal and replacement, 7-24 troubleshooting, 4-9, 4-17 A16 test set motherboard illustration, 6-23, 6-27, 6-31 operation, 5-11 part number, 6-22, 6-26, 6-30 removal and replacement, 7-28 test nodes, 4-32, 4-33 troubleshooting, 4-32, 4-33 A17 QABC board illustration, 6-16, 6-17 operation, 5-15 part number, 6-16 removal and replacement, 7-30 A18 MASS 26.5 illustration, 6-16, 6-17 operation, 5-9, 5-17 part number, 6-16 removal and replacement, 7-32 troubleshooting, 4-43, 4-45 A19 MASS 26.5 illustration, 6-23, 6-27, 6-31 operation, 5-9, 5-17 part number, 6-22, 6-26, 6-30

removal and replacement, 7-34 troubleshooting, 4-43, 4-45 A2 display assembly illustrated, 6-11 operation, 5-27 part number, 6-10 removal and replacement illustrated, 7-11 procedure, 7-11 troubleshooting, 4-12 A20 mixer brick illustration, 6-23, 6-27, 6-31 operation, 5-22 part number, 6-22, 6-26, 6-30 removal and replacement, 7-36 troubleshooting, 4-46 A21 test port 1 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 A22 test port 2 coupler illustration, 6-23, 6-27, 6-31 operation. 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 A23 test port 3 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 A24 test port 4 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting. 4-43 A25 source step attenuator illustration, 6-27, 6-31 operation, 5-17 part number, 6-26, 6-30 removal and replacement, 7-40 troubleshooting, 4-43, 4-44, 4-45 A26 source step attenuator illustration, 6-16, 6-17 operation, 5-17 part number, 6-16 removal and replacement, 7-42 troubleshooting, 4-43, 4-45 A29 reference switch illustration, 6-31 operation, 5-22part number, 6-30 removal and replacement, 7-44

troubleshooting, 4-47 A3 front panel interface board illustrated, 6-11 operation, 5-27 part number, 6-10 removal and replacement illustrated, 7-11 procedure, 7-12 troubleshooting, 4-12 A4 power supply assembly illustration, 6-13, 6-16, 6-17 operation, 5-30 part number, 6-12, 6-16 removal and replacement, 7-14 troubleshooting, 4-7 A41 hard disk drive location of illustration, 6-43 operation, 5-29 part numbers, 6-44 removal and replacement illustrated, 7-47 procedure, 7-46 A41 hard disk drive (parallel ATA) illustrated. 6-45 A41 hard disk drive (serial ATA) illustrated, 6-47 part numbers, 6-46 A5 SPAM board illustration, 6-13, 6-16, 6-17 operation analog, 5-22 digital, 5-28 part number, 6-12, 6-16 removal and replacement, 7-16 troubleshooting, 4-46 A6 multiplier board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-30 troubleshooting all bands, 4-38 A7 fractional-N synthesizer board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-31 troubleshooting band 4, 4-36 bands 0-3, 4-36 bands 5-17, 4-37 A8 multiplier board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16

removal and replacement, 7-16 test nodes, 4-30 troubleshooting all bands, 4-39 A9 fractional-N synthesizer board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-31 troubleshooting band 4, 4-38 bands 0-3, 4-38 bands 5-17, 4-39 accessories analyzer, 2-6 CD-RW drive, 2-6 in operator's check, 3-10 in test port cable checks, 3-12 USB part numbers, 6-49 USB hub, 2-6 accuracy dynamic accuracy test, 3-34 frequency test, 3-30 adapters required for servicing, 2-8 adding options, 8-15 adjustments frequency at 10 MHz, 3-35 LO power, 3-36 receiver calibration, 3-38 source calibration, 3-37 system, 3-1, 3-35 getting ready, 3-4 administrator password Agilent, 7-51 Agilent administrator password, 7-51 contacting, 2-11 support, 2-10 all traces troubleshooting, 4-28 analyzer accessories. 2-6 block diagram digital control group, 5-26 digital processor group, 5-26 receiver group, 5-23, 5-24 signal separation group, active, 5-19, 5-20 signal separation group, passive, 5-16 source group, 5-7 covers illustration, 6-41

part numbers, 6-40 removal and replacement, 7-6 external replaceable parts illustration, 6-41 part numbers, 6-40 feet illustration, 6-41 part numbers, 6-40 frequency range and max ouput power, 5-4 frequency reference board assembly, 5-10 front panel interconnects. 5-27 functional groups, 5-3 digital control, 5-5 digital processing, 5-5 power supply, 5-5 receiver group, 5-5 signal separation, 5-5 synthesized source, 5-4 internal replaceable parts illustration, 6-39 part numbers, 6-38 miscellaneous replaceable parts part numbers, 6-48 mounting in equipment rack, 2-4operation configurable test set, Option 014, 5-18 CPU board, 5-28 data acquisition subgroup, 5 - 28digital control group, 5-25 digital processor group, 5-25 display assembly, 5-27 fractional-N synthesizer boards, 5-9 front panel interface board, 5 - 27front panel subgroup, 5-27 hard disk drive, 5-29 keypad assembly, 5-27 main RAM, 5-28 MASS 26.5, 5-9, 5-17 mixer brick, 5-22 multiplier boards, 5-9 processing subgroup, 5-28 receiver group, 5-22 reference channel switch, 5-22 signal separation group, 5-16 source group, 5-6 source step attenuator, 5-17 SPAM board-analog, 5-22 SPAM board-digital, 5-28 test port couplers, 5-17 test set motherboard, 5-11

USB hub, 5-29 options, 2-3 understanding numbers, 2-3 QABC board, 5-15 rear panel interconnects, 5-10, 5-11, 5-29 rear panel replaceable parts illustration, 6-43 part numbers. 6-42 strap handle illustration, 6-41 part number, 6-40 system block diagram, 5-3 system operation theory of, 5-3 upgrades, 2-6 warmup time, 3-4 ANSI/NCSL Z540-1-1994 verification, 3-8 ANSI/NCSL Z540-1-1994 non-type verification, 3-9 assemblies location of part numbers, 6-7 rebuilt-exchange procedure, 6-5 rebuilt-exchange program, 6-5 replacement cautions about, 7-4 list of procedures, 7-4 sequence, 6-4, 7-4 warnings about, 7-4 attenuator source operation, 5-17 attenuator bracket illustration, 6-37 part number, 6-36 attenuators required for servicing, 2-8 **AUX I/O connector** pin assignments, 5-14 rear panel, 5-11

В

B channel troubleshooting, 4-25 typical power output, 4-42 **B trace** troubleshooting, 4-25, 4-28 **B1 fan** removal and replacement, 7-53 **band modes** troubleshooting all bands, 4-38, 4-39, 4-41 band 4, 4-36, 4-38, 4-40 bands 0-3, 4-36, 4-38, 4-40 bands 5-17, 4-37, 4-39, 4-41 battery removal and replacement illustrated, 7-57 procedure, 7-56 battery disposal, 1-8 before applying power, 1-3 block diagram configurable test set, Option 014, 5-19, 5-20 digital control group, 5-26 digital processor group, 5-26 receiver group, 5-23, 5-24 signal separation group, active, 5-19, 5-20 signal separation group, passive, 5-16 source group, 5-7 bottom assembly, all options hardware illustration, 6-37 part numbers, 6-36 bottom assembly, Option 140/240 replaceable cables illustration, 6-25 part numbers, 6-24 replaceable parts illustration, 6-23 part numbers, 6-22 bottom assembly, Option 145/245 replaceable cables illustration, 6-29 part numbers, 6-28 replaceable parts illustration. 6-27 part numbers, 6-26 bottom assembly, Option 146/246 replaceable cables illustration, 6-33 part numbers, 6-32 replaceable parts illustration, 6-31 part numbers, 6-30 bracket attenuator illustration, 6-37 part number, 6-36 broadband failure, 4-34 built-in tests for commercial calibration, Option 897, 2-5 for standards compliant calibration, Option 898, 2-5

С

C channel troubleshooting, 4-25 typical power output, 4-42 C trace

troubleshooting, 4-25, 4-28 C, D, and R3 traces troubleshooting, 4-28 cable substitution. 3-23 test port checks, 3-10, 3-12, 3-13, 3-14, 3-15, 3-17 connector repeatability failure, 3-18 insertion loss failure, 3-14 magnitude and phase stability failure, 3-16 return loss failure, 3-13 cables GPIB part numbers, 6-48 in bottom assembly, Option 140/240illustration, 6-25 part numbers, 6-24 in bottom assembly. Option 145/245illustration, 6-29 part numbers, 6-28 in bottom assembly, Option 146/246illustration, 6-33 part numbers, 6-32 in top assembly, all options except 146/246 illustration, 6-15 part numbers, 6-14 in top assembly, Options 146/246illustration, 6-19, 6-21 part numbers, 6-18, 6-20 required for servicing, 2-8 calibration certificate of, 3-7 coefficients test, 3-33 commercial, built-in tests, Option 897, 2-5 commercial, Option R-50C-001, 2 - 10kits, 2-8, 3-7 substitution, 3-23 measurement, 8-4 options available, 2-10 receiver, 3-38 source, 3-37 standards compliant, built-in tests, Option 898, 2-5 standards compliant, Option R-50C-002, 2-10 care of connectors, 3-5 caution, 1-3 CD-RW drive, 2-6

CE mark, 1-7 certificate of calibration, 3-7 changing a serial number, 8-17 channel A troubleshooting, 4-25, 4-42 typical power output, 4-42 channel B troubleshooting, 4-25, 4-42 typical power output, 4-42 channel C troubleshooting, 4-25, 4-42 typical power output, 4-42 channel D troubleshooting, 4-25, 4-42 typical power output, 4-42 channel R troubleshooting, 4-25 checks cable connector repeatability, failure of, 3-18 insertion loss, failure of, 3-14 magnitude and phase stability, failure of. 3-16 return loss, failure of, 3-13 test port cables, 3-10, 3-12 operator's, 3-10 accessories used in, 3-10 dialog box, 3-11 failure of, 3-11 performing, 3-10 Port 1, 3-10 Port 2, 3-10 preliminary, 3-10 system, 3-1 getting ready, 3-4 test port cable accessories used in, 3-12 connector repeatability, 3-17 insertion loss, 3-14 magnitude and phase stability, 3-15 performing, 3-12 return loss, 3-13 COM, 8-9 commercial calibration built-in tests, Option 897, 2-5 commercial calibration, **Option R-50C-001**, 2-10 compression test, receiver, 3-31 configurable test set, Option 014 block diagram, 5-19, 5-20 description of, 2-4 operation, 5-18 configuration high dynamic range active measurement, 5-21 diagram, 5-21

normal active measurement, 5-18 Option 014, 5-18 connector care principles of, 3-5 quick reference, 3-5 protective end caps part numbers, 6-48 repeatability check failure of, 3-18 of test port cables, 3-17 connector repeatability check test port cables, 3-17 connectors care of, 3-5 front panel, 5-27 USB, 5-27 rear panel, 5-10, 5-11, 5-29 1284-C, 5-29 AUX I/O. 5-11, 5-14 Display, 5-29 EXT 10 MHz REF IN, 5-10 EXT 10 MHz REF OUT, 5-10 GPIB, 5-29 HANDLER I/O, 5-11, 5-13 PARALLEL, 5-29 RS-232, 5-29 SERIAL, 5-29 TEST SET I/O, 5-11, 5-12 TRIG IN, 5-11 TRIG OUT, 5-11 USB, 5-29 VGA, 5-29 constants correction, 8-20 contacting Agilent, 2-11 controller board, touch screen removal and replacement illustrated, 7-11 procedure, 7-10 controllers troubleshooting with, 4-19 correction constants, 8-20 coupler port 1 illustration, 6-23, 6-27, 6-31 part number, 6-22, 6-26, 6-30 troubleshooting, 4-43 port 2 illustration, 6-23, 6-27, 6-31 part number, 6-22, 6-26, 6-30 troubleshooting. 4-43 port 3 illustration, 6-23, 6-27, 6-31 part number, 6-22, 6-26, 6-30 troubleshooting, 4-43

port 4 illustration, 6-23, 6-27, 6-31 part number, 6-22, 6-26, 6-30 troubleshooting, 4-43 cover, removing, 1-4 covers, analyzer illustration, 6-41 part numbers, 6-40 removal and replacement, 7-6 **CPU** board illustration, 6-13 operation, 5-28 part numbers, 6-12, 6-16, 6-17 removal and replacement, 7-24 troubleshooting, 4-17 cross-over cable, LAN, 4-21 CSA mark, 1-7

D

D channel troubleshooting, 4-25 typical power output, 4-42 **D** trace troubleshooting, 4-25, 4-28 dangerous voltage, 1-4 data acquisition operation, 5-28 data acquisition and processing subgroup, 5-25 data storage hard disk, 5-29 IDE, 5-29 data, option recovering, 8-16 repairing, 8-16 DC block illustration, 6-31 part number, 6-30 removal and replacement, 7-44 DCOM. 8-9 description functional digital control group, 5-5 digital processing group, 5-5 power supply group, 5-5 receiver group, 5-5 signal separation group, 5-5 synthesized source group, 5-4 digital control group block diagram, 5-26functional description of, 5-5 operation, 5-25digital processing and control functional group, 5-3 digital processing group block diagram, 5-26 functional description of, 5-5 operation, 5-25

Index

directivity cause of failure, 8-11 definition of, 8-11 measurements affected by, 8-11 disabling options, 8-15 display assembly illustrated, 6-11 operation, 5-27 parts list, 6-10 removal and replacement illustrated, 7-11 procedure, 7-11 troubleshooting, 4-12 display assembly, touch screen removal and replacement illustrated, 7-11, 7-13 procedure, 7-13 **Display port** rear panel connector, 5-29 display test running, 4-15 documentation optional, 1-iv part numbers, 6-48 standard, 1-iv dynamic range, high active measurement configuration, 5-21

\mathbf{E}

earth ground, 1-3 electrostatic discharge, See ESD EMI/RFI supplies part numbers, 6-49 enabling options. 8-15 entitlement certificate, option, 8-14 environment, operating specifications, 3-4 verification, 3-4 equipment rack horizontal spacing, 2-4 mounting analyzer in, 2-4 equipment, service test required, 2-7 error term data description of, 8-10 error terms access to, 8-8 via COM/DCOM commands, 8-9 via front panel, 8-8 via SCPI commands (using GPIB), 8-9 cause of failure to, 8-3

descriptions, 8-10 directivity, 8-11 flowgraph of one port, 8-4 flowgraph of two port, 8-5, 8-6, 8-7 identifying using flowgraphs, 8-4 isolation, 8-13 load match. 8-11 magnitude affected by, 8-3 monitoring over time, 8-3 reflection tracking, 8-12 shape affected by, 8-3 source match, 8-11 transmission tracking, 8-12 typical data, 8-10 using as diagnostic tool, 8-3 using to aid troubleshooting, 8-3 worse than typical values, 8-10 ESD protection, 1-6, 3-4, 4-3, 7-3, 8-4 supplies part numbers, 6-49 exchange module procedure, 6-5 rebuilt assemblies program, 6-5 EXT 10 MHz REF IN connector rear panel, 5-10 **EXT 10 MHz REF OUT connector** rear panel, 5-10 extended power range, Option 1E1, extender board measurement points, 4-8 voltages, 4-8 external analyzer replaceable parts illustration, 6-41 part numbers, 6-40

\mathbf{F}

F13, 13.5 GHz frequency range option, 2-5
F20, 20 GHz frequency range option, 2-5
failure broadband, 4-34 of connector repeatability check, 3-18 of insertion loss check, 3-14 of magnitude and phase stability check, 3-16 of operator's check, 3-11 of return loss check, 3-13 of system verification, 3-25

flowchart, 3-25 single vs. broadband, 4-34 fan troubleshooting, 4-11 feet analyzer illustration, 6-41 part numbers, 6-40 firmware upgrade downloading from the internet, 8-18 flowgraph of one port error terms, 8-4 of two port error terms, 8-5, 8-6, 8-7 using to identify error terms, 8-4 Fourier transform, 2-4 fractional-N synthesizer board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-31 troubleshooting band 4, 4-36, 4-38, 4-40 bands 0-3, 4-36, 4-38, 4-40 bands 5-17, 4-37, 4-39, 4-41 fractional-N synthesizer board, second source illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-20 frequency accuracy test, 3-30 frequency adjustment at 10 MHz, 3-35 frequency offset mode, **Option 080**, 2-4 frequency range and max output power, 5-4 frequency reference board illustration, 6-13, 6-16, 6-17 operation, 5-10 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-31 troubleshooting, 4-35 front panel connectors USB, 5-27 interconnects, 5-27 knob illustrated, 6-9 part number, 6-8 test, **4-15** troubleshooting, 4-12 LED board illustration, 6-37 part number, 6-36

name plate illustrated, 6-9 part number, 6-8 operation, 5-27 overlays illustrated, 6-9 part numbers, 6-8 speaker, 5-27 subgroup, 5-25 troubleshooting, 4-12 USB troubleshooting, 4-17 front panel assembly removal and replacement, 7-8 replaceable parts illustrated, 6-9, 6-11 part numbers, 6-8, 6-10 front panel interface board illustrated, 6-11 operation, 5-27 part number, 6-10 removal and replacement illustrated, 7-11 procedure, 7-12 troubleshooting, 4-12 front panel keypad assembly troubleshooting, 4-12 front panel subassemblies removal and replacement illustrated, 7-11 procedures, 7-10 functional groups, 5-3 fuses, 6-48

G

general safety considerations, 1-3 GPIB, 8-9 cables part numbers, 6-48 port rear panel connector, 5-29 running test software, 4-18 troubleshooting, 4-18 systems check, 4-18 ground, safety earth, 1-3 groups functional, 5-3

Η

handle damaged, 1-3 kits part numbers, 6-49 HANDLER I/O connector pin assignments, 5-13 rear panel, 5-11 handles with rack mount. 2-4 hard disk drive copying files from, 7-46 data storage, 5-29 installing backup files onto, 7-51 location of illustration, 6-43 operation, 5-29 part number, 6-44 removal and replacement illustrated, 7-47 procedure, 7-46 replaceable parts illustrated, 6-47 part numbers, 6-44 unique files located on, 7-46 hard disk drive (parallel ATA) illustrated, 6-4 replaceable parts illustrated, 6-45 hard disk drive (serial ATA) illustrated, 6-47 part number, 6-46 replaceable parts part numbers, 6-46 hardware in bottom assembly illustration, 6-37 part numbers, 6-36 in external analyzer illustration, 6-41 part numbers, 6-40 in hard disk drive (parallel ATA) assembly illustrated, 6-45 in hard disk drive (serial ATA) part numbers, 6-46 in hard disk drive (serial ATA) assembly illustrated, 6-47 in hard disk drive assembly part numbers, 6-44 in internal analyzer illustration, 6-39 part numbers, 6-38 in rear panel assembly illustration, 6-43 part numbers, 6-42 in top assembly illustration, 6-34, 6-35 part numbers, 6-34 location of part numbers, 6-7 options, 2-3, 8-15 high dynamic range active measurement configuration, 5-21 configuration

diagram, 5-21

Ι

IDE data storage, 5-29 illustration hardware in bottom assembly, 6-37 in external analyzer, 6-41 in internal analyzer, 6-39 in rear panel assembly, 6-43 in top assembly, all options, 6-34, 6-35 replaceable cables in bottom assembly, Option 140/240, 6-25 in bottom assembly, Option 145/245, 6-29 in bottom assembly, Option 146/246, 6-33 in top assembly, all options except 146/246, 6-15 in top assembly, Options 146/246, 6-19, 6-21 replaceable parts analyzer covers, 6-41 analyzer feet, 6-41 analyzer strap handle, 6-41 in bottom assembly, all options, 6-37 in bottom assembly, Option 140/240, 6-23 in bottom assembly, Option 145/245, 6-27 in bottom assembly, Option 146/246, 6-31 in external analyzer, 6-41 in internal analyzer, 6-39 in rear panel assembly, 6-43 in top assembly, all options, 6-34, 6-35 in top assembly, all options except 146/246, 6-13 in top assembly, Options 146/246, 6-16, 6-17 insertion loss check failure of, 3-14 test port cables, 3-14 installing a serial number, 8-17 instruction documentation symbol, 1-7 instrument markings, 1-7 instrument specifications, 3-6 interconnects AUX I/O

pin assignments, 5-14 front panel, 5-27 USB. 5-27 HANDLER I/O pin assignments, 5-13 rear panel, 5-10, 5-11, 5-29 1284-C, 5-29 AUX I/O, 5-11 Display, 5-29 EXT 10 MHz REF IN, 5-10 EXT 10 MHz REF OUT, 5-10 GPIB, 5-29 HANDLER I/O, 5-11 LAN, 5-29 PARALLEL, 5-29 RS-232, 5-29 SERIAL, 5-29 TEST SET I/O, 5-11 **TRIG IN**, 5-11 TRIG OUT, 5-11 USB, 5-29 VGA. 5-29 TEST SET I/O pin assignments, 5-12 internal analyzer replaceable hardware illustration, 6-39 part numbers, 6-38 replaceable parts illustration, 6-39 part numbers, 6-38 inverter board removal and replacement illustrated, 7-11 procedure, 7-10 IP address, LAN, 4-19 ISM1-A mark, 1-7 isolation cause of failure, 8-13 definition of, 8-13 measurements affected by, 8-13

K

keypad assembly illustrated, 6-11 operation, 5-27 part number, 6-10 removal and replacement illustrated, 7-11 procedure, 7-12 test, 4-14 troubleshooting, 4-12 kits calibration, 2-8, 3-7 handle part numbers, 6-49 rack mount part numbers, 6-49 upgrade part numbers, 6-49 verification, 2-8, 3-7 **knob** front panel illustrated, 6-9 part number, 6-8 test, 4-15 troubleshooting, 4-12

\mathbf{L}

LAN connector rear panel, 5-29 cross-over cable, 4-21 IP address, 4-19 ping command, 4-19 ping to and from, 4-19 subnet mask, 4-19 testing between analyzers, 4-21 troubleshooting, 4-19 LED board, front panel illustration, 6-37 part number, 6-36 limiter illustration, 6-31 part number, 6-30 removal and replacement, 7-44 linearity source power test, 3-29 test port output power test, 3-29 lithium battery removal and replacement, 7-56 illustrated, 7-57 lithium battery disposal, 1-8 LO power adjustment, 3-36 load match cause of failure, 8-11 definition of, 8-11 measurements affected by, 8-11, 8-12 load, 50-ohm illustration, 6-21, 6-31 part number, 6-20, 6-30 locating assembly part numbers, 6-7 hardware part numbers, 6-7 miscellaneous part numbers, 6-7 replaceable part numbers by reference designator, 6-6 by type of part, 6-7

М

machine screws in bottom assemblies illustration, 6-37 part numbers, 6-36 in external analyzer illustration. 6-41 part numbers, 6-40 in hard disk drive assembly part numbers, 6-44 in rear panel assembly illustration, 6-43 part numbers. 6-42 magnitude check failure of, 3-16 test port cables, 3-15 maintenance cleaning, 2-3 preventive effect on error terms, 8-3 **MASS 26.5** illustration, 6-16, 6-17, 6-23, 6-27, 6-31 operation, 5-9, 5-17 part number, 6-16, 6-22, 6-26, 6-30 removal and replacement, 7-32, 7 - 34troubleshooting, 4-43, 4-45 MASSQuad illustration, 6-16, 6-17, 6-23, 6-27, 6-31 operation, 5-9, 5-17 part number, 6-16, 6-22, 6-26, 6 - 30removal and replacement, 7-32, 7-34troubleshooting, 4-43, 4-45 max output power and frequency range, 5-4 measurement calibration, 8-4 traceability, 3-21 path, 3-21 uncertainty, 3-20 measurement configuration active high dynamic range, 5-21 normal, 5-18 measurement system troubleshooting, 4-23 measuring high-dynamic range devices, 2-4 high-power devices, 2-4 memory modules part numbers, 6-49 midweb removal and replacement, 7-53

midweb fans troubleshooting. 4-11 miscellaneous parts location of part numbers, 6-7 required for servicing, 2-9 miscellaneous replaceable parts part numbers, $\overline{6}$ -48 mixer brick illustration, 6-23, 6-27, 6-31 operation, 5-22 part number, 6-22, 6-26, 6-30 removal and replacement, 7-36 troubleshooting, 4-46 module exchange procedure, 6-5 motherboard, system illustration, 6-13, 6-16, 6-17 operation, 5-27 part number, 6-12, 6-16 removal and replacement, 7-22 troubleshooting, 4-11 motherboard, test set illustration, 6-23, 6-27, 6-31 part number, 6-22, 6-26, 6-30 multiplier board illustration, 6-13, 6-16, 6-17 operation, 5-9 part number, 6-12, 6-16 removal and replacement, 7-16 test nodes, 4-30 troubleshooting all bands, 4-38, 4-39, 4-41 multiplier board, second source illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-20

Ν

name plate front panel illustrated, 6-9 part number, 6-8 network analyzer, *See analyzer* noise floor, test, 3-32 noise, trace noise test, 3-30 Non-ANSI/NCSL Z540-1-1994 verification, 3-9

0

OCXO (oven-controlled crystal oscillator) frequency adjustment, 3-35 theory of operation, 5-10 operating environment specifications, 3-4 verification, 3-4 operating system recovery, 8-19 operation configurable test set, Option 014, 5-18 CPU board, 5-28 data acquisition, 5-28 digital control, 5-25 digital processor, 5-25 display assembly, 5-27 fractional-N synthesizer boards, 5-9frequency reference board, 5-10 front panel, 5-27 front panel interface board, 5-27 hard disk drive, 5-29 keypad assembly, 5-27 main RAM, 5-28 MASS 26.5, 5-9, 5-17 mixer brick, 5-22 multiplier boards, 5-9 power supply, 5-30 processing subgroup, 5-28 QABC board, 5-15 receiver group, 5-22 reference channel switch, 5-22 signal separation group, 5-16 source group, 5-6 SPAM board-analog, 5-22 SPAM board-digital, 5-28 step attenuator source, 5-17 system motherboard, 5-27 test port couplers, 5-17 test set motherboard, 5-11 USB hub, 5-29 operator's check, 3-10 accessories used in, 3-10dialog box, 3-11 failure of, 3-11 performing, 3-10 Port 1, 3-10 Port 2, 3-10 option analyzer, 2-3 understanding numbers, 2-3 calibration, 2-10 data recovering, 8-16 repairing, 8-16 enable utility accessing, 8-14 dialog box, 8-14 enabling and removing, 8-15 entitlement certificate, 8-14 hardware, 8-15 service and support, 2-10 software, 8-15

Option 010, time domain, 2-4 Option 014, configurable test set, block diagram, 5-19, 5-20 normal configuration, 5-18 operation, 5-18 **Option 080, frequency offset** mode, **Option 140/240** description of, 2-3 replaceable cables, in bottom assembly illustration, 6-25 part numbers, 6-24 replaceable cables, in top assembly illustration, 6-15 part numbers, 6-14 replaceable parts, in bottom assembly illustration, 6-23 part numbers, 6-22 replaceable parts, in top assembly illustration, 6-13 part numbers, 6-12 **Option 145/245** description of, 2-3 replaceable cables, in bottom assembly illustration, 6-29 part numbers, 6-28 replaceable cables, in top assembly illustration, 6-15 part numbers, 6-14 replaceable parts, in bottom assembly illustration, 6-27 part numbers, 6-26 replaceable parts, in top assembly illustration, 6-13 part numbers, 6-12 **Option 146/246** description of, 2-3 replaceable cables, in bottom assembly illustration, 6-33 part numbers, 6-32 replaceable cables, in top assembly illustration, 6-19, 6-21 part numbers, 6-18, 6-20 replaceable parts, in bottom assembly illustration, 6-31 part numbers, 6-30

replaceable parts, in top assembly illustration, 6-16, 6-17 part numbers, 6-16 **Option 1CM, rack mount without** handles, 2-4 **Option 1CM, rack mount without** handles option, 2-4 **Option 1CP, rack mount with** handles, 2-4 **Option 1E1, source attenuator** description of, 2-5 operation, 5-17 **Option 897** built-in tests for commercial calibration, 2-5 **Option 898** built-in tests for standard compliant calibration, 2-5 **Option F13, 13.5 GHz frequency** range, Option F20, 20 GHz frequency range, 2-5Option S02, second source, 2-5 Option R-50C-001 commercial calibration, 2-10 Option R-50C-002 standards compliant calibration, 2-10 ordering information options and upgrades, 2-3, 2-6 replaceable parts, 6-3 output power, source accuracy test, 3-28 linearity, 3-29 maximum test, 3-29 output power, test port accuracy test, 3-28 linearity, 3-29 maximum test, 3-29 overlays front panel illustrated, 6-9 part numbers, 6-8

Р

pads required for servicing, 2-8 paint touch-up part numbers, 6-50 PARALLEL port rear panel connector, 5-29 troubleshooting, 4-18 part numbers accessories USB, 6-49 cables

GPIB, 6-48 documentation, 6-48 hardware in bottom assembly, 6-36 in external analyzer, 6-40 in hard disk drive, 6-44 in hard disk drive (serial ATA), 6-46 in internal analyzer. 6-38 in rear panel assembly, 6-42 in top assembly, all options, 6-34 kits handle, 6-49 rack mount, 6-49 locating by reference designator, 6-6 by type of part, 6-7 for assemblies, 6-7 for hardware, 6-7 for miscellaneous parts, 6-7 paint touch-up, 6-50 protective end caps for connectors, 6-48 replaceable cables in bottom assembly, Option 140/240, 6-24 in bottom assembly, Option 145/245, 6-28 in bottom assembly, Option 146/246, 6-32 in top assembly, all options except 146/246, 6-14 in top assembly, Options 146/246, 6-18, 6-20 replaceable parts analyzer covers, 6-40 analyzer feet, 6-40 analyzer strap handle, 6-40 in bottom assembly, all options, 6-36 in bottom assembly, Option 140/240, 6-22 in bottom assembly, Option 145/245, 6-26 in bottom assembly, Option 146/246, 6-30 in external analyzer, 6-40 in front panel assembly, 6-8, 6-10 in hard disk drive (serial ATA), 6-46 in hard disk drive assembly, 6-44 in internal analyzer, 6-38 in rear panel assembly, 6-42

in top assembly, all options, 6 - 34in top assembly, all options except 146/246, 6-12 in top assembly, Options 146/246, 6-16 miscellaneous analyzer, 6-48 supplies EMI/RFI, 6-49 ESD, 6-49 memory modules, 6-49 tools service. 6-48 upgrade kits, 6-49 parts in bottom assembly illustration, 6-37 part numbers, 6-36 in bottom assembly, Option 140/240illustration, 6-23 part numbers, 6-22 in bottom assembly, Option 145/245illustration, 6-27 part numbers, 6-26 in bottom assembly, Option 146/246illustration, 6-31 part numbers, 6-30 in external analyzer illustration, 6-41 part numbers, 6-40 in front panel assembly illustrated, 6-9, 6-11 part numbers, 6-8, 6-10 in hard disk drive (parallel ATA) assembly illustrated, 6-45 in hard disk drive (serial ATA) assembly illustrated, 6-47 in hard disk drive assembly part numbers, 6-44 in hard disk drive assembly (serial ATA) part numbers, 6-46 in internal analyzer illustration. 6-39 part numbers, 6-38 in rear panel assembly illustration, 6-43 part numbers, 6-42 in top assembly, all options illustration, 6-34, 6-35 part numbers, 6-34

in top assembly, all options except 146/246 illustration, 6-13 part numbers, 6-12 in top assembly, Options 146/246illustration, 6-16, 6-17 part numbers, 6-16 locating by reference designator, 6-6 by type of part, 6-7 miscellaneous part numbers, 6-48 required for servicing, 2-9 replaceable listing of, 6-6 ordering information, 6-3 parts, hardware in bottom assembly illustration, 6-37 part numbers, 6-36 in external analyzer, all options illustration, 6-41 part numbers, 6-40 in hard disk drive assembly, all options part numbers, 6-44 in internal analyzer, all options illustration, 6-39 part numbers, 6-38 in rear panel assembly, all options illustration, 6-43 part numbers, 6-42 in top assembly, all options illustration, 6-34, 6-35 part numbers, 6-34 password Agilent administrator, 7-51 performance tests, 3-28 calibration coefficients, 3-33 description of, 3-7 dynamic accuracy, 3-34 frequency accuracy, 3-30 noise floor, 3-32 receiver compression, 3-31 source maximum power output, 3-29 source power accuracy, 3-28 source power linearity, 3-29 test port output maximum power, 3-29 test port output power accuracy, 3-28 test port output power linearity, 3-29 trace noise, 3-30

verification ANSI/NCSL Z540-1-1994, 3-8 non-ANSI/NCSLZ540-1-1994, 3-9 phase stability check failure of, 3-16 test port cables, 3-15 pin assignments connectors AUX I/O, 5-14 HANDLER I/O, 5-13 **TEST SET I/O**, **5-12** ping command, LAN, 4-19 from network, 4-20 to analyzer, 4-19 pixel damaged, 4-15definition, 4-15 plenum removal and replacement, 7-18 plenum bracket removal and replacement, 7-18 Port 1 check, 3-10 typical power output, 4-42 Port 2 check, 3-10 typical power output, 4-42 Port 3 typical power output, 4-42 Port 4 typical power output, 4-42 post-repair procedures, 7-58 power supply check, 4 functional description of, 5-5 functional group, 5-3 if all voltages are missing, 4-9 operation, 5-30 voltage checks, 4-8 power supply assembly illustration, 6-13, 6-16, 6-17 part number, 6-12, 6-16 removal and replacement, 7-14 troubleshooting, 4-7 power, source accuracy test, 3-28 linearity test, 3-29 power, source output maximum test, 3power, test port output accuracy test, 3-2 linearity test, 3-29 maximum test, 3-29 pre-repair procedures caution about, 7-3 warnings about, 7-3

preventive maintenance effect on error terms, 8-3 processing subgroup operation, 5-28 protection against EMI/RFI, 6-49 against ESD, 1-6, 3-4, 4-3, 7-3, 8-4 protective end caps for connectors part numbers, 6-48

Q

QABC board illustration, 6-16, 6-17 operation, 5-15 part number, 6-16 removal and replacement, 7-30 QuintBrick illustration, 6-23, 6-27, 6-31 operation, 5-22 part number, 6-22, 6-26, 6-30 Quintbrick removal and replacement, 7-36

R

R channel troubleshooting, 4-25 **R** trace troubleshooting, 4-25, 4-28 rack mount kits part numbers, 6-49 with handles, Option 1CP, 2-4 without handles, Option 1CM, 2-4RAM, main operation, 5-28 rear panel connectors 1284-C, 5-29 AUX I/O, 5-11 Display, 5-29 EXT 10 MHz REF IN, 5-10 GPIB, 5-29 HANDLER I/O, 5-11 LAN, 5-29 PARALLEL, 5-29 RS-232, 5-29 SERIAL, 5-29 TEST SET I/O, 5-11 **TRIG IN**, 5-11 TRIG OUT, 5-11 USB, 5-29 VGA, 5-29 interconnects, 5-10, 5-11, 5-29 replaceable parts illustration, 6-43

Index

part numbers, 6-42 troubleshooting, 4-17 rebuilt-exchange assemblies program, 6-5 receiver accuracy dynamic accuracy test, 3-34 calibration, 3-38 compression test, 3-31 dynamic accuracy test, 3-34 functional description of, 5-5 functional group, 5-3 linearity dynamic accuracy test, 3-34 outputs troubleshooting, 4-46 receiver display running the test, 4-25 receiver group block diagram, 5-23, 5-24 defined, 4-27 operation, 5-22 troubleshooting, 4-46 recovery option data, 8-16 recovery, operating system, 8-19 reference channel switch operation, 5-22 troubleshooting, 4-47 reference channel, See R channel reference switch illustration, 6-31 part number, 6-30 removal and replacement, 7-44 reflection tracking cause of failure, 8-12 definition of, 8-12 measurements affected by, 8-12 removal A10 frequency reference board, 7 - 16A11 vertical motherboard, 7-18 A12 multiplier board, 7-20 A13 fractional-N synthesizer board, 7-20 A14 system motherboard, 7-22 A15 CPU board, 7-24 A16 test set motherboard, 7-28 A17 QABC board, 7-30 A18 MASS 26.5, 7-32 A19 MASS 26.5, 7-34 A20 mixer brick, 7-36 A21 test port 1 coupler, 7-38 A22 test port 2 coupler, 7-38 A23 test port 3 coupler, 7-38 A24 test port 4 coupler, 7-38 A25 60-dB source step attenuator, 7-40

A26 60-dB source step attenuator, 7-42 A29 reference switch, 7-44 A4 power supply assembly, 7-14 A5 SPAM board, 7-16 A6 multiplier board, 7-16 A7 fractional-N synthesizer board, 7-16 A8 multiplier board, 7-16 A9 fractional-N synthesizer board, 7-16 DC block, 7-44 fan. 7-53 front panel assembly, 7-8 limiter, 7-44 midweb, 7-53 plenum, 7-18 plenum bracket, 7-18 removing assemblies, See specific assembly. options, 8-15 parts, See specific part. removing the cover, 1-4 repair post-repair procedures, 7-58 procedures caution about, 7-3 warnings about, 7-3 repairing option data, 8-16 replaceable cables in bottom assembly, Option 140/240illustration, 6-25 part numbers, 6-24 in bottom assembly, Option 145/245illustration, 6-29 part numbers, 6-28 in bottom assembly, Option 146/246illustration, 6-33 part numbers, 6-32 in top assembly, all options except 146/246 illustration. 6-15 part numbers, 6-14 in top assembly, Options 146/246illustration, 6-19, 6-21 part numbers, 6-18, 6-20 replaceable hardware in bottom assembly illustration, 6-37 part numbers, 6-36 in external analyzer illustration, 6-41

part numbers, 6-40 in hard disk drive (parallel ATA) assembly illustrated, 6-45 in hard disk drive (serial ATA) part numbers, 6-46 in hard disk drive (serial ATA) assembly illustrated. 6-47 in hard disk drive assembly part numbers, 6-44 in internal analyzer illustration, 6-39 part numbers, 6-38 in rear panel assembly illustration, 6-43 part numbers, 6-42 replaceable parts hardware, in bottom assembly illustration, 6-37 part numbers, 6-36 in bottom assembly, Option 140/240illustration, 6-23 part numbers, 6-22 in bottom assembly, Option 145/245illustration, 6-27 part numbers, 6-26 in bottom assembly, Option 146/246illustration, 6-31 part numbers, 6-30 in external analyzer illustration. 6-41 part numbers, 6-40 in front panel assembly illustrated, 6-9, 6-11 part numbers, 6-8, 6-10 in hard disk drive (parallel ATA) assembly illustrated, 6-45 in hard disk drive (serial ATA) part numbers, 6-46 in hard disk drive (serial ATA) assembly illustrated, 6-47 in hard disk drive assembly part numbers, 6-44 in internal analyzer illustration, 6-39 part numbers, 6-38 in rear panel assembly illustration, 6-43 part numbers, 6-42 in top assembly, all options illustration, 6-34, 6-35

part numbers, 6-34 in top assembly, all options except 146/246 illustration, 6-13 part numbers, 6-12 in top assembly, Options 146/246illustration, 6-16, 6-17 part numbers, 6-16 listing of, 6-6 locating by reference designator, 6-6 by type of part, 6-7 miscellaneous analyzer part numbers, 6-48 ordering information, 6-3 replacement A1 keypad assembly illustrated, 7-11 procedure, 7-12 A10 frequency reference board, 7 - 16A11 vertical motherboard, 7-18 A12 multiplier board, 7-20 A13 fractional-N synthesizer board, 7-20 A14 system motherboard, 7-22 A15 CPU board, 7-24 A16 test set motherboard, 7-28 A17 QABC board, 7-30 A18 MASS 26.5, 7-32 A19 MASS 26.5, 7-34 A2 display assembly illustrated, 7-11 procedure, 7-11 A20 mixer brick, 7-36 A21 test port 1 coupler, 7-38 A22 test port 2 coupler, 7-38 A23 test port 3 coupler, 7-38 A24 test port 4 coupler, 7-38 A25 60-dB source step attenuator, 7-40 A26 60-dB source step attenuator, 7-42 A29 reference switch, 7-44 A3 front panel interface board illustrated, 7-11 procedure, 7-12 A4 power supply assembly, 7-14 A41 hard disk drive illustrated, 7-47 procedure, 7-46 A5 SPAM board, 7-16 A6 multiplier board, 7-16 A7 fractional-N synthesizer board, 7-16

A8 multiplier board, 7-16

A9 fractional-N synthesizer board, 7-16 analyzer covers, 7-6 assembly cautions about, 7-4 list of procedures, 7-4 sequence, 6-4, 7-4 warnings about, 7-4 DC block, 7-44 fan, 7-53 front panel assembly, 7-8 front panel subassemblies illustrated. 7-11 procedures, 7-10 inverter board illustrated, 7-11 procedure, 7-10 limiter, 7-44 lithium battery illustrated, 7-57 procedure, 7-56 midweb, 7-53 plenum, 7-18 plenum bracket, 7-18 touch screen controller board illustrated, 7-11 procedure, 7-10 touch screen display illustrated, 7-13 touch screen display assembly illustrated, 7-11 procedure, 7-13 USB connector board illustrated, 7-11 procedure, 7-12 replacement sequence, 4-3 return loss check failure of, 3-13 test port cables, 3-13 **RFI/EMI** supplies part numbers, 6-49 rotary pulse generator (RPG) illustrated, 6-9 part number, 6-8 test, 4-15 troubleshooting, 4-12 RS-232 port rear panel connector, 5-29 troubleshooting, 4-18

\mathbf{S}

S02, second source option, 2-5 safety considerations, 1-3 earth ground, 1-3 symbols, 1-3 **SCPI**, 8-9 screws for bottom assemblies illustration, 6-37 part numbers, 6-36 in external analyzer illustration, 6-41 part numbers, 6-40 in hard disk drive assembly part numbers, 6-44 in rear panel assembly illustration, 6-43 part numbers, 6-42 second source, Option S02, 2-5 serial bus test, 4-29 dialog box, 4-30 performing, 4-29 serial number changing, 8-17 installing, 8-17 SERIAL port rear panel connector, 5-29 troubleshooting, 4-18 service contacting Agilent, 2-11 EMI/RFI parts part numbers, 6-49 memory modules part numbers, 6-49 miscellaneous parts required, 2-9 options, 2-10procedures caution about, 7-3 post-repair, 7-58 warnings about, 7-3 static safety parts part numbers, 6-49 required, 2-9 test equipment required, 2-7 tools part numbers, 6-48 required, 2-9 warnings, 1-4 warrantv standard, 2-10 three-year return to Agilent, 2-10shipment for service or repair, 2-11 signal separation functional description of, 5-5 functional group, 5-3 signal separation group defined, 4-27 operation, 5-16

troubleshooting, 4-42 signal separation group, active block diagram, 5-19, 5-20 signal separation group, passive block diagram, 5-16 single band failure, 4-34 software options, 8-15 source calibration, 3-37 functional group, 5-3 maximum output power test, 3 - 29power accuracy test, 3-28 power linearity test, 3-29 source attenuator description of Option 1E1, 2-5 illustration, 6-27, 6-31 operation, 5-17 part number, 6-26, 6-30 removal and replacement, 7-40 troubleshooting, 4-43, 4-45 source attenuator, second source description of Option S02, 2-5 illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-42 source group block diagram, 5-7 defined, 4-27 operation, 5-6 troubleshooting, 4-29 source match cause of failure, 8-11 definition of, 8-11 measurements affected by, 8-11 SPAM board illustration, 6-13, 6-16, 6-17 operation analog, 5-22 digital, 5-28 part number, 6-12, 6-16 removal and replacement, 7-16 troubleshooting, 4-46 speaker front panel, 5-27 troubleshooting, 4-12 specifications instrument, 3-6 stabilization, warm up time, 3-4 system, 3-6 stabilization warm up time, 3-4 standards compliant calibration built-in tests, Option 898, 2-5 standards compliant calibration, Option R-50C-002, 2-10 static safety parts required for servicing, 2-9

step attenuator, second source illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-42 step attenuator, source illustration, 6-27, 6-31 operation, 5-17 part number, 6-26, 6-30 removal and replacement, 7-40 troubleshooting, 4-43, 4-44, 4 - 45storage data IDE, 5-29 strap handle analyzer illustration, 6-41 part number, 6-40 subgroup data acquisition and processing, 5 - 25front panel, 5-25 subnet mask, LAN, 4-19 substitution cable, 3-23 calibration kits, 3-23 verification kits, 3-23 supplies ÊÑI/RFI part numbers, 6-49 EŜD part numbers, 6-49 memory modules part numbers, 6-49 support contacting Agilent, 2-11 options, 2-10 organization, 2-10 switch, reference illustration, 6-31 part number, 6-30 synthesized source functional description of, 5-4 synthesized source group operation, 5-6 system adjustments, 3-1, 3-35 frequency at 10 MHz, 3-35 getting ready, 3-4 LO power, 3-36 receiver calibration, 3-38 source calibration, 3-37checks, 3-1 getting ready, 3-4 operating recovery, 8-19 specifications. 3-6 verification, 3-1, 3-7, 3-19 dialog box, 3-23 example of results, 3-26, 3-27

failure flowchart, 3-25 failure of, 3-25 getting ready, 3-4 interpreting results, 3-26 performing, 3-22 procedure, 3-23 what it verifies, 3-19 **system motherboard** illustration, 6-13, 6-16, 6-17 operation, 5-27 part number, 6-12, 6-16 removal and replacement, 7-22 troubleshooting, 4-11

Т

termination, 50-ohm illustration, 6-21, 6-31 part number, 6-20, 6-30 test calibration coefficients, 3-33 dynamic accuracy, 3-34 frequency accuracy, 3-30 noise floor, 3-32 performance frequency accuracy, 3-30 source maximum power output, 3-29 source power accuracy, 3-28 test port maximum power output, 3-29 test port power accuracy, 3-28 receiver compression, 3-31 source power linearity, 3-29 test port output power linearity, 3 - 29trace noise, 3-30 test equipment required for service, 2-7 required for servicing, 2-7 test port cable checks connector repeatability failure, 3-18 dynamic accuracy test, 3-34 maximum output power test, 3-29noise floor test, 3-32 output power accuracy test, 3-28 output power linearity test, 3-29 test port 1 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 test port 2 coupler illustration, 6-23, 6-27, 6-31

operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 test port 3 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 test port 4 coupler illustration, 6-23, 6-27, 6-31 operation, 5-17 part number, 6-22, 6-26, 6-30 removal and replacement, 7-38 troubleshooting, 4-43 test port cable checks, 3-10 accessories used in, 3-12 connector repeatability, 3-17 insertion loss, 3-14 insertion loss failure. 3-14 magnitude and phase stability, 3-15 magnitude and phase stability failure, 3-16 performing, 3-12 return loss, 3-13 return loss failure, 3-13 **TEST SET I/O** connector pin assignments, 5-12 rear panel, 5-11 test set motherboard illustration, 6-23, 6-31 operation, 5-11 part number, 6-22, 6-26, 6-27, 6-30 removal and replacement, 7-28 test nodes, 4-32, 4-33 troubleshooting, 4-32, 4-33 tests adjustments, 3-35 performance, 3-7, 3-28 serial bus, 4-29 dialog box, 4-30 performing, 4-29 source group, 4-34 tests nodes on A10 frequency reference, 4 - 31on A16 test set motherboard, 4-32, 4-33 on A6 multiplier board, 4-30 on A7 fractional-N synthesizer board. 4-31 on A8 multiplier board, 4-30

on A9 fractional-N synthesizer board, 4-31 time domain, Option 010 description of, 2-4 tools required for servicing, 2-9 service, part numbers, 6-48 top assembly, all options hardware illustration, 6-34, 6-35 part numbers, 6-34 top assembly, all options except 146/246 replaceable cables illustration, 6-15 part numbers, 6-14 replaceable parts illustration, 6-13 part numbers, 6-12 top assembly, Options 146/246 replaceable cables illustration, 6-19, 6-21 part numbers, 6-18, 6-20 replaceable parts illustration, 6-16, 6-17 part numbers, 6-16 touch screen controller board removal and replacement illustrated, 7-11 procedure, 7-10 touch screen display removal and replacement illustrated, 7-13 touch screen display assembly removal and replacement illustrated, 7-11 procedure, 7-13 touch-up paint part numbers, 6-50 trace troubleshooting all traces, 4-28 troubleshooting all, 4-25 trace A troubleshooting, 4-25, 4-28 trace B troubleshooting, 4-25, 4-28 trace C troubleshooting, 4-25, 4-28 trace D troubleshooting, 4-25, 4-28 trace noise test, 3-30 trace R troubleshooting, 4-25, 4-28 trace. all troubleshooting, 4-28 traceability

measurement, 3-21 path, 3-21 traces A, B, and R1 troubleshooting, 4-28 traces C, D, and R 3 troubleshooting, 4-28 transmission tracking cause of failure, 8-12 definition of, 8-12 **TRIG IN connector** rear panel, 5-11 TRIG OUT connector rear panel, 5-11 troubleshooting 1284-C port, 4-18 A10 frequency reference board, 4 - 35A12 multiplier board all bands, 4-41 A13 fractional-N synthesizer board band 4, 4-40 bands 0-3, 4-40 bands 5-17, 4-41 A14 motherboard, 4-11 A15 CPU board, 4-17 A16 test set motherboard, 4-32, 4 - 33A18 MASSQuad, 4-43, 4-45 A19 MASSQuad, 4-43, 4-45 A2 display assembly, 4-12 A20 mixer brick, 4-46 A21 test port 1 coupler, 4-43 A22 test port 2 coupler, 4-43 A23 test port 3 coupler, 4-43 A24 test port 4 coupler, 4-43 A25 source step attenuator, 4-44, 4-45 A26 source step attenuator, 4-45 A29 reference channel switch, 4 - 47A3 front panel interface board, 4 - 12A4 power supply assembly, 4-7 A5 SPAM board, 4-46 A6 multiplier board all bands, 4-38 A7 fractional-N synthesizer board band 4, 4-36 bands 0-3, 4-36 bands 5-17, 4-37 A8 multiplier board all bands, 4-39 A9 fractional-N synthesizer board band 4, 4-38 bands 0-3, 4-38

bands 5-17, 4-39 all bands, 4-39, 4-41 all traces, 4-28 band 4, 4-36, 4-38, 4-40 bands 0-3, 4-36, 4-38, 4-40 bands 5-17, 4-37, 4-39, 4-41 channel A, 4-25, 4-42 channel B, 4-25, 4-42 channel C, 4-25, 4-42 channel D, 4-25, 4-42 channel R, 4-25 check the basics. 4-4 error term failure suspect devices, 8-3 fans, 4-11 front panel, 4-12 front panel keypad, 4-12 front panel knob, 4-12 front-panel USB, 4-12 GPIB port, 4-18 LAN, 4-19 measurement system, 4-23 receiver group, 4-46 running the receiver display, 4 - 25signal separation group, 4-42 source group, 4-29, 4-34 traces A, B, C, D, R, 4-25 where to begin, 4-27 order of removal of boards, 4-9 PARALLEL port, 4-18 ping command, 4-19 power output of channel A, 4-42 power output of channel B, 4-42 power output of channel C, 4-42 power output of channel D, 4-42 power up, 4-6 power supply check, 4-7 rear panel, 4-17 rear-panel USB, 4-17 receiver outputs, 4-46 RPG, 4-12 RS-232 port, 4-18 SERIAL port, 4-18 source group single vs. broadband, 4-34 speaker, 4-12 trace A, 4-25 trace B, 4-25 trace C, 4-25 trace D. 4-25 trace R, 4-25 typical power output Port 1, 4-42 Port 2, 4-42 Port 3, 4-42 Port 4, 4-42

using controllers to system troubleshoot, 4-19 using error terms, 8-3 using the extender board, 4-8 VGA port, 4-18 where to begin, 4-4

U

uncertainty measurement, 3-20 upgrade 20 GHz frequency range, Option F20, 2-5 configurable test set, Option 014, 2-4 extended power range, Option 1E1, 2-5 firmware downloading from the internet, 8-18 frequency offset mode, Option 080, 2-4 how to order, 2-3, 2-6 second source, Option S02, 2-5 source attenuator, Option 1E1, 2-5 time domain, Option 010, 2-4 upgrade kits part numbers, 6-49 upgrades analyzer, 2-6 USB accessories CD-RW drive, 2-6 hub, 2-6 part numbers, 6-49 port front panel connector, 5-27 rear panel connector, 5-29 rear panel troubleshooting, 4-17 **USB** board troubleshooting, 4-12 USB connector board removal and replacement illustrated, 7-11 procedure, 7-12 **USB** hub operation, 5-29 utility option enable accessing, 8-14 dialog box, 8-14

V

VCO (voltage-controlled oscillator) defined, 5-6 ventilation requirements, 1-3 verification ANSI/NCSL Z540-1-1994, 3-8 kits, 2-8, 3-7 substitution, 3-23 non-ANSI/NCSL Z540-1-1994, 3-9of operating environment, 3-4 of operating specifications, 3-4 system, 3-1, 3-7, 3-19 dialog box, 3-23 example of results, 3-26, 3-27 failure flowchart, 3-25 failure of, 3-25 getting ready, 3-4 interpreting results, 3-26 performing, 3-22 procedure, 3-23 what it verifies, 3-19 vertical motherboard illustration, 6-16, 6-17 part number, 6-16 removal and replacement, 7-18 VGA port rear panel connector, 5-29 troubleshooting, 4-18

W

warm up analyzer, 3-4 warning, 1-3 warnings for servicing, 1-4 warranty service standard, 2-10 three-year return to Agilent, 2-10 Windows, 2-7

Index