

**Agilent
U1241A and U1242A
Handheld Digital
Multimeters**

User's and Service Guide



Agilent Technologies

Notices

© Agilent Technologies, Inc. 2007-2009

No part of this manual may be reproduced in any form or by any means (including electronic storage and retrieval or translation into a foreign language) without prior agreement and written consent from Agilent Technologies, Inc. as governed by United States and international copyright laws.

Manual Part Number

U1241-90003

Edition

Second Edition, April 01, 2009

Printed in Malaysia

Agilent Technologies, Inc.
3501 Stevens Creek Blvd.
Santa Clara, CA 95052 USA

Warranty

The material contained in this document is provided “as is,” and is subject to being changed, without notice, in future editions. Further, to the maximum extent permitted by applicable law, Agilent disclaims all warranties, either express or implied, with regard to this manual and any information contained herein, including but not limited to the implied warranties of merchantability and fitness for a particular purpose. Agilent shall not be liable for errors or for incidental or consequential damages in connection with the furnishing, use, or performance of this document or of any information contained herein. Should Agilent and the user have a separate written agreement with warranty terms covering the material in this document that conflict with these terms, the warranty terms in the separate agreement shall control.

Technology Licenses

The hardware and/or software described in this document are furnished under a license and may be used or copied only in accordance with the terms of such license.

Restricted Rights Legend

U.S. Government Restricted Rights. Software and technical data rights granted to the federal government include only those rights customarily provided to end user customers. Agilent provides this customary commercial license in Software and technical data pursuant to FAR 12.211 (Technical Data) and 12.212 (Computer Software) and, for the Department of Defense, DFARS 252.227-7015 (Technical Data - Commercial Items) and DFARS 227.7202-3 (Rights in Commercial Computer Software or Computer Software Documentation).

Safety Notices

CAUTION









 



 



A **CAUTION** notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in damage to the product or loss of important data. Do not proceed beyond a **CAUTION** notice until the indicated conditions are fully understood and met.

WARNING






A **WARNING** notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in personal injury or death. Do not proceed beyond a **WARNING** notice until the indicated conditions are fully understood and met.

Safety Symbols

The following symbols on the instrument and in the documentation indicate precautions which must be taken to maintain safe operation of the instrument.

| | | | |
|---|---|---|---|
|  | Direct current (DC) |  | Off (supply) |
|  | Alternating current (AC) |  | On (supply) |
|  | Both direct and alternating current |  | Caution, risk of electric shock. |
|  | Three-phase alternating current |  | Caution, risk of danger (refer to this manual for specific Warning or Caution information). |
|  | Earth (ground) terminal |  | Caution, hot surface. |
|  | Protective conductor terminal |  | Out position of a bi-stable push control. |
|  | Frame or chassis terminal |  | In position of a bi-stable push control. |
|  | Equipotentiality | CAT III 1000 V | Category III 1000 V Overvoltage Protection |
|  | Equipment protected throughout by double insulation or reinforced insulation. | CAT IV 600 V | Category IV 600 V Overvoltage Protection |

Regulatory Markings

| | | | |
|---|---|---|---|
|  | <p>The CE mark is a registered trademark of the European Community. This CE mark shows that the product complies with all the relevant European Legal Directives.</p> |  | <p>The C-tick mark is a registered trademark of the Spectrum Management Agency of Australia. This signifies compliance with the Australia EMC Framework regulations under the terms of the Radio Communication Act of 1992.</p> |
| <p>ICES/NMB-001</p> | <p>ICES/NMB-001 indicates that this ISM device complies with Canadian ICES-001.</p> |  | <p>The UL mark is a registered trademark of Underwriters Laboratories Inc.</p> |
|  | <p>The CSA mark is a registered trademark of the Canadian Standards Association.</p> |  | <p>This instrument complies with the WEEE Directive (2002/96/EC) marking requirement. This affixed product label indicates that you must not discard this electrical/electronic product in domestic household waste.</p> |

Waste Electrical and Electronic Equipment (WEEE) Directive 2002/96/EC



This instrument complies with the WEEE Directive (2002/96/EC) marking requirement. This affixed product label indicates that you must not discard this electrical/electronic product in domestic household waste.

Product Category:

With reference to the equipment types in the WEEE directive Annex 1, this instrument is classified as a "Monitoring and Control Instrument" product. The affixed product label is shown as below:

Do not dispose in domestic household waste

To return this unwanted instrument, contact your nearest Agilent office, or visit:


www.agilent.com/environment/product

for more information.

General Safety Information

The following general safety precautions must be observed during all phases of operation, service and repair of this instrument. Failure to comply with these precautions or with specific warnings elsewhere in this manual violates safety standards of design, manufacture and intended use of the instrument. Agilent Technologies assumes no liability for the customer's failure to comply with these requirements.

WARNING

- **Observe all markings on the instrument before connecting any wiring to the instrument.**
 - **When working above 60 VDC, 30 VAC RMS or 42 V peak, exercise caution – such range pose a shock hazard.**
 - **Do not measure more than the rated voltage (as marked on the meter) between terminals, or between terminal and earth ground.**
 - **Double-check the meter's operation by measuring a known voltage.**
 - **For current measurement, turn off circuit power before connecting the meter to the circuit. Always place the meter in series with the circuit.**
 - **When connecting probes, always connect the common test probe first. When disconnecting probes, always disconnect the live test probe first.**
 - **Detach test probes from the meter before you open the battery cover.**
 - **Do not use the meter with the battery cover or part of the cover removed or loose.**
 - **Replace the battery as soon as the low battery indicator  flashes on screen. This is to avoid false readings, which may lead to possible electric shock or personal injury.**
 - **Do not operate the product in an explosive atmosphere or in the presence of flammable gases or fumes.**
 - **Inspect the case for cracks or missing plastic. Pay extra attention to the insulation surrounding the connectors. Do not use the meter if it is damaged.**
 - **Inspect the test probes for damaged insulation or exposed metal, and check for continuity. Do not use the test probe if it is damaged.**
-

WARNING

- **Do not use repaired fuses or short-circuited fuse-holders. For continued protection against fire, replace the line fuses only with fuses of the same voltage and current rating and recommended type.**
 - **Do not service or perform adjustments alone. Under certain condition, hazardous voltages may exist, even with the equipment switched off. To avoid dangerous electric shock, service personnel must not attempt internal service or adjustment unless another person, capable of rendering resuscitation or first aid, is present.**
 - **Do not substitute parts or modify equipment to avoid the danger of introducing additional hazards. Return the product to Agilent Technologies Sales and Service Office for service and repair to ensure the safety features are maintained**
 - **Do not operate damaged equipment as the safety protection features built into this product may have been impaired, either through physical damage, excessive moisture, or any other reason. Remove power and do not use the product until safe operation can be verified by service-trained personnel. If necessary, return the product to Agilent Technologies Sales and Service Office for service and repair to ensure the safety features are maintained.**
-

CAUTION

- Turn off circuit power and discharge all high-voltage capacitors in the circuit before you perform resistance, continuity, diodes, or capacitance tests.
 - Use the correct terminals, function, and range for your measurements.
 - Never measure voltage when current measurement is selected.
 - Ensure proper insertion of battery in the meter, and follow the correct polarity.
-

Environment Conditions

This instrument is designed for indoor in the area with low condensation and use with standard or compatible test probes. Table 1 shows general environment requirements.



Table 1 Environment Requirements

| Environment Conditions | Requirements |
|-------------------------------|--|
| Operating environment | Full accuracy at –10 °C to 55 °C |
| Operating relative humidity | Full accuracy up to 80% RH for temperature up to 30 °C, decreasing linearly to 50% RH at 55 °C |
| Storage environment | –20 °C to 70 °C |
| Altitude | 0 – 2000 meters per IEC 61010-1 2 nd Edition CAT III, 1000 V/ CAT IV, 600 V |
| Pollution Degree | Pollution Degree II |

CAUTION

The Agilent U1241A and U1242A are safety-certified in compliance with the following safety and EMC requirements:

- IEC 61010-1:2001 / EN61010-1:2001
- USA: UL 61010-1:2004
- Canada: CSA C22.2 No. 61010-1:2004
- IEC 61326-1:2005/ EN 61326-1:2006
- Canada: ICES-001:2004
- Australia/New Zealand: AS/NZS CISPR11:2004

| | | |
|---|--|---|
|  Agilent Technologies | DECLARATION OF CONFORMITY According to EN ISO/IEC 17050-1:2004 |  |
|---|--|---|

Manufacturer's Name: Agilent Technologies Microwave Products (M) Sdn Bhd
Manufacturer's Address: Bayan Lepas Free Industrial Zone
 11900 Penang, Malaysia

Declares under sole responsibility that the product as originally delivered:

Product Name: Handheld Digital Multimeter
Model Number: U1241A, U1242A
Product Option: This declaration covers all options of the above product(s)

complies with the essential requirements of the following applicable European Directives, and carries the CE marking accordingly:

Low Voltage Directive (2006/95/EC)
 EMC Directive (2004/108/EC)

and conforms with the following standards:


| EMC | Standards | Limit |
|---------------|---|---|
| | IEC61326-1:2005 / EN61326-1:2006 | |
| | <ul style="list-style-type: none"> ▪ CISPR 11:2003 / EN 55011:2007 ▪ IEC 61000-4-2:2001 / EN 61000-4-2:1995+A1:1998+A2:2001 ▪ IEC 61000-4-3:2002 / EN 61000-4-3:2002 | Group 1 Class A 4 kV CD, 8 kV AD 3 V/m (80 MHz-1.0 GHz) 3 V/m (1.4 GHz-2.0 GHz) 1 V/m (2.0 GHz-2.7 GHz) |
| | Canada: ICES/NMB-001:2004 Australia/New Zealand: AS/NZS CISPR 11:2004 | |
| Safety | IEC 61010-1:2001 / EN 61010-1:2001 CAN/CSA-C22.2 No.61010-1-04 ANSI/UL61010-1:2004 | |

Additional Information:

The product was tested in a typical configuration with Agilent Technologies test systems.

U1241A and U1242A are powered with 4 x 1.5Vdc battery only.
 Below power line tests are not applicable to U1241A and U1242A Handheld Multimeter:
 CISPR 11:2003 / EN 55011:2007 [Conducted emission] Class A Group 1
 IEC 61000-4-4:2004 / EN 61000-4-4:2004 0.5 kV signal lines, 1 kV power lines
 IEC 61000-4-5:2001 / EN 61000-4-5:1995:A1:2001 0.5 kV line-line, 1 kV line-ground
 IEC 61000-4-6:2003 / EN 61000-4-6:2007 3 V, 0.15-80 MHz
 IEC 61000-4-11:2004 / EN 61000-4-11:2004 100% Dip (0.5 cycle, 1 cycle), 60% Dip (10 cycles), 30% Dip (25 cycles)
 100% short interruptions (250 cycles)

This DoC applies to above-listed products placed on the EU market after:

| | |
|---|---|
| <p>30-Jan-09 _____ Date</p> |  _____ Tay Eng Su Quality Manager |
|---|---|

For further information, please contact your local Agilent Technologies sales office, agent or distributor, or Agilent Technologies Deutschland GmbH, Herrenberger Straße 130, 71034 Böblingen, Germany.

Product Regulations

EMC Standards

IEC61326-1:2005 / EN61326-1:2006

- CISPR 11:2003 / EN 55011:2007
- IEC 61000-4-2:2001 / EN 61000-4-2:1995+A1:1998+A2:2001
- IEC 61000-4-3:2002 / EN 61000-4-3:2002

Performance Criteria

Group 1 Class A

A

A

Performance Criteria:

A Pass - Normal operation, no effect.

B Pass - Temporary degradation, self recoverable.

C Pass - Temporary degradation, operator intervention required.

D Fail - Not recoverable, component damage.

N/A – Not applicable

Notes:

Regulatory Information for Canada

ICES/NMB-001:2004

This ISM device complies with Canadian ICES-001.

Cet appareil ISM est conforme à la norme NMB-001 du Canada.

Regulatory Information for Australia/New Zealand

This ISM device complies with Australian/New Zealand AS/NZS CISPR11:2004

 N10149

In This Guide...

- 1 Getting Started** Chapter 1 introduces key features and steps to get started with a U1241A or U1242A handheld digital multimeter. This chapter also guides you through the basics of the front panel operations.
- 2 Features and Functions** Chapter 2 contains the information on how to set up connections to perform meter measurements. It also describes the features and functions that are available in the U1241A and U1242A handheld digital multimeters in step-by-step instructions.
- 3 Default Setting Configurations** Chapter 3 describes on how to change and configure the default setting of the U1241A and U1242A handheld digital multimeters including data logging and other setting features
- 4 Service and Maintenance** Chapter 4 provides the information on the warranty, services, maintenance procedures and troubleshooting hints to solve general problems that you may encounter with the meter.
- 5 Performance Tests and Calibration** Chapter 5 contains the procedures of the performance verification tests and calibration adjustments.
- 6 Specifications and Characteristics** Chapter 6 lists the specifications and characteristics of the U1241A and U1242A handheld digital multimeters.

Contents

| | | |
|----------|---|----------|
| 1 | Getting Started | 1 |
| | Introduction | 2 |
| | Checking the Shipping Contents | 3 |
| | The Front Panel at a Glance | 4 |
| | Adjusting Tilt Stand | 4 |
| | The Annunciator at a Glance | 5 |
| | Analog Bar Graph | 6 |
| | The Keypad and Rotary Switch at a Glance | 6 |
| | The Input Terminal at a Glance | 8 |
| | | |
| 2 | Features and Functions | 9 |
| | Measuring Voltage | 10 |
| | Measuring Current (> 440 mA) | 10 |
| | Measuring Current (< 440 mA) | 11 |
| | Measuring % Scale of 4 – 20 mA | 11 |
| | Measuring Frequency | 12 |
| | Measuring Resistance and Testing Continuity | 12 |
| | Testing Diodes | 13 |
| | Measuring Capacitance | 14 |
| | Measuring Temperature | 14 |
| | Measuring Harmonic Ratio (U1242A) | 16 |
| | Using Switch Counter | 16 |
| | MINMAX Recording | 18 |
| | Data Hold (Trigger Hold) | 18 |
| | Refresh Hold | 19 |
| | NULL (Relative) | 19 |
| | Data Logging (U1242A) | 20 |
| | Scanning Temperature Measurement (U1242A) | 23 |
| | Checking Battery Capacity | 23 |
| | Alerts and Warning During Measurement | 24 |

| | | |
|----------|--|-----------|
| 3 | Default Setting Configurations | 25 |
| | Setting Configurations | 26 |
| 4 | Service and Maintenance | 29 |
| | General Maintenance | 30 |
| | Battery Replacement | 30 |
| | Fuse Replacement | 31 |
| | Troubleshooting | 33 |
| | Returning Instrument for Service | 34 |
| 6 | Performance Tests and Calibration | 35 |
| | Calibration Overview | 36 |
| | Closed-case Electronic Calibration | 36 |
| | Calibration Interval | 36 |
| | Adjustment is Recommended | 37 |
| | Recommended Test Equipment | 38 |
| | Basic Operating Test | 39 |
| | Backlight Test | 39 |
| | Testing the Display | 39 |
| | Input-A Terminal Test | 40 |
| | Input-mA Terminal Alert Test | 40 |
| | Calibration Process | 40 |
| | Test Considerations | 41 |
| | Input Connections | 42 |
| | Performance Verification Tests | 42 |
| | Calibration Security | 46 |
| | Using the Front Panel for Adjustments | 48 |
| | Adjustment Considerations | 49 |
| | Valid Adjustment Input Values | 50 |
| | Calibration Adjustments | 51 |
| | Exiting Adjustment Mode | 55 |
| | Calibration Count | 56 |
| | Calibration Errors | 56 |

| | | |
|----------|--|-----------|
| 6 | Specifications and Characteristics | 57 |
| | DC Specifications | 58 |
| | AC Specifications | 59 |
| | Resistance Specifications | 60 |
| | Diode Check/Audible Continuity Test Specifications | 60 |
| | Temperature Specifications | 61 |
| | Capacitance Specifications | 62 |
| | Harmonic Ratio Specifications | 62 |
| | Frequency Specifications | 63 |
| | Operating Specifications | 64 |
| | General Characteristics | 65 |
| | Index | 67 |

Contents



1 Getting Started

| | |
|--|---|
| Introduction | 2 |
| Checking the Shipping Contents | 3 |
| The Front Panel at a Glance | 4 |
| Adjusting Tilt Stand | 4 |
| The Annunciator at a Glance | 5 |
| The Keypad and Rotary Switch at a Glance | 6 |
| The Input Terminal at a Glance | 8 |

This chapter introduces key features and steps to get started with a U1241A or U1242A handheld digital multimeter. This chapter also guides you through the basics of the front panel operations.



Introduction

The handheld digital multimeters' key features are:

- DC, AC voltage and current measurements.
- True-RMS measurement for both AC voltage and current
- Harmonic ratio for power quality of sine wave (for U1242A)
- Switch counter for detecting the bounce of switch
- Ambient temperature display with each measurement
- SCAN temperature measurement for T1, T2 and T1-T2 (for U1242A)
- Resistance measurement up to 100 M Ω
- Diode and audible continuity tests
- Capacitance measurement up to 10mF
- The % scale readout for 4–20 mA or 0–20 mA measurement
- Temperature test with selectable 0 °C compensation (without ambient temperature compensation).
- K- type (for U1241A) and J/K- types temperature measurement (for U1242A)
- MINMAX Recording for minimum, maximum and average readings
- Data Hold with manual or auto trigger
- Null/Relative function
- Auto or manual data logging memories (for U1242A)
- Battery capacity indicator
- Adjustable brightness level of blue LED backlight display
- Closed case calibration
- 10,000 count precision true RMS digital multimeter, designed to meet EN/IEC 61010- 1:2001 Category III 1000 V/ Category IV 600 V Overvoltage Protection, Pollution Degree II standards

Checking the Shipping Contents

Verify that you have received the following items for the standard shipped items or optional accessories that you may have ordered. If any of the above item missing, or any mechanical damage and defect on the meter, notify your nearest Agilent Technologies Sales Office.

Table 1-1 List of standard items and optional accessories

| Type | Model ID | Items |
|----------|----------|--|
| Standard | | U1241A or U1242A handheld digital multimeter |
| | | Four 1.5 V AAA alkaline batteries |
| | | Test Leads |
| | | Quick Start Guide |
| | | Product Reference CD |
| | | Certificate of Calibration |
| Optional | U1162A | Alligator clips |
| | U1163A | SMT Grabbers |
| | U1164A | Fine tip test probe |
| | U1181A | Immersion probe type-K |
| | U1182A | Industrial surface probe |
| | U1183A | Air probe |
| | U1184A | Temperature probe adapter |
| | U1185A | Thermocouple (J-type) probe and adapter |
| | U1186A | Thermocouple (K-type) probe and adapter |
| | U1583A | AC current clamp |

The Front Panel at a Glance


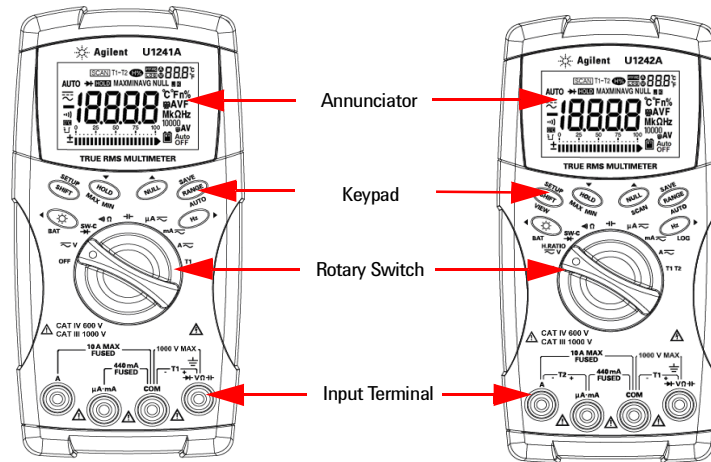


Figure 1-1 Front panel of a U1241A and U1242A handheld digital multimeters


Adjusting Tilt Stand

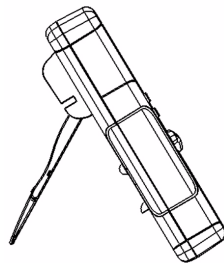Tilt stand at 60°



Pull the tilt stand outwards to its maximum reach (approximately 60°)

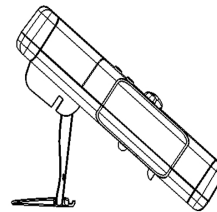Tilt stand at 30°



Bend the tip of the stand

Figure 1-2 Tilt stand positions

The Annunciator at a Glance

To view the full display, press and hold **HOLD** while turning the rotary switch from OFF to any non- OFF position. Press any key to resume normal functionality mode.

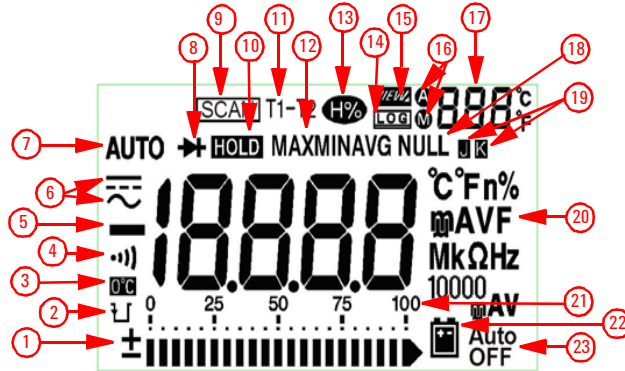


Figure 1-3 Annunciator display of a U1242A handheld digital multimeter

Table 1-2 Descriptions of each annunciator



| No. | Descriptions | No. | Descriptions |
|-----|---|-----|---|
| 1 | 21-segment analog bar graph display | 12 | MINMAX Recording mode |
| 2 | Capacitor discharge indicator | 13 | Harmonic Ratio mode (for U1242A) |
| 3 | Cold junction of ambient temperature disabled | 14 | Data logging mode (for U1242A) |
| 4 | Audible continuity for resistance and diode function | 15 | Data logging View mode (for U1242A) |
| 5 | Primary display -18888 | 16 | Auto or manual for data logging mode and datalog viewing mode |
| 6 | AC or DC measurement mode | 17 | Secondary display (temperature display) |
| 7 | Auto range | 18 | Null math function |
| 8 | Diode / Audible continuity | 19 | Thermocouple type for temperature measurement |
| 9 | T1, T2 and T1 – T2 temperature measurements scan (for U1242A) | 20 | Primary measurement units |
| | | 21 | Measurement range |
| 10 | Data hold | 22 | Low battery indicator |
| 11 | T1, T2* or T1 – T2* temperature measurements | 23 | Auto power off indicator |

*T2 temperature measurement and delta (T1 – T2) are only available for U1242A.

Analog Bar Graph

When frequency is indicated on the primary display during voltage or current measurement, the bar graph represents the voltage or current value. When 4–20 mA% scale or 0–20 mA% scale is indicated on the primary display, the bar graph represents the current value. Each segment represents 500 or 50 counts depending on the range indicated on the peak bar graph.

Table 1-3 Bar graph counts

| Range | Counts / Segment | Function |
|---|------------------|-------------|
|  | 50 | Diode |
|  | 500 | V, A, Ω, Hz |

The Keypad and Rotary Switch at a Glance

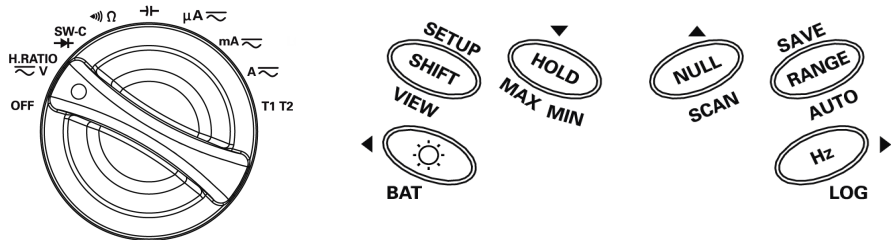


Figure 1-4 Keypad and rotary switch of a U1242A handheld digital multimeter

Table 1-4 Keypad descriptions and functions




 
 











 
 
| Function | First level functions | Range | Second level functions (press ) | Range |
|---|-------------------------|--------------------------------|---|----------------------|
| OFF | Turn off the meter | | | |
|  | DCV measurement | 0.1 mV to 1000 V | ACV measurement | 0.1 mV to 1000 V |
| | | | Harmonic ratio (for U1242A only) | 0.0% to 99.9% |
|  | Diode measurement | | Switch counter measurement | |
|  | Resistance measurement | 0.1 Ω to 100 M Ω | Audible continuity measurement | |
|  | Capacitance measurement | 0.1 nF to 10 mF | | |
|  | DC μ A | 0.1 μ A to 10 mA | AC μ A measurement | 0.1 μ A to 10 mA |
|  | DCmA | 0.01 mA to 440 mA | ACmA measurement | 0.01 mA to 440 mA |
| | | | mA% scale | |
|  | DCA | 0.001 A to 10 A | ACA measurement | 0.001 A to 10 A |
| T1 | T1 temperature | -40 °C to 1000 °C | T2 and T1–T2 temperature measurements (for U1242A) | -40 °C to 1000 °C |

Table 1-5 Features that can be accessed through front panel keypad

| Actions | Steps |
|--|---|
| Turns ON backlight | Press  |
| Checks battery capacity | Press and hold  for > 1 second |
| Freezes the measured value | Press  |
| Starts MIN/MAX/AVG recording | Press and hold  for > 1 second |
| Offsets the measured value | Press  |
| Scans the measured temperature (for U1242A only) | Press and hold  for > 1 second |
| Changes the measuring range | Press  |
| Turns on auto range | Press and hold  for > 1 second |
| Measures frequency for AC signal | Press  |
| Starts manual data logging | Press and hold  for > 1 second |

NOTE

Please use manual ranging to measure AC signal with a DC offset.

The Input Terminal at a Glance

WARNING

To avoid damaging this device, do not exceed the input limit.

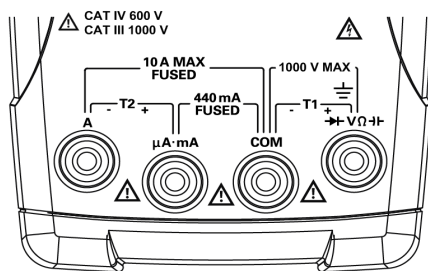


Figure 1-5 Input terminal of a U1242A handheld digital multimeter

Table 1-6 Terminal connections for different measuring functions

| Measurement Functions | Input terminal | | Overload Protection |
|-------------------------------|----------------|-----|--------------------------------------|
| Voltage | | COM | 1000 V R.M.S. |
| Diode | | | 1000 V R.M.S |
| Resistance | | | < 0.3 A short circuit current |
| Capacitance | | | |
| μA & mA | μA mA | COM | 440 mA/1000 V 30 kA/fast-acting fuse |
| A | A | COM | 11 A/1000 V 30 kA/fast-acting fuse |
| Temperature | +T1 | -T1 | 1000 V R.M.S. |
| Temperature (for U1242A only) | +T2 | -T2 | 440 mA/1000 V 30 kA/fast-acting fuse |



Features and Functions

| | |
|---|----|
| Measuring Voltage | 10 |
| Measuring Current (> 440 mA) | 10 |
| Measuring Current (< 440 mA) | 11 |
| Measuring % Scale of 4 – 20 mA | 11 |
| Measuring Frequency | 12 |
| Measuring Resistance and Testing Continuity | 12 |
| Testing Diodes | 13 |
| Measuring Capacitance | 14 |
| Measuring Temperature | 14 |
| Measuring Harmonic Ratio (U1242A) | 16 |
| Using Switch Counter | 16 |
| MINMAX Recording | 18 |
| Data Hold (Trigger Hold) | 18 |
| Refresh Hold | 19 |
| NULL (Relative) | 19 |
| Data Logging (U1242A) | 20 |
| Scanning Temperature Measurement (U1242A) | 23 |
| Checking Battery Capacity | 23 |
| Alerts and Warning During Measurement | 24 |

This chapter contains the detail information on how to configure connections to perform the meter measurements using the U1241A and U1242A handheld digital multimeters. It builds on information you learned in the Quick Start Guide.

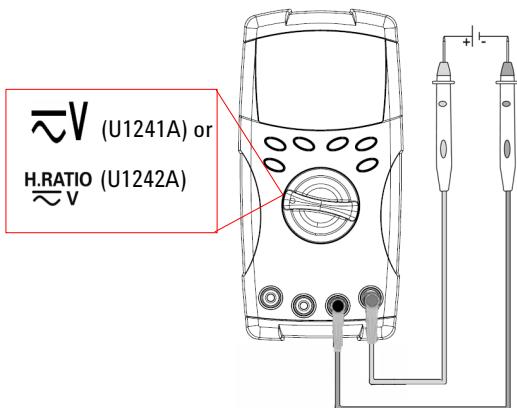


Measuring Voltage


WARNING

Ensure that terminal connections are correct for that particular measurement before any measurement. To avoid damaging the device, do not exceed the input limit.

Measuring DC Voltage




Measuring AC Voltage

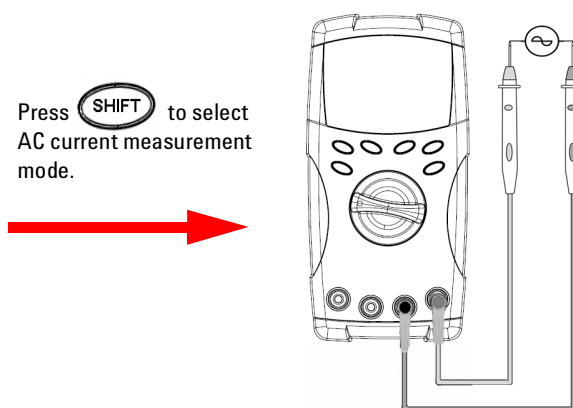


Measuring Current (> 440 mA)

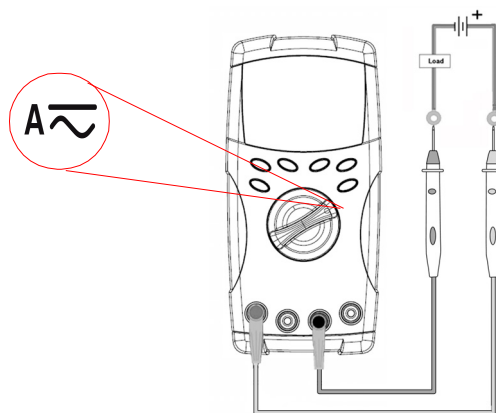Measuring DC current




Measuring AC current

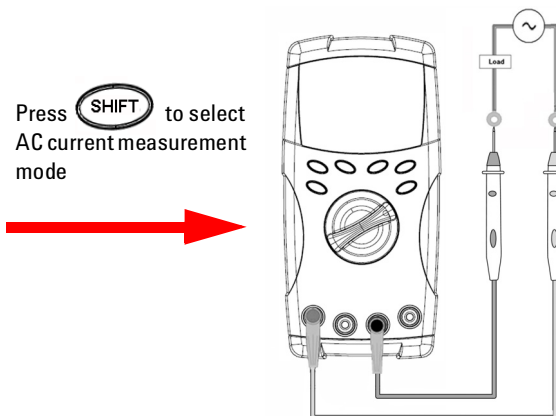


Measuring Current (< 440 mA)

NOTE

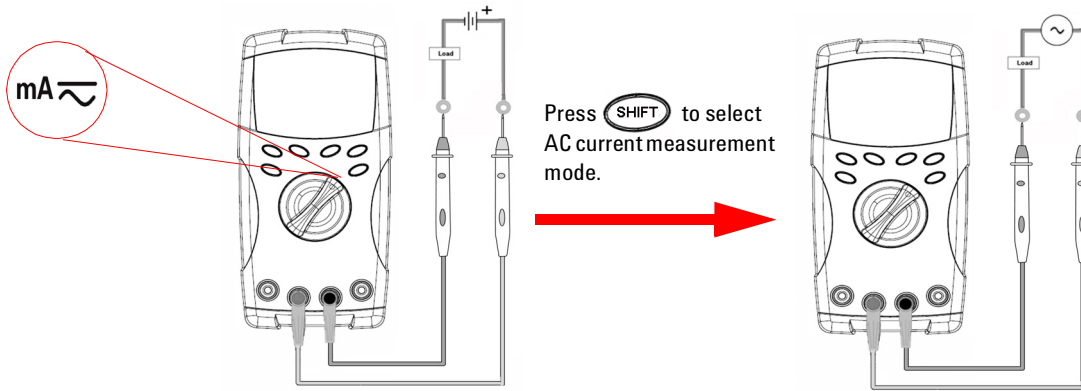If the measured value is lower than 440 mA, use the mA or μ A current measurement mode.




Measuring % Scale of 4 – 20 mA

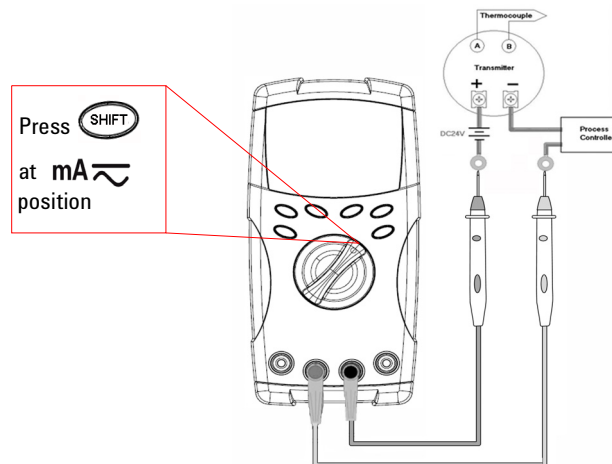

The % scale of 0 – 20 mA or 4 – 20 mA is selectable in setup mode. The mA% scale for 4-20 or 0-20 is indicated on primary display and the bar graph indicates the current value. The 25% scale readout represents DC 8 mA at 4 – 20mA, and DC 5 mA at 0 – 20mA.

Measuring Frequency

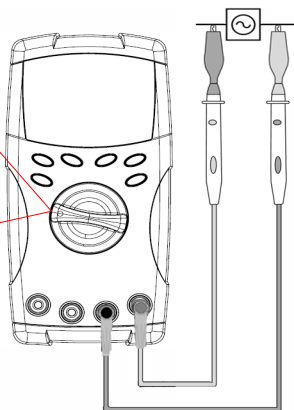Press **Hz** at $\sim V$ (U1241A) or **H.RATIO** $\sim V$ (U1242A) position



The frequency measurement is applicable for DC and AC current measurements.


The bar graph is used to indicate the value of AC voltage. Alternatively, press **RANGE** button to display the value of AC voltage. The meter will return to frequency value display automatically after three seconds.

Measuring Resistance and Testing Continuity

CAUTION


Disconnect circuit power and discharge all high-voltage capacitors before measuring resistance to prevent possible damage to the meter or the device under test.

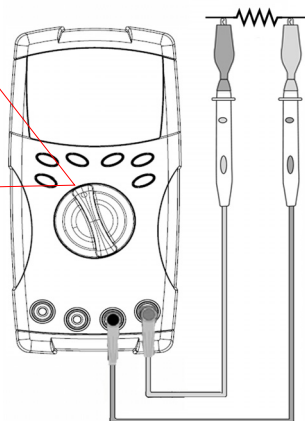Press **SHIFT** at Ω position to enable the continuity test function



| Measurement range | Beeper sounds when |
|-------------------|--------------------|
| 1000.0 Ω | < 10 Ω |
| 10.000 k Ω | < 100 Ω |
| 100.00 k Ω | < 1 k Ω |
| 1.0000 M Ω | < 10 k Ω |
| 10.000 M Ω | < 100 k Ω |
| 100.00 M Ω | < 1 M Ω |

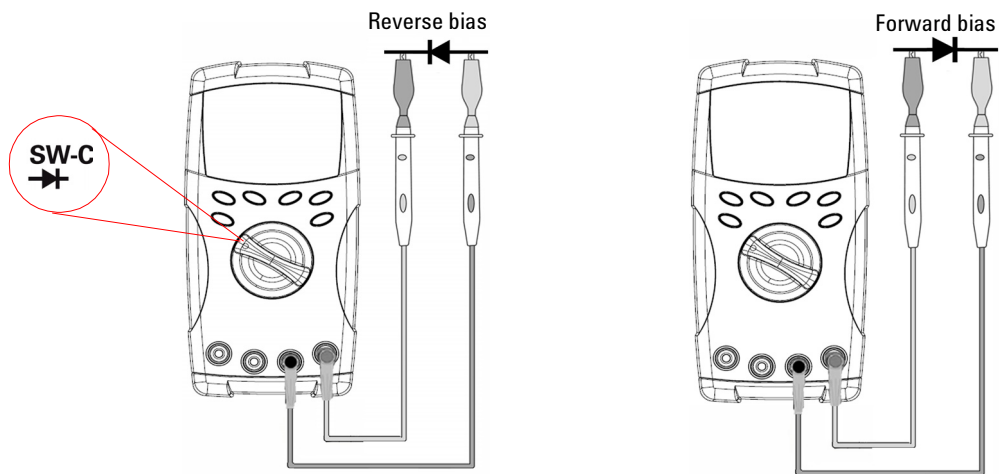
NOTE

Press  button to select measurement range from 1 k Ω to 100 M Ω .

Testing Diodes

CAUTION

Disconnect circuit power and discharge all high-voltage capacitors before testing diodes to prevent possible damage to the meter.


**NOTE**

The meter can display diode forward bias of up to approximately 1.1 V. Typical diode forward bias is between the range of 0.3 to 0.8 V range with audible beeper sound.

Measuring Capacitance

CAUTION

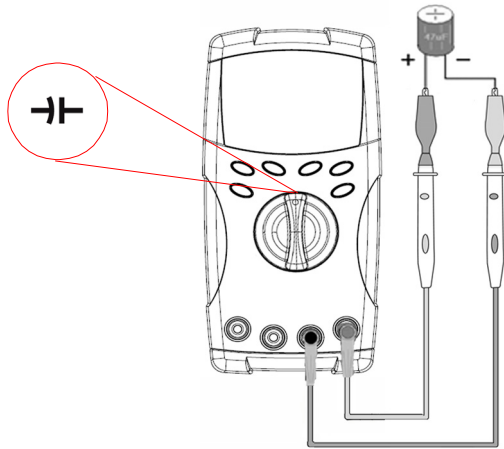Disconnect circuit power and discharge all high-voltage capacitors before measuring capacitance to prevent possible damage to the meter or the device under test. To confirm that capacitors have discharged, use the DC voltage function.




Measuring tips:

- For measuring capacitances greater than 10,000 μF , discharge the capacitor and manually select a suitable measurement range. This will speed up measuring time in order to obtain the correct capacitance value.
- Ensure the correct polarity when measuring polarized capacitors.
- For measuring small capacitances, press **NULL** with the test leads open to subtract the residual capacitance of the meter and leads.

Measuring Temperature

CAUTION

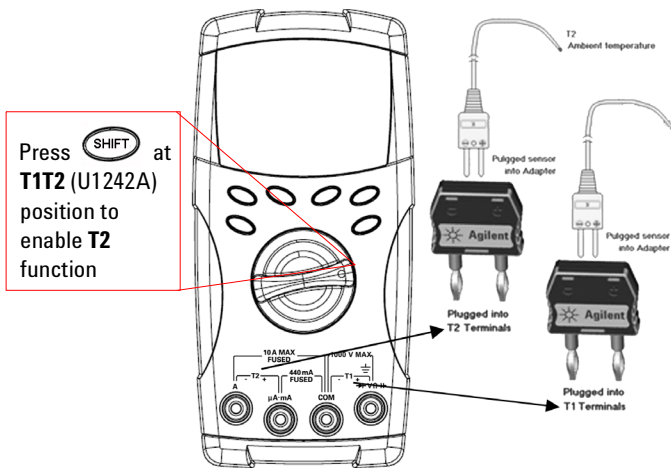- Do not bend the thermocouple leads at sharp angles. Repeated bending over a period of time can break leads.
- Do not contact the temperature sensor to any surface that is energized voltage or current sources, such the voltage source will pose a shock hazard.



Measuring tips:

- Clean the measurement surface and remember to disable the applied power.
- When measuring temperature, move the thermocouple along the surface until you get the highest/lowest temperature reading.
- For quick measurement, use the 0 °C compensation to see the temperature variation of the thermocouple sensor. The 0 °C compensation assists you in measuring relative temperature.

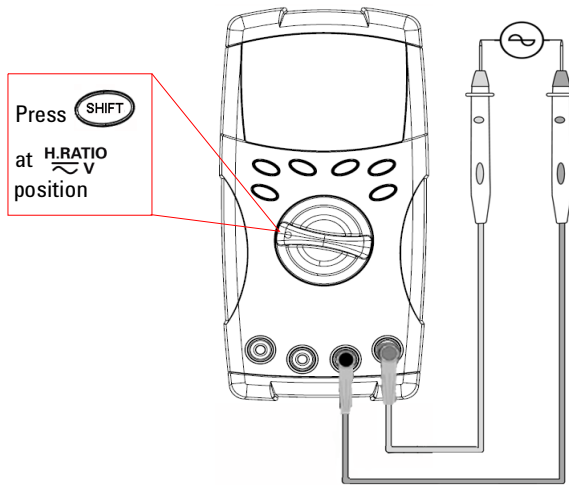
If you are working in a varied environment, where ambient temperature is not constant, do the following:

- 1 Press **RANGE** for more than one second to enable 0 °C compensation. This function allows a quick measurement of the relative temperature.
- 2 Avoid contact between the thermocouple probe and the measurement surface.
- 3 After a constant reading is obtained, press **NULL** to set the reading as the relative reference temperature.
- 4 Touch the measurement surface with the thermocouple probe.
- 5 Read the display for the relative temperature.

NOTE

The T2 temperature measurement is only available for U1242A.


Measuring Harmonic Ratio (U1242A)



Harmonics ratio function indicates the deviation of non-sinusoidal to sinusoidal waveform from the range of 0% to 100%. A pure sinusoidal waveform without harmonics gives a value of 0.0%.

Alternatively, press **RANGE** button to display the RMS value of AC voltage. The meter will resume back to harmonic ratio value display automatically after 3 seconds.

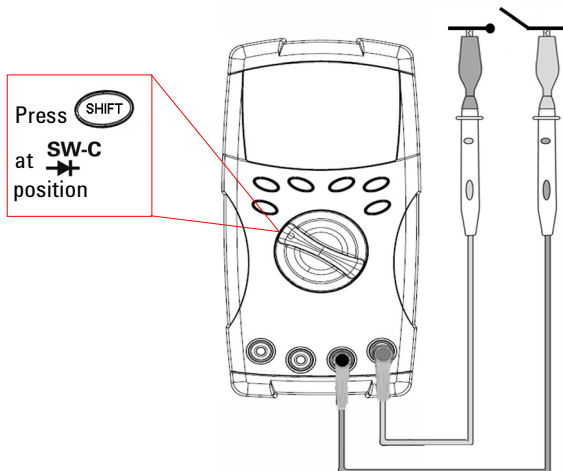Using Switch Counter



The switch counter is used to check the open/close condition of a switch, relay or push button. The meter provides the time base of 10 and 100 seconds, or user-defined time base.

This function detects switch condition in normally close (Low level) or normally open (High level) of a circuit with voltage less than 3 V. The switch counter counts the intermittent for longer than 250 μ sec.




- 1 Remove the power on the contacts or switch before measured.
- 2 Press **SHIFT** at **SW-C** position to activate the switch counter function.
The meter will detect the switch condition as shown in [Table 2- 7](#).

Table 2-7 Annunciator display for each switch condition

| Switch Condition | Circuit Switch | Display |
|-----------------------------|----------------|------------------------|
| Low Level (< 430 Ω) | Normally close | Lo |
| Intermittent | Close to open | Number of switch count |
| Intermittent | Open to close | Number of switch count |
| High level | Normally open | Hi |

- 3 Press **NULL** to restart the switch counter, the meter will check the current switch condition and set intermittent recognition for the counter.
- 4 Press **RANGE** to select time base in 10 seconds, 100 seconds or Hand (user- defined). The second display shows **10**, **100** or **HAn** respectively.
- 5 The first intermittent will cause the meter to beep and starts to down count the time base. Each intermittent will increase the counter once.
- 6 The counter value and time base are indicated on primary display and secondary display respectively. Press **NULL** to start next counting.
- 7 Press **SHIFT** to exit switch counter function.

MINMAX Recording




- 1 Press  for more than one second to enter MINMAX Recording mode. Meter is now in continuous mode or non- data hold (non- trigger) mode.
- 2 The beeper sounds when a new maximum or minimum value is recorded.
- 3 Press  to scroll through maximum, minimum, average and present readings. The **MAX**, **MIN**, **AVG** or **MAXMINAVG** annunciator light up correspondingly to the displayed readings.
- 4 Press  for more than one second to exit MINMAX Recording mode.

NOTE

- The average value is the true average of all measured values taken in the MINMAX Recording mode.
- If an overload is recorded, the averaging function will stop and the average value becomes **OL** (overload).
- The auto power off feature (**Auto OFF**) is disabled in MINMAX Recording mode.



Data Hold (Trigger Hold)

The data hold function allows users to freeze the displayed digital value.

- 1 Press  to freeze the displayed value and to enter manual trigger mode. Notice the **HOLD** annunciator is displayed.
- 2 Press  to trigger the freeze of the next value being measured. The **HOLD** annunciator will flash before the new value is updated onto the display.
- 3 Press  for more than one second to exit this mode.

Refresh Hold

Users are required to activate the Refresh Hold in the setup mode.




- 1 Press  to enter Refresh Hold mode. The present value will be held, and the **HOLD** annunciator is displayed.
- 2 The meter is ready to hold new measuring value once the variation of measuring value exceeds the setting of variation count, and the **HOLD** annunciator is flashed.
- 3 The hold value will be updated until the measuring value is stable. The **HOLD** annunciator will stop flashing and stays lit, an audible tone will sound to remind user.
- 4 Press  again to disable this function.

NOTE

- For voltage, current and capacitance measurements, the holding value will not be updated if the reading is below 50 counts.
- For resistance and diode measurements, the holding value will not be updated if the reading is in “OL” (open state).
- The holding value may not be updated if the reading does not reach stable state for all measurements.


NULL (Relative)

The NULL function subtracts a stored value from the present measurement and displays the difference between the two values.

- 1 Press  to store the displayed reading as the reference value to be subtracted from subsequent measurements and to set the display to zero. The **NULL** annunciator is displayed.
- 2 Press  to view the stored reference value. The **NULL** annunciator will flash for three seconds before the display returns to zero. To exit this mode, press  while **NULL** is flashing on the display.

2 Features and Functions

NOTE

- In resistance measurement, the meter reads a non-zero value due to the presence of test leads resistance. Use the Null function to zero-adjust the effect of test lead resistance.
- In DC voltage measurement, the thermal effect will influence the accuracy. Short the test leads and press  once the displayed value is stable in order to zero out the offset.

Data Logging (U1242A)


 
 
The data logging function stores the data in non-volatile memory. Thereby, the data remains saved when the meter is turned off. Data logging records only the value on primary display. Two options of data logging are offered – Hand (manual) logging and Interval (automatic) logging functions.

Table 2-8 Functions available for data logging

| Function | Mode | Range |
|----------------|--------------------------|---------------------------------|
| Voltage | DC, AC | 1000 mV to 1000 V |
| Current | DC, AC, % of mA | 1000 μ A to 10 A |
| Hz | AC | Auto |
| Harmonic Ratio | AC | Auto |
| Ω | Continuity | 1000 Ω to 100 M Ω |
| Diode | | 1.1 V |
| Switch Counter | | 10, 100, HAn |
| Capacitance | | 1000 nF to 10 mF |
| Temperature | T1, T2, T1 – T2, | |
| Relative | | |
| Recording mode | MAX, MIN, AVG, MAXMINAVG | |
| HOLD | | |

Manual Logging

To enable the Hand (manual) logging function, select the Hand logging mode in Setup mode.

- 1 Press  (Log) for more than one second to store the present value and function on primary display to memory.
- 2 Press  (Log) again for the next value that you want to save into memory, see [Figure 2-6](#).
- 3 Press  (Log) for more than one second to exit this mode.

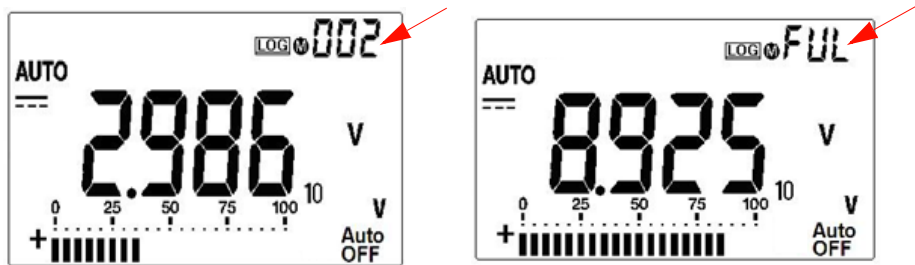



 
Figure 2-6 Manual logging display

NOTE

Maximum data that can be stored is 100 entries. When the 100 entries are filled, **FUL** annunciator is indicated on the secondary display.

Interval Logging

To enable the Interval (automatic) logging function, select the Interval logging by defining the interval setting in Setup mode.

- 1 Press  (Log) for more than one second to store the present value and function on primary display to memory.
- 2 The reading automatically logs into the memory in every interval as preset in Setup mode, see [Figure 2-7](#).
- 3 Press  (Log) for more than one second to exit this mode.

2 Features and Functions

NOTE

When interval (automatic) logging is enabled, all keypad operation is disabled, except for LOG function.

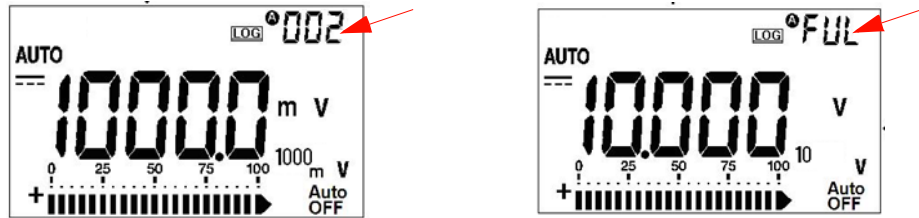


Figure 2-7 Interval logging display

NOTE

Maximum data that can be stored is 200 entries. When the 200 entries are filled, **FUL** annunciator is indicated on the secondary display.

Reviewing Logged Data



- 1 Press **SHIFT** (View) for more than one second to enter Log View mode. The last recorded entry and last logging index are displayed on the secondary display.
- 2 Press **▲** to ascend or **▼** to descend through logged data. Press **◀** to select the first record and press **▶** to select the last record for quick navigation.
- 3 Press **SHIFT** to switch between hand (manual) and interval (automatic) logging review mode.
- 4 Press **SHIFT** (View) for more than one second to exit Log View mode.

Removing Logged Data


Press **Hz** (Log) for more than one second at the respective Log Review mode (hand or interval) to clear all logged data in the memory.

Scanning Temperature Measurement (U1242A)


This scanning temperature measurement function allows users to measure and display temperature T1, T2 and T1- T2 sequentially.

- 1 Press and hold  (SCAN) button for more than one second to enable SCAN mode. Notice the meter will scan through and display the value of T1, T2 and T1- T2 periodically.
- 2 The meter will set to the states for T1, T2 or T1- T2 when you disabled SCAN mode by pressing  (SCAN) for more than one second.

Checking Battery Capacity

The battery sign  will flash when the battery voltage drops below 4.4 V. Once the low battery sign is displayed, it is highly recommended to replace the batteries immediately. See [Battery Replacement](#) in chapter 4.

To check the battery capacity, see the following steps:

- 1 Press  (BAT) for more than one second to view the battery capacity. The meter will resume back to normal function automatically after three seconds.
- 2 The primary display illustrates the flashing **bAt** annunciator and the bar graph indicates the battery capacity in proportional percentage from 4.2 V (0%) to 6.0 V (100%).

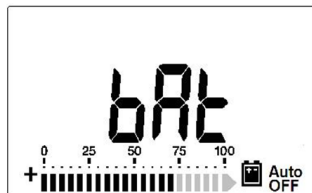


Figure 2-8 Battery capacity display

Alerts and Warning During Measurement

Overload Alert

WARNING

For your safety, please be aware of the alert. When you are alerted, just remove the test leads from the measuring source.

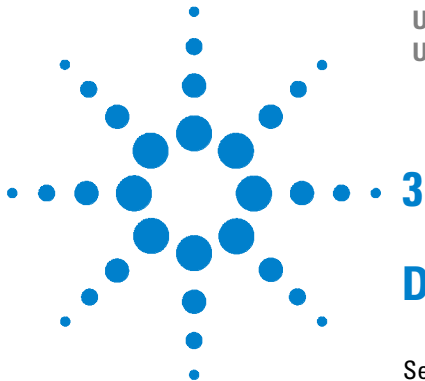
The meter provides an overload alert for voltage measurement in both auto and manual range modes. The meter beeps periodically once the measuring voltage exceeds 1100.0 V. For your safety, please be aware of this alert.

Input-A Warning Alert

The meter sounds an alerting beep when the test lead is inserted to the **A** input terminal but the rotary switch is not set to the corresponding **A** location. The display indicates a flashing **AErr** annunciator until the test lead is removed from the **A** input terminal. This warning alert is not available in T1/T2 temperature measurements mode.

Input-mA Warning Alert

The meter sounds an alerting beep when the $\mu\text{A}/\text{mA}$ input terminal detects a voltage level of more than 1.6 V. The display indicates a flashing **CErr** annunciator until the test lead is removed from the $\mu\text{A}/\text{mA}$ input terminal.




Default Setting Configurations

Setting Configurations 26


This chapter describes on how to change and configure the default setting of U1241A and U1242A handheld digital multimeters including data logging and other setting features.



Setting Configurations

- 1 Turn meter OFF.
- 2 From OFF position, press and hold  (SETUP) while turning the rotary switch to any non- OFF position.

NOTE

After you hear a beep, the meter is in Setup mode and you can release  button.

To change a menu item setting in Setup mode, perform the following steps:











- 1 Press  or  to scroll through menu items.
- 2 Press  or  to scroll through available settings. See [Table 3-9](#) for the details of each available option.
- 3 Press  (SAVE) to save the changes. These parameters remain in the non- volatile memory.
- 4 Press and hold  (SETUP) for more than one second to exit Setup mode.


Table 3-9 Available setting options in Setup mode


| Menu item | | Available setting options | | Default factory setting |
|-----------|---|--|--|-------------------------|
| Setup | Description | Selection | Description | |
| rHd | Trigger hold | OFF | Enables Data Hold (manual trigger) | 500 |
| | | 100–1000 | Sets variation count that determines Refresh Hold (auto trigger) | |
| SCA | Percentage scale | 0–20 mA, 4–20 mA | Sets % scale readout for 0 to 20 mA or 4 to 20 mA | 4–20 mA |
| FrE | Minimum frequency can be measured | 0.5 Hz, 1 Hz, 2 Hz, 5 Hz | Sets the minimum frequency that can be measured in AC measurement mode | 0.5 Hz |
| bEP | Frequency of beep sound | 2400 Hz, 1200 Hz, 600 Hz, 300 Hz | Sets frequency of beep sound of the meter | 2400 Hz |
| | | OFF | Disables beep sound of meter | |
| tnP | Thermocouple | tYPE | Sets thermocouple type to K-type | tYPE K |
| | | tYPE ^[1] | Sets thermocouple type to J-type (for U1242A) | |
| | | tYPE mV | Sets 100 mV measurement for T1 input | |
| Log | Data logging (for U1242A) | Hand | Enables manual data logging | Hand |
| | | 1–9999 | Sets interval for automatic data logging from 1 to 9999 seconds. Press  to toggle through the digit to be adjusted. | |
| APF | Auto power off ^[1] | 1–99 m | Sets timer in minutes for auto power off | 15 m |
| | | OFF | Disables auto power off | |
| Lit | Backlight timer | 1–99 | Sets timer in seconds for auto turn-off for backlight display | 15 |
| | | OFF | Disables auto turn-off for backlight display | |
| dAC | Default AC or DC for voltage and current measurements | dC, AC | Defines the preferred setup of AC or DC for voltage and current measurement once meter is turned on. | dC |
| rSt | Reset | dFAU | Resets the meter to the factory settings by pressing and holding  for more than 1 second. A beep sound indicates the reset is being done. | dFAU |

3 Default Setting Configurations

| Menu item | | Available setting options | | Default factory setting |
|-----------|----------------------------|---------------------------|---|-------------------------|
| Setup | Description | Display | Description | |
| tEMP | Temperature ^[2] | d-CF | Sets temperature measurement to °C, pressing  to change measurement unit to °F | d-CF |
| | | d-F | Sets temperature measurement to °F | |
| | | d-FC | Sets temperature measurement to °F, pressing  to change measurement unit to °C | |
| | | d-C | Sets temperature measurement to °C | |

[1] To activate the meter after it has auto power off, press any button to resume back to respective functional mode.

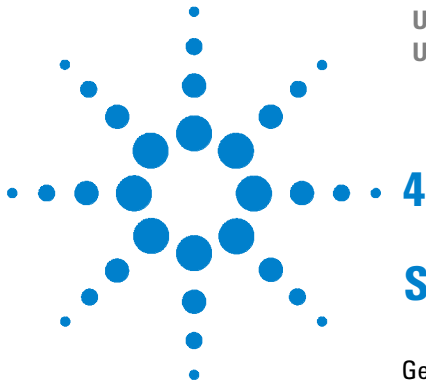[2] To view Temperature (tEMP) menu, press  for more than one second.



4

Service and Maintenance

| | |
|----------------------------------|----|
| General Maintenance | 30 |
| Battery Replacement | 30 |
| Fuse Replacement | 31 |
| Troubleshooting | 33 |
| Returning Instrument for Service | 34 |

This chapter provides you with warranty services, maintenance procedures and troubleshooting hints to solve general problems that you may encounter with the instrument. Repair or service which are not covered in this manual should only be performed by qualified personnel.



General Maintenance

WARNING

To avoid electrical shock or damage to the meter, ensure no water stays inside the casing.

Besides the above hazard, dirt or moisture in the terminals can distort readings. Cleaning steps are as follows:

- 1 Turn the meter off and remove the test leads.
- 2 Turn the meter over and shake out any dirt that may have accumulated in the terminals.
- 3 Wipe the case with a damp cloth and mild detergent – do not use abrasives or solvents. Wipe the contacts in each terminal with a clean swab dipped in alcohol.

Battery Replacement

WARNING

Do not discharge the battery by shorting the battery or reverse the battery polarity in any subjects.

The meter is powered by 6.0 V (1.5 V x 4 batteries), and use only specified battery. To ensure the specification specified, it is suggested to replace battery immediately when the sign of low battery is displayed and flashing. See the following procedures for battery replacement:

- 1 At the rear panel, turn the stand to up side.
- 2 Unscrew the battery cover, notice the screw may not remove as loosed.
- 3 Lift and remove the battery cover to the direction of screw.
- 4 Replace the specified batteries, ensure the correct polarity of batteries.
- 5 Reverse the procedures of opening the cover to close the battery cover.

| Battery Types | ANSI/NEDA | IEC |
|---------------|-----------|------|
| Alkaline | 24A | LR03 |
| Zinc Chloride | 24D | R03 |

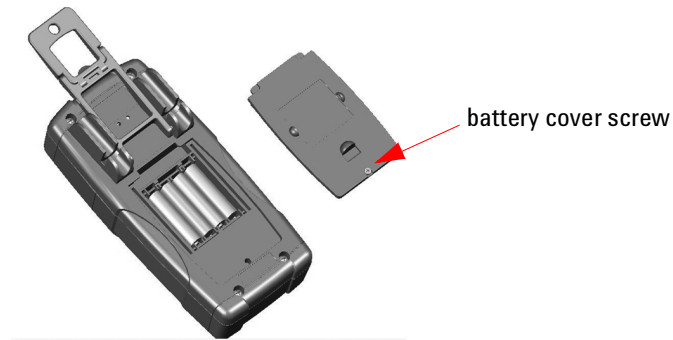


Figure 4-9 Battery replacement

Fuse Replacement

NOTE

Users are recommended to use clean/dry gloves when performing fuse replacement. Do not touch any components except the fuse and plastic parts. No recalibration is required after replacing the fuse.

- 1 Turn the meter off and disconnect the test leads from external equipment.
- 2 Loosen four screws on bottom case, lift and remove the cover.
- 3 Gently remove the defective Fuse 1 by prying one end of the fuse and removing it out of the fuse bracket, see [Figure 4-10](#).
- 4 Replace a new fuse of the same size and rating into the center of the fuse holder.

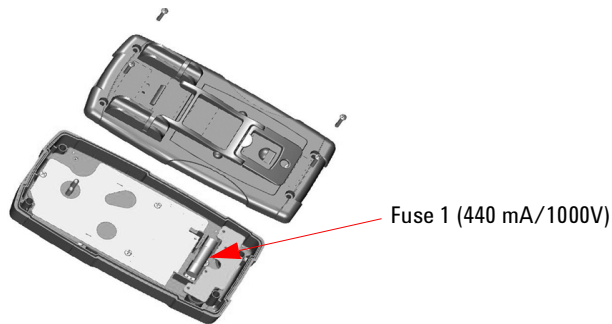


Figure 4-10 Fuse 1 replacement

- 5 If you want to replace a defective Fuse 2, remove Fuse 1 prior to removing the Fuse 2. Loosen the four screws (shown in [Figure 4-11](#)) to lift and remove the circuit board from top case.
- 6 Gently remove the defective Fuse 2 by prying one end of the fuse loose and removing it out of the fuse bracket, see [Figure 4-11](#).
- 7 Replace a new fuse of the same size and rating into the center of the fuse holder.

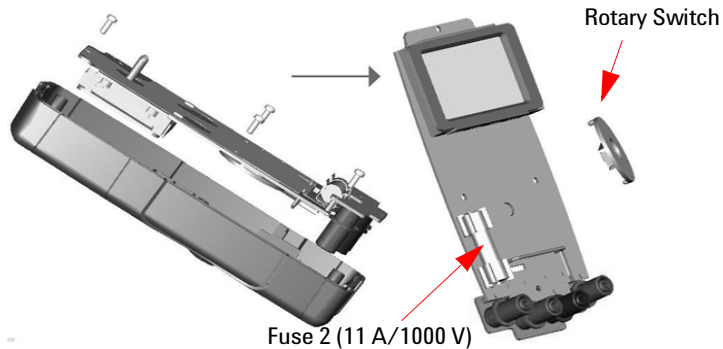


Figure 4-11 Fuse 2 replacement

- 8 Ensure that the rotary switch position is aligned with the align marking on the top case and circuit board switch stay on the OFF position.
- 9 Then re- fasten the circuit board and the bottom cover respectively.

Troubleshooting

WARNING

To avoid electrical shock, do not perform any service unless you are qualified to do so.

If the instrument fails to operate, check the batteries and test leads, replace them if necessary. If the instrument still doesn't function, check the identification procedures as described in [Table 4-10](#).

Table 4-10 Basic troubleshooting hints

| Malfunction | Identification |
|-------------------------------|---|
| No LCD display after power ON | <ul style="list-style-type: none"> Check the battery polarity and replace batteries if necessary. Ensure that the replaced batteries are new batteries, it is recommended not to mix old batteries with new batteries. |
| No beeper tone | <ul style="list-style-type: none"> Check setup mode and verify if the beeper is set to OFF. Then select the desired driving frequency. |
| Failed on current measurement | <ul style="list-style-type: none"> Check the fuse. |

When servicing, use the specified replacement parts only. The [Table 4-11](#) shows the replacement part numbers.

Table 4-11 List of replacement part number

| Part number | Description |
|-------------|---|
| U1241-40001 | U1241A front housing |
| U1242-40001 | U1242A front housing |
| U1241-44404 | Back housing |
| U1241-46401 | Battery cover |
| U1241-44701 | Meter stand |
| U1241-60002 | LCD display |
| 2110-1400 | Fast blow fuse 1000 V, 0.44 A (10 mm x 35 mm) |
| 2110-1402 | Fast blow fuse 1000 V, 11 A (10 mm x 35 mm) |

Returning Instrument for Service

Before shipping your instrument for repair or replacement, Agilent recommends that you acquire the shipping instructions from the Agilent Technologies Service Center. A clear understanding of the shipping instructions is necessary to secure your product for shipment.

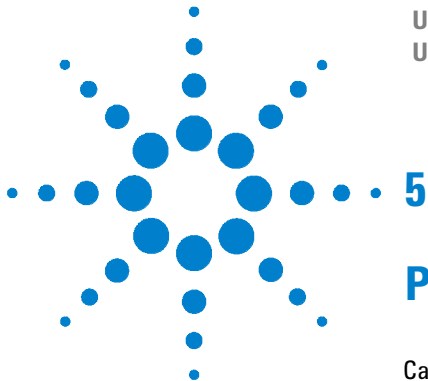
- 1 Write the following information on a tag and if attach to the instrument.
 - Name and address of owner
 - Instrument model number
 - Instrument serial number
 - Description of the service required or failure indications
- 2 Remove all accessories from the instrument. Do not include accessories unless they are associated with the failure symptoms.
- 3 Protect the instrument by wrapping it in plastic or heavy paper.
- 4 Pack the instrument in foam or other shock absorbing material and place it in a strong shipping container.

You are recommended to use the original shipping material or order materials from an Agilent Technologies Sales Office. If both options are not available, place 8 to 10 cm (3 to 4 inches) of shock- absorbing and static- free packaging material around the instrument to avoid movement during shipping.

- 5 Seal the shipping container securely.
- 6 Mark the shipping container as FRAGILE.

In the ensuing correspondence, refer to the instrument by its model number and full serial number.

Agilent suggests that you always insure your shipments.



5

Performance Tests and Calibration

| | |
|--------------------------------|----|
| Calibration Overview | 36 |
| Recommended Test Equipment | 38 |
| Basic Operating Test | 39 |
| Calibration Process | 40 |
| Test Considerations | 41 |
| Performance Verification Tests | 42 |
| Calibration Security | 46 |
| Adjustment Considerations | 49 |
| Calibration Adjustments | 51 |
| Calibration Count | 56 |
| Calibration Errors | 56 |

This chapter contains procedures of performance verification tests and calibration adjustments. The performance tests is meant to verify the U1241A or U1242A handheld digital multimeter to ensure the meter is operating within its published specifications.



Calibration Overview

NOTE

Ensure that you have read [Test Considerations](#) before calibrating the meter.

Closed-case Electronic Calibration

The meter features closed- case electronic calibration. No internal mechanical adjustments are required. The meter calculates correction factors based upon the input reference value you set. The new correction factors are stored in non- volatile memory until the next calibration adjustment is performed. Non- volatile EEPROM calibration memory does not change when power has been off.

Calibration Interval

A 1-year interval is adequate for most applications. Accuracy specifications are warranted only if adjustment is made at regular calibration intervals. Accuracy specifications are not warranted beyond the 1- year calibration interval. Agilent does not recommend extending calibration intervals beyond 2 years for any application.

Adjustment is Recommended

Specifications are only guaranteed within the period stated from the last adjustment. Whatever calibration interval you select, Agilent recommends that complete re- adjustment should always be performed at the calibration interval. This will assure that the U1241A/U1242A will remain within specification for the next calibration interval. This criteria for re- adjustment provides the best long-term stability.

Performance data is measured during Performance Verification Tests and does not guarantee the meter will operate within the test limits unless the adjustment is performed.

Refer to [Calibration Count](#) to verify that all adjustments have been performed.

Recommended Test Equipment

The test equipment recommended for the performance verification and adjustment procedures is listed below. If the exact equipment is not available, substitute the calibration standards of equivalent accuracy.


Table 5-12 Recommended test equipment


| Application | Recommended Equipment | Recommended Accuracy Requirements |
|--------------------|---|--|
| DC Voltage | Fluke 5520A | <1/5 instrument 1 year specifications |
| DC Current | Fluke 5520A | <1/5 instrument 1 year specifications |
| AC Voltage | Fluke 5520A | <1/5 instrument 1 year specifications |
| AC Current | Fluke 5520A | <1/5 instrument 1 year specifications |
| Resistance | Fluke 5520A | <1/5 instrument 1 year specifications |
| Frequency | Fluke 5520A | <1/5 instrument 1 year specifications |
| Capacitance | Fluke 5520A | <1/5 instrument 1 year specifications |
| Diode | Fluke 5520A | <1/5 instrument 1 year specifications |
| Temperature | Fluke 5520A K-type thermal sensor | <1/5 instrument 1 year specifications |
| Short | Shorting Plug - Dual banana plug with copper wire short between 2 terminals | <1/5 instrument 1 year specifications |

Basic Operating Test


Basic Operating Test is used to test the basic operability of the meter. Repair is required if the meter fails the Basic Operating Test.

Backlight Test

To test the backlight function, press  momentarily to turn backlight ON at medium level of brightness intensity. Press again to toggle the highest level of brightness intensity. The backlight turns OFF automatically

after setting period. Alternatively, you can press  for the third time to turn the backlight OFF.

Testing the Display

To view all segments of the display, press and hold the  button while turning the rotary switch from OFF to any non- OFF position. Compare the display with the [Figure 5-12](#).

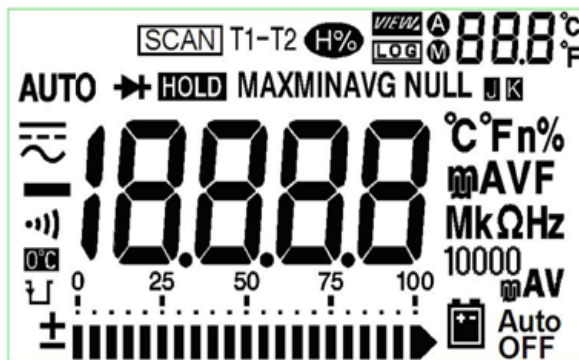


Figure 5-12 Annunciator display

Input-A Terminal Test

This test determines if the input warning of the **A** current terminal test is functioning properly. The meter sounds an alerting beep when the test lead is inserted to the **A** input terminal but the rotary switch is not set to the corresponding **A** location. The display indicates a flashing **AErr** annunciator until the test lead is removed from the **A** input terminal. This warning alert is not available in T1/T2 temperature measurements mode.

Input-mA Terminal Alert Test

This test determines if the detected input voltage level is within the accepted boundaries when the $\mu\text{A}/\text{mA}$ input terminal is connected. The meter sounds an alerting beep when the $\mu\text{A}/\text{mA}$ input terminal detects a voltage level of higher than 1.6 V. The display indicates a flashing **CErr** annunciator until the test lead is removed from the $\mu\text{A}/\text{mA}$ input terminal.

NOTE

The alerting beep will not be impacted even if the beep function is disabled.

Calibration Process

- 1 Prior to performing the verification tests, see [Test Considerations](#).
- 2 Perform the verification tests to characterize the meter, see [Performance Verification Tests](#).
- 3 Unsecure the meter for calibration, see [Calibration Security](#).
- 4 Prior to performing the adjustments, see [Adjustment Considerations](#).
- 5 Perform the adjustment procedures, see [Calibration Adjustments](#).
- 6 Secure the meter against unauthorized calibration, see [Exiting Adjustment Mode](#). Ensure that the meter has quit the Adjustment Mode and turned off.
- 7 Record the new security code and calibration count in the meter's maintenance records.

Test Considerations

Error may be induced by AC signals that present on the input leads. Long test leads can also act as an antenna causing pick-up of AC signals.

For optimum performance, all procedures should comply with the following recommendations:

- Ensure that the calibration ambient temperature is stable and between 18 °C and 28 °C. Ideally the calibration should be performed at $23\text{ °C} \pm 2\text{ °C}$.
- Ensure that the ambient relative humidity (RH) is less than 80%.
- Ensure that the low battery indicator does not appear during the performance verification test. If it does, replace the batteries to avoid any inaccurate reading.
- During temperature performance verification test, ensure that the meter has been switched ON and placed in the test environment for at least one hour with J/K-type thermo- couple connected between the meter and calibration source.
- Allow one minute warm- up period with a Shorting Plug connected to the V and COM input terminals.
- Use shielded twisted pair Teflon- insulated cables to reduce settling and noise errors. Keep the input cables as short as possible.
- Connect the input cable shields to earth ground. Except where noted in the procedures, connect the calibrator **LO** source to earth ground at the calibrator. It is important that the **LO** to earth ground connection be made at only one place in the circuit to avoid ground loops.

During DC voltage, DC current, and resistance gain verification measurements, ensure that the calibrator's "0" output is correct. It is recommended to set the offset for each range of the measuring function being verified.

Input Connections

Test connections to the meter are best accomplished using the K- type thermocouple wire and mini- connectors for temperature measurement. The J- type thermocouple wire and mini- connectors can also be used for temperature measurements (for U1242A). Shielded, twisted- pair, Teflon interconnect cables of minimum length are recommended between the calibrator and the meter. Cable shields should be earth ground referenced. This configuration is recommended for optimal noises and settling time performance during calibration.

Performance Verification Tests




 

The performance verification tests are recommended as acceptance tests when you first receive the meter. The acceptance test results should be compared against the one year test limits. After acceptance, you should repeat the performance verification tests at every calibration interval.

If the meter fails performance verification, adjustment or repair is required. Adjustment is recommended at every calibration interval. If no adjustment is being performed, it is highly recommended to establish a 'guard band', using not more than 80% of the specifications, as the verification limits.

NOTE





Users are highly recommended to read the [Test Considerations](#) before performing performance verification tests.

Table 5-13 Verification Tests

| Step | Test Function | Range | 5520A Output | Error from nominal 1 year | |
|--------|---|----------|-------------------|---------------------------|--------|
| | | | | U1241A | U1242A |
| 1 | Turn the rotary switch to  V position | 1000 mV | 1000.0 mV | ± 1.4 mV | |
| | | 10 V | 10.000 V | ± 11 mV | |
| | | 100 V | 100.00 V | ± 110 mV | |
| | | 1000 V | 1000.0 V | ± 2 V | |
| 2 | Press  to go to  V function | 1000 mV | 1000.0 mV, 500 Hz | ± 10.5 mV | |
| | | | 1000.0 mV, 1 kHz | ± 20.5 mV | |
| | | 10 V | 10.000 V, 500 Hz | ± 105 mV | |
| | | | 10.000 V, 1 kHz | ± 105 mV | |
| | | | 10.000 V, 2 kHz | ± 205 mV | |
| | | 100 V | 100.00 V, 500 Hz | ± 1.05 V | |
| | | | 100.00 V, 1 kHz | ± 1.05 V | |
| | | | 100.00 V, 2 kHz | ± 2.05 V | |
| 1000 V | 1000.0 V, 1 kHz | ± 10.5 V | | | |
| 3 | Press  to go to frequency mode | 100 Hz | 1.000 V, 70 Hz | ± 51 mHz | |
| | | 1000 Hz | 1.000 V, 1000 Hz | ± 600 mHz | |
| | | 10 kHz | 1.000 V, 2 kHz | ± 3.6 Hz | |
| 4 | Turn the rotary switch to  position | Diode | 1.000 V | ± 5 mV | |

5 Performance Tests and Calibration

| Step | Test Function | Range | 5520A Output | Error from nominal 1 year | |
|------|--|---------------------|--------------------------------|---|--------|
| | | | | U1241A | U1242A |
| 5 | Turn the rotary switch to Ω position | 1000 Ω | 1000.0 Ω | $\pm 3.3 \Omega$ ^[1] | |
| | | 10 k Ω | 10.000 k Ω | $\pm 33 \Omega$ ^[1] | |
| | | 100 k Ω | 100.00 k Ω | $\pm 330 \Omega$ | |
| | | 1000 k Ω | 1000.0 k Ω | $\pm 3.3 \text{ k}\Omega$ | |
| | | 10 M Ω | 10.000 M Ω | $\pm 83 \text{ k}\Omega$ | |
| | | 100 M Ω | 100.00 M Ω | $\pm 1.53 \text{ M}\Omega$ ^[2] | |
| 6 | Turn the rotary switch to μF position | 1000 nF | 1000.0 nF | $\pm 12.4 \text{ nF}$ | |
| | | 10 μF | 10.000 μF | $\pm 0.124 \mu\text{F}$ | |
| | | 100 μF | 100.00 μF | $\pm 1.24 \mu\text{F}$ | |
| | | 1000 μF | 1000.0 μF | $\pm 20.4 \mu\text{F}$ | |
| | | 10 mF | 10.000 mF | 0.204 mF | |
| 7 | Turn the rotary switch to μA position | 1000 μA | 1000.0 μA | $\pm 1.3 \mu\text{A}$ | |
| | | 10000 μA | 10000 μA | $\pm 13 \mu\text{A}$ | |
| 8 | Press SHIFT to go to μA function | 1000 μA | 1000.0 μA , 500 Hz | $\pm 10.5 \mu\text{A}$ | |
| | | | 1000.0 μA , 1 kHz | $\pm 15.5 \mu\text{A}$ | |
| | | 10000 μA | 10000 μA , 500 Hz | $\pm 105 \mu\text{A}$ | |
| | | | 10000 μA , 1 kHz | $\pm 155 \mu\text{A}$ | |
| 9 | Turn the rotary switch to mA position | 100 mA | 100.0 mA | $\pm 0.23 \text{ mA}$ | |
| | | 440 mA | 400.0 mA ^[3] | $\pm 2.3 \text{ mA}$ | |
| 10 | Press SHIFT to go to mA function | 100 mA | 100.00 mA, 500 Hz | $\pm 1.05 \text{ mA}$ | |
| | | | 100.00 mA, 1 kHz | $\pm 1.55 \text{ mA}$ | |
| | | 440 mA | 400 mA ^[3] , 500 Hz | $\pm 4.5 \text{ mA}$ | |
| | | | 400 mA ^[3] , 1 kHz | $\pm 6.5 \text{ mA}$ | |

| Step | Test Function | Range | 5520A Output | Error from nominal 1 year | |
|------|--|--|----------------------------------|---------------------------|----------|
| | | | | U1241A | U1242A |
| 11 | Turn the rotary switch to  A position | 10 A | 10.000 A ^[4] | ± 65 mA | |
| 12 | Press  to go to  A function | 10 A | 10.000 A ^[4] , 500 Hz | ± 105 mA | |
| | | 10 A | 10.000 A ^[4] , 1 kHz | ± 155 mA | |
| 13 | Turn the rotary switch to T1 or T1T2 ^[5] position | -40 °C until 1000 °C ^[6] | -40 °C | ± 1.4 °C | |
| | | | 0 °C | ± 1 °C | |
| | | | 1000 °C | ± 11 °C | |
| 14 | Press  to go to T2 function ^[5] | -40 °C until 1000 °C ^[6] | -40 °C | | ± 1.4 °C |
| | | | 0 °C | | ± 1 °C |
| | | | 1000 °C | | ± 11 °C |

[1] The accuracy of 1 k Ω and 10 k Ω are specified after Math Null, that is used to substrate the test lead resistance and the thermal effect.

[2] For the range of 100 M Ω , the RH is specified for <60%.

[3] Current can be measured from 50 mA to 440 mA continuously. An addition of 0.2% to the specified accuracy when measuring a signal greater than 440 mA to 1100 mA for 30 seconds maximum. After measuring > 440 mA current, cool down the meter for twice the measuring time taken before proceed for low current measurement.

[4] Current can be measured from 0.5 A up to 10 A continuously with the maximum operating temperature of 50 °C. An addition 0.3% needs to be added to the specified accuracy if the signal measured is in the range of 10 A to 19.999 A for 15 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for 60 seconds before applying low current measurement.

[5] Only available in U1242A.

[6] The meter should be ON for at least 1 hour before measurements are taken. The accuracy does not include the tolerance of thermocouple probe. When measuring temperature with respect to any temperature calibrator, set both the calibrator and meter with external reference (without internal ambient compensation 0 °C). If both calibrator and meter are set with internal reference (with internal ambient compensation), deviation may be present between the readings of the calibrator and meter.

Calibration Security

The calibration security code prevents accidental or unauthorized adjustments to the meter. The meter is secured when the meter is shipped from factory. Before performing any adjustment to the meter, you are required to unsecure the meter by entering the correct security code (see [Unsecuring the Meter for Calibration](#)). The security code may contain up to 4 numeric characters.

NOTE

You can unsecure and change the security code from the meter front panel. If you forget your security code, see [Unsecuring the Meter Without the Security Code](#).







Unsecuring the Meter for Calibration

Before performing adjustment to the meter, you are required to unsecure the meter by entering the correct security code. The security code is set to 1234 when the meter is shipped from the factory. The security code is stored in non-volatile memory, and does not change when power is off.



 






Unsecuring the Meter from the Front Panel

- 1 Turn the rotary switch to $\approx V$.
- 2 Press **SHIFT** and **Hz** simultaneously to enter the Calibration Security Code entry mode. The primary display shows **5555** and the secondary display shows **SEU**.
- 3 Press **←** or **→** to step each character in the code. Press **▲** or **▼** to change the value of the selected character. Press **HOLD**.
- 4 Press **RANGE** (Save) when done.
- 5 If the correct security code is entered, the secondary display will show **PAS**. If an invalid code is entered, the meter will show error code **E02** on the secondary display for approximately 3 seconds and return to the Calibration Security entry mode.

Changing the Meter Calibration Security Code from the Front Panel

- 1 When the meter is in the unsecured mode, press  button for more than one second to enter Calibration Security Code setting mode.
- 2 The factory default calibration security code 1234 will be displayed on primary display.
- 3 Press  or  to step each character in the code. Press 
or  to change the value of the selected character.
- 4 Press  (Save) button, to store new calibration security code.
- 5 If the new calibration security code has been successfully stored, the secondary display will show PASS. If the new code failed to save, the meter will show error code **E07** on the secondary display for approximately 3 seconds and return to the Calibration Security Code setting mode.

 Unsecuring the Meter Without the Security Code

- 1 Record the last 4 digit serial numbers of the meter.
- 2 Turn the rotary switch to .
- 3 Press  and  simultaneously to enter the Calibration Security Code entry mode. The primary display shows **5555** and the secondary display shows **SEC**.
- 4 Press  for more than one second to enter Set Default Security Code mode. The secondary display shows **SEr** and primary display shows **"5555"**.
- 5 Press  or  to step each character in the code. Press 
and  to change the value of the selected character.
- 6 Set the code, same as the last 4 digit serial number of the meter. Press  (Save) to confirm the entry.
- 7 If the 4 digit serial number entered is correct, the secondary display will show **PAS**. If an invalid code is entered, the meter will show error code **E03**. Ensure that the last 4 digit serial number is entered correctly and repeat the step 1 to 7.

 




Using the Front Panel for Adjustments

This section describes the process used to perform adjustments from the front panel.

Selecting the Adjustment Mode

Unsecure the meter, see [Unsecuring the Meter for Calibration](#) or [Unsecuring the Meter Without the Security Code](#). Once the meter has been unsecured, the reference value will be indicated on the primary display.

Entering Adjustment Values

- 1 Press  and  to step through each character in the primary display.
- 2 Press  and  to change the value of the corresponding character from digits 0 through 9.
- 3 Apply the respective corresponding input signal from the recommended test equipment in [Table 5-12](#).
- 4 Press  (SAVE) when done to start calibration.

NOTE

Ensure that the accuracy of the input signal adheres to the [Valid Adjustment Input Values](#) in [Table 5-14](#).

Adjustment Considerations

NOTE

After each adjustment, the secondary display shows **PAS**. If the calibration fails, the meter sounds a beep, and an error number is shown in the secondary display. Calibration error messages are described in [Calibration Errors](#).

- 1 Allow the meter to warm up and stabilize for five minutes before performing the adjustments.
- 2 Assure that the low battery indicator does not appear during the adjustment. Replace the batteries to avoid inaccurate readings.
- 3 Consider the thermal effects of the test leads connected to the calibrator and meter. It is recommended to wait for one minute before start performing the calibration.
- 4 During ambient temperature adjustment, ensure that the meter has been turned on for at least one hour with K- type thermocouple connected between the meter and calibration source.








CAUTION

Do not turn off the meter during adjustments., as this may delete the calibration memory for the present function.

Valid Adjustment Input Values

Adjustment can be accomplished using the following input values below.

Table 5-14 Valid adjustment input values

| Function | Range | Valid Input Reference Values |
|---|--|--|
|  V | 1000 mV, 10 V, 100 V, 1000 V | 0.9 to 1.1 x Full Scale |
|  V | 1000 mV, 10 V, 100 V, 1000 V | 0.9 to 1.1 x Full Scale |
|  | 1 V | 0.9 to 1.1 x Full Scale |
| Ω | 1000 Ω , 10 k Ω , 100 k Ω , 1000 k Ω , 10 M Ω | 0.9 to 1.1 x Full Scale |
|  | 1000 nF, 10 μ F, 100 μ F, 1000 μ F, 10 mF | 0.9 to 1.1 x Full Scale |
| μ A  | 1000 μ A, 10000 μ A | 0.9 to 1.1 x Full Scale |
| mA  | 100 mA, 1000 mA | 0.9 to 1.1 x Full Scale |
| A  | 10 A | 0.9 to 1.1 x Full Scale |
| T1 | 0 °C | Ensure that 0 °C with ambient compensation is provided |
| DCmV (T1) | 100 mV | 0.9 to 1.1 x Full Scale |

CAUTION

 
The minimum AC current output of Fluke 5520A calibrator is 29 μ A. Ensure that at least 50 μ A is set at the calibrator source of AC μ A.

Calibration Adjustments

NOTE

Review the [Test Considerations](#) and [Adjustment Considerations](#) before beginning the adjustment procedures.

- 1 Turn the rotary switch to **Test Function** position, as shown in [Table 5-14](#).
- 2 After unsecuring the meter, the meter will go into the adjustment mode, see [Unsecuring the Meter for Calibration](#).
- 3 The primary display will show the reference value of the Cal Items. Configure each Cal Item shown in Valid Adjustment Input Reference Values in [Table 5-14](#).



- 4 Use the **HOLD** and **NULL** arrow keys to select the Cal Range.
- 5 Apply the input signal as shown in the **Valid Input Reference Value** column of the [Table 5-14](#). The bar graph will display the input reading. There is no bar graph display for temperature adjustment.

NOTE

Users are highly recommended to complete the adjustments in the same order as shown in [Table 5-14](#).

- 6 Enter the actual applied input, see [Entering Adjustment Values](#).
- 7 Press **RANGE** to start the adjustments. The **CAL** flashes in the secondary display indicating the calibration is in progress.
- 8 Upon completion of each adjustment value, the secondary display will show **PAS**. If the adjustment failed, the meter will sound a long beep and the calibration error number appears in the secondary display. The primary display remains at the current Cal Item.

NOTE




If the adjustment failed, check the input value, range, function, and entered adjustment value and repeat the adjustment steps.



 
5 Performance Tests and Calibration

9 Turn the rotary switch to the next function according to the **Test Function** column shown in [Table 5-14](#). Repeat steps 3 to 8 for each adjustment point shown in the calibration adjustment, see [Table 5-15](#).







10 Verify the adjustments using the [Performance Verification Tests](#).





Table 5-15 Calibration Adjustments

| Step | Test Function | Cal Range | Input Reference Value | Cal Item | |
|------|---|-----------|--|-----------|--------|
| | | | | U1241A | U1242A |
| 1 | Turn the rotary switch to  V position | Short | Dual banana plug with copper wires short between two terminals | SHrt | |
| | | 1000 mV | 1 V | 1000.0 mV | |
| | | 10 V | 10 V | 10.000 V | |
| | | 100 V | 100 V | 100.00 V | |
| | | 1000 V | 1000 V | 1000.0 V | |
| 2 | Press  to go to  V function | 1000 mV | 30 mV, 70 Hz | 30.0 mV | |
| | | | 1000 mV, 70 Hz | 1000.0 mV | |
| | | | 1000 mV, 1 kHz | 1000.0 mV | |
| | | 10 V | 1 V, 70 Hz | 1.000 V | |
| | | | 10 V, 70 Hz | 10.000 V | |
| | | | 10 V, 1 kHz | 10.000 V | |
| | | 100 V | 10 V, 70 Hz | 10.00 V | |
| | | | 100 V, 70 Hz | 100.00 V | |
| | | | 100 V, 1 kHz | 100.00 V | |
| | | 1000 V | 100 V, 70 Hz | 100.0 V | |
| | | | 1000 V, 70 Hz | 1000.0 V | |
| | | | 1000V, 1 kHz | 1000.0 V | |


 
| Step | Test Function | Cal Range | Input | Cal Item | |
|------|--|-----------------|--|-------------------|--------|
| | | | | U1241A | U1242A |
| 3 | Turn the rotary switch to position  | Short | Dual banana plug with copper wires short between two terminals | SHrt | |
| | | 1 V | 1 V | 1.000 V | |
| 4 | Turn the rotary switch to position  | Short | Dual banana plug with copper wires short between two terminals | SHrt | |
| | | 10 M Ω | Input terminals open (remove all test leads and shorting plugs from input terminals) | oPEn | |
| | | | 10 M Ω | 10.000 M Ω | |
| | | 1000 k Ω | 1000 k Ω | 1000.0 k Ω | |
| | | 100 k Ω | 100 k Ω | 100.00 k Ω | |
| | | 10 k Ω | 10 k Ω | 10.000 k Ω | |
| | | 1000 Ω | 1000 Ω | 1000 Ω | |
| 5 | Turn the rotary switch to position  | Open | Input terminals open (remove all test leads and shorting plugs from input terminals) | oPEn | |
| | | 1000 nF | 400 nF | 400.0 nF | |
| | | | 1000 nF | 1000.0 nF | |
| | | 10 μ F | 10 μ F | 10.000 μ F | |
| | | 100 μ F | 100 μ F | 100.00 μ F | |
| | | 1000 μ F | 1000 μ F | 1000.0 μ F | |
| | 10 mF | 10 mF | 10.000 mF | | |

5 Performance Tests and Calibration

| Step | Test Function | Cal Range | Input | Cal Item | |
|------|---|---------------------|---|----------------------|--------|
| | | | | U1241A | U1242A |
| 6 | Turn the rotary switch to  μA position | Open | Input terminals open (remove all test leads and shorting plugs from input terminals) | oPEn | |
| | | 1000 μA | 1000 μA | 1000.0 μA | |
| | | 10000 μA | 10000 μA | 10000 μA | |
| 7 | Press  to go to  μA function | 1000 μA | 50 μA , 70 Hz | 50.0 μA | |
| | | | 100 μA , 70 Hz | 100.0 μA | |
| | | | 1000 μA , 70 Hz | 1000.0 μA | |
| | | 10000 μA | 1000 μA , 70 Hz | 1000 μA | |
| | | | 10000 μA , 70 Hz | 10000 μA | |
| 8 | Turn the rotary switch to  mA position | Open | Input terminals open (remove all test leads and shorting plugs from input terminals) | oPEn | |
| | | 100 mA | 100 mA | 100.00 mA | |
| | | 1000 mA | 320 mA | 320.0 mA | |
| 9 | Press  to go to  mA function | 100 mA | 5 mA , 70 Hz | 5.00 mA | |
| | | | 10 mA , 70 Hz | 10.00 mA | |
| | | | 100 mA , 70 Hz | 100.00 mA | |
| | | 1000 mA | 100 mA , 70 Hz | 100.0 mA | |
| | | | 320 mA , 70 Hz | 320.0 mA | |

| Step | Test Function | Cal Range | Input | Cal Item | |
|--|---|-----------|---|-----------|--------|
| | | | | U1241A | U1242A |
| Move the test lead from “μA.mA” and “COM” terminal to “A” and “COM” terminal | | | | | |
| Caution: Connect the calibrator to the meter's “A” and “COM” terminal before applying 10 A | | | | | |
| 10 | Turn the rotary switch to  A position | Open | Input terminals open (remove all test leads and shorting plugs from input terminals) | oPEn | |
| | | 10 A | 10 A | 10.000 A | |
| 11 | Press  to go to  A function | 10 A | 0.5 A, 70 Hz | 0.500 A | |
| | | | 1 A, 70 Hz | 1.000 A | |
| | | | 10 A, 70 Hz | 10.000 A | |
| 12 | Turn the rotary switch to T1 or T1T2 position | Short | Dual banana plug with copper wires short between two terminals | SHrt | |
| | | 100 mV | 100 mV | 100.00 mV | |
| 13 | Press  to go to T1 function | K-type | 0 °C | 000.0 °C | |



Exiting Adjustment Mode

- 1 Remove all shorting plugs and connectors from the meter.
- 2 Record the new Calibration Count, see [Calibration Count](#).
- 3 Press  and  simultaneously to exit the Adjustment Mode. Power off and on the meter to return to normal measurement mode and secured.

Calibration Count

The meter provides the calibration count information for users to access through front panel operation. Note that the meter was calibrated prior to shipping out to users. Users are recommended to record the initial value of the calibration count once receiving the meter.

The count value increases by one for each calibration point, from 0000 up to the maximum of 19999. After the maximum count, the calibration count will be reset to 0. The calibration count can be read from the front panel after the meter has been unsecured, see the following steps:


- 1 In adjustment mode, press and hold  for more than one second to view the calibration count viewing mode. The primary display indicates the calibration count value while the secondary display indicates “Cnt”.
- 2 Take note of the calibration count to keep track of the number of calibration counts that has been performed.
- 3 Press and hold  for more than one second to exit the calibration count mode.

Calibration Errors

The following error codes indicate failures that may occur during a calibration. The error code is displayed on secondary display.

Table 5-16 Calibration error codes

| Code | Descriptions |
|------|--|
| 200 | Calibration error: Calibration mode is secured |
| E02 | Calibration error: Invalid secure code |
| E03 | Calibration error: Invalid serial number code |
| E04 | Calibration error: Calibration aborted |
| E05 | Calibration error: Value out of range |
| E06 | Calibration error: Signal measurement out of range |
| E07 | Calibration error: Frequency out of range |
| E08 | EEPROM write failure |

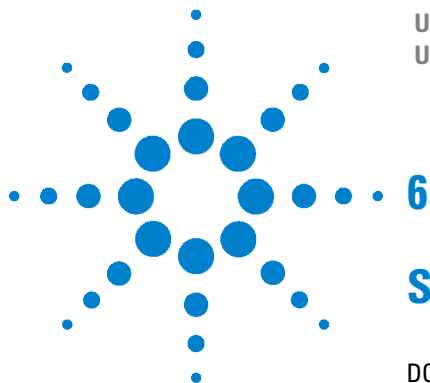

6

Specifications and Characteristics

| | |
|--|----|
| DC Specifications | 58 |
| AC Specifications | 59 |
| Resistance Specifications | 60 |
| Diode Check/Audible Continuity Test Specifications | 60 |
| Temperature Specifications | 61 |
| Capacitance Specifications | 62 |
| Harmonic Ratio Specifications | 62 |
| Frequency Specifications | 63 |
| Operating Specifications | 64 |
| General Characteristics | 65 |

This chapter lists specifications and characteristics of the U1241A and U1242A handheld digital multimeters. These specifications apply when using the meter in an environment that is *free* of electromagnetic interference and electrostatic charge.

When using the meter in an environment where electromagnetic interference or significant electrostatic charge is present, measurement accuracy may be reduced.



DC Specifications

Table 6-1 DC specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Test Current/ Burden Voltage | Accuracy | |
|-------------------------------|-------------------------|-------------|---------------------------------|-----------|--------|
| | | | | U1241A | U1242A |
| Voltage ^[1] | 1000.0 mV | 0.1 mV | - | 0.09% + 5 | |
| | 10.000 V | 0.001 V | - | 0.09% + 2 | |
| | 100.00 V | 0.01 V | - | | |
| | 1000.0 V | 0.1 V | - | 0.15% + 5 | |
| Current | 1000.0 μ A | 0.1 μ A | < 0.06 V (50 Ω) | 0.1%+3 | |
| | 10000 μ A | 1 μ A | < 0.55 V (50 Ω) | 0.1%+3 | |
| | 100.00 mA | 0.01 mA | < 0.18 V (0.5 Ω) | 0.2%+3 | |
| | 440.0 mA ^[2] | 0.1 mA | < 0.8 V (0.5 Ω) | 0.5%+3 | |
| | 10.000 A ^[3] | 0.001 A | < 0.4 V (0.01 Ω) | 0.6%+5 | |

[1] Input impedance: 10 M Ω (nominal).

[2] Current can be measured up to 440 mA continuously. An additional 0.2% needs to be added to the specified accuracy if the signal measured is in the range of 440 mA to 1100 mA for 30 seconds maximum. After measuring current of > 440 mA, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[3] Current can be measured up to 10 A continuously with the maximum operating temperature of 50 °C. An additional 0.3% needs to be added to the specified accuracy if the signal measured is in the range of 10 A to 19.999 A for 15 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for 60 seconds before applying low current measurement.

AC Specifications

Table 6-2 AC specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Test Current/ Burden Voltage | Accuracy | | |
|--|-------------------------|-------------|---------------------------------|-----------------|-----------------|----------------|
| | | | | 40 Hz to 500 Hz | 500 Hz to 1 kHz | 1 kHz to 2 kHz |
| AC Voltage ^{[1][2]} True RMS | 1000.0 mV | 0.1 mV | – | 1% + 5 | 2% + 5 | - |
| | 10.000 V | 0.001 V | – | | 1% + 5 | 2% + 5 |
| | 100.00 V | 0.01 V | – | | | |
| | 1000.0 V | 0.1 V | – | | | – |
| AC Current ^[2] True RMS | 1000.0 μ A | 0.1 μ A | < 0.06 V (50 Ω) | 1% + 5 | 1.5% + 5 | – |
| | 10000 μ A | 1 μ A | < 0.55 V (50 Ω) | | | |
| | 100.00 mA | 0.01 mA | < 0.18 V (0.5 Ω) | | | |
| | 440.0 mA ^[3] | 0.1 mA | < 0.8 V (0.5 Ω) | | | |
| | 10.000 A ^[4] | 0.001 A | < 0.4 V (0.01 Ω) | | | |

[1] Input impedance: 10 M Ω (nominal) in parallel with <100 pF, with overload protection of 1000 V R.M.S.

[2] ACV and AC μ A/mA/A specifications are true RMS AC coupled, valid from 5% to 100% of range. The crest factor may up to 3 at full scale and for 1000 V range, the crest factor is 1.5 at full scale. For non-sinusoidal waveforms with crest factor > 3, add 2% reading + 2% full scale typical.

[3] Current can be measured from 50 mA to 440 mA continuously. An additional 0.2% needs to be added to the specified accuracy if the signal measured is in the range of 440 mA to 1100 mA for 30 seconds maximum. After measuring current of > 440 mA, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[4] Current can be measured from 0.5 A up to 10 A continuously with the maximum operating temperature of 50 °C. An additional 0.3% needs to be added to the specified accuracy if the signal measured is in the range of 10 A to 19.999 A for 15 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for 60 seconds before applying low current measurement.

Resistance Specifications

Table 6-3 Resistance specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Test Current/ Burden Voltage | Accuracy |
|---------------------------|----------------------------------|------------------|---------------------------------|----------|
| Resistance ^[1] | 1000.0 Ω ^[2] | 0.1 Ω | 0.5 mA | 0.3% + 3 |
| | 10.000 k Ω ^[2] | 0.001 k Ω | 50 μ A | |
| | 100.00 k Ω | 0.01 k Ω | 4.91 μ A | |
| | 1000.0 k Ω | 0.1 k Ω | 447 nA | |
| | 10.000 M Ω | 0.001 M Ω | 112 nA | 0.8% + 3 |
| | 100.00 M Ω ^[3] | 0.01 M Ω | 112 nA | 1.5% + 3 |

Diode Check/Audible Continuity Test Specifications

Table 6-4 Diode test/audible continuity test specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Test Current/ Burden Voltage | Accuracy |
|---------------------------|-------|------------|---------------------------------|----------|
| Diode test ^[4] | 1 V | 0.001 V | Approximately 0.5 mA | 0.3% + 2 |

[1] The maximum open voltage is < 2.8 V. For instant continuity, the built-in buzzer sounds when resistance is <10% of each resistance range.

[2] The accuracy of 1 k Ω and 10 k Ω is specified after Null function, which is used to substrate the test lead resistance and the thermal effect.

[3] For the range of 100 M Ω , the R.H. is specified for < 60%. The temperature coefficient will be 0.15 times of specified accuracy as > 50 M Ω .

[4] Overload protection: 1000 V R.M.S. for circuits < 0.3 A short circuit current. The built-in buzzer sounds when reading is approximately below 50 mV and audible single tone for normal forward biased diode or semiconductor junction as 0.3 V \leq Reading \leq 0.8 V.

Temperature Specifications

Table 6-5 Temperature specifications with accuracy of \pm (% of reading + offset error)

| Function | Thermocouple Type | Range | Resolution | Accuracy ^[1] |
|----------------------------|-------------------|-------------------|------------|-------------------------|
| Temperature ^[2] | K | -40 °C to 1000 °C | 0.1 °C | 1% + 1 °C |
| | | -40 °F to 1832 °F | 0.1 °F | 1% + 1.8 °F |
| | J ^[3] | -40 °C to 1000 °C | 0.1 °C | 1% + 1 °C |
| | | -40 °F to 1832 °F | 0.1 °F | 1% + 1.8 °F |

[1] The accuracy is specified as following condition:

- The accuracy does not include the tolerance of thermocouple probe. The thermal sensor plugged into the meter should be placed in the operating environment for at least one hour.
- Use Null function to reduce the thermal effect.
- When measuring temperature with respect to any temperature calibrator, set both the calibrator and meter with external reference (without internal ambient compensation). If both calibrator and meter are set with internal reference (with internal ambient compensation), deviation may be shown between the readings of the calibrator and meter, due to differences in ambient compensation between calibrator and meter.
- Do not contact the temperature sensor to any surface that is energized above 33 Vrms or 70 VDC, such the voltage source will pose a shock hazard.

[2] The temperature calculation is according to the standard of EN/IEC-60548-1 and NIST175.

[3] Only available in U1242A.

Capacitance Specifications

Table 6-6 Capacitance specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Accuracy |
|----------------------------|----------------|---------------|-----------|
| Capacitance ^[1] | 1000.0 nF | 0.1 nF | 1.2 % + 4 |
| | 10.000 μ F | 0.001 μ F | |
| | 100.00 μ F | 0.01 μ F | |
| | 1000.0 μ F | 0.1 μ F | 2% + 4 |
| | 10.000 mF | 0.001 mF | |

Harmonic Ratio Specifications

Table 6-7 Harmonics ratio specifications

| Function | Range ^[2] | Frequency | Voltage |
|----------------|----------------------|----------------|---------------------|
| Harmonic ratio | 0.0% – 99.9% | 40 Hz – 500 Hz | 100 mVAC – 1000 VAC |

[1] Overload protection: 1000 V R.M.S. for circuits < 0.3 A short circuit current. The accuracy is calculated based on the film capacitor. Use Relative mode for residual value.

[2] Pure sinusoidal waveforms without harmonics have a harmonics ratio of 0%, higher the harmonics ratio, more harmonics are present in the sinusoidal waveform.

Frequency Specifications

Table 6-8 Frequency specifications with accuracy of \pm (% of reading + No. of Least Significant Digit)

| Function | Range | Resolution | Accuracy | Min. Input Frequency |
|--------------------------|-------------|------------|-----------|----------------------|
| Frequency ^[1] | 100.00 Hz | 0.01 Hz | 0.03% + 3 | 1 Hz |
| | 1000.0 Hz | 0.1 Hz | | |
| | 10.000 kHz | 0.001 kHz | | |
| | 100.00 kHz | 0.01 kHz | | |
| | 1000.00 kHz | 0.1 kHz | | |

Frequency Sensitivity During Voltage Measurement^[2]

| Input Range (Maximum input for specified accuracy = 10 x Range or 1000 V) | Minimum Sensitivity (R.M.S. sine wave) | |
|---|--|-------------------|
| | 20 Hz to 50 kHz | 50 kHz to 200 kHz |
| 1000.0 mV | 0.3 V | 0.6 V |
| 10.000 V | 0.5 V | 1.8 V |
| 100.00 V | 5 V | 10 V (<100 kHz) |
| 1000.0 V | 50 V | 100 V (<100 kHz) |

Frequency Sensitivity During Current Measurement^[3]

| Input Range | Minimum Sensitivity (R.M.S. Sine wave) |
|----------------|--|
| | 20 Hz – 20 kHz |
| 1000.0 μ A | 100 μ A |
| 10000 μ A | 500 μ A |
| 100.00 mA | 10 mA |
| 440.0 mA | 50 mA |
| 10.000 A | 1 A |

[1] The input signal is lower than the product of 20,000,000 V-Hz.

[2] For the accuracy of the maximum input, refer to AC voltage specifications.

[3] For the accuracy of the maximum input, refer to AC current specifications.

Operating Specifications

Table 6-9 Measuring rate of U1241A and U1242A

| Function | Times/second |
|-----------------------|-------------------|
| ACV | 7 |
| DCV (V or mV) | 7 |
| Ω | 14 |
| Diode | 14 |
| Capacitance | 4 (< 100 μ F) |
| DCA (μ A, mA, A) | 7 |
| ACA (μ A, mA, A) | 7 |
| Temperature | 7 (single) |
| Frequency | 1 (>10 Hz) |

General Characteristics

Table 6-10 General characteristics of U1241A and U1242A

| | |
|---|---|
| Power Supply | <ul style="list-style-type: none"> 4 single standard 1.5 V AAA batteries (Alkaline or Zinc Chloride type) |
| Display | <ul style="list-style-type: none"> Dual display (secondary display is cater for temperature function display only) are 4-digit liquid crystal display (LCD) with maximum reading of 11,000 counts. Automatic polarity indication. |
| Power Consumption | <ul style="list-style-type: none"> 0.22 VA maximum |
| Operating Environment | <ul style="list-style-type: none"> Full accuracy at -10°C to 55°C Full accuracy to 80% R.H. for temperature up to 30°C, decreasing linearly to 50% R.H. at 55°C |
| Storage Environment | <ul style="list-style-type: none"> -20°C to 70°C |
| Altitude | <ul style="list-style-type: none"> 0 – 2000 meters per IEC 61010-1 2nd Edition CAT III, 1000 V/ CAT IV, 600 V |
| Safety Compliance | <ul style="list-style-type: none"> IEC 61010-1:2001 / EN61010-1:2001 USA: UL 61010-1:2004 Canada: CSA C22.2 No. 61010-1:2004 |
| Measurement Category | <ul style="list-style-type: none"> CAT III, 1000 V/ CAT IV, 600 V Overvoltage Protection, Pollution degree 2 |
| EMC Compliance | <ul style="list-style-type: none"> Certified to IEC 61326-1:2005/ EN 61326-1:2006 Canada: ICES-001:2004 Australia/New Zealand: AS/NZS CISPR11:2004 |
| Common Mode Rejection Ratio (CMRR) | <ul style="list-style-type: none"> > 90 dB at DC, 50/60 Hz $\pm 0.1\%$ (1 kΩ unbalanced) |
| Normal Mode Rejection Ratio (NMRR) | <ul style="list-style-type: none"> > 60 dB at 50/60 Hz $\pm 0.1\%$ |
| Temperature Coefficient | <ul style="list-style-type: none"> $0.1 \times$ (specified accuracy) / $^{\circ}\text{C}$ (from -10°C to 18°C or 28°C to 55°C) |
| Crest Factor | <ul style="list-style-type: none"> ≤ 3.0 |
| Shock and Vibration | <ul style="list-style-type: none"> Tested to IEC/EN 60068-2 |
| Dimension (HxWxD) | <ul style="list-style-type: none"> 193.8 mm x 92.2 mm x 58 mm |

6 Specifications and Characteristics

Weight

- 450 g with batteries
- 400 g without batteries

Warranty

- 3 years
-

Index

A

AC 59
 accessories 3
 accuracy 58
 adapter 3
 Adjustment 37, 49, 55
 Adjustments 51
 adjustments VI, 35
 Air probe 3
 Alerts 24
 alkaline 3
 Alligator 3
 Altitude VII, 64
 Analog 6
 Annunciator 5
 auto range 7
 automatic 20
 average 18

B

Backlight 39
 backlight 7, 27
 Bar Graph 6
 Battery 2, 23, 30
 battery V, 7
 beep 27
 bracket 32
 brightness 2

C

Calibration 3, 36, 40, 56
 Overview 36
 Services 36

calibration 35
 calibrator 60
 Capacitance 2, 8, 14, 61
 Capacity 23
 capacity 2, 7
 Category 2, 64
 CD 3
 CE IV
 Certificate 3
 Characteristics 64
 characteristics 57
 Cleaning 30
 close 16
 Closed-case 36
 CMRR 64
 Coefficient 64
 Common 64
 compensation 2, 15
 Compliance 64
 compliance VII
 condensation VII
 condition 16
 Conditions VII
 Configurations 26
 configure 9
 Connections 42
 Considerations 41, 49
 container 34
 Continuity 12
 continuity 2
 Count 56
 cover 30, 33
 Crest Factor 64
 CSA IV, VII
 C-tick IV
 Current 10, 11
 current clamp 3

D

damage 3, 14
 Data 2
 Data Hold 2, 18
 Data Logging 20
 Data logging 27
 data logging 7
 DC 58
 DC Accuracy 58
 default 25
 defective 32
 Degree VII
 Dimension 64
 Diode 2, 8
 Diodes 13
 discharge 14, 30
 Display 39
 display 33

E

EMC 64
 energized 14
 Entering Adjustment Values 48
 Environment VII
 Equipotentiality III
 Errors 56
 Existing 55

F

fast-acting 8
 flammable V
 forward bias 13
 FRAGILE 34
 freeze 18

Index

Freezes 7
Frequency 12, 62
frequency 7, 27
Front Panel 4
 Adjustments 48
fumes V
functional 28
Fuse 31
fuse 8, 33

G

General 64
Grabbers 3
Guide 3

H

Hand 20
Harmonic Ratio 16, 61
Harmonic ratio 2
hazard V, 14, 30
hazardous VI
housing 33
humidity VII, 41

I

IEC VII
Immersion 3
Impedance 59
impedance 58
indoor VII
Industrial 3
Input 50
Input Connections 42
input limit 8, 10
Input-A 24

Input-mA 24
insulation III, V
Interval 20, 36
Interval Logging 21
Interval, calibration 36
Introduction 2

J

J-type 3, 27, 42

K

key features 1, 2
Keypad 6
K-type 3, 27, 42

L

LCD 33
loose 32

M

Magnetic 3
Maintenance 30
maintenance 29
manual 7, 20
Manual Logging 21
maximum 18
memory 20
minimum 18
MINMAX 2
MINMAX Recording 18
model 34
moisture VI, 30

N

NMRR 64
nominal 58
non-volatile 20
Normal 64
NULL 19
Null 2

O

open 16
Operating VII, 39, 63
option 26
optional 3
Overload 24, 59
Overvoltage VII, 2

P

Percentage 27
performance 35
polarity VI, 14, 30
Pollution VII, 2
power off 27, 28
probe 3
problems 29
Protection VII, 2

R

range 7
Recording 2
recording 7
Refresh Hold 19
Regulatory IV
Rejection 64

Relative 2, 19
 relative 15
 Removing 22
 repair VI
 Replacement 30, 31
 replacement 33
 residual 14
 Resistance 2, 8, 12
 Returning 34
 Reviewing 22
 Rotary Switch 6

S

Safety III, V, 64
 Scale 11
 scale 27
 SCAN 2, 23
 Scan 7
 Scanning 23
 Security 46
 Selecting the Adjustment Mode 48
 Sensitivity 62
 serial 34
 Service 34
 service VI
 services 29
 Setup 26, 27
 shipping 34
 Shock 64
 shock V, 14, 34
 short 8
 sinusoidal 16
 specifications 57
 stand 33
 standard 3
 Storage VII

surface probe 3
 Switch Counter 16
 Switch counter 2
 switch counter, 17
 symbols III

T

Temperature 8, 28, 60
 Test
 Considerations 40
 Equipment 38
 Test Equipment 38
 Test Leads 3
 test leads 31
 test probes V
 Thermocouple 3, 27
 thermocouple 14, 15, 42
 Tilt Stand 4
 timer 27
 tips 14, 15
 Trigger Hold 18
 Trigger hold 27
 Troubleshooting 33
 True-RMS 2
 type-K 3

U

UL IV, VII
 Using the Front Panel for Adjustments
 48

V

variation 15
 Verification 42

verification 35
 Vibration 64
 View 22
 Voltage 8, 10

W

Warm Up Period, Calibration 41
 Warning 24
 Warranty 65
 warranty 29
 WEEE IV
 Weight 65

www.agilent.com

Contact us

To obtain service, warranty or technical support assistance, contact us at the following phone numbers:

United States:

(tel) 800 829 4444 (fax) 800 829 4433

Canada:

(tel) 877 894 4414 (fax) 800 746 4866

China:

(tel) 800 810 0189 (fax) 800 820 2816

Europe:

(tel) 31 20 547 2111

Japan:

(tel) (81) 426 56 7832 (fax) (81) 426 56 7840

Korea:

(tel) (080) 769 0800 (fax) (080) 769 0900

Latin America:

(tel) (305) 269 7500

Taiwan:

(tel) 0800 047 866 (fax) 0800 286 331

Other Asia Pacific Countries:

(tel) (65) 6375 8100 (fax) (65) 6755 0042

Or visit Agilent worldwide web at:

www.agilent.com/find/assist

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2009

Printed in Malaysia

Second Edition, April 01, 2009

U1241-90003



Agilent Technologies