







Agilent U1251B and U1252B Handheld Digital Multimeter

Quick Start Guide



The following items are included with your multimeter:

- ✓ Silicone test leads  , 19 mm probes  , 4mm probes  , and alligator clips 
- ✓ Printed Quick Start Guide
- ✓ 9 V alkaline battery (for U1251B only)
- ✓ Rechargeable 7.2 V battery (for U1252B only)
- ✓ Power cord and AC adapter (for U1252B only)
- ✓ Certificate of Calibration

If anything is missing or damaged, please contact the nearest Agilent Sales Office.

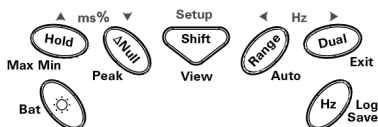
For more detailed information, please refer to the *Agilent U1251B and U1252B Handheld Digital Multimeter User's and Service Guide* on Agilent Web site (www.agilent.com/find/handheld-tools).









 


 
WARNING

Ensure the terminal connections are correct for that particular measurement selection before starting any measurement. To avoid damage to the device, do not exceed the input limit.

 


Functions and Features

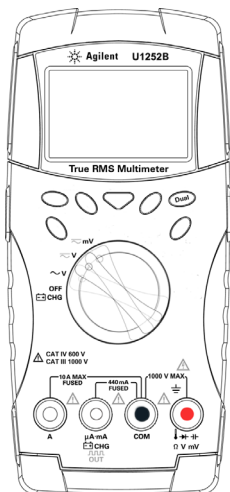


Action	Steps
Turns ON backlight	Press  .
Checks battery capacity	Press and hold  for >1 s.
Freezes the measured value	Press  .
Starts MIN/MAX/AVG recording	Press and hold  for >1 s.
Offsets the measured value	Press  .
Changes the measuring range	Press  .
Turns on auto range	Press and hold  for > 1 s.
Turns on dual display	Press  .
Starts manual data logging	Press and hold  for > 1 s.
Views the logged data	Press  for > 1 s, press ▲▼ to scroll through the logged data.
Clears the logged data	Press  for > 1 s, press  for >1 s.

Input Terminals and Overload Protection

Measurement Functions	Input Terminal	Overload Protection	
Voltage	 Ω V mV	1000 V R.M.S	
Diode		1000 V R.M.S < 0.3 A short circuit current	
Resistance			
Capacitance			
Temperature			
Current (μ A and mA)	μ A.mA	COM	440 mA/1000 V 30 kA/fast-acting fuse
Current (A)	A	COM	11 A/1000 V 30 kA/fast-acting fuse

Performing Voltage Measurements



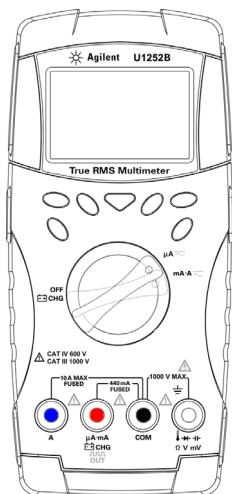
Measuring AC voltage

- 1 Set the rotary switch to $\sim V$. For $\sim V$ and $\sim mV$ mode, press **Shift** to ensure \sim is shown on the display.
- 2 Connect the red and black test leads to input terminals **V. mV (red)** and **COM (black)** respectively.
- 3 Probe the test points and read the display.
- 4 Press **Dual** to display dual measurements. Parameter can be switched consecutively.





Measuring DC voltage

- 1 Set the rotary switch to V or mV . Ensure that $---$ is shown on the display.
- 2 Connect the red and black test leads to input terminals **V. mV (red)** and **COM (black)** respectively.
- 3 Probe the test points and read the display.
- 4 Press **Dual** to display dual measurements. Parameter can be switched consecutively.



 
Performing Current Measurements



Measuring AC current

- 1 Set the rotary switch to μA  or mA . Press  to ensure  is shown on the display.
- 2 Connect the red and black test leads to input terminals μA .mA (red) and COM (black) or A (blue) and COM (black) respectively.
- 3 Probe the test points in series with the circuit and read the display.

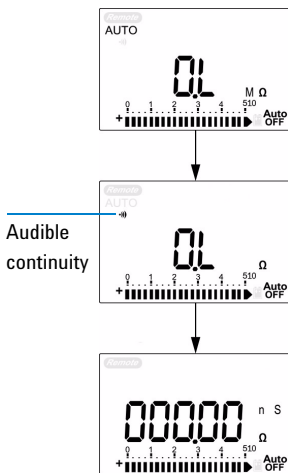
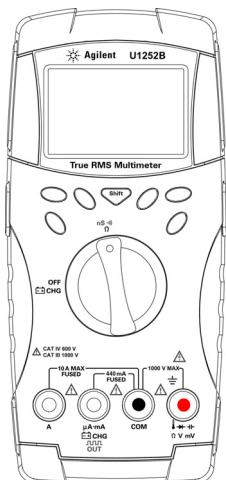
Measuring DC current


- 1 Set the rotary switch to μA  or mA . Ensure that  is shown on the display.
- 2 Connect the red and black test leads to input terminals μA .mA (red) and COM (black) or A (blue) and COM (black) respectively.
- 3 Probe the test points in series with the circuit and read the display.

CAUTION

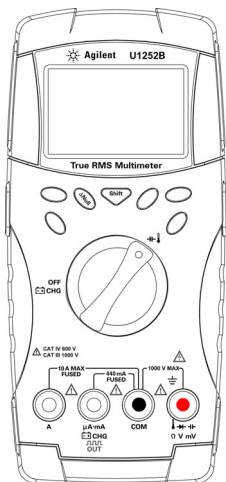
- If the current is ≤ 440 mA, connect the red and black test leads to input terminals μA .mA (red) and COM (black).
- If the current is > 440 mA, connect the red and black test leads to input terminals A (red) and COM (black).

Performing Resistance, Conductance, and Continuity Measurements


 


- 1 Set the rotary switch to $nS \rightarrow \Omega$.
- 2 Connect the red and black test leads to input terminals Ω (red) and COM (black) respectively.
- 3 Probe the test points (by shunting the resistor) and read the display.
- 4 Press  to scroll through audible continuity, conductance, and resistance tests as shown.



 
Performing Capacitance and Temperature Measurements



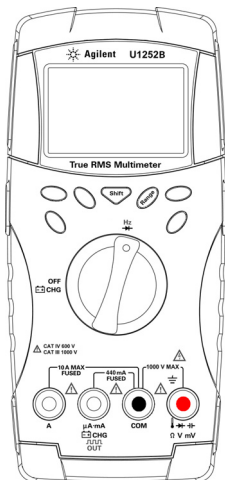
Capacitance

- 1 Set the rotary switch to .
- 2 Connect the red and black test leads to input terminals  (**red**) and **COM** (**black**) respectively.
- 3 Connect the red test lead to the positive terminal of the capacitor, and the black test lead to the negative terminal.
- 4 Read the display.

Temperature

- 1 Set the rotary switch to . Press  to select temperature measurement.
- 2 Plug the thermocouple adapter (with the thermocouple probe connected to it) into input terminals  (**red**) and **COM** (**black**).
- 3 Touch the measurement surface with the thermocouple probe.
- 4 Read the display.

Frequency and Frequency Counter Measurements



Frequency Measurement

During AC/DC voltage or AC/DC current measurements, you can measure the signal frequency by pressing **Hz** at any time.

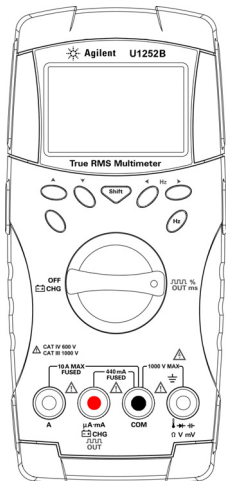
Frequency Counter Measurement



- 1 Set the rotary switch to **Hz**.
- 2 Press **Shift** to select the frequency counter (Hz) function. “—1—” on the secondary display means the input signal frequency is divided by 1. This accommodates for higher frequency range of up to 985 kHz.
- 3 Connect the red and black test leads to input terminals **V (red)** and **COM (black)** respectively.
- 4 Probe the test points and read the display.
- 5 If the reading is unstable or zero, press **Range** to select division of input signal frequency by 100. This accommodates a higher frequency range of up to 20 MHz.
- 6 The signal is out of range if the reading is still unstable after [step 5](#).

WARNING


- Use the frequency counter for low voltage applications. Never use the frequency counter on AC power line systems.
- For input more than 30 Vpp, you are required to use frequency measurement mode available under the current or voltage measurement instead of frequency counter.

Square Wave Output (for U1252B only)



 
- 1 Turn the rotary switch to  **% OUT ms**. Default display setting is 600 Hz on secondary display and 50% duty cycle on primary display.
- 2 Press ◀ or ▶ to scroll through the available frequencies (there are 28 frequencies to choose from).
- 3 Press  to select duty cycle (ms) on the primary display.
- 4 Press ▲ or ▼ to adjust the duty cycle. Duty cycle can be set for 256 steps and each step is 0.390625%. The display only indicates the best resolution with 0.001%.


NOTE

Pressing  is the same as pressing ▶.

When Charging the Battery...

CAUTION



- Do not rotate the rotary switch from  **CHG** position when charging the battery.
- Perform battery charging **only** with 7.2 V or 8.4 V NiMH rechargeable battery, 9 V size.
- Disconnect test leads from all the terminals when charging the battery.
- Ensure proper insertion of battery in the multimeter, and follow the correct polarity.

Safety Notices

CAUTION

A **CAUTION** notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in damage to the product or loss of important data. Do not proceed beyond a **CAUTION** notice until the indicated conditions are fully understood and met.

 



WARNING

A **WARNING** notice denotes a hazard. It calls attention to an operating procedure, practice, or the like that, if not correctly performed or adhered to, could result in personal injury or death. Do not proceed beyond a **WARNING** notice until the indicated conditions are fully understood and met.

Safety Information

This meter is safety-certified in compliance with EN/IEC 61010-1:2001, UL 61010-1 Second Edition and CAN/CSA 22.2 61010-1 Second Edition, CAT III 1000 V/CAT IV 600 V Overvoltage Protection, Pollution Degree II. Use with standard or compatible test probes.

Safety Symbols

	Earth (ground) terminal
	Equipment protected throughout by double insulation or reinforced insulation
	Caution, risk of electric shock
	Caution, risk of danger (refer to the instrument manual for specific Warning or Caution information)
CAT III 1000 V	Category III 1000 V overvoltage protection
CAT IV 600 V	Category IV 600 V overvoltage protection

**For further safety information details, refer to the
Agilent U1251B and U1252B Handheld Digital Multimeter
User's and Service Guide.**

Printed in Malaysia



U1251-90046

First Edition, December 1, 2009
© Agilent Technologies, Inc., 2009



Agilent Technologies