S E R V I C E N O T E

SUPERSEDES: NONE

HP 4156A Precision Semiconductor Parameter Analyzer

Serial Numbers: JP10A00368 / JP10A00639

04155-66501/04155-69501 CPU Assembly

Replacing CPU board ROMs to fix firmware defects

Duplicate Service Notes:

4155A-07 Serial Numbers: JP10A00377 / JP10A00648 4156A-08 Serial Numbers: JP10A00368 / JP10A00639

To be Performed by: HP-qualified personnel

Parts Required:

HP P/N QTY Description

04155-65411 1 ROM Upgrade Kit 1.04

Continued

DATE: June 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ HP LOCATION	SERVICE RETURN USED RETURN PARTS: SCRAP SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	HP RESPONSIBLE UNTIL:	
AUTHOR: MO	ENTITY: 3300	ADDITIONAL INFORMATION:	

© 1996 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 Service Note 4156A-08

Situation:

The firmware revision 1.04 of the HP 4155A/4156A was released. The firmware 1.04 fixes four defects found in the firmware revision 1.02. It also includes several improvements. This firmware update can be implemented in the installed base.

The ADC ROM revision did not change. (Current revision is 1.00.)

The following are the items fixed by revision 1.04:

- In the part of the model of Printer/Plotter, headers aren't printed correctly by using quarterly print.
- · Date cannot sometimes be changed by HP-IB.
- Help information of File Name area of Graph Plot isn't correct.
- In SMU Vpulse Mode, Width sometimes lags 0.1ms.

Solution/Action:

Replace the following three ROMs on the 04155-66501/04155-69501 CPU Assembly:

ROM	New Rev (1.04) P/N	
HOSTC 1/2	04155-85191	
HOSTC 2/2	04155-85192	
SMUC	04155-85195	

The ROM upgrade kit (04155-65411) contains three new revision ROMs plus manual supplement (04155-90906), which explains the new functions available on the firmware 1.04. The ROMs are identical for the HP 4155A and HP 4156A. For replacement procedure, see "Replacement Procedures" in the HP 4155A/4156A Service Manual (HP P/N 04155-90600). To do this replacement, HP 41501A SMU/PGU Expander for the HP 4155A/4156A is not necessary.