INFORMATION ONLY - DOES NOT COMMUNICATE A MODIFICATION OR SAFETY CONDITION

SERVICE NOTE

Supersedes: 4279A-03

4279A-03A

Agilent 4279A 1 MHz C-V Meter

Serial Numbers: 0000J00000 / 9999J99999

New Part Numbers for CPU Board and EEPROM

Parts Required: See Solution / Action

To Be Performed By: Agilent-Qualified Personnel

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: H.O PRODUCT LINE: WN

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2003 PRINTED IN U.S.A.





February 10, 2003

Page 2 of 2

Situation:

The CPU board used in the 4279A was obsoleted and replaced with a new CPU board. The old CPU board is not available any more. When the CPU board is defective, use the new replacement CPU board (P/N:04278-66667 or 04278-69667).

New EEPROM compatible with the new CPU board is also set up. The new EEPROM can be used for the new CPU board only.

Solution/Action:

When replacing the CPU board or EEPROM, use the replacement parts specified below:

1. Parts required when replacing the CPU board or EEPROM

Part Number	Qty	Description	
04278-66667 ¹	1	4279A A7 CPU board without ROM	
04278-69667	1	4279A A7 CPU board without ROM (Exchange)	
5183-4149	2	EEPROM	

2. Compatibility between the CPU boards and EEPROMs

Description	Old Part Number	New Part Number
A7 CPU board without ROM	04278-66657 ²	04278-66667 ³
A7 CPU board without ROM (Exchange)	04278-69657 ⁴	04278-69667 ³
EEPROM	1818-5719 ⁵	5183-4149 ⁶

3. Post repair procedure

The following adjustment is required after the EEPROM is replaced.

• UPDATING CALIBRATION DATA

¹ The part number 04279-66567 is an original A7 CPU board.

² Without ROM SET(04279-86103) / With 2 EEPROMs(1818-5719)

³ Without ROM SET(04279-86103) / With 2 EEPROMs(5183-4149)

⁴ Without ROM SET(04279-86103) / Without 2 EEPROMs(1818-5719)

 $^{^{5}}$ Can be distinguished with the manufacturer part number HN58V65AP-10 on the top of the EEPROM and can not be used with the 04278-66667 or 04278-69667

⁶ Can be distinguished with the manufacturer part number HN58V66AP-10 on the top of the EEPROM and can not be used with the 04278-66657 or 04278-69657