

S E R V I C E N O T E

SUPERSEDES: None

3488A Switch/Control Unit

Serial Numbers: 0000A00000 / 9999Z99999

Wrong standoffs installed on plug-in module shields

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

Part No.	Description
03488-00603	Shield, component side

Situation:

A number of component-side shields for the 3488A plug-in modules were supplied with incorrect standoffs. It is not possible to install more than one module in the 3488A slots because of the increased top-to-bottom dimension. The space between the bottom of the shield and the component side of the PC assembly should measure approximately 13mm. the faulty standoffs will measure approximately 15mm.

Solution/Action:

The problem is corrected by replacing the component-side shield of the plug-in module.

DATE: October 1995

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour		
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input checked="" type="checkbox"/> ON-SITE <input type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: October 1997			
AUTHOR: DMT	ENTITY: 0900	ADDITIONAL INFORMATION:			