

S E R V I C E N O T E

SUPERSEDES: None

35670A Digital Signal Analyzer

Serial Numbers: 0000A00000 to 3337A00600

Notification of incompatibility with new C1405B Vectra Keyboards**Parts Required:**

Part No.	Description
35670-66510	A10 Rear Panel PC Assembly

Situation:

All instruments with the above listed serial numbers are incompatible with the C1405B Vectra keyboards. The C1405B keyboard replaces the original C1405A for which the 35670A was designed. The incompatibility is due to different timing and buffer requirements of the newer keyboard. This may lead to instrument lockup during IBASIC Programming. This incompatibility was corrected and implemented in Serial Prefix 3340A and above.

Solution/Action:

The solution is to replace the Rear Panel A10 assembly with a new one, Date Code 3340 or higher. Refer to the disassembly instructions in the 35670A Service Guide.

Note the A10 replacement is only necessary if the customer buys a C1405B keyboard.

DATE: 20 October 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR:

MJL

ENTITY:

A100

ADDITIONAL INFORMATION:

C1405B Vectra Keyboard compatibility