5342A-60

S	Е	R	V	I	С	Е	Ν	0	Т	Е
						ę	SUPERSEDE	S: None		
534	2A Mi	icroway	ve Cou	nter						
Serial Numbers: 1720A00101 / 2941A13477 without Option 001										
A18 Modification when A24Y1 changes from 0960-0394 to 0960-0612										
Duplicate Service Notes: 5343A-32 5342A-60										
Situ	ation:									
not b Mod repla	been avai el 5342 aced with	ilable sind A and 534 In the new	ce 1992. I3A provi er version	A substided that n. The r	titute cry at the A1 newer ve	stal, 0960-0 8 Time Bas rsion board	umber 0960-02 0612, is availab se Buffer Board is board mfg since late 1991	ole. It will d is modif date code	work in	
Solu	tion/Act	ion:								
A18	board, o		w 05342-		-		612. If your ur make the follo			
								C	Continued	

DATE: 27 August 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: Labor 1.0 Hour			
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT SEE TEXT			
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 27 August 1995			
AUTHOR: CF	ENTITY: 0200	ADDITIONAL INFORMATION:			

© 1993 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



1. Remove the following parts:

A18	R2	3.48K 1% .05W	0698-7249
A18	R4	3.48K 1% .05W	0698-7249
A18	R5	100-ohm 5% .05W	0698-3113
A18	U1	74S74 F/F	1820-0693
A18	U4	74128 DVR	1820-1074
A18	U5	74132 STG	1820-1056

2. Replace the parts removed in Step 1 with the following parts:

A18	R2	5.11K 1% .05W	0698-7253
A18	R4	5.11K 1% .05W	0698-7249
A18	R5	100-ohm 1% .05W	0698-7212
A18	U1	74LS74 F/F	1820-1112
A18	U4	74ALS28 DVR	1820-3479
A18	U5	74LS132 STG	1820-1425