5343A-32

S	Е	R	V		С	Е	Ν	0	Т	Е
							SUPERSEDE	S: None		
5343A Microwave Counter										
Serial Numbers: 2014A00101 / 3020A02990 without Option 001										
A18 Modification when A24Y1 changes from 0960-0394 to 0960-0612										
<b>Duplicate Service Notes:</b> 5343A-32 5342A-60										
Situation:										
not l Mod repla	been avai lel 5342 aced with	ilable sind A and 534 In the new of the new	ce 1992. 3A provi er version	A subst ided that n. The 1	itute cry at the A1 newer ve	stal, 0960- 8 Time Ba rsion boar	number 0960-03 0612, is availal ase Buffer Boar d is board mfg since late 1991	ole. It will d is modif date code	work in fied or	
Solu	tion/Act	ion:								
If A24Y1 is defective and must be replaced, order 0960-0612. If your unit has the older A18 board, order a new 05342-60048 board assembly, or make the following changes to your older A18 board:										
								C	Continued	

DATE: 27 August 1993

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:						
MODIFICATION RECOMMENDED						
ACTION CATEGORY:	<ul> <li>IMMEDIATELY</li> <li>ON SPECIFIED FAILURE</li> <li>AGREEABLE TIME</li> </ul>	STANDARDS: Labor 1.0 Hour				
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE    RETURN USED    RETURN INVENTORY:    SCRAP    PARTS:    SCRAP    SEE TEXT    SEE TEXT				
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 27 August 1995				
AUTHOR: CF	ENTITY: 0200	ADDITIONAL INFORMATION:				

© 1993 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



1. Remove the following parts:

A18	R2	3.48K 1% .05W	0698-7249
A18	R4	3.48K 1% .05W	0698-7249
A18	R5	100-ohm 5% .05W	0698-3113
A18	U1	74S74 F/F	1820-0693
A18	U4	74128 DVR	1820-1074
A18	U5	74132 STG	1820-1056

2. Replace the parts removed in Step 1 with the following parts:

A18	R2	5.11K 1% .05W	0698-7253
A18	R4	5.11K 1% .05W	0698-7253
A18	R5	100-ohm 1% .05W	0698-7212
A18	U1	74LS74 F/F	1820-1112
A18	U4	74ALS28 DVR	1820-3479
A18	U5	74LS132 STG	1820-1425