

S E R V I C E N O T E

SUPERSEDES: None

6050A Multiple Input Electronic Load Mainframe

Serial Numbers: 0000A00000 / 3312A02483

High CCrms noise in Load Module Installed in slot 2 and/or 5

Duplicate Service Notes: None

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

5060-3538 Fan Assembly consisting of:

P/N	Description	Qty.
3160-0364	Fan-tubeaxial	1
06050-00015	Shield-steel	1
06050-80017	Adhesive-foam	1

Situation:

Magnetic coupling between fan motor and load module may cause load module CCrms noise to be above specified limit when the 6050A cooling fans B1 and/or B2 are operating at low fan speeds.

Solution/Action:

Install steel shield part number 06050-00015 on B1 and B2 fan motor hub using adhesive foam part number 06050-80017. Install shield on center of fan motor hub between fan motor and module. Replace a defective B1/B2 cooling fan with fan assembly 5060-3538.

DATE: 14 June 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 1.0 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: BH	ENTITY: 2100	AGILENT RESPONSIBLE UNTIL: 14 June 1995	
		ADDITIONAL INFORMATION:	