

S E R V I C E N O T E

SUPERSEDES: 6011A-08

**6011A System Autoranging DC Power Supply**

**Serial Numbers:** 0000A00000 / 9999A99999

**A1U1 Rectifier Bridge Replacement**

**Duplicate Service Notes:**

- 6010A-07A
- 6011A-08A
- 6012B-06A
- 6015A-04A
- 6030A-14A
- 6031A-06A
- 6032A-15A
- 6035A-05A

**To Be Performed By:** Agilent-Qualified Personnel

**Situation:**

A1U1 Rectifier Discontinued

**Solution/Action:**

A1U1 part number 1906-0218 has been discontinued, no longer manufactured, and has been replaced by part number 1906-0389. The new part 1906-0389 is not mechanically interchangeable with part number 1906-0218. The A1 board has been modified to accept either part.

*Continued*

DATE: 28 September 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
<b>INFORMATION ONLY</b>		
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
BH	2100	

Replacement should be as follows. All A1 assemblies part number 06011-60021 or 06011-61021 with Revision letter A, B, or C use part number 1906-0218 for A1U1. All A1 assemblies part number 06011-60021 or 06011-61021 with Revision letter D or greater use part number 1906-0389 for A1U1. Although Rev. D boards can use either part 1906-0218 or 1906-0389 it is recommended that only part 1906-0389 be used in Rev. D boards. The A1 board revision letter is printed on the top right rear of the board next to the J5 ribbon cable.