

S E R V I C E N O T E

SUPERSEDES: 6012B-06

6012B System Autoranging DC Power Supply**Serial Numbers:** 0000A00000 / 9999A99999**A1U1 Rectifier Bridge Replacement****Duplicate Service Notes:**

6010A-07A
 6011A-08A
 6012B-06A
 6015A-04A
 6030A-14A
 6031A-06A
 6032A-15A
 6035A-05A

To Be Performed By: Agilent-Qualified Personnel**Situation:**

A1U1 Rectifier Discontinued

Solution/Action:

A1U1 part number 1906-0218 has been discontinued, no longer manufactured, and has been replaced by part number 1906-0389. The new part 1906-0389 is not mechanically interchangeable with part number 1906-0218. The A1 board has been modified to accept either part.

Continued

DATE: 28 September 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: BH	ENTITY: 2100	ADDITIONAL INFORMATION:
--------------------------	----------------------------	--------------------------------

Replacement should be as follows. All A1 assemblies part number 06032-60021 or 06032-61021 with Revision letter A, B, C or D use part number 1906-0218 for A1U1. All A1 assemblies part number 06032-60021 or 06032-61021 with Revision letter E or greater use part number 1906-0389 for A1U1. Although Rev. E boards can use either part 1906-0218 or 1906-0389 it is recommended that only part 1906-0389 be used in Rev. E boards. The A1 board revision letter is printed on the top right rear of the board next to the J5 ribbon cable.