

## S E R V I C E N O T E

SUPERSEDES: 6015A-04

**6015A System Autoranging DC Power Supply****Serial Numbers:** 0000A00000 / 9999A99999**A1U1 Rectifier Bridge Replacement****Duplicate Service Notes:**

6010A-07A  
 6011A-08A  
 6012B-06A  
 6015A-04A  
 6030A-14A  
 6031A-06A  
 6032A-15A  
 6035A-05A

**To Be Performed By:** Agilent-Qualified Personnel**Situation:**

A1U1 Rectifier Discontinued

**Solution/Action:**

A1U1 part number 1906-0218 has been discontinued, no longer manufactured, and has been replaced by part number 1906-0389. The new part 1906-0389 is not mechanically interchangeable with part number 1906-0218. The A1 board has been modified to accept either part.

*Continued*

DATE: 28 September 1992

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

**INFORMATION ONLY**

<b>AUTHOR:</b>  BH	<b>ENTITY:</b>  2100	<b>ADDITIONAL INFORMATION:</b>
--------------------------	----------------------------	--------------------------------

Replacement should be as follows. All A1 assemblies part number 06030-60027 or 5060-3145 with Revision letter A, B, or C use part number 1906-0218 for A1U1. All A1 assemblies part number 06030-60027 or 5060-3145 with Revision letter D or greater use part number 1906-0389 for A1U1. Although Rev. D boards can use either part 1906-0218 or 1906-0389 it is recommended that only part 1906-0389 be used in Rev. D boards. The A1 board revision letter is printed on the top right rear of the board next to the J5 ribbon cable.