

S E R V I C E N O T E

SUPERSEDES: None

**66102A DC Power Supply Module**

**Serial Numbers:** 0000A00000 / 3421A01449

**Status reported before Delay**

**Duplicate Service Notes:**

- 66101A-03: Serials 0000A00000 / 3421A01252
- 66102A-02: Serials 0000A00000 / 3421A01449
- 66103A-02: Serials 0000A00000 / 3421A01330
- 66104A-03: Serials 0000A00000 / 3421A00691
- 66105A-03: Serials 0000A00000 / 3421A00372
- 66106A-02: Serials 0000A00000 / 3421A00339

**To Be Performed By:** Agilent-Qualified Personnel or Customer

**Parts Required:** 5080-2235, ROM, Rev A.00.06

**Situation:**

ROM revisions A.00.03 and before had a firmware bug that would sometimes allow the Status to be reported before the Delay time ran down. This situation would occur about 1% to 3% of the time.

**Solution/Action:**

Remove the cover and replace the ROM, U2 with revision A.00.06 or higher. This does not affect the alignment of the module so only operation verification is required.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: DF	ENTITY: 2100	AGILENT RESPONSIBLE UNTIL: Product's Support Life	
		ADDITIONAL INFORMATION:	

