

S E R V I C E N O T E

SUPERSEDES: NONE

**6574A General Purpose Power Supply**

Serial Number: see below

**Improper Crimps on Output Transformer & Choke**

**Duplicate Service Notes:**

6574A-03      3634A00351,3634A00522,3634A00526, US36340137/ S36340294  
 6575A-04      US36340132 / US36340145  
 6674A-05      US36370248,US36370721,US36370755, US36370757,US36370759,  
                   US36370770 / US36370876  
 6675A-06      US36370219,US36370262,US36370283, US36370302 / US36370345

**To Be Performed By:** Agilent-Qualified Personnel

**Parts Required:**

6674A,	T900	p/n 9100-4910,	L900 p/n 06674-80002
6675A,	T900	p/n 9100-4944,	L900 p/n 06675-80003
6674AJ06	T900	p/n 9100-4976,	L900 p/n 06674-80005
6675AJ11	T900	p/n 9100-5364,	L900 p/n 06675-80009
6675AJ06	T900	p/n 9100-5053,	L900 p/n 06675-80005
6674AJ07			L900 p/n 06674-80006
6675AJ14			L900 p/n 06675-80010

*Continued*

DATE: March 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input checked="" type="checkbox"/> IMMEDIATELY <input type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 2.0 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: BM	ENTITY: 2100	AGILENT RESPONSIBLE UNTIL: End of Product Support Life	
		ADDITIONAL INFORMATION: This is a multi Model No. Service Note	

**Situation:**

Units with Output Transformer, T900 & Choke L900 with date codes 90121 and 90321 could have been improperly crimped. The date codes are printed in white on top of the devices. This could result in intermittent output, arcing or buzzing Sounds, unit resets itself, high ripple.

**Solution / Action:**

Units returned for any reason with the specified serial numbers should have their date codes checked, and replace the transformer-T900 and choke-L900 if they have the affected date codes (90121;90321).