S E R V I C E N O T E

SUPERSEDES: NONE

8164A Lightwave Measurement System

Serial Numbers: potential units from DE38700101 to DE38701400 manufactured before May,31,2000

8164A Membrane Circuit

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N Description Quantity

08164-26501 Membrane Circuit 1

Situation:

Occasionally the system will hangup while booting, it will not recognize modules. An error message is displayed like "please update mainframe to newest firmware" although the update was already done. This is possibly due to an intermittent shortage on the membrane circuit (key foil).

Solution / Action:

Test if a "good" membrane circuit is installed: The system shall always boot without the problem listed above. In case the system is not able to boot, the membrane circuit has to be replaced. Good parts are available from ATLS.

DATE: July 2000

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY☐ ON SPECIFIED FAILURE☐ AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☐ SERVICE CENTER	SERVICE ☐ RETURN USED ☐ RETURN INVENTORY: ☐ SCRAP PARTS: ■ SCRAP SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: May 2003
AUTHOR: VE	ENTITY: OCMD	ADDITIONAL INFORMATION:

© 2000 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

