87510A-11

S	Е	R	V	T	С	Е	Ν	0	Т	Е
							SUPERSEDI	ES: None		
875	10A Ga	ain-Pha	ase Ai	nalyzer						
Seria	l Numbo	ers: 0000	J00000) / 3240J0	0288					
no p	oicture	on the	displa				CRT failure w	hich lea	ads to	
	s Requir	-	e							
Part	-	Qty.	Ľ	Descriptio	n					
1400	-0611	1	C	Cable Clar	np					
8751	0-61646	1	F	latcable						
The f	(p/n 875						eut off by the ed e the flatcable is			
								C	Continued	,
							DATE: 14 Jur	ne 1994		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:								
	MODIFICATION	RECOMMENDED						
ACTION CATEGORY:	 ■ IMMEDIATELY ■ ON SPECIFIED FAILURE ■ AGREEABLE TIME 	STANDARDS: Labor 1.0 Hour						
LOCATION CATEGORY:	 CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER 	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT						
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: June 1996						
AUTHOR: KI	ENTITY: 3355	ADDITIONAL INFORMATION:						

© 1994 AGILENT TECHNOLOGIES
PRINTED IN U.S.A.




Solution/Action:

If the flatcable is crushed then replace the flatcable with a new one. Fix the cable to the CRT assembly with a cable clamp regardless of the degree of flatcable deterioration.

Procedure:

- 1. Disconnect the power cable from the 87510A.
- 2. Remove the top cover from the 87510A.
- 3. Remove the twelve screws which fasten the shield plate over the A51 board and the CRT, and remove the shield plate.
- 4. Check carefully if the flatcable (CRT -A51) is crushed by the shield plate and A51 board. If it is crushed or damaged then replace it with a new one (p/n 87510-61646).
- 5. Regardless of the degree of flatcable degradation, fasten the flatcable in place with the Cable Clamp (p/n 1400-0611) so that the edges of the shield plate (p/n 87510-64915) and the A51 board do not pinch the flatcable. (Refer to Figure 1).
- 6. Install the shield plate over the A51 board and the CRT.
- 7. Turn the 87510A ON and confirm the "POWER ON TEST FAILED" message is NOT displayed.
- 8. Turn the 87510A OFF.
- 9. Reinstall the top cover on the 87510A.

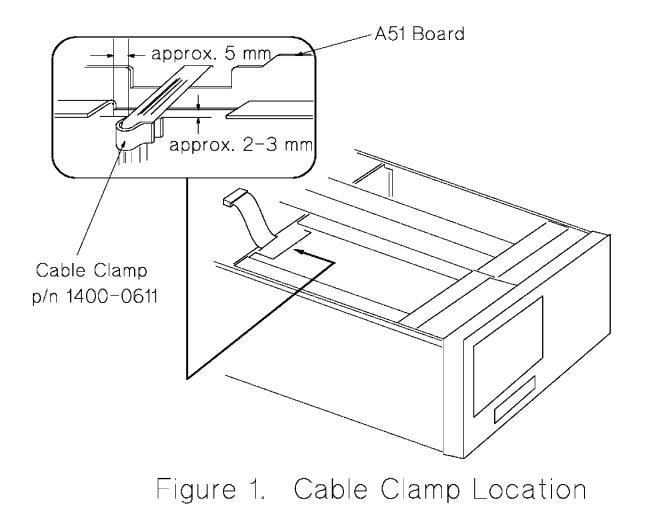

Page 3