Installation and Quick Start Guide

Agilent Technologies PNA Series RF Network Analyzers E8356A, E8357A, and E8358A



Manufacturing Part Number: E8356-90001
Printed in USA
Print Date: January 2001

Supersedes Print Date: November 2000

Notice

The information contained in this document is subject to change without notice.

Agilent Technologies makes no warranty of any kind with regard to this material, including but not limited to, the implied warranties of merchantability and fitness for a particular purpose. Agilent Technologies shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

[©] Copyright 2000, 2001 Agilent Technologies, Inc.

Certification

Agilent Technologies certifies that this product met its published specifications at the time of shipment from the factory. Agilent Technologies further certifies that its calibration measurements are traceable to the United States National Institute of Standards and Technology, to the extent allowed by the Institute's calibration facility, and to the calibration facilities of other International Standards Organization members.

Regulatory and Warranty Information

The regulatory and warranty information is located in Chapter 5, "Safety and Regulatory Information."

Assistance

Product maintenance agreements and other customer assistance agreements are available for Agilent Technologies products. For any assistance, contact your nearest Agilent Technologies sales or service office. See Table 5-1 on page 5-4 for the nearest office.

Safety Notes

The following safety notes are used throughout this manual. Familiarize yourself with each of the notes and its meaning before operating this instrument. Additional safety information is located in Chapter 5, "Safety and Regulatory Information."

WARNING	Warning denotes a hazard. It calls attention to a procedure which, if not correctly performed or adhered to, could result in injury or loss of life. Do not proceed beyond a warning note until the indicated conditions are fully understood and met.	
CAUTION	Caution denotes a hazard. It calls attention to a procedure that, if not correctly performed or adhered to, would result in damage to or destruction of the instrument. Do not proceed beyond a caution sign until the indicated conditions are fully understood and met.	

Documentation Map



The *Installation and Quick Start Guide* provides procedures for installing, configuring, and verifying the operation of the analyzer. It also will help you familiarize yourself with the basic operation of the analyzer.



The **CD-ROM** provides the *Installation and Quick Start Guide*, the *Service Guide*, and the online Network Analyzer Help in PDF format for viewing or printing from a PC. It also provides the Network Analyzer Product Overview multimedia presentation and the online Network Analyzer Help in formats that can be used on your PC.



The optional *Service Guide* provides information on troubleshooting and servicing your analyzer.



The optional printed version of the online Network Analyzer Help provides the Help system in printed form.

How to Use This Guide

This guide uses the following conventions:

Front Panel Key This represents a key physically located on the

instrument.

Windows Interface This represents window titles, menu items, or dialog box

selections in the Network Analyzer or the Microsoft® Windows® 2000 Professional personal computer operating

system and applications.

Screen Text This represents text displayed on the instrument's screen.

Microsoft® is a U.S. registered trademark of Microsoft Corporation. Windows® and MS Windows® are U.S. registered trademarks of Microsoft Corporation.

Contents

1.	Installing Your Analyzer		
	STEP 1. Check the Shipment1-		
	STEP 2. Meet Electrical and Environmental Requirements		
	STEP 3. Set Up the Analyzer for Use on a Bench Top		
	or in an Equipment Rack		
	To Set Up the Analyzer for Bench Top Use		
	To Set Up the Analyzer for Use in an Equipment Rack		
	(Option 1CP - Rack Mounting with Handles)		
	To Set Up the Analyzer for Use in an Equipment Rack		
	(Option 1CM - Rack Mounting without Handles)		
	STEP 4. Connect the Accessories to the Analyzer1-10		
	To Connect the Accessories Using the Basic Setup		
	(Without a USB Hub)		
	To Connect the Accessories Using the Complete Setup		
	(With a USB Hub)1-19		
	STEP 5. Start Up the Analyzer for the First Time		
	STEP 6. Perform Additional Administrative Tasks		
	To Create an Emergency Repair Disk		
	To Set Up Additional Network Analyzer Users		
	STEP 7. Run the Operator's Check		
	2122 · · · · · · · · · · · · · · · · · ·		
9	Becoming Familiar with Your Analyzer		
۵.	Front Panel		
	Display		
	Keypad 2-1 Rear Panel 2-1		
	Redi I dilei		
9	Getting Started with Measurements		
3.	Making Basic Measurements using a Mouse and Keyboard3-		
	Set Up the Measurement		
	Calibrate the Setup		
	Display a Second Window with Two Measurement Traces		
	Display Multiple Channels in a Window		
	Display a Third Window with a Different Format		
	Making Basic Measurements using the Front Panel Keypad		
	Set Up the Measurement		
	Calibrate the Setup		
	Display a Second Window with Two Measurement Traces		
	Display Multiple Channels in a Window		
	Display a Third Window with a Different Format		
	December Familian with Halm		
4.	Becoming Familiar with Help Notwork Analysis Product Overview		
	Network Analyzer Product Overview		
	Network Analyzer Help		
	Using the Help Home Page to Find Information4-		
	Using the Index (Keyword Search) to Find Information		
	Using Contents to Find Information		
	Using the Glossary to Find Information		

Contents

	Using the Context-sensitive Help to Find Information	4-12
	Network Analyzer Help on the Web	4-13
5.	Safety and Regulatory Information	
	General Information	. 5-3
	Maintenance	. 5-3
	Assistance	. 5-3
	Shipment for Service	
	Safety Symbols	
	General Safety Considerations	
	Safety Earth Ground	
	Before Applying Power	
	Servicing	
	Regulatory Information	
	Instructions for Use	
	Instrument Markings	
	Declaration of Conformity	
	Compliance with German Noise Requirements	

1 Installing Your Analyzer

This chapter shows you how to install your PNA-series network analyzer and confirm the correct operation. There are six major steps to installing the analyzer and confirming its operation. Each of these steps is listed below.


- "STEP 1. Check the Shipment" on page 1-3
- "STEP 2. Meet Electrical and Environmental Requirements" on page 1-6
- "STEP 3. Set Up the Analyzer for Use on a Bench Top or in an Equipment Rack" on page 1-7
- "STEP 4. Connect the Accessories to the Analyzer" on page 1-16
- "STEP 5. Start Up the Analyzer for the First Time" on page 1-23
- "STEP 6. Perform Additional Administrative Tasks" on page 1-31
- "STEP 7. Run the Operator's Check" on page 1-45

1-2 Chapter 1


STEP 1. Check the Shipment

1. Unpack the contents of the shipping container.

WARNING The network analyzer is heavy. Use proper lifting techniques.

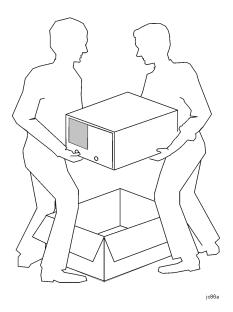

2. Carefully inspect the analyzer to make sure that it was not damaged during shipment.

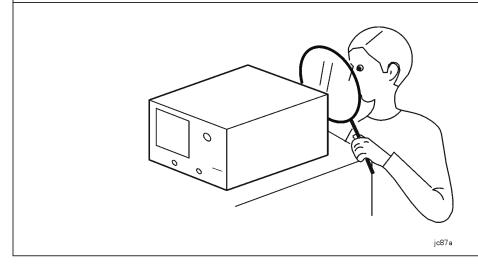


NOTE

If your analyzer was damaged during shipment, contact your nearest Agilent Technologies office or sales representative. A list of Agilent Technologies sales and service offices is provided in Table 5-1 on page 5-4.

3. Verify that the following accessories have been included with the analyzer. jc88a **Item Number Part Number Part Description** 1 E8356-90001 Installation and Quick Start Guide 2 E8356-10001 PNA Series RF Network Analyzer Documentation CD-ROM **AC Power Cord** 3 Unique to country 1150-7788 **USB** Keyboard 4 5 1253-4226 Parallel Port Adapter 6 1150-1199 **USB Mouse** 7 5063-9229 Front Handle Kit

1-4 Chapter 1

4. If you ordered any of the following options, verify that these accessories were included in the shipment. *Note that if you ordered Option 1CM or 1CP, these are shipped in a separate container.*

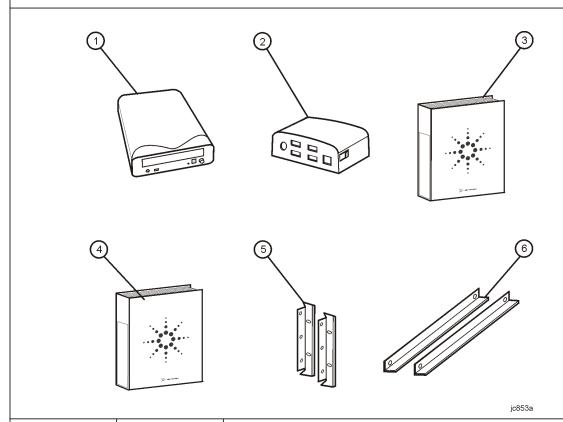

Item Number	Option Number	Part Description
1	AM8	Read/Write CD-ROM Drive
2	B30	USB Hub
3	0BW	Service Guide
4	AVK	Printed Version of Help – English Language
	ABF	Printed Version of Help – French Language
	ABJ	Printed Version of Help – Japanese Language
	ABE	Printed Version of Help – Spanish Language
	ABD	Printed Version of Help – German Language
5	1CM	Rack Mount Flange Kit (For use without handles)
6		Rack Mount Rail Set
5	1CP	Rack Mount Flange Kit (For use with handles)
6		Rack Mount Rail Set

STEP 2. Meet Electrical and Environmental Requirements

1. Ensure the available AC power source meets the following requirements:

2. Ensure the the following

2. Ensure the operating environment meets the following requirements:

CAUTION

This instrument has autoranging line voltage input. Be sure the supply voltage is within the specified range.

The specified range for the power requirements is:

- 90 132 V_{AC}
- 48 66 Hz / 400 Hz (single phase)
- or -
- 198 264 V_{AC}
- 48 66 Hz (single phase)


The instrument power consumption is 600 VA maximum.

- 0 to 40 °C
- 5% to 95% relative humidity at 40 °C (non-condensing)
- 0 to 4,500 meters (0 to 14,760 feet) altitude

NOTE

Some analyzer performance parameters are specified for 25 °C. Later, you can refer to the Help system for the complete specifications.

3. Verify that the AC power cable is not damaged, and that the power-source outlet provides a protective earth contact.

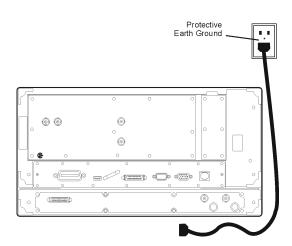

CAUTION

Always use the three-prong AC power cord supplied with this product. Failure to ensure adequate earth grounding by not using this cord may cause product damage.

1-6 Chapter 1

STEP 3. Set Up the Analyzer for Use on a Bench Top or in an Equipment Rack

The analyzer can be set up to be used on a bench top or in an equipment rack. This step guides you through setting up the analyzer for use in both situations. Furthermore, when installing the analyzer in an equipment rack, the analyzer can be set up with handles (option 1CP) or without handles (option 1CM).

In all installations, consider the following ventilation requirements when deciding where to set up your analyzer.

CAUTION

Ventilation Requirements: When installing the product in a cabinet, the convection into and out of the product must not be restricted. The ambient temperature (outside the cabinet) must be less than the maximum operating temperature of the instrument by 4 °C for every 100 watts dissipated in the cabinet. If the total power dissipated in the cabinet is greater than 800 watts, then forced convection must be used.

Refer to the section, listed below, that applies to your installation.

- **For bench top setup**, continue with "To Set Up the Analyzer for Bench Top Use" on page 1-8.
- For equipment rack installation with handles, continue with "To Set Up the Analyzer for Use in an Equipment Rack (Option 1CP Rack Mounting with Handles)" on page 1-10.
- For equipment rack installation without handles, continue with "To Set Up the Analyzer for Use in an Equipment Rack (Option 1CM Rack Mounting without Handles)" on page 1-13.


To Set Up the Analyzer for Bench Top Use

When you set up the analyzer for bench top use, you will affix the handles to the analyzer.

1. Ensure complete.	that the front handle kit is	2. Remove the trim strips from the analyzer. Use a screwdriver to peel up the corner. Then, pull the trim away from the analyzer.
• 2 Hand	Гrim Strips (self-adhesive)	qg630d
	he handles to the sides of the Use three screws for each handle.	4. Place the new trim strip over the screws on the handles.
	at time.	qg632c
WARNING	If an instrument handle is damaged, you should replace it immediately. Damaged handles can break while you are moving or lifting the instrument and cause personal injury or damage to the instrument.	

1-8 Chapter 1

5. Place the instrument on the bench making sure that there is *at least four inches* of clearance on the sides and back of the analyzer for adequate ventilation.

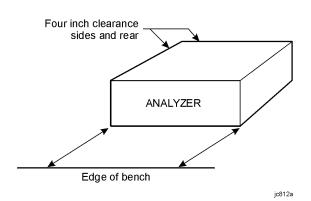

CAUTION

Consider the ventilation requirement described in "STEP 3. Set Up the Analyzer for Use on a Bench Top or in an Equipment Rack" on page 1-7 when selecting the location of your analyzer.

6. Continue with "STEP 4. Connect the Accessories to the Analyzer" on page 1-16.



qg646d

To Set Up the Analyzer for Use in an Equipment Rack (Option 1CP - Rack Mounting with Handles)

When you set up the analyzer for use in an equipment rack, you will install the rack mount rail set in the rack to support the weight of the analyzer. Affix the rack mount flanges to the analyzer, and secure the analyzer to the equipment rack.

1. Ensure that the front handle kit, the rack mount flange kit, and the rack mount rail set are complete.

Handle Kit Contents

• 6 Screws

- 2 Side Trim Strip
- 2 Handles
- Installation Instructions

Flange Kit Contents

- 6 Screws (Long)
- 4 Screws with Washers
- 4 Nuts with Metal Clips
- 2 Flanges
- Installation Instructions


Rail Set Contents


- 4 Screws
- 4 Nuts with Metal Clips
- 2 Rails
- Installation Instructions

NOTE

If any items are damaged or missing from a kit, contact the nearest Agilent sales or service office to order a replacement kit (refer to Table 5-1 on page 5-4). Items within these kits are not individually available.

- 2. Install the rack mount rails into the equipment rack using the instructions provided with the rail set. Consider the height of the analyzer is 222 mm (8.75 inches) when installing the rail set.
- **3.** Remove the trim strips from the analyzer. Use a screwdriver to peel up the corner. Then, pull the trim away from the analyzer.

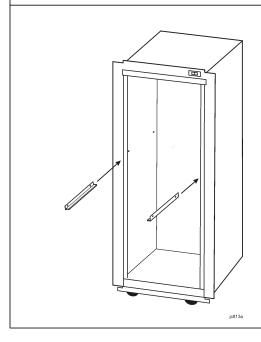


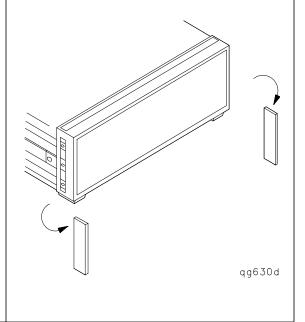


1-10 Chapter 1

4. Attach the cabinet mount flanges and the handles to the sides of the front panel, using three long screws per side. (Attach the flanges to the outside of the handles.)

5. Remove the feet before cabinet mounting the analyzer using the directions imprinted on the feet.

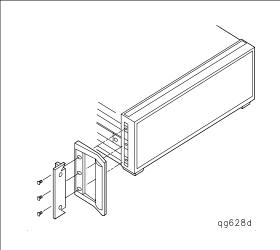

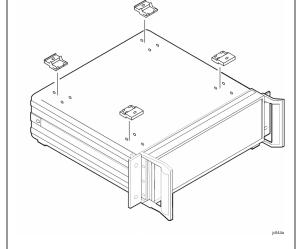


WARNING If an instrument handle is damaged, you should replace it immediately. **Damaged handles can** break while you are moving or lifting the

to the instrument.

instrument and cause personal injury or damage


6. Ensure there are at least four inches of clearance between the sides and back of the system cabinet for adequate ventilation.

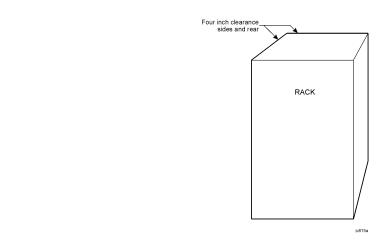


CAUTION

Consider the ventilation requirements described on page 1-7 when selecting the location of your analyzer.

7. Lift the analyzer and slide it onto the rails that you installed earlier from the front of the equipment rack. Secure the analyzer to the equipment rack using the screws with washers and metal-clipped nuts provided in the flange kit.

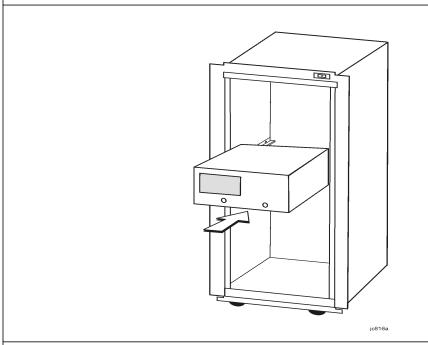

8. Continue with "STEP 4. Connect the Accessories to the Analyzer" on page 1-16.

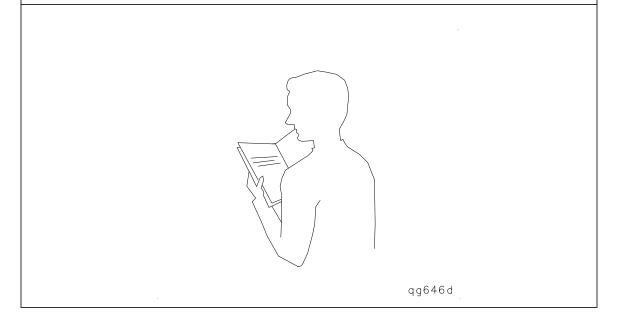

1-12 Chapter 1

To Set Up the Analyzer for Use in an Equipment Rack (Option 1CM - Rack Mounting without Handles)

When you set up the analyzer for use in an equipment rack, you will install rails in the rack to support the weight of the analyzer, affix the rack mount flanges to the analyzer, and secure the analyzer to the equipment rack.

1. Ensure that the rack mount flange kit and the rack mount rail set are complete.

Flange Kit Contents

- 6 Screws
- 4 Screws with Washers
- 4 Nuts with Metal Clips
- 2 Flanges
- Installation Instructions


Rail Set Contents

- 4 Screws
- 4 Nuts with Metal Clips
- 2 Rails
- Installation Instructions


NOTE


If any items are damaged or missing from a kit, contact the nearest Agilent sales or service office to order a replacement kit (refer to Table 5-1 on page 5-4). Items within these kits are not individually available.

2. Install the rack mount rails into the equipment rack using the instructions provided with the rail set. Consider the height of the analyzer is 222 mm (8.75 inches) when installing the rail set.

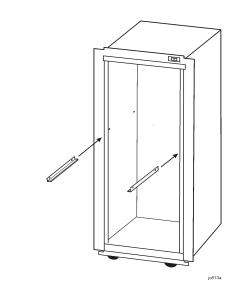


- **3.** Remove the trim strips from the analyzer. Use a screwdriver to peel up the corner. Then, pull the trim away from the analyzer.
- **4.** Using three long screws, attach a flange on each the side of the front panel.

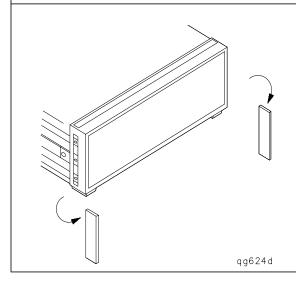


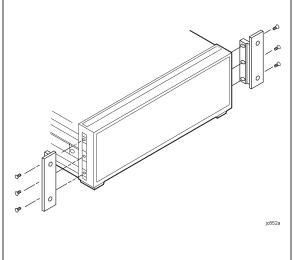

5. Remove the feet before cabinet mounting the analyzer using the directions imprinted on the feet.

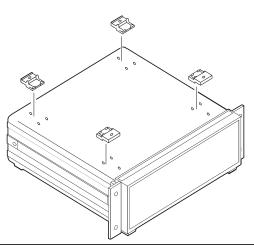

6. Ensure there are at least four inches of clearance between the sides and back of the system cabinet for adequate ventilation.

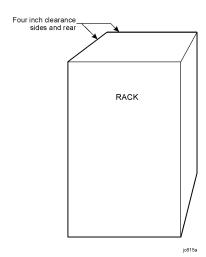


CAUTION


Consider the ventilation requirements described on page 1-7 when selecting the location of your analyzer.

1-14 Chapter 1

7. From the front of the equipment rack, lift the analyzer and slide it onto the rails that you installed earlier. Secure the analyzer to the equipment rack using the screws with washers and metal-clipped nuts provided in the flange kit.

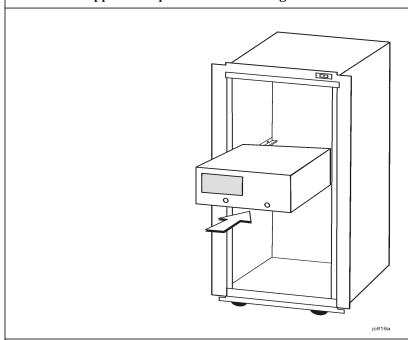

8. Continue with "STEP 4. Connect the Accessories to the Analyzer" on page 1-16.

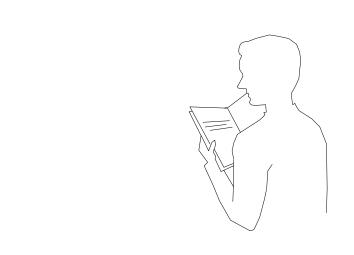

Chapter 1 1-15

qg646d

STEP 4. Connect the Accessories to the Analyzer

The PNA series network analyzer has several standard and optional accessories that can be connected to the analyzer through the Universal Serial Bus (USB). These accessories include:

- Mouse (standard)
- Keyboard (standard)
- Read/Write CD-ROM drive (optional)
- USB Hub (optional)
- Electronic Calibration (ECal) Modules (separate product)
- Printer (separate product)


There are two USB ports on the analyzer which allows the analyzer to control two USB devices at a time. However, an optional USB hub provides you with additional connector ports to the USB. This provides the capability to connect more accessories that just the mouse and the keyboard. There are two types of USB hubs: self powered and bus powered. In order to provide you the maximum flexibility, it is recommended that the self powered hub be used. Typically, a bus powered hub will not be able to support accessories that require more than 100 mA.


On the analyzer, one USB port is located on the front panel and another USB port is located on the rear panel. This section shows you how to connect the network analyzer accessories in two different ways:

- **Basic setup**. A setup that connects only the mouse and the keyboard. For installation procedures using the basic setup, refer to "To Connect the Accessories Using the Basic Setup (Without a USB Hub)" on page 1-17.
- **Complete setup**. A setup that includes a USB hub, a mouse, a keyboard, one or more ECal modules, a printer, and a read/write CD-ROM. For installation procedures using the complete setup, refer to "To Connect the Accessories Using the Complete Setup (With a USB Hub)" on page 1-19.

1-16 Chapter 1

To Connect the Accessories Using the Basic Setup (Without a USB Hub)

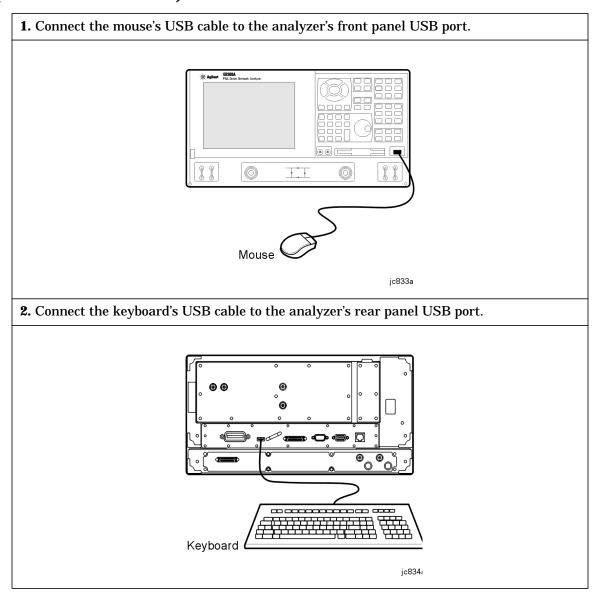


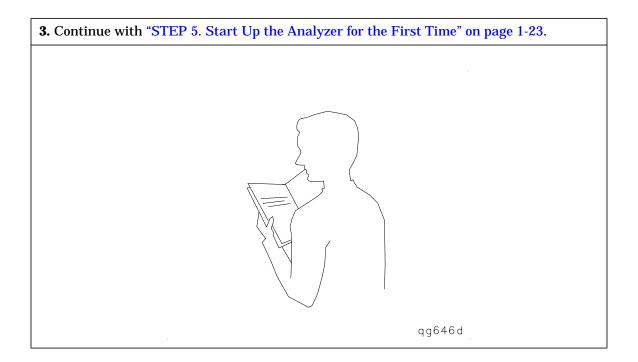


1-18 Chapter 1


To Connect the Accessories Using the Complete Setup (With a USB Hub)

1. If you are using an ECal module, connect one end of the USB cable (included in the ECal kit) to the module. Connect the other end of the USB cable to the USB port on the front panel of the analyzer. If you are *not* using an ECal module, connect the mouse's USB cable to the USB port (as shown in step 1 of "To Connect the Accessories Using the Basic Setup (Without a USB Hub)" on page 1-17).

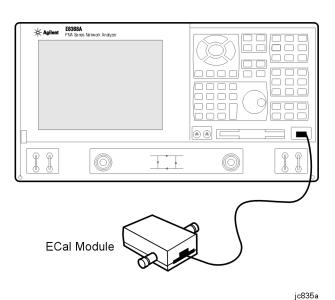



2. Connect one end of the USB cable (included in the USB hub kit) to the hub. Connect the other end of the USB cable to the USB port on the rear panel of the analyzer.

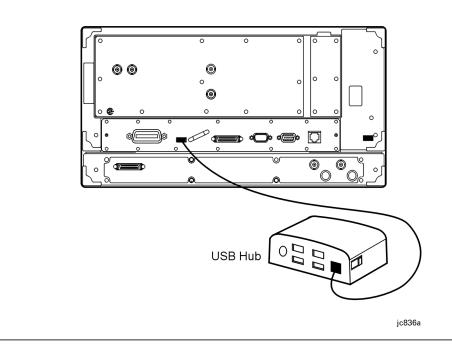

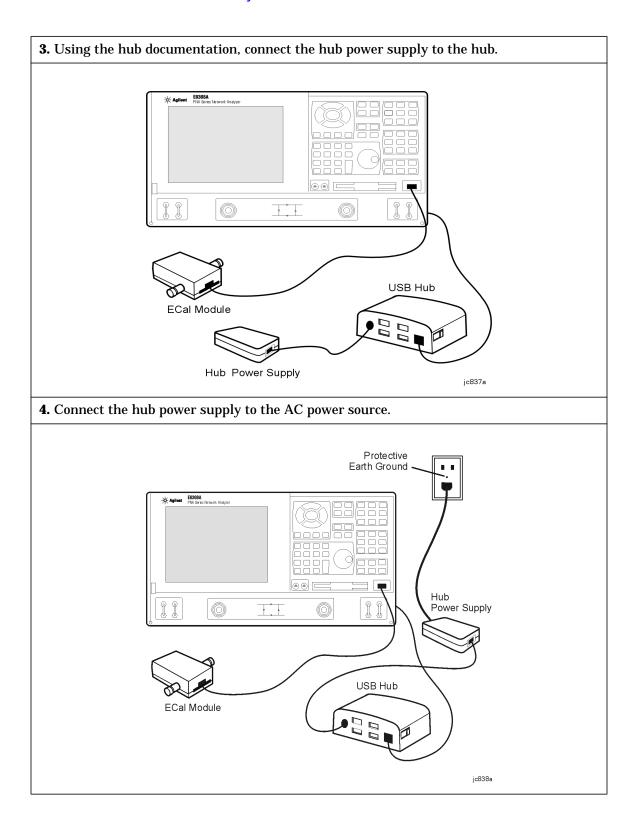

1-20 Chapter 1

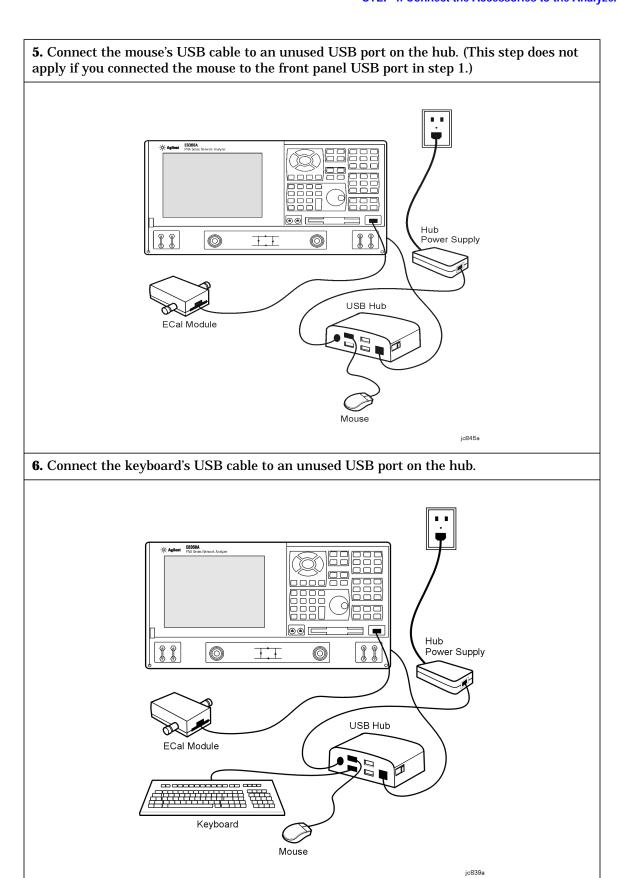

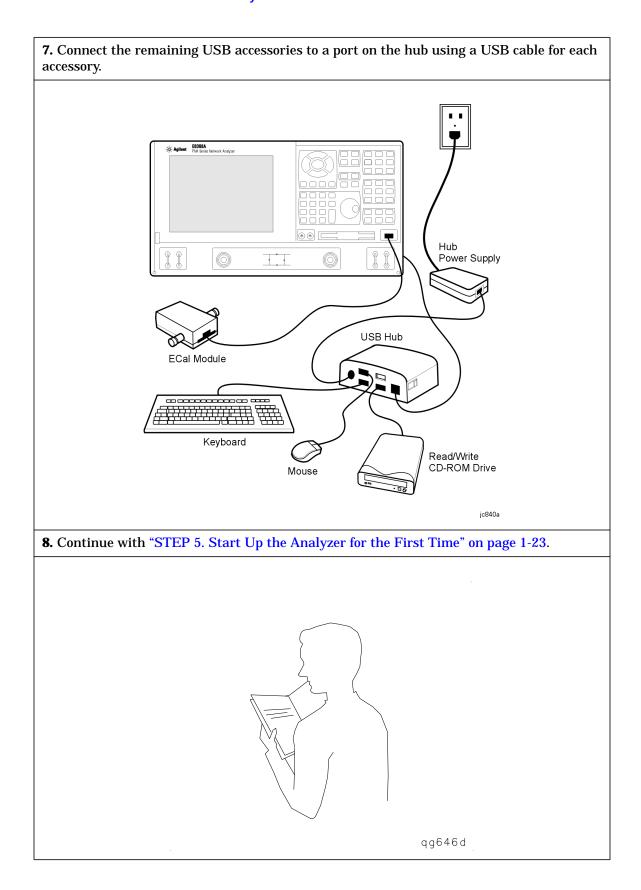

1-22 Chapter 1

STEP 5. Start Up the Analyzer for the First Time

The Agilent PNA Series Network Analyzer is a network analyzer that operates on a personal computer (PC) platform with Microsoft® Windows® 2000 Professional as the operating system. When the PC boots up the first time, you will need to set up the PC. These instructions will guide you through these steps.

CAUTION

Install the instrument so that the detachable power cord is readily identifiable and is easily reached by the operator. The detachable power cord is the instrument disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the instrument. The front panel switch is only a standby switch and is not a LINE switch. Alternatively, an externally installed switch or circuit breaker (which is readily identifiable and is easily reached by the operator) may be used as a disconnecting device.

CAUTION

Only in an emergency. should the power cord be removed from the network analyzer without first turning the analyzer off and waiting for the analyzer to switch to hibernation state. Removing the power cord without the network analyzer in hibernation state **is likely** to damage the analyzer.

NOTE Turning Off the Network Analyzer


When you turn off the power to the network analyzer, simply press the On/Off switch momentarily. Do not hold down the switch. Do not repeatedly press the switch. Within a few seconds after pressing the On/Off switch, two banners (the first, reading "Ready to Hibernate", and the second, reading "Preparing to Hibernate") are displayed. Wait until the hibernation process turns off the power to the analyzer. The On/Off switch color changes from green to yellow when the analyzer has finished switching to hibernation state.

The hibernation state is the normal "Off" state. A small amount of standby power is supplied to the analyzer when it is in the hibernation mode. This standby power only supplies the power switch circuits. No other CPU-related circuits are powered during standby.


Only remove the power from the analyzer for specific reasons, such as moving or servicing the analyzer.

When the analyzer is in the hibernation state, pressing the On/Off switch wakes up the analyzer. The network analyzer application wakes up in the exact state that it was in before the analyzer was hibernated.

1. Connect the AC power cable from the power-source outlet to the AC input on the rear panel of the analyzer.

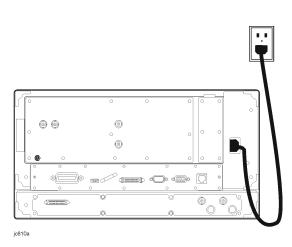


2. Turn the analyzer on by pressing the front panel On/Off button. When the analyzer is turned on, the On/Off button changes color from yellow to green.

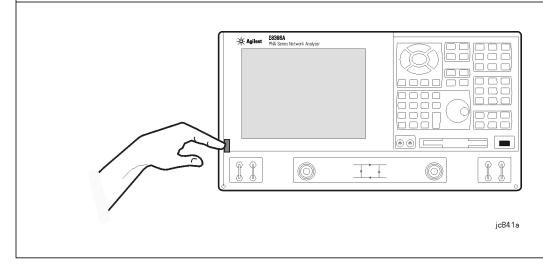


1-24 Chapter 1


3. The analyzer takes approximately 3 minutes to boot up after the analyzer has ac power applied and it is turned on. Once the License Agreement is displayed, read the agreement and select **I accept this agreement**. When done, click **Next**.

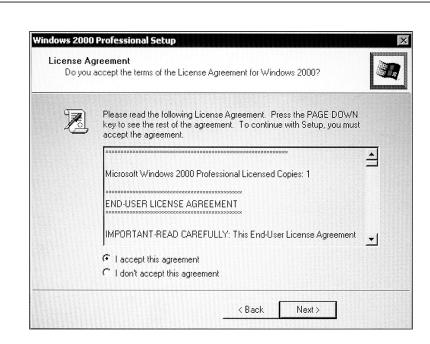


4. This screen may or may not be displayed. If it is not displayed, proceed to step 5. If it is displayed, and if desired, click **Customize** to customize the settings for system locale or keyboard layout. Follow the instructions as they appear on the screen. When done, click **Next**.

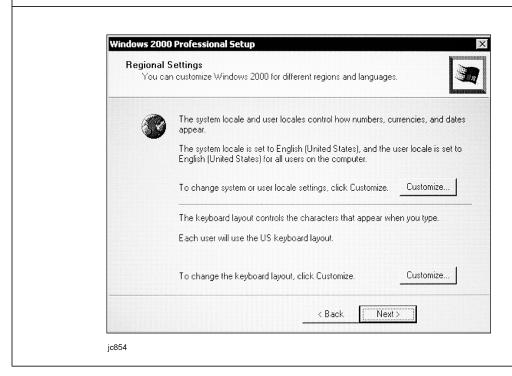

5. Type your full name in the **Name** box. Type the name of your company or organization in the **Organization** box. When done, click **Next**.

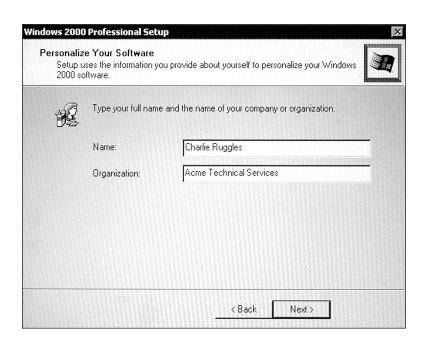


6. This screen may or may not be displayed. If it is not displayed, proceed to step 7. If it is displayed, enter the 25-character Product Key as instructed. This Product Key can be found on the Certificate of Authenticity that is located on the right side of the analyzer's outer cover. When done, click **Next**.

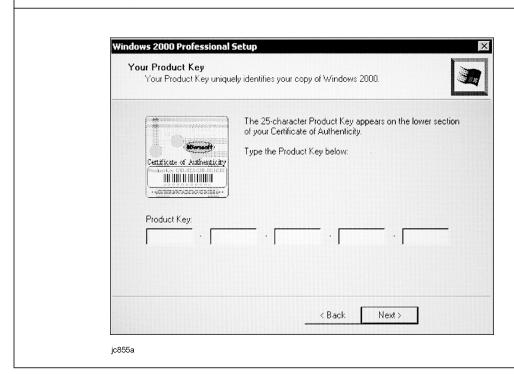


1-26 Chapter 1

7. The software assigns a random computer name in conjunction with your input for your organization. You may use this name or change it. Note the name you use for the computer. If you are planning to connect the analyzer to your Local Area Network (LAN), contact your network administrator for the appropriate name. When done, click **Next**.

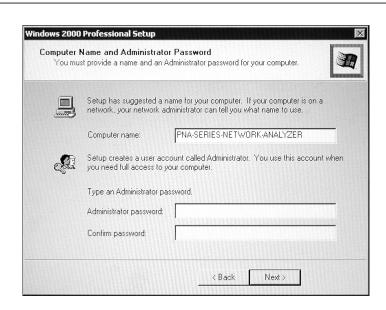


8. Enter an administrator password in the **Administrator password** box. Retype the password in the **Confirm password** box. When done, click **Next**.

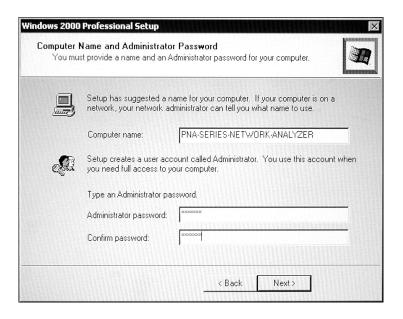


CAUTION

It is *extremely* important that you remember the administrator password. If your security program allows, record the password and store it in a safe place. Without the password, you will be prevented from accessing several features within the analyzer.

9. If the displayed date is incorrect, click the **Date** entry to display a calendar. Select the correct date from the calendar. If the displayed time is incorrect, click the **Time** (hours, minutes, seconds, or AM/PM) entries and then type in the correct time or click the arrows to select the correct time. When done, click **Next**.

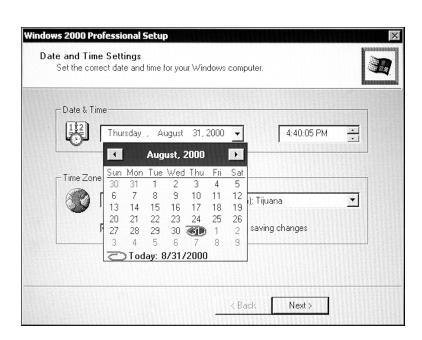


10. In the **Time Zone** list, click your local time zone. If your location observes daylight savings time, click the **Automatically adjust clock for daylight saving changes** box to make the time change automatically. When done, click **Next**.

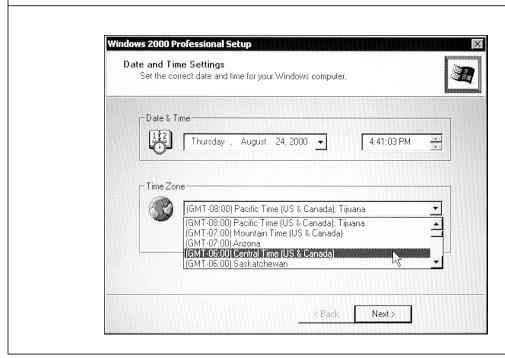



1-28 Chapter 1



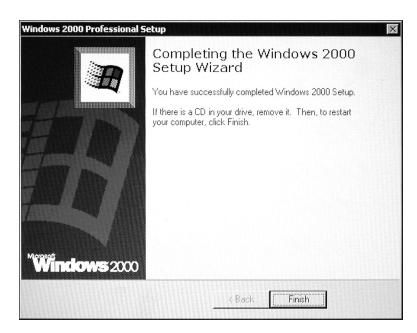

12. Click **Restart Now** to restart the network analyzer. The analyzer will open in the network analyzer application. This process will take several minutes.

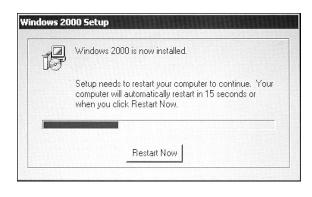

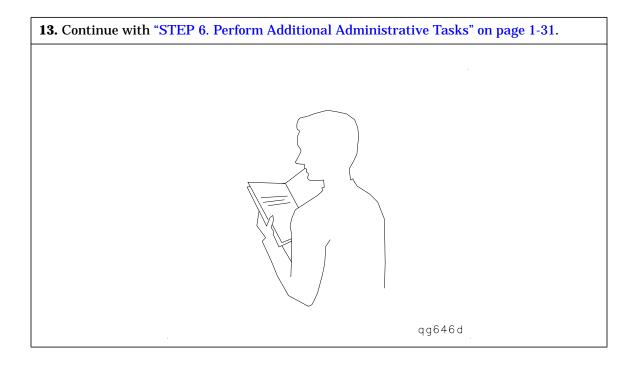

1-30 Chapter 1


STEP 6. Perform Additional Administrative Tasks

This section will guide you through the following tasks.


- Creating an emergency repair disk.
 Refer to "To Create an Emergency Repair Disk" on page 1-31.
- Setting up additional network analyzer users.
 Refer to "To Set Up Additional Network Analyzer Users" on page 1-37.

To Create an Emergency Repair Disk


An Emergency Repair Disk (ERD) will help you recover if the hard disk in your analyzer is damaged. You need a blank, formatted 3.5-inch floppy disk to create an ERD.

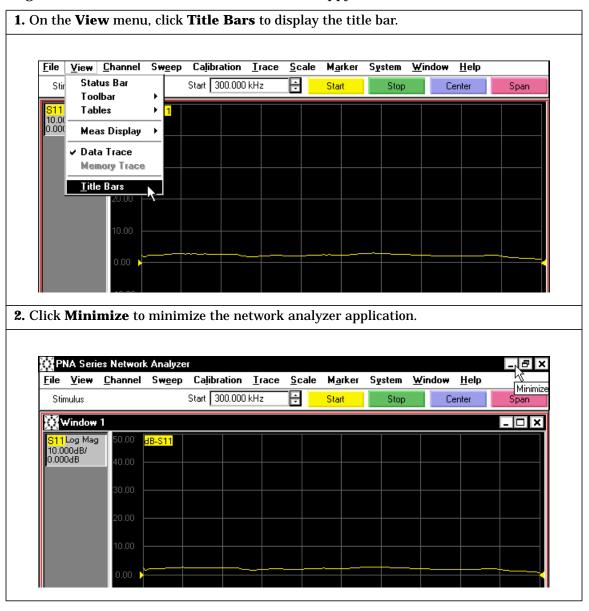

3. Click **Start**, then point to **Programs**, **Accessories**, **System Tools**, and click **Backup** to open the Backup window.

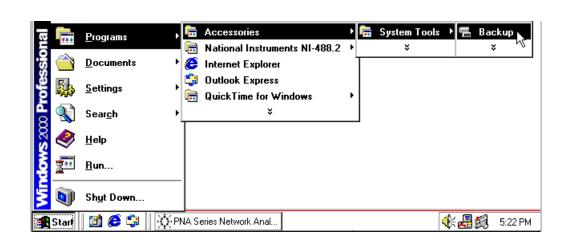


4. On the Tools menu, click Create an Emergency Repair Disk.

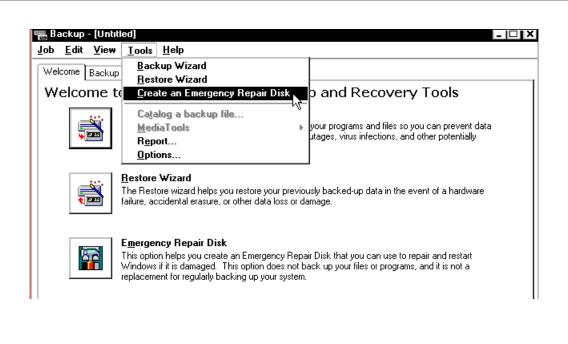


1-32 Chapter 1

 ${f 5.}$ When prompted, insert a blank, formatted floppy disk into the analyzer's front panel disk drive.

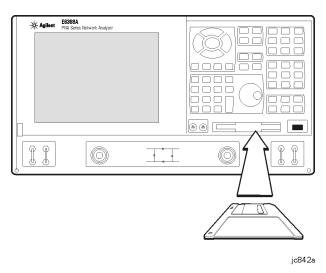


6. Click the Also backup the registry to the repair directory box. Then, click OK.



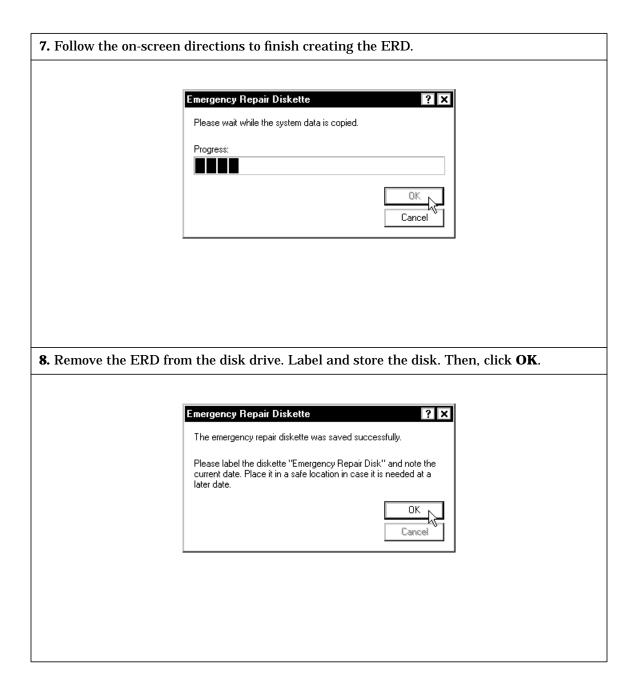

1-34 Chapter 1

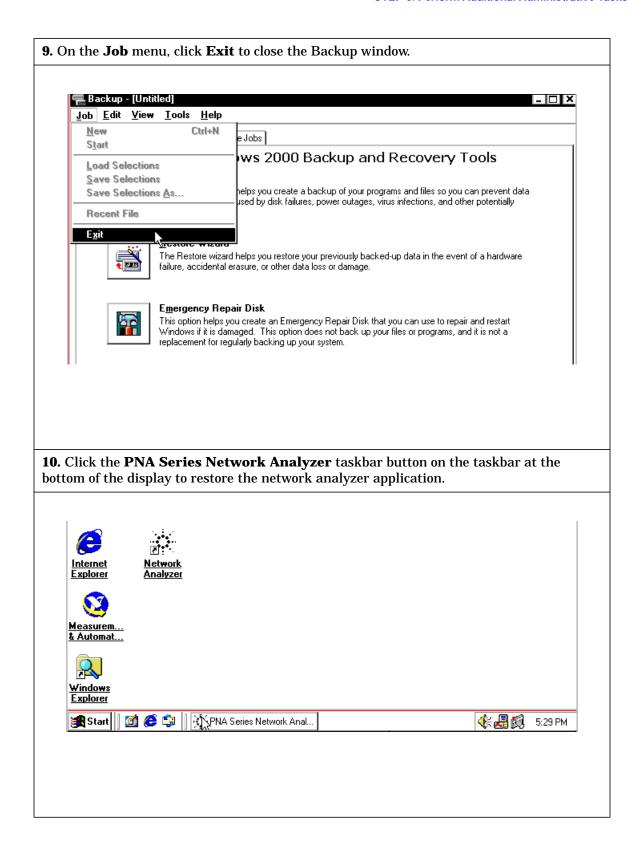


11. If you want to set up the network analyzer to be used by other co-workers, continue with "To Set Up Additional Network Analyzer Users" on page 1-37. If you are the only person that will be using the network analyzer, continue with "STEP 7. Run the Operator's Check" on page 1-45.


1-36 Chapter 1

To Set Up Additional Network Analyzer Users

As the administrator of the network analyzer, you can set the analyzer to allow others to use it with reduced permissions. That is, other people can be signed on to use the analyzer but they will not have the ability to perform all of the administrative functions that you can as the administrator.

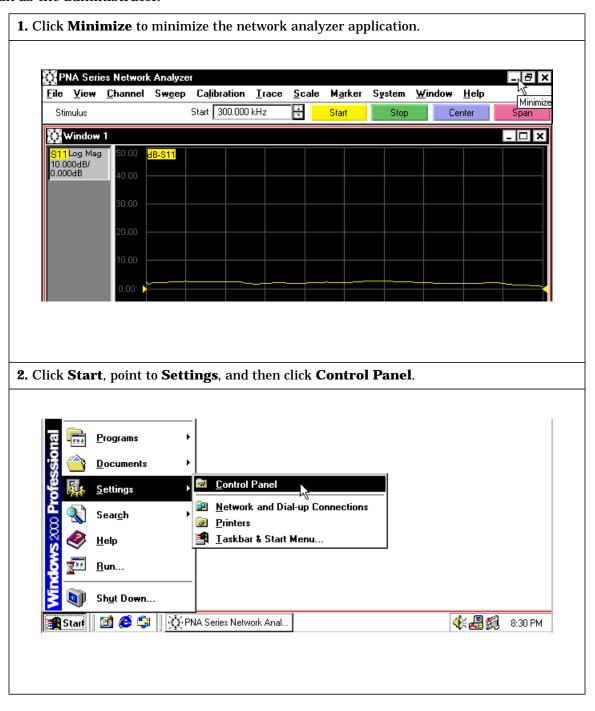


3. In the **Control Panel** window, scroll down and select the **Users and Passwords** application.

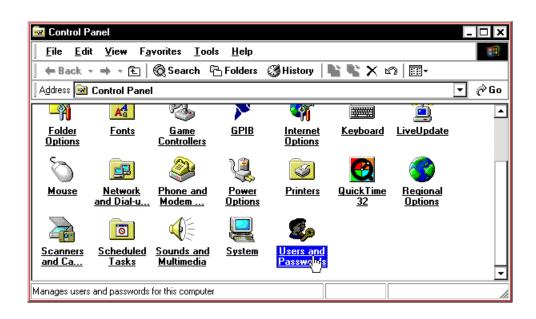

4. On the **Users** tab, if the **Add** button appears dimmed, select the **Users must enter a user name and password to use this computer** check box near the top of the window.



1-38 Chapter 1

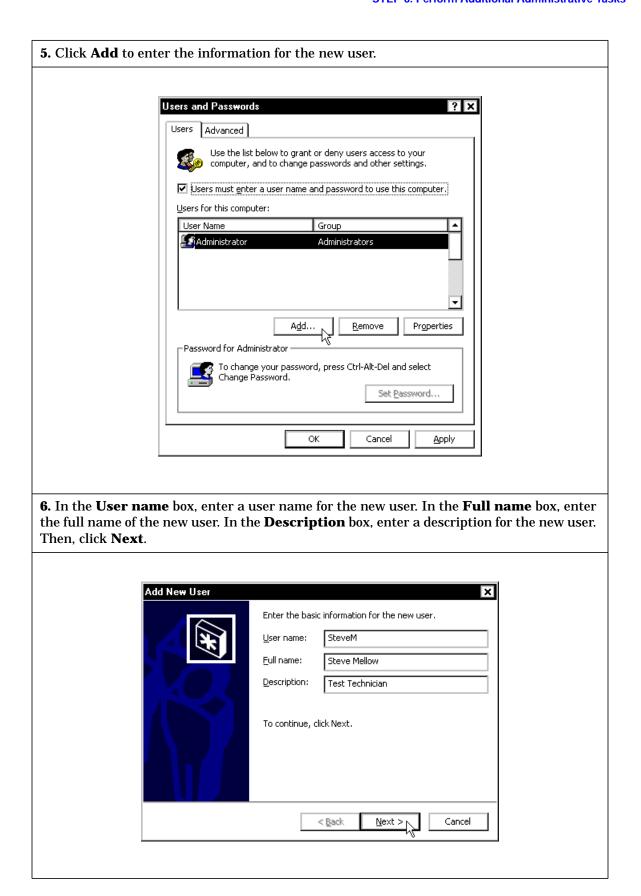

7. In the **Password box**, have the new user type a password. Have the new user retype the password in the **Confirm password** box. Then, click **Next**.



8. Consider the level of access that you wish to grant this new user.

Levels of access not listed on the **Add New Users** window are:

Administrators: have complete and unrestricted access to the computer/domain

Backup Users: can override security restrictions for the sole purpose of backing up or restoring

files

Guests: have the same access as members of the Users group by default, except for the

Guest account which is further restricted

Power Users: possess most administrative powers with some restrictions. Thus, Power Users

can run legacy applications in addition to certified applications

Replicators: support file replication in a domain


Users: are prevented from making accidental or intentional system-wide changes. Thus,

Users can run certified applications, but not most legacy



1-40 Chapter 1


9. The two standard selections are **Standard user** and **Restricted user**. There are several other levels of security that you may grant in the **Other** list. A description of each of these other levels is displayed beneath the **Other** box when it is selected.

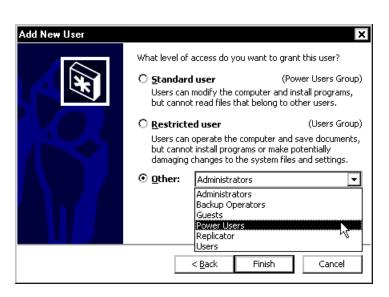

10. Select the level of access that you wish to grant this new user. Then, click Finish.




11. In the Users and Passwords window, validate the user name and security level group of the new user displayed in the Users for the computer list.

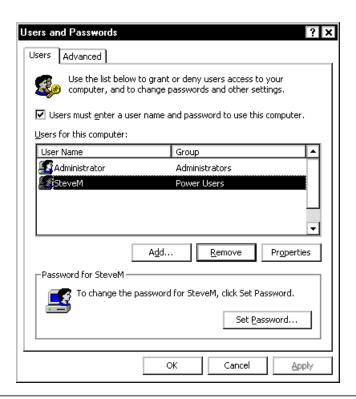



12. If you want this user to be able to use the network analyzer without entering their password each use, clear the **Users must enter a user name and password to use this computer** check box in the Users and Passwords window (in the previous illustration). (If the **Users must enter a user name and password to use this computer** check box is checked, the **Automatically Log On** window is not displayed.)

When the **Automatically Log On** window is displayed, have the new user type their password in the **Password** box and have them retype the password in the **Confirm Password** box. Then, click **OK**.

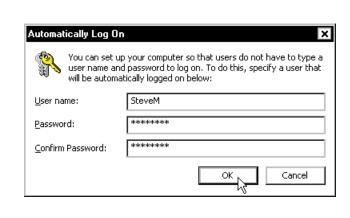


1-42 Chapter 1

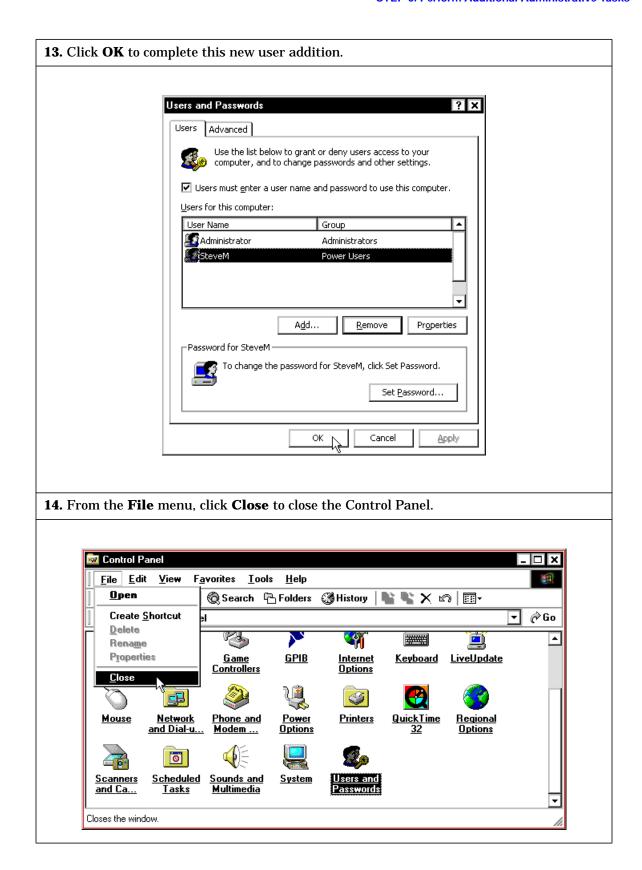

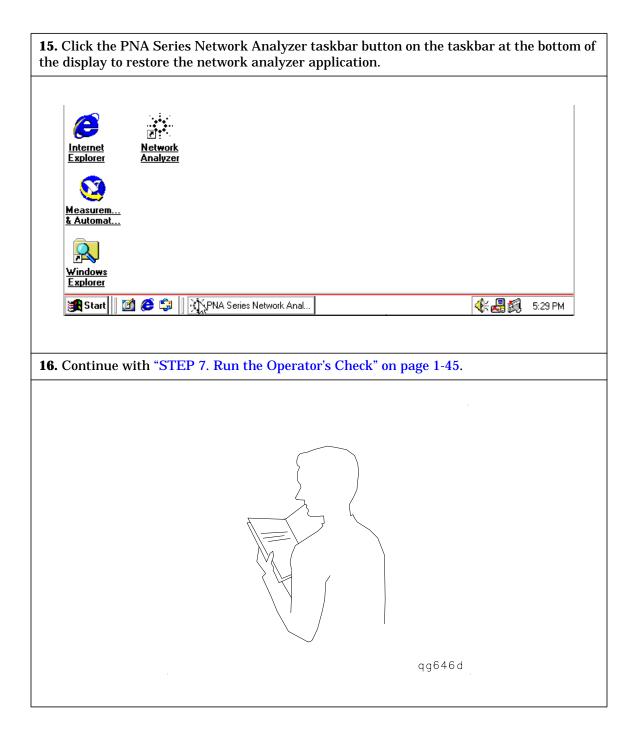


1-44 Chapter 1

STEP 7. Run the Operator's Check

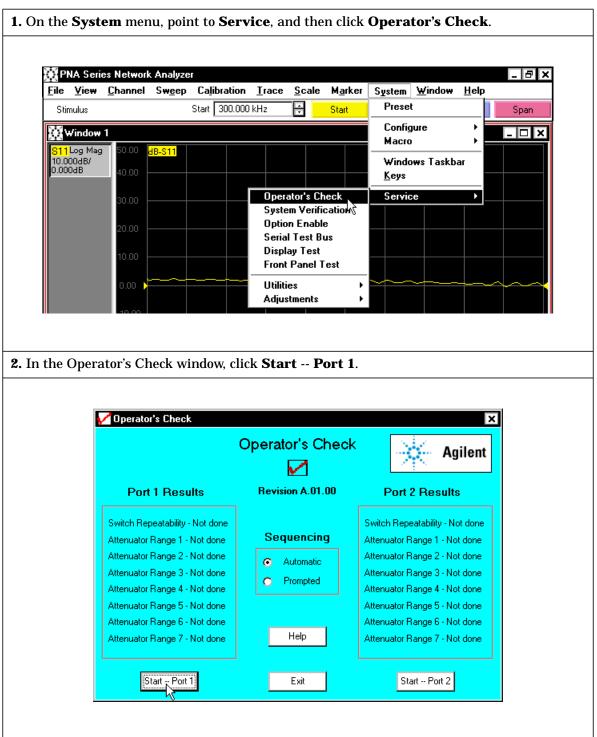


3. When prompted, connect a short from your calibration kit to test port 1. Then, click \mathbf{OK} to start the automated check.

The calibration kit is neither a standard nor an option to you network analyzer. It is a separate Agilent product that is used to calibrate your network analyzer. If you do not have a calibration kit for your network analyzer, contact your nearest Agilent sales or service office. Refer to Table 5-1 on page 5-4 for a list of sales and service offices.

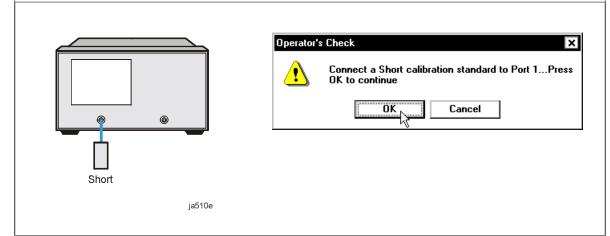


4. After the operator's check on test port 1 is complete, click **Start** -- **Port 2** to start the operator's check on test port 2.

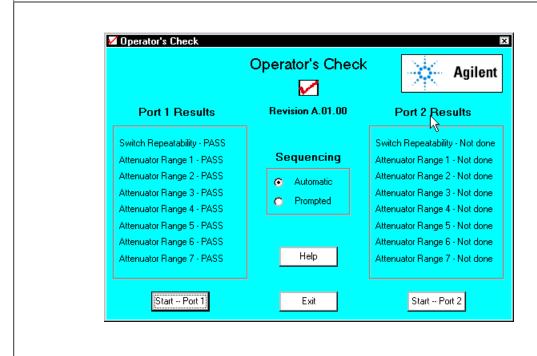


1-46 Chapter 1

5. When prompted, move the short from test port 1 to test port 2. Then, click \mathbf{OK} to start the automated check on test port 2.

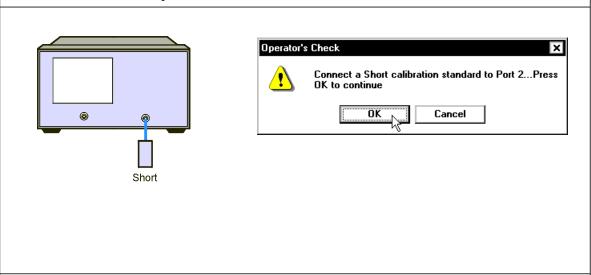

- **6.** After the operator's check on test port 2 is complete and the Operator's Check window is displayed, note the operator's check results on test ports 1 and 2.
- If the operator's check passed all of the checks, click Exit to complete the operator's check
 and return to the network analyzer measurement window. Now, you are ready to make a
 measurement. Continue with Chapter 3, "Getting Started with Measurements."
- If the operator's check failed any check, contact your nearest Agilent sales or service office. Refer to Table 5-1 on page 5-4 for a list of sales and service offices.

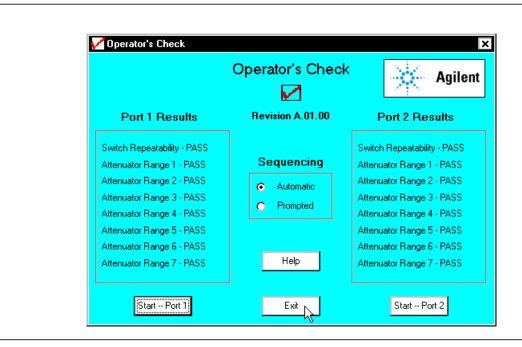

2	Becoming Familiar with Your Analyze

This chapter describes the features of the network analyzer that you will use to make measurements. Each front panel and rear panel feature is described. This is a list of the front panel and rear panel features.

•	Fr	ont Panel
		On/Off Switch Display Keypad USB Connector 3.5-inch Floppy Disk Drive Probe Power Connector Test Ports Auxiliary Output Connectors
•	Di	splay
	00000000	Menu Titles Window Control Buttons Active Entry Toolbar Measurement Toolbar Sweep Control Toolbar Stimulus Toolbar Marker Toolbar Trace Bar Screen Grid Tables
•	Κe	ypad
		Navigation keys Keys include: Left Arrow, Right Arrow, Up Arrow, Down Arrow, Click, F1, F2, F3, and F4 Display keys Keys include: Trace, Window, Measure Setups, and Arrange
		Channel Setup keys <i>Keys include:</i> Start/Center, Stop/Span, Power, Sweep Setup, Channel, Sweep Type, Trigger, Average, and Cal
		Command keys Keys include: OK, Help, Cancel, and Menu/Dialog
		Trace Setup keys Keys include: Measure, Format, Scale, Marker, Marker Table, Limit Table, Marker Search, Marker Function, and Math/Memory
		Entry keys Keys include: 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, G/n , M/u , Enter, $+/- \Leftarrow$, and . Front panel knob also included
		Utility keys Keys include: Save, Restore Up / Down, Preset, Recall, Print, and Macro/Local

2-2 Chapter 2


- · Rear Panel
 - **□** Top Assemblies Rear Panel Interconnects
 - External Detector Input Connector
 - External AM Input Connector
 - 10 MHz Reference Output Connector
 - 10 MHz Reference Input Connector
 - AC Input
 - ☐ CPU Board Rear Panel Interconnects
 - General Purpose Interface Bus (GPIB) Connector
 - Universal Serial Bus (USB) Connector
 - Parallel Interlace Port Connector
 - Serial Interface Port (COM1) Connector
 - Video Graphics Adapter (VGA) Output Connector
 - Local Area Network (LAN) Connector
 - ☐ Test Set Motherboard Rear Panel Interconnects
 - Auxiliary I/O Connector
 - Test Port 1 Bias Input Connector
 - Test Port 1 Bias Input Fuse
 - Test Port 2 Bias Input Connector
 - Test Port 2 Bias Input Fuse

Chapter 2 2-3

Front Panel

The network analyzer front panel has several features with which to become familiar. Refer to Figure 2-1 for an illustration of the front panel. This illustration is followed by the name and description of each feature. The display and keypad features are described in greater detail in subsequent sections of this chapter.

Figure 2-1 Front Panel

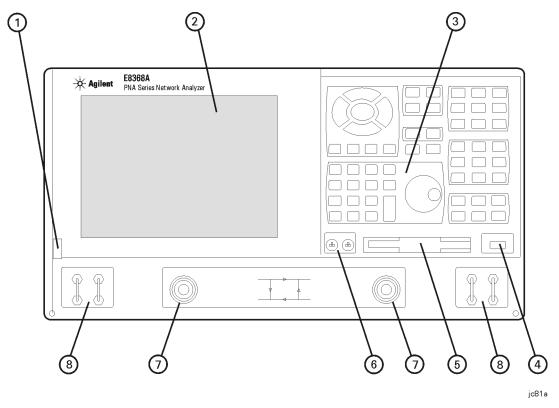

Refer to Figure 2-1 when identifying each of the following front panel features:

1. On/Off Switch

The On/Off switch toggles the analyzer between the On and Hibernate conditions. For the On condition the button is green. For the Hibernate condition, the button is an yellow light.

To switch off the analyzer, press the power button and the instrument saves the states of all the programs running and switches off the power. When you press the button again, the instrument loads the states that were saved at the time the power was switched off.

The front panel switch is only a standby switch and is not a LINE switch (disconnecting device). Refer to the note describing Turning Off the Network Analyzer on page 1-23 for additional information.

2. Display

The display features are discussed in detail in the section entitled "Display" on page 2-6.

2-4 Chapter 2

3. Keypad

The keypad is used as an interface to set up the network analyzer. The keypad features are discussed in detail in the section entitled "Keypad" on page 2-8.

4. USB Connector

The Universal Serial Bus (USB) allows you to control the analyzer using a mouse, keyboard, or other pointing devices. This connector can also accommodates electronic calibration modules. It can provide a maximum current of 0.5A.

5. 3.5-inch Floppy Disk Drive

Installs files on the analyzer hard drive or stores data files from the analyzer. Access this disk drive by using NT Explorer. The disk drive has an unformatted data capacity of 2MB and is compatible with high density (2HD) and normal density (2DD) disks.

6. Probe Power Connector

These connectors supply power for active probes. For the voltage specifications of these connectors, refer to the specifications in the embedded Help system.

7. Test Ports

These 50-ohm, type-N (female) ports that can be switched between the analyzer RF source and receiver, to allow measurements of the device under test in two directions.

A green light around the port, indicates the source output port. An orange light around the port, indicates the receiver input port.

These test ports have the following input damage levels:

- CW Level: +15 dBm
- DC Voltage Level: ±30 V

8. Auxiliary Output Connectors

These connectors are used to develop custom measurements. Refer to the troubleshooting chapter in the PNA series network analyzer service guide for the block diagram of internal hardware for details.

Port 1

The Port 1 connectors are labeled A and R1. The A output connector is connected to the coupled arm of the Port 1 coupler. The A input connector is connected directly to the input of receiver A. If Option 015 (configurable test set option) is installed, the path is connected directly to a variable attenuator and then to the receiver's input.

The R1 output connector is connected to the transfer switch Reference 1 output. The R1 input connector is connected directly to the R1 receiver input.

Port 2

The Port 2 connectors are labeled B and R2. The B output connector is connected to the coupled arm of the Port 2 coupler. The B input connector is connected directly to the input of receiver B. If Option 015 (configurable test set option) is installed, the path is connected directly to a variable attenuator and then to the receiver's input.


The R2 output connector is connected to the transfer switch Reference 2 output. The R2 input connector is connected directly to the R2 receiver input.

Chapter 2 2-5

Display

The network analyzer display has several features with which to become familiar. Refer to Figure 2-2 for an illustration of the display. This illustration is followed by the name and description of each feature.

Figure 2-2 Display

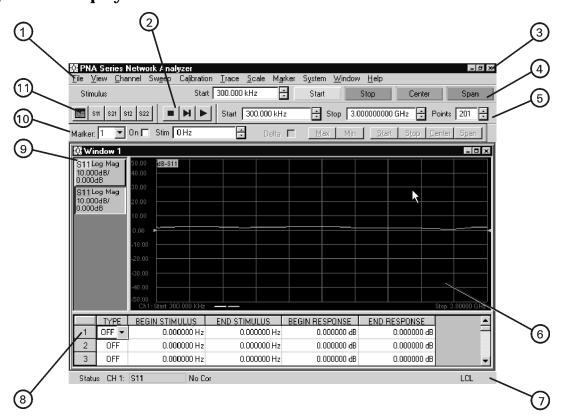

Refer to Figure 2-2 when identifying each of the following display features:

1. Menu Titles

Allows you to access the drop-down menus, revealing the analyzer functions.

2. Sweep Control Toolbar

Allows you to stop the current measurement sweep (\blacksquare), make a single measurement sweep (\blacksquare), or make measurement sweeps continuously (\blacktriangleright).

3. Window Control Buttons

Allows you to minimize, enlarge and reduce, and close the network analyzer application and the window that is part of the application.

4. Active Entry Toolbar

Allows you to choose from the functions available when you press a front panel key.

2-6 Chapter 2

5. Stimulus Toolbar

Allows you to change values for the stimulus settings by selecting start and stop frequencies and the number of points.

6. Screen Grid (Graticule)

Allows you to view the measurement traces. You can view up to four windows on the analyzer screen. You can view up to four measurement traces and four memory traces in each window.

7. Status Bar

Allows you to view current network analyzer information. The information that is included on the bar includes the active channel, the selected measurement, whether measurement correction is being applied, and whether the analyzer is in local or remote mode. If sweep averaging, smoothing, transform, gating, and electrical delay is on, this information is also displayed on the bar.

8. Tables

Allows you to alternately view the marker data, the settings for a segment sweep, or the settings for a limit test.

9. Trace Bar

Allows you to select an active measurement trace, using a mouse or other pointing device. A measurement must be active to modify any settings associated with it.

10. Marker Toolbar

Allows you to assign markers to a stimulus value, use markers to search for specified values, and set stimulus values based on a marker location.

11. Measurement Toolbar


Allows you to add an S-parameter measurement. The measurement appears in the active window and the settings of the active channels apply.

Chapter 2 2-7

Keypad

The network analyzer keypad has several features with which to become familiar. Refer to Figure 2-3 for an illustration of the keypad. This illustration is followed by the name and description of each feature.

Figure 2-3 Keypad

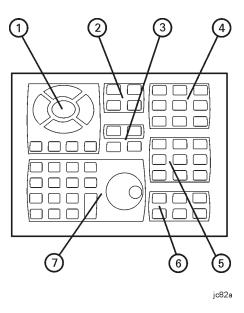

Refer to Figure 2-3 when identifying each of the following keypad features:

1. **Navigation** keys allow you to select choices from the active entry toolbar and navigate through menus and dialog boxes.

Left Tab / Right Tab keys

- · Moves the cursor left and right through menus.
- Moves the cursor tab-left and tab-right within dialog boxes.

Up Arrow / Down Arrow keys

- · Move the cursor up and down through menus.
- In a dialog box:
 - Modify a numeric value.
 - Move through items in a drop-down list.
 - Move through options buttons in a group of option buttons.

Click key makes a selection just like a mouse click.

F1, **F2**, **F3**, **F4** keys select choices from the active entry toolbar. The color of the key corresponds to the active entry toolbar choice.

2-8 Chapter 2

2. Display keys allow you to manage and create traces and windows, quickly configure a set of measurements, and arrange the display of current measurements.

Trace key, when first pressed, allows you to cycle through the traces in a window, making each trace active in turn. You can make modifications only to the active trace. This key also allows you to create or delete traces using the active entry toolbar.

Window key allows you to cycle through the windows that are currently setup, making each window active in turn. You can make size modifications only to an active window. A window must also be active to cycle through the traces in the window. This key also allows you to create or delete windows.

Measure Setups key allows you choose from four preconfigured measurement setups.

Arrange key allows you to choose from four window arrangements: Overlay, Stack 2, Split 3, Quad 4.

3. Command keys allow you to issue commands in a dialog box, display menus or dialog boxes, and start the analyzer embedded Help system.

OK key closes a dialog box and enters any values made in the dialog box.

Help key launches the analyzer Help (embedded documentation) system.

Cancel key closes a dialog box.

Menu / Dialog key allows you to browse the menus with the Navigation keys.

4. Channel Setup keys allow you to configure a channel with various stimulus settings and perform a measurement calibration.

Start / Center key allows you to enter a value for the start or center of a measurement range.

Stop / Span key allows you to enter a value for the stop or span of the measurement range.

Power key allows you to specify the source power level.

Sweep Setup key allows you to define how the analyzer source provides a stimulus to a device under test.

Channel key allows you to select an active channel, or delete a channel. A channel must be active to modify any channel settings.

Sweep Type key allows you to select the way the analyzer source sweeps and the properties associated with the sweep.

Trigger key allows you to specify how the start of the measurement sweep is initiated.

Average key allows you to apply measurement averages which reduces noise. The analyzer performs a complex exponential average of a number of sweeps that you specify.

Cal (Calibration) key initiates a measurement calibration. Pressing **Menu / Dialog**, **Cal** displays the Calibration Wizard. Otherwise, pressing **Cal** displays the calibration active entry toolbar.

Chapter 2 2-9

5. Trace Setup keys allow you to configure a measurement type and extract data from the results.

Measure key allows you to select an S-parameter measurement. Through the dialog box, you can also select an arbitrary ratio or unratioed power measurement.

Format key allows you to select the format the analyzer uses to display the measurement data.

Scale key allows you to specify the value the analyzer uses to scale the displayed measurement response. You can also let the analyzer automatically set the Y-axis scales to fit the entire measurement trace on the screen.

Marker key allows you to activate a marker and set the value. Markers provide numerical readout of measured data.

Marker Table key displays the marker table, showing the data readout for all of the markers on the active trace.

Limit Table key displays the table of values that allow you to create pass/fail testing based on these limit segments.

Marker Search key presents access to the marker search functions. If there is no marker displayed, this key will activate a marker.

Marker Function key allows you to change measurement settings, based on the location of an active marker. If there is no marker displayed, this key will activate a marker.

Math / Memory key allows you to select trace math and memory functions that the analyzer performs on the measurement data.

6. Utility keys allow you to print measurement results, preset the analyzer, run macros, manipulate the window size, and save and recall the following: 1) instrument states, 2) measurement calibrations, and 3) measurement data.

Save key allows you to save instrument states, calibration data, and measurement data to a file.

Restore Up / Down key changes the selected window to the full measurement screen size and then restores it to the previous window size.

Preset key changes the analyzer to its preset (default) conditions.

Recall key allows you to recall a file that may contain an instrument state, measurement calibration, and measurement data.

Print key initiates a print function, allowing you to select the print conditions and printer.

Macro / Local key allows you to manage and run macros. Also when the analyzer is in an automated mode, it allows the front panel to accept user input.

2-10 Chapter 2

7. Entry keys allow you to enter values for measurement settings.

Numeric keys (0, 1, 2, and so forth) selects values for measurement settings, then press **Enter**, G/n, or M/μ to complete the selection.

Units keys (**G/n**, **M/** μ , or **Enter**) completes the value selection, assigning a unit of measurement. The **G/n** units key defines **G** equals the units being input times 10^9 and **n** equals the units being input times 10^{-9} . The **M/** μ units key defines **M** equals the units being input times 10^6 and μ equals the units being input times 10^{-6} . As an example, when you are entering the value for the center frequency and you enter the number 650 followed by the **M/** μ key, you are specifying a center frequency of 650 MHz.

Enter key enters the values that you select for the measurement settings.

Plus/Minus Backspace key (+/ $- \Leftarrow$) selects the appropriate sign when the cursor is in the first position of a numeric entry but serves as a backspace, deleting the previous character, in any other position.

Decimal Point key (.) enters a decimal point to designate fractions of a whole number.


Front Panel knob rotates to increase or decrease the value of the active entry.

Chapter 2 2-11

Rear Panel

The network analyzer rear panel has several features with which to become familiar. Refer to Figure 2-4 for an illustration of the rear panel. This illustration is followed by the name and description of each feature.

Figure 2-4 Rear Panel

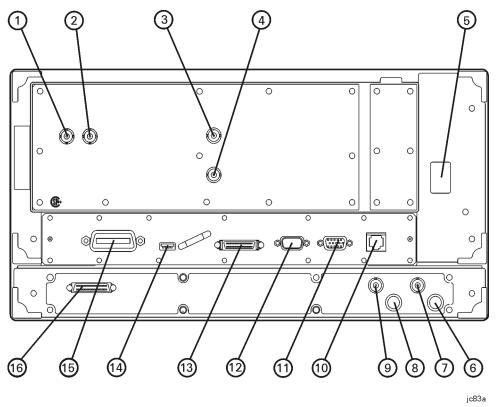

Refer to Figure 2-4 when identifying each of the following rear panel features. The embedded Help system in the analyzer lists the specifications for each connector.

1. External Detector Input Connector

This BNC (female) connector allows you to input a buffered DC signal from an external, negative polarity diode detector for controlling the power level at the test ports.

2. External AM Input Connector

This BNC (female) connector allows you to input a voltage that provides low frequency AM modulation to the test port output signal. You could also input a voltage to shift the test port output power level. An input of 0 volts leaves the power level unaffected. A positive voltage input shifts the test port power to a higher level. A negative voltage shifts the power to a lower level.

3. 10 MHz Reference Input Connector

This BNC (female) connector allows the analyzer to work with an external 10 MHz reference signal that has an input power level between -15 to +20 dBm.

2-12 Chapter 2

4. 10 MHz Reference Output Connector

This BNC (female) connector provides a frequency 10 MHz reference (sine wave) signal. The output level of this reference signal is 10 dBm and has an output impedance of 50 ohms.

5. AC Input

The detachable power cord is the instrument disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the instrument. The front panel switch is only a standby switch and is not a LINE switch (disconnecting device).

6. Test Port 1 Bias Input Fuse

This is a bipin, non-time delay fuse rated at 1 A, 125 V.

7. Test Port 1 Bias Input

This BNC (female) connector allows external bias to be applied at Test Port 1. This input has a maximum voltage of 30 VDC and a maximum current of 1A, (200 mA with no degradation of RF specifications). $^{\rm a}$

8. Test Port 2 Bias Input Fuse

This is a bipin, non-time delay fuse rated at 1 A, 125 V.

9. Test Port 2 Bias Input

This BNC (female) connector allows external bias to be applied at Test Port 2. This port has a maximum allowable voltage of $\pm 30~V_{DC}$ and a maximum current of $\pm 1~A$, ($\pm 200~mA$ with no degradation of RF specifications).

10. Local Area Network (LAN) Connector

This 10/100BaseT Ethernet connection has a standard 8-pin configuration and auto selects between the two data rates.

11. Video Graphics Adapter (VGA) Output Connector

This 15-pin female D-sub connector allows connection of external VGA monitors with the following resolutions. You can simultaneously view the internal and external displays. The device resolutions are as follows: **Flat Panel (TFT):** 1024×768 , 800×600 , 640×480 ; **Flat Panel (DSTN):** 800×600 , 640×480 ;

CRT Monitor: 1280×1024 . 1024×768 . 800×600 . 640×480

12. Serial Interface Port (COM1) Connector

This 9-pin male D-sub connector is RS-232 compatible.

13. Parallel Interface Port Connector

This 36-pin, mini-D, 1284-C connector provides connection to printers or any other parallel port peripheral. An adapter that allows connection between this parallel port and a Centronics port is provided.

14. Universal Serial Bus (USB) Connector

This connector can be used to connect a USB mouse, keyboard, or other device. The USB jack is of the Type A configuration (4 contacts inline) Contact 1 (on the left) is Vcc (4.75 to 5.25 VDC, 500mA maximum, protected by an automatically resettable fuse rated at 1 A); Contact 2 is -Data; Contact 3 is +Data; and Contact 4 is Ground.

Chapter 2 2-13

a. Up to 200 mA level, the instrument will meet all of its RF specifications. As the DC bias is increased, particularly at low RF frequencies (that is, typically <100 MHz, but predominantly >10 MHz), the low frequency corrected source match and directivity will degrade. Above 100 MHz RF, with up to 1 A bias, there is very little degradation in corrected source match and directivity.

15. General Purpose Interface Bus (GPIB) Connector

This 24-pin connector is a Type D-24, female compatible with IEEE-488.

16. Auxiliary I/O Connector

This connector provides the External Trigger (pin 18) and the Ready for Trigger (pin 19) signals.

2-14 Chapter 2

3 Getting Started with Measurements

This chapter shows you how to make basic measurements with the PNA series network analyzer. A procedure has been created to step you through some basic measurements and show some of the network analyzer features. This procedure is shown in two ways.

- First, this procedure guides you through making the measurements using the mouse and keyboard that were provided with your analyzer. The mouse and keyboard method is quicker than using the keypad method. (Refer to "Making Basic Measurements using a Mouse and Keyboard" on page 3-3.)
- Then, the procedure guides you through making the same measurements using the front panel keypad. The keypad method is useful if your space is limited and you do not have a good place to leave the mouse and keyboard. (Refer to "Making Basic Measurements using the Front Panel Keypad" on page 3-21.)

Both methods have the complete access to the network analyzer features. However, the mouse and keyboard is required for some other Microsoft Windows 2000 Professional applications.

Traces, Channels, and Windows

Before we start making measurements, there are three terms with which you should become familiar, *traces*, *channels*, and *windows*. Each of these terms is described below. As you follow the measurement procedure, it will also help with understanding each of these terms.

Channel: A channel has a set of independent attributes that are associated with collecting data. These attributes apply to all the traces assigned to that channel. The analyzer supports four independent channels.

Trace: A trace has a unique set of attributes that are associated with mathematical operations performed on the collected data. The analyzer supports up to 16 data traces. It also supports a maximum of four data traces and four memory traces on a window.

Window: A window is used for viewing traces. The analyzer can show 1, 2, 3, or 4 windows on the screen. A maximum of four data traces and four memory traces may be displayed on a window.

Additional information about these topics can be found in the Analyzer Operation Model topic on the Quick Start page of the PNA Series Network Analyzer Help system.

NOTE	Before beginning these procedures, make sure the network analyzer
	application is displayed. If the network analyzer application is not displayed,
	display it by clicking the PNA Series Network Analyzer taskbar button on
	the taskbar at the bottom of the screen. If this taskbar button is not on the
	taskbar, click the Network Analyzer icon on the desktop.

3-2 Chapter 3


Making Basic Measurements using a Mouse and Keyboard

This procedure guides you through setting up measurements using a mouse and keyboard. Measurements are set up in a variety of ways, using multiple traces, channels, and windows. A calibration procedure is also demonstrated using this procedure.

Set Up the Measurement


1. From the **System** menu, click **Preset**.

Notice in the trace status bar on the left of your network analyzer screen that the network analyzer is set up to make S11 measurements.

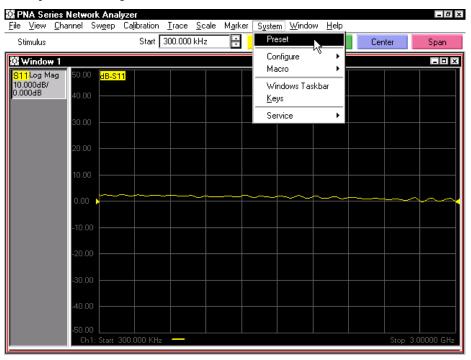


2. Connect the DUT to the network analyzer.

In this example, the DUT is a bandpass filter with a center frequency of approximately 1.53 GHz.

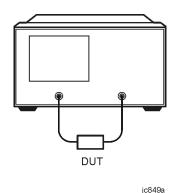


Chapter 3 3-3

3. On the **Trace** menu, click **Measure**. **S11** is shown with an indicator to its left. Click **S21** to change to a S21 measurement.

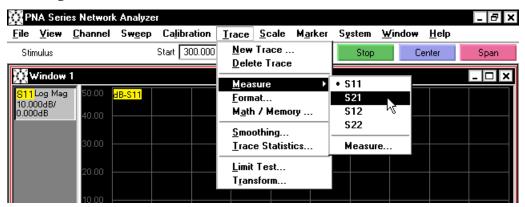


The network analyzer now displays a different trace. Also notice that the trace status bar displays a S21 measurement.

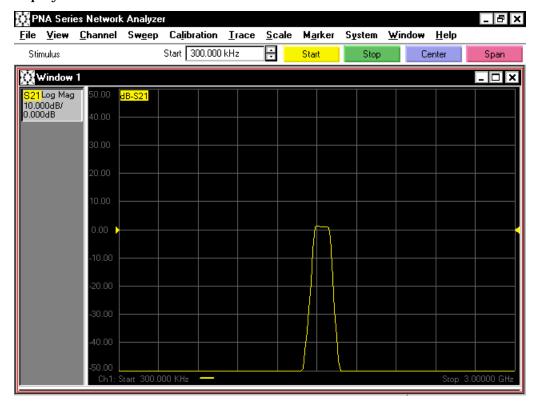


3-4 Chapter 3

4. On the **Channel** menu, click **Center/Span** to display the **Frequency Center/Span** window.

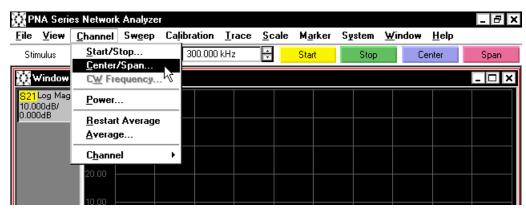


5. With the **Center** box highlighted, enter the center frequency of the bandpass filter. For this DUT, enter **1.53g** to center the 1.53 GHz pass band. Select the **Span** box and enter the span. This example uses a 1.2 GHz span, so enter **1.2g**. Click **OK**.

Note that when using a USB keyboard to enter a frequency terminator, type "g" for GHz, "m" for MHz, and "k" for kHz.

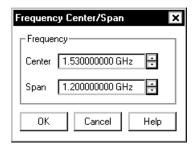


6. On the Scale menu, click Scale to display the Scale window.

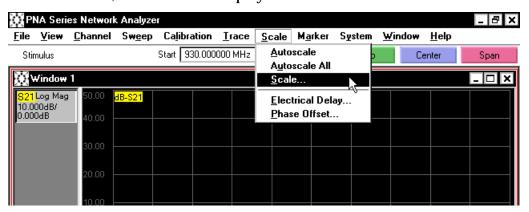


Chapter 3 3-5

7. In the **Scale** window, set the scale and reference settings so the trace is easy to view. For this example, in the **Scale Per Division** box, enter **20**. In the **Reference Level** box, enter **-60**. Click **OK**.

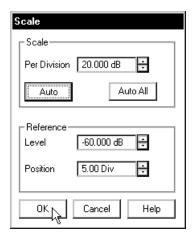


Note that Autoscale could have been selected to have the network analyzer automatically set the scale.

8. On the **Sweep** menu, click **IF Bandwidth**.

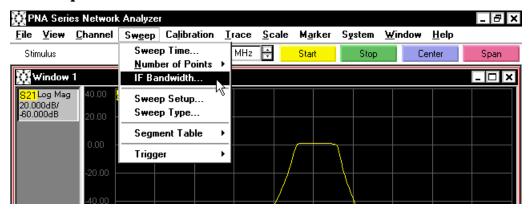


9. In the **IF Bandwidth** window, change the IF bandwidth setting so that the trace is sweeping at a stable level using the arrows. In this example, change the IF bandwidth setting to 10 **kHz**. Click **OK**.

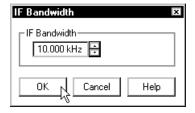


3-6 Chapter 3

10. Disconnect the test cables from the DUT.

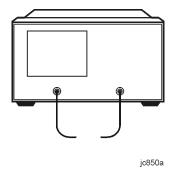


Calibrate the Setup


1. On the Calibration menu, click Calibration Wizard.

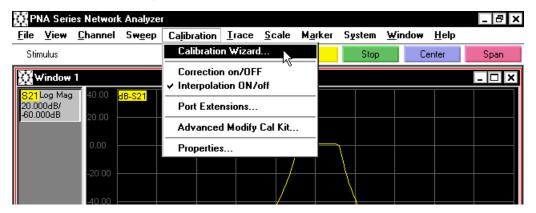


2. In the **Cal Wizard** window, click **Cal Type**.

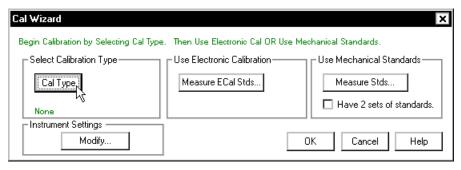

3. In the **Select Calibration Type** window, click **Full SOLT 2-Port**. The Short-Open-Load-Thru (SOLT) 2-port calibration calibrates for reflection and transmission measurements in both the forward and reverse directions. Click **OK**.

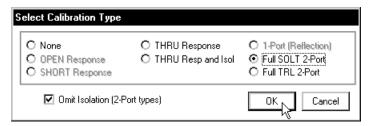


4. In the Cal Wizard window, click Measure Stds for using a mechanical calibration kit.

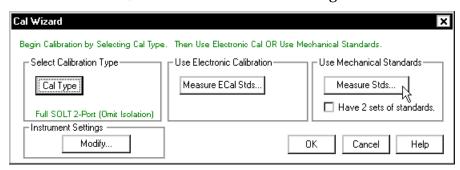


3-8 Chapter 3


5. In the Measure Mechanical Standards window, click Select Cal Kit.

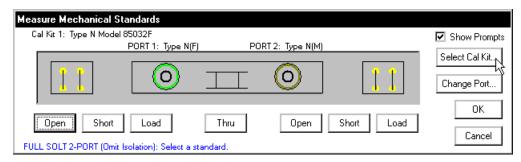


6. In the **Select Mechanical Cal Kit for Calibration** window, select the appropriate mechanical calibration kit. In this example, each end of the test cable is a type N (M) connection, so click **Kit ID 3 Type N (M) Type N (M) Type N Model 85032B**. Click **OK**.

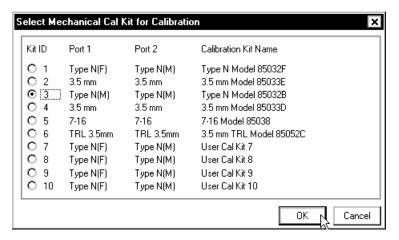


7. In the **Measure Mechanical Standards** window, measure the open, short, load, and thru standards by selecting the button for each. Select the **Open** for Test Port 1 on the left of the window. Calibrate from left to right.

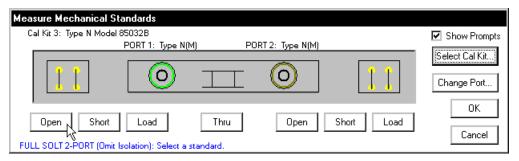

8. Connect the standards as prompted in the **Connect Calibration Standard** window. After each standard has been measured, a check mark is displayed above the corresponding button in the **Measure Mechanical Standards** window.

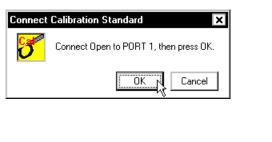

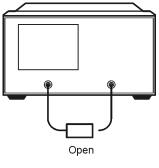


jc851a

9. Repeat the previous two steps, calibrating the remaining standards from left to right, following the prompts as each standard is selected.


NOTE

If you inadvertently use the wrong setup during the calibration, you do not have to recalibrate all of the standards again. Rerun the calibration for the individual standard and the correct data will be saved.

10. After all standards have been measured, click **OK**.

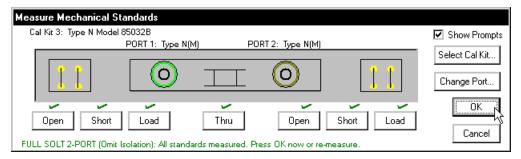

11. In the Cal Wizard window, click OK.

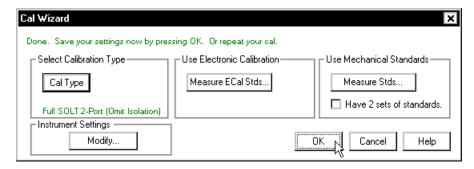


3-10 Chapter 3

12. A **Calibration Information** window is displayed showing that the calibration data is being saved along with the path and file name of the data. Click **OK**.




After the calibration is complete, the analyzer returns to the measurement mode.

13. Reattach the cables to the DUT.

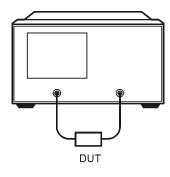


The network analyzer is now making a calibrated S21 measurement of the DUT.

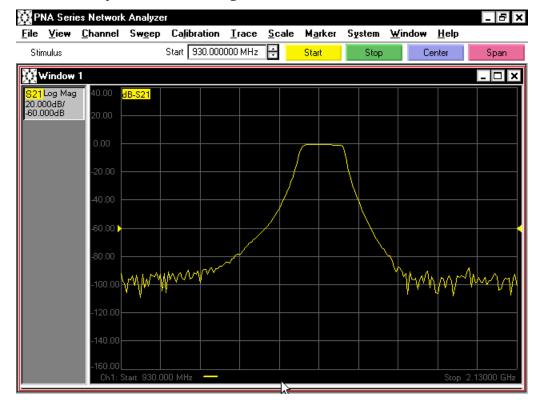


Display a Second Window with Two Measurement Traces

This procedure displays a second window. This second window will display two measurements (S12 and S22) on the same channel.


1. From the **Trace** menu, click **New Trace** to display the **New Trace** window.

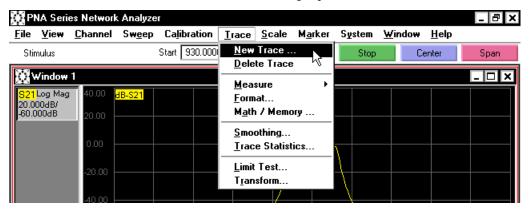

2. Under **S-Parameters**, click **S12.** Select the **Create in a New Window** check box. Click **OK**.

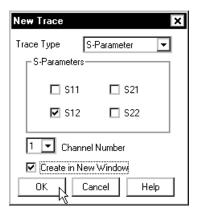


3-12 Chapter 3

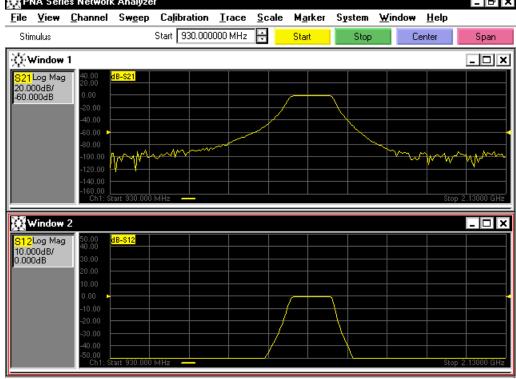


Now, add the second measurement, an S22 measurement trace, to Channel 1 of Window 2.

- 3. From the Trace menu, click New Trace.
- 4. Under S-Parameters, click S22. Click OK.
- 5. From the **Scale** menu, click **Autoscale All** to autoscale both of the traces in Window 2.

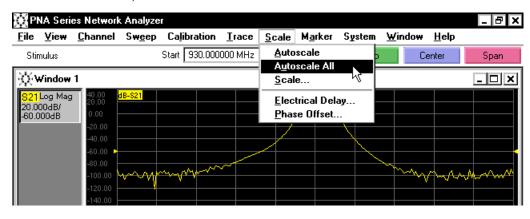

Window 1, with a S21 measurement, is displayed above Window 2, with a S12 and a S22 measurement.

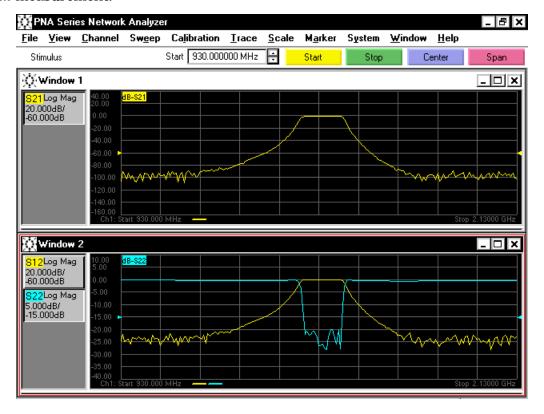


3-14 Chapter 3

Display Multiple Channels in a Window


This procedure displays two additional measurement traces to Window 1. These two new measurements (S11 and a second S21) are displayed on separate channels.

1. Select Window 1 by clicking anywhere within the window.

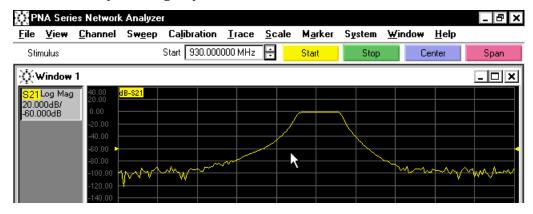

Notice that the title bar of the window is dark with light text when the window is selected.

- 2. From the **Trace** menu, click **New Trace**.
- 3. Under S-Parameters, click S11. In Channel Number box, click 2. Click OK.

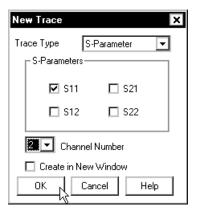


4. From the **Scale** menu, select **Autoscale**.

The S11 trace is displayed on the screen grid and indicated on the trace bar. Also notice that near the bottom of the Window 1 screen grid, channel 1 and channel 2 settings are displayed, along with a color indicator to distinguish between the traces.




Now, add another S21 measurement to the display. This S21 measurement is displayed in a narrow span on a third channel.

- 5. From the **Trace** menu, click **New Trace**.
- 6. Under S-Parameters, click S21. In Channel Number box, click 3. Click OK.

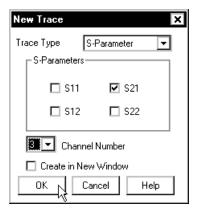

A new trace is displayed and channel 3 information is now displayed near the bottom of the Window 1.

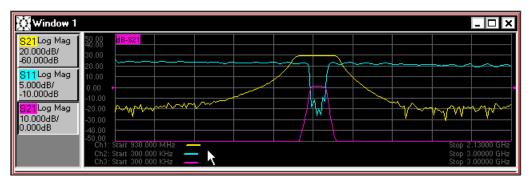


- 7. From the **Channel** menu, click **Center/Span** to display the **Frequency Center/Span** window.
- 8. In the **Center** box, type **1.53g** to set the center frequency to 1.53 GHz. In the Span box, type **300m** to set the span to 300 MHz. Click **OK**.


3-16 Chapter 3


9. From the **Scale** menu, select **Autoscale**.

Note that three measurement traces are displayed in Window 1. The trace bar, along the left edge of the display, indicates that there are two S21 measurements (one in wide and one in narrow span) and an S11 measurement. Also, near the bottom of Window 1, the three traces and their start and stop frequencies are list along with their color indicators.

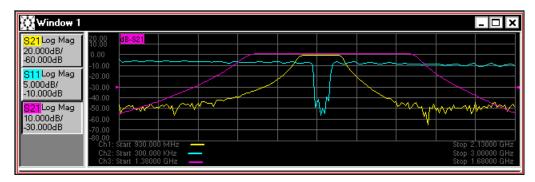

10. If the two S21 measurements are difficult to view, select one of the measurement traces on the trace bar, and select **Scale** from the **Scale** menu. Then, change the reference level by selecting the **Level** box and typing in a new level or clicking the arrows to select a new level until both traces can be seen clearly. (Notice that the scaling for each trace is independent.) Then, click **OK**.

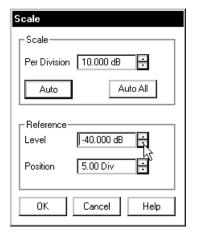


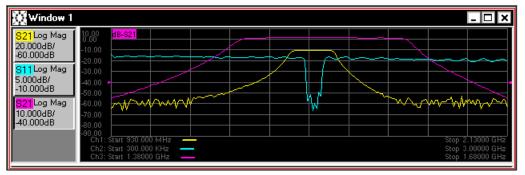

Display a Third Window with a Different Format

This procedure displays two reflection measurement traces in a third Window. The two measurement traces are S11 and S22 displayed in Smith Chart Format.

- 1. From the **Trace** menu, click **New Trace**.
- 2. Under S-Parameters, click S11. In Channel Number box, click 1. Select the Create in New Window check box. Click OK.

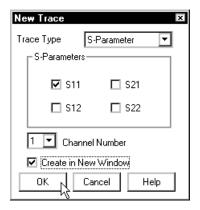


The first two windows are displayed side by side and Window 3, the new window, is displayed across the bottom of the screen grid.




Now, change the trace format in Window 3 from LogMag format to Smith Chart format.

3-18 Chapter 3

3. From the **Trace** menu, select **Format** to display the **Format** window.

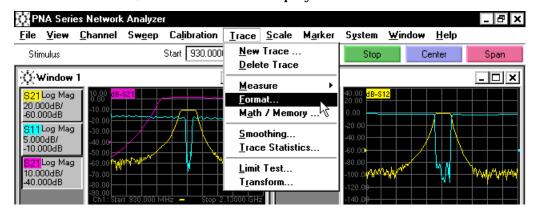


4. Under the Format for Data Traces, select Smith Chart. Then, click OK.

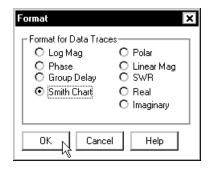

5. From the **Scale** menu, select **Autoscale**.


The S11 reflection measurement is now displayed in Smith chart format in Window 3.

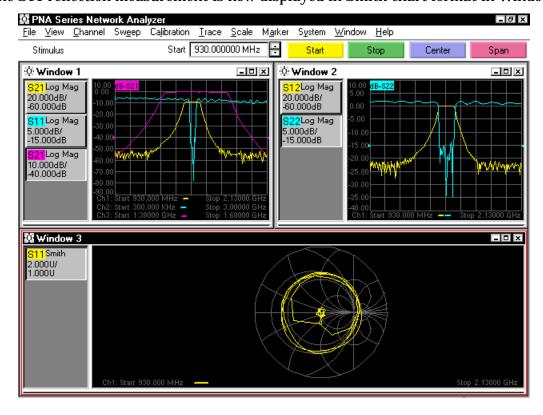

Now, add the second reflection measurement, a S22 measurement, to Window 3.

- 6. From the **Trace** menu, click **New Trace**.
- 7. Under S-Parameters, click S22. In Channel Number box, click 2. Click OK.
- 8. From the **Scale** menu, select **Autoscale**.

The S22 measurement trace is displayed in Window 3.

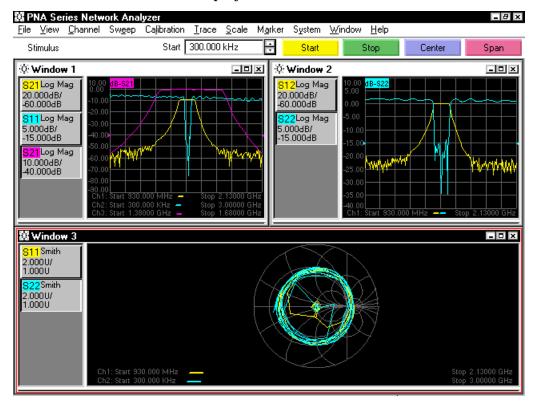

3-20 Chapter 3


Making Basic Measurements using the Front Panel Keypad

This procedure guides you through setting up measurements using the front panel keypad. Measurements are set up in a variety of ways, using multiple traces, channels, and windows. A calibration procedure is also demonstrated using this procedure.


Set Up the Measurement

1. From the **TRACE SETUP** block, press **Preset**.

Notice in the trace status bar, on the left of your network analyzer screen, that the network analyzer is set up to make S11 measurements.

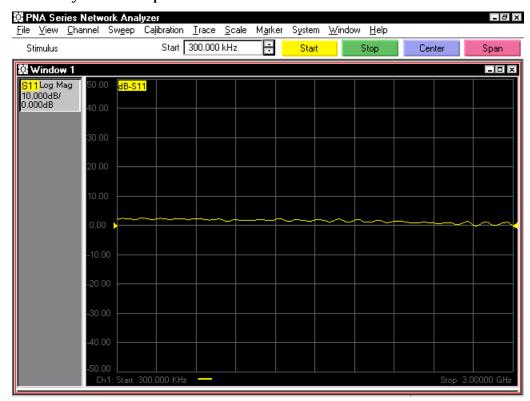


2. Connect the DUT to the network analyzer. In this example, the DUT is a bandpass filter with a center frequency of approximately 1.53 GHz.

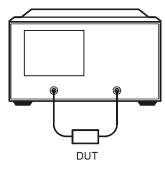

jc849a

3. From the **TRACE SETUP** block, press **Measure**. From the **NAVIGATION** block, press **F2 (S21)**.

The network analyzer now displays a different trace. Also notice that the trace status bar displays an S21 measurement.

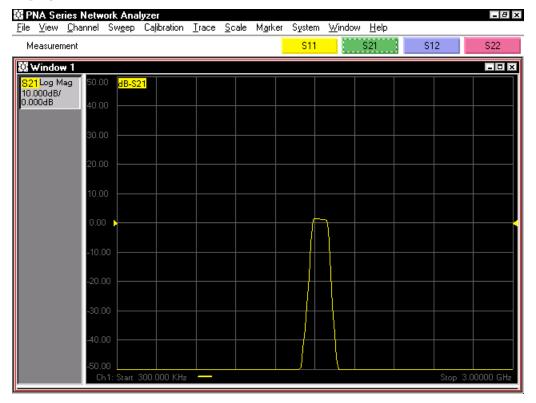


3-22 Chapter 3

4. From the **CHANNEL SETUP** block, press **Start/Center**. From the **NAVIGATION** block, press **F3** (**Center**). From the **ENTR**Y block, press **1.53 G/n** to center the 1.53 GHz pass band. To set the span to 1.2 GHz, press **F4** (**Span**) and enter **1.2 G/n**.

NOTE

Units keys (**G/n**, **M/** μ , or **Enter**) completes the value selection, assigning a unit of measurement. The **G/n** units key defines **G** as the units being input times 10^9 and **n** as the units being input times 10^{-9} . The **M/** μ units key defines **M** as the units being input times 10^6 and μ as the units being input times 10^{-6} . **Enter** has no multiplication factor.

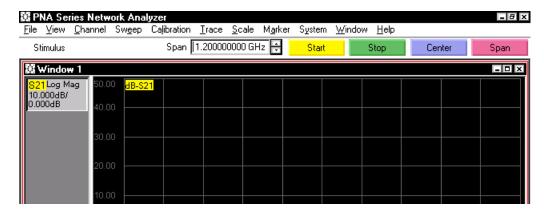


5. From the **TRACE SETUP** block, press **Scale**. Press **F2** (**Scale**). From the **ENTRY** block, press **20**, **Enter** to set the scale to 20 dB/division. Press **F3** (**Ref Level**). Press **-60**, **Enter** to set the reference level to -60 dB.


Note that **Scale**, **F1** (**Autoscale**) could have been selected to have the network analyzer automatically set the scale.



6. From the **CHANNEL SETUP** block, press **Sweep Setup**. Press F3 (**Bandwidth**). From the **NAVIGATION** block, press Up Arrow or Down Arrow until the bandwidth is set to 10 kHz.

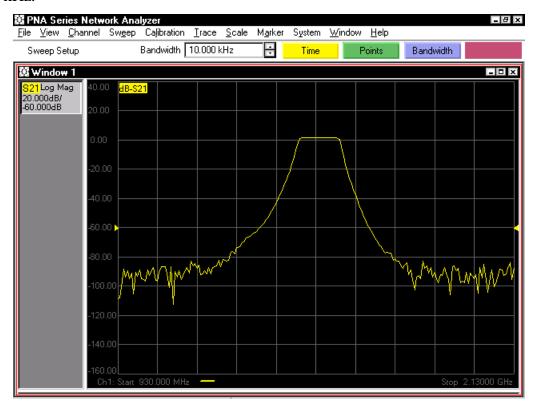


7. Disconnect the test cables from the DUT.

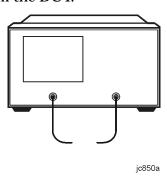

3-24 Chapter 3


Calibrate the Setup

- 1. In the Calibration menu, click Calibration Wizard.
- 2. From the CHANNEL SETUP block, press Cal. Press F1 (Cal Wizard).
- 3. In the **Cal Wizard** window, press Right Tab until the **Cal Type** button is selected. From the **NAVIGATION** block, press **Click**.

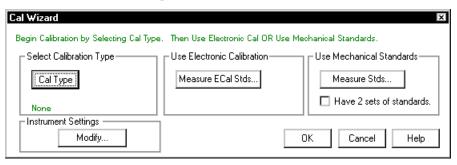


NOTE An item is selected when a dotted line is displayed around the item label. As an example, in the illustration above, **Cal Type** is selected.


4. In the **Select Calibration Type** window, press Up Arrow or Down Arrow until **Full SOLT 2-Port** is selected. The Short-Open-Load-Thru (SOLT) 2-port calibration calibrates for reflection and transmission measurements in both the forward and reverse directions. Press **OK**.

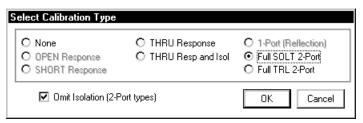


5. In the **Cal Wizard** window, press Right Tab until **Measure Stds** is selected for using a mechanical calibration kit. Then, press **Click**.

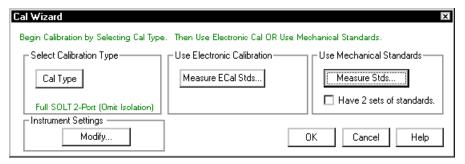


6. Press Right Tab until Select Cal Kit is selected. Then, press Click.

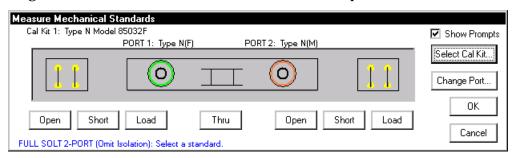

7. In the **Select Mechanical Cal Kit for Calibration** window, select the appropriate mechanical calibration kit. In this example, each end of the test cable is a type N (M) connection, press Up Arrow or Down Arrow until **Kit ID 3 Type N (M) Type N Model 85032B** is selected. Press **OK**.

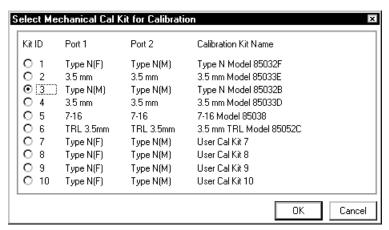


8. In the **Measure Mechanical Standards** window, the short, open, load, and thru standards are measured by selecting the button for each. So to calibrate the first standard, press Right Tab until the **Open** button for Test Port 1 is selected and press **Click**.

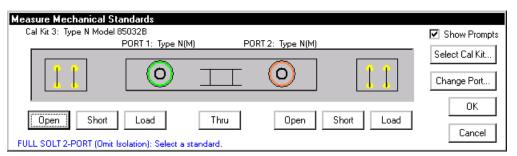

3-26 Chapter 3

9. Connect the standards as prompted in the **Connect Calibration Standard** window and then press **Click**. After each standard has been measured, a check mark is displayed above the corresponding button in the **Measure Mechanical Standards** window.



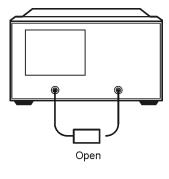


ic851a

10. Repeat the previous two steps, calibrating the remaining standards from left to right, following the prompts as each standard is selected.


NOTE

If you inadvertently use the wrong setup during the calibration, you do not have to recalibrate all of the standards again. Rerun the calibration for the individual standard and the correct data will be saved.

11. After all standards have been measured, press OK.

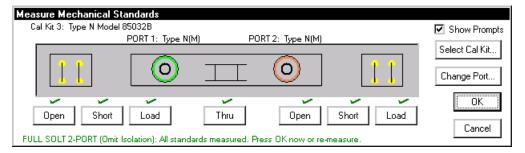

12. In the Cal Wizard window, press OK.

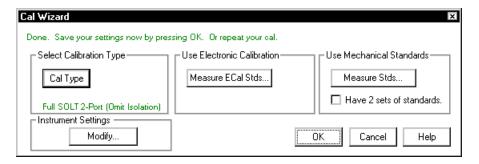


13. A **Calibration Information** window is displayed showing that the calibration data is being saved along with the path and file name of the data. Press **OK**.




After the calibration is complete, the network analyzer returns to the measurement mode.

14. Reattach the cables to the DUT.

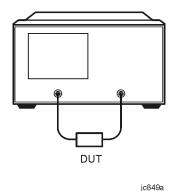

The network analyzer is now making a calibrated S21 measurement of the DUT.

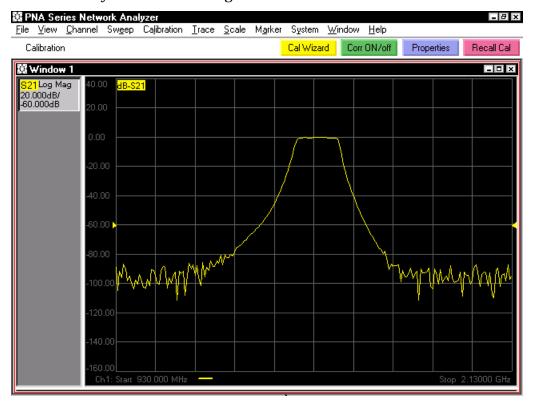


3-28 Chapter 3

Display a Second Window with Two Measurement Traces

This procedure displays a second window. This second window will display two measurements (S12 and S22) on the same channel.

- 1. From the **DISPLAY** block, press **Window**, then press **F1** (**New**).
- 2. From the **TRACE SETUP** block, press **Measure** then press **F3** (**S12**).
- 3. From the **TRACE SETUP** block, press **Scale** then press **F1** (**Autoscale**).


Two windows are displayed. Window 1, the original window with a S21 measurement, is displayed above Window 2, the new window with S12 measurement.

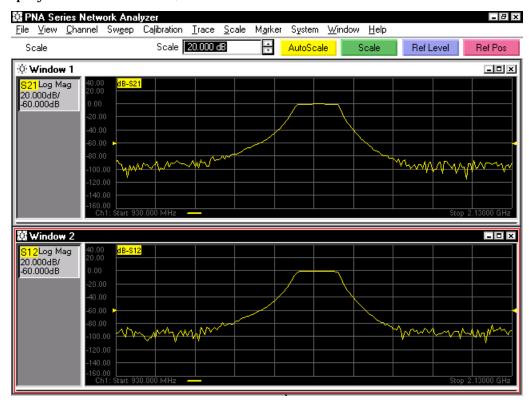

Now, add the second measurement, a S22 measurement trace, to Channel 1 of Window 2.

4. From the **DISPLAY** block, press **Trace** then press **F1** (**New**).

5. Press Menu/Dialog. Press Right Tab until the Trace menu is displayed. Press Down Arrow until Measure is selected, then press Click. Press Down Arrow until S22 is selected, then press Click.

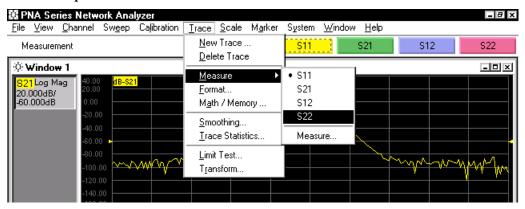

NOTE

This step performs a similar task as was performed in step 2 of this section. However, performing the task in this manner provides the same flexibility (through the menu bar) as if you were performing the task with a mouse using the menu bar.

6. From the **TRACE SETUP** block, press **Scale** then press **F1** (**Autoscale**).

Window 1, with a S21 measurement, is displayed above Window 2, with a S12 and a S22 measurement.



3-30 Chapter 3

Display Multiple Channels in a Window


This procedure displays two additional measurement traces to Window 1. These two new measurements (S11 and a second S21) are displayed on separate channels.

1. From the **DISPLAY** block, press **Window** to select Window 1. Then, press **F2** (**Next Window**).

Notice that the title bar of the window is dark with light text when the window is selected.


Now, add a S11 measurement to the window. This S11 measurement is displayed on channel 2.

2. From the **COMMAND** block, press **Menu/Dialog**. Press Right Tab until the **Channel** menu is displayed. Press Down Arrow until **Channel** is selected, then press **Click**. Press Down Arrow until **Channel 2** is selected, then press **Click**.

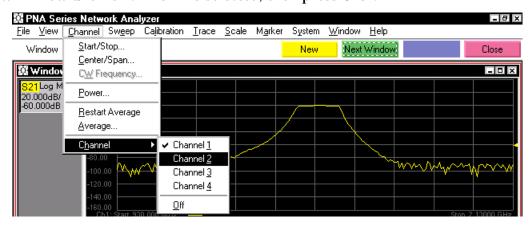

3. From the TRACE SETUP block, press Scale then press F1 (Autoscale).


The S11 trace is now displayed on the screen grid and indicated on the trace bar. Also notice that near the bottom of the Window 1 screen grid, channel 1 and channel 2 settings are displayed, along with a color indicator to quickly distinguish between the traces.

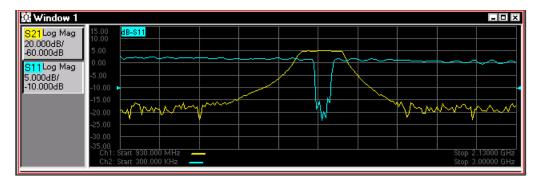


Now, add another S21 measurement to the display. This S21 measurement is displayed in a narrow span on channel 3.

- 4. Press Channel, F3 (Ch 3) to display a measurement trace on Channel 3.
- 5. Change the channel 3 trace to an S21 measurement by pressing Measure, F2 (S21).
- 6. Change the channel 3 center frequency to 1.53 GHz and span to 300 MHz. From the **CHANNEL SETUP** block, press **Start/Center**, then press **F3 (Center**). From the **ENTRY** block, press **1.53 G/n** to center the 1.53 GHz pass band. To set the span to 300 MHz, press **F4 (Span)** and then press **300 M/**μ.
- 7. Scale the trace by pressing **Scale**, **F1** (**Autoscale**).

Note that three measurement traces are displayed in Window 1. The trace bar indicates that there are two S21 measurements (one in wide and one in narrow span) and an S11 measurement. Also, near the bottom of Window 1, the three traces and their start/stop frequencies are listed along with their color indicator.

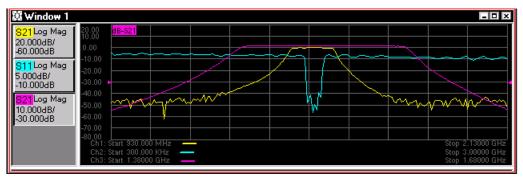

8. If the two S21 measurements are difficult to view, press **Scale**, **F3** (Ref Level) and turn the front panel knob until both traces can be seen clearly.

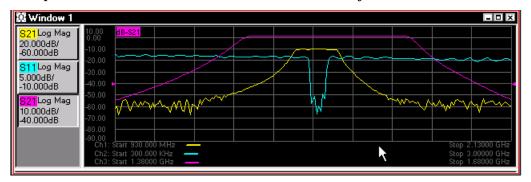


3-32 Chapter 3

Display a Third Window with a Different Format

This procedure displays two reflection measurement traces in a third Window. The two measurement traces are S11 and S22 displayed in Smith Chart Format.

1. Display a new window by pressing Window, F1 (New).

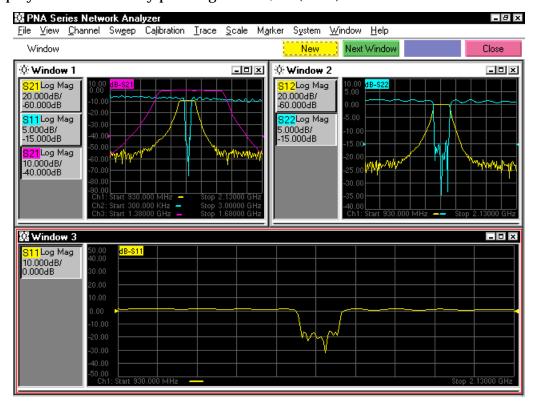


The first two windows are displayed side by side and Window 3, the new window, is displayed across the bottom of the screen grid.

2. If the measurement in Window 3 is not already set up as an S11 measurement, press Measure, F1 (S11).


Now, change the trace format in Window 3 from LogMag format to Smith Chart format.

- 3. Press Menu/Dialog. Press Right Tab until the **Trace** menu is displayed. Press Down Arrow until **Format** is selected, then press **Click**.
- 4. In the **Format** window, press Down Arrow until **Smith Chart** is selected, then press **OK**.

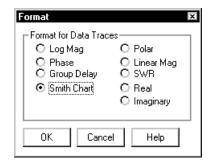

5. Scale the trace by pressing Scale, F1 (Autoscale).


The S11 measurement is now displayed in Smith chart format in Window 3.

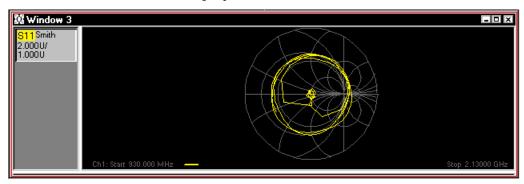

Now, add the second measurement, an S22 measurement to the window.

- 6. Display a new trace by pressing Trace, F1 (New).
- 7. Set the measurement to S22 by pressing Measure, F4 (S22).
- 8. Scale the trace by pressing Scale, F1 (Autoscale).

The S22 reflection measurement trace is now displayed in Window 3.

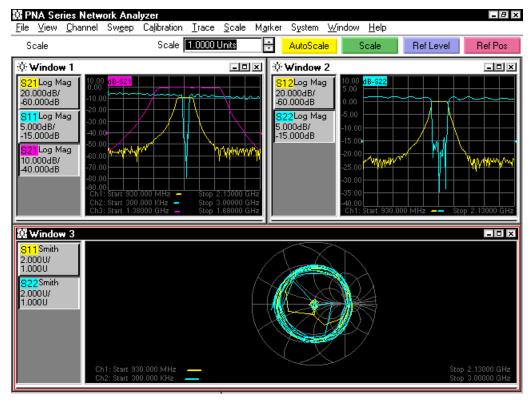


3-34 Chapter 3

4 Becoming Familiar with Help


This chapter explains how to use the PNA Series RF Network Analyzer Help resources. The PNA Series RF Network Analyzer Help is provided in three distinct formats. These formats are:

- "Network Analyzer Product Overview" on page 4-3
- "Network Analyzer Help" on page 4-4
- "Network Analyzer Help on the Web" on page 4-13

These Help formats are accessed by clicking the desired format from the **Help** menu.

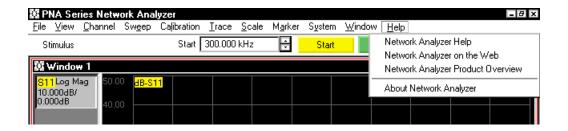


One additional feature of the **Help** menu is the **About Network Analyzer** window that displays specific information about your network analyzer. Although this window is not directly a part of the Help system, it contains information that you may need to know. The **About Network Analyzer** window is shown below.

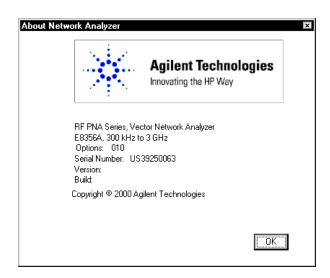

4-2 Chapter 4

Network Analyzer Product Overview

The PNA Series RF Network Analyzers Product Overview is a multimedia presentation that will show you how the PNA series RF network analyzer can help you make the measurements that you need.

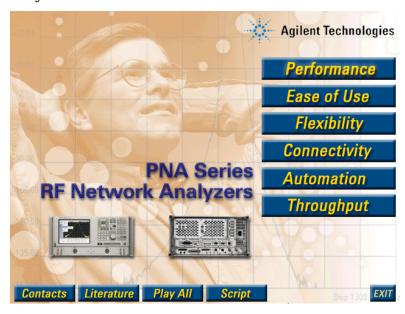

This presentation consists of six, self-contained topics related to the PNA series network analyzer. At any point during the presentation, you may stop the presentation and return to the main product overview screen. The total time for the entire presentation is approximately 20 minutes.

The six presentation topics are:

- Performance
- Ease of Use
- Flexibility
- Connectivity
- Automation
- Throughput

Start any topic by clicking the title with the mouse.

There are four additional selections to help you with the PNA series network analyzer:

Contacts provides a telephone number to contact an Agilent Technologies

representative based on your geographical location.

Literature provides a list of PNA-series product literature and application notes for

your use in pdf format.

Play All starts the PNA series multimedia presentation. The six topics are played

consecutively.

Script displays the PNA series multimedia presentation script in pdf format.

Chapter 4 4-3


Network Analyzer Help

The network analyzer help system contains five distinct ways of finding information about the PNA series network analyzer. The five ways of finding information are:

- Home Page
- Index (keyword search)
- Table of Contents
- Glossary
- Context-sensitive Help

Using the Help Home Page to Find Information

The Network Analyzer Help Home page is a good way to find information about general topics. Clicking one of the eight topics or icons listed on the Home page displays a page specific to that topic which lists even more specific information topics.

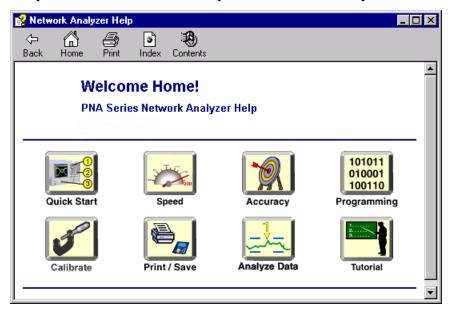


Each of the eight general topics is described throughout the remainder of this section.

4-4 Chapter 4


Quick Start

The Quick Start selection presents information on getting started with the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

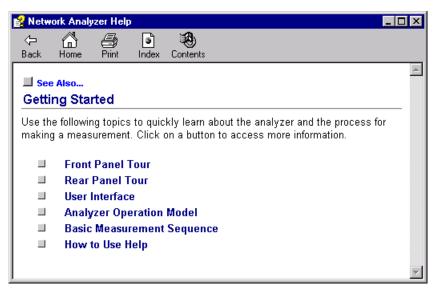

Speed


The Speed selection presents information on increasing measurement throughput using the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

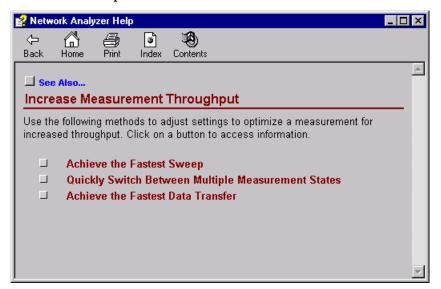

Chapter 4 4-5


Accuracy

The Accuracy selection presents information on improving measurement accuracy using the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

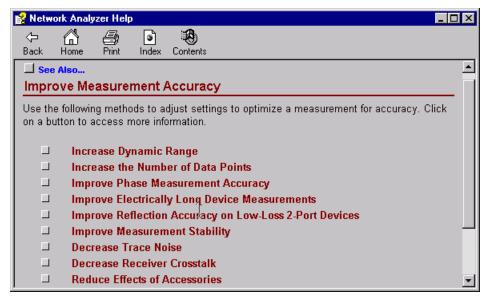

Programming


The Programming selection presents information on programming the PNA series network analyzer using SCPI and COM commands. Click the indicator to the left of each topic, for SCPI commands and for COM commands, to access the specific information about that topic.

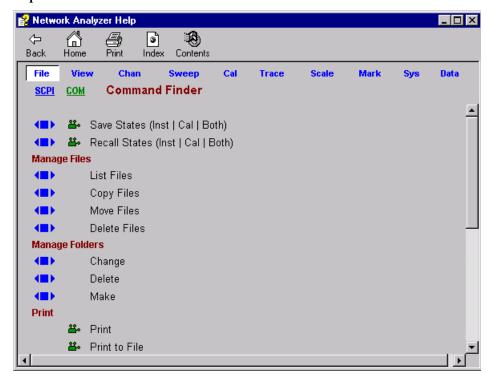

4-6 Chapter 4


Calibrate

The Calibrate selection presents information on performing a measurement calibration on the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

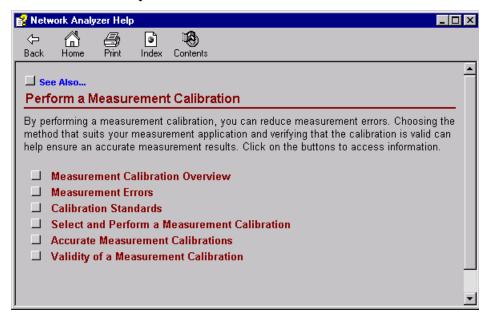

Print/Save


The Print/Save selection presents information on printing, saving, and recalling data using the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

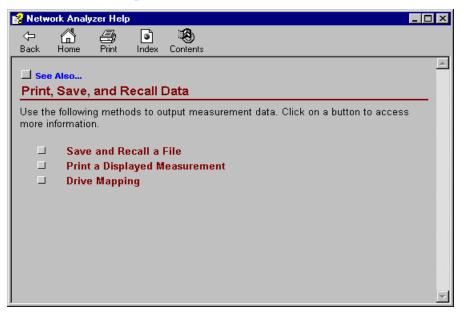

Chapter 4 4-7


Analyze Data

The Analyze Data selection presents information on analyzing data using the PNA series network analyzer. Click the box to the left of each topic to access the specific information of that topic.

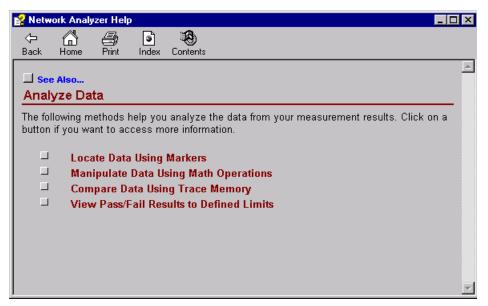

Tutorial


The Tutorial selection presents information to help you understand and perform various network analyzer measurements. Click the box to the left of each topic to access the specific information of that topic.

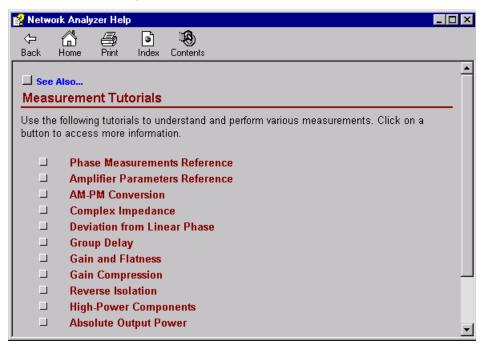

4-8 Chapter 4

Using the Index (Keyword Search) to Find Information

Click **Index** on the Network Analyzer Help title bar to open the index. The index can also be opened by clicking the **Index** button at the top of the **Contents** window.

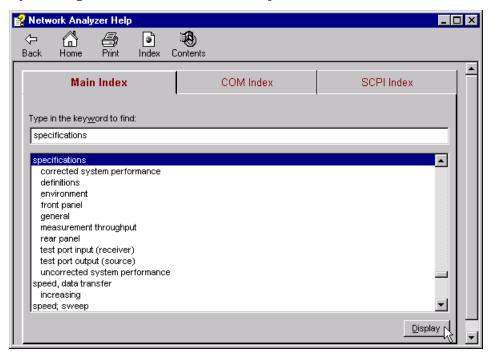


Find information using the index by typing a topic in the **Type in the keyword to find** box. Find and select the exact topic in the list of index topics displayed below the **Type in the keyword to find** box. Then, click **Display** to view the topic.

After clicking the **COM Index** tab or the **SCPI Index** tab at the top of the page, programming information can be found using the same method described above.

Chapter 4 4-9

Using Contents to Find Information

Click **Contents** on the Network Analyzer Help title bar to access the list of contents.

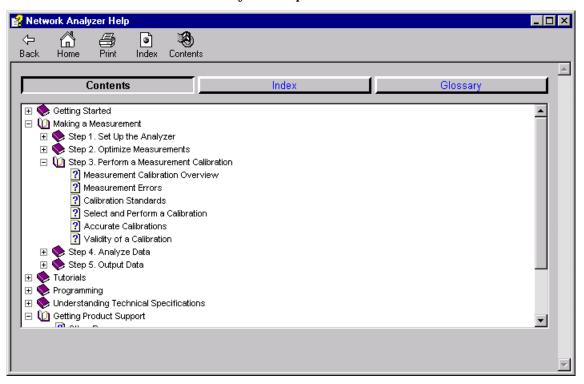


A list of contents is displayed listing the title of general topics. Each topic is preceded by an icon.

- **If the icon is a closed book**, double-click the icon to display a list of more specific topics related to the topic at the right of the icon. (This icon is preceded by a box containing "+" indicating there is information that is not displayed.)
- **If the icon is an open book**, double-click the icon to close the list of topics related to the topic at the right of the icon. (This icon is preceded by a box containing "—" indicating all information is displayed.)
- **If the icon is a page with a "?"**, double-click the icon to display specific information related to the topic at the right of the icon.

4-10 Chapter 4

Using the Glossary to Find Information

Double-click **Glossary** from the **Contents** list to open the glossary. The glossary can also be opened by clicking the **Glossary** button at the top of the **Contents** window.

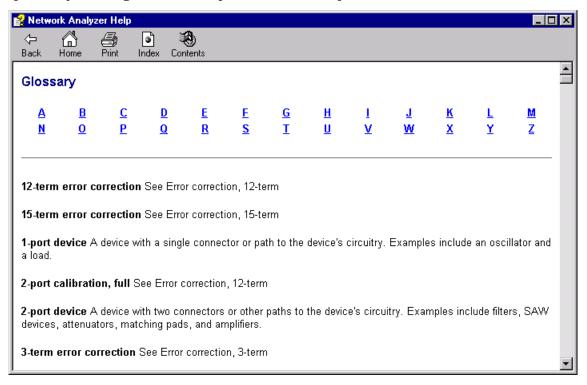


From the list of letters across the top of the **Glossary** page, click a letter to access glossary terms that begin with that letter. You may also scroll through the list using the scroll bar on the right.

Chapter 4 4-11

Using the Context-sensitive Help to Find Information


Click **Help** in any network analyzer window, to access the context-sensitive Help information. Clicking **Help** presents information related to the window. If related information is available, you may click **See Also** in the **Help** window.

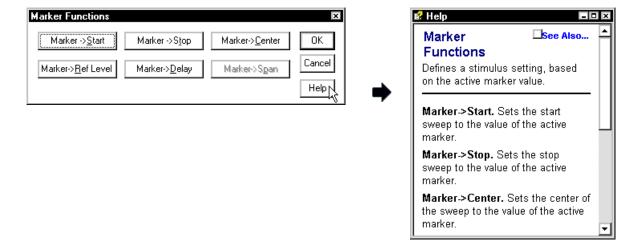

4-12 Chapter 4

Network Analyzer Help on the Web

The Agilent PNA Series Network Analyzer System Web page is another resource for help with the network analyzer.

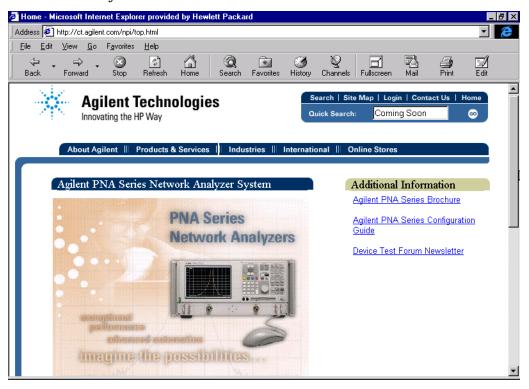

This Web page has links to:

- Web pages for each PNA series network analyzer product
 These Web pages describe and list the features of the specific network analyzer.
- Equipment used by PNA series network analyzers
 This equipment includes:
 - Accessories
 - Cables
 - Calibration and Verification Kits
- Literature related to PNA series network analyzers

This literature is in pdf format and includes:

- PNA Series Network Analyzer Product Brochure
- PNA Series Network Analyzer Configuration Guide
- Device Test Forum Newsletter

The Web page also has links to the rest of the Agilent Technologies Web site where you can find a variety of information. Some topics include online manuals, service notes, product information, and training that is being offered.

Chapter 4 4-13

5 Safety and Regulatory Information

This chapter provides safety information that will help protect you and your network analyzer. It also contains information that is required by various government regulatory agencies. General information is also listed in this chapter which includes information about cleaning, finding assistance with repairs, and information that you will need to ship your network analyzer to Agilent Technologies for repair.

5-2 Chapter 5

General Information

This section includes information about cleaning, finding assistance with repairs, and information that you will need to ship your network analyzer to Agilent Technologies for repair.

Maintenance

To remove dirt or dust from the external case of the network analyzer, clean the case using a dry or slightly-dampened cloth only.

WARNING

To prevent electrical shock, disconnect the Agilent Technologies E8356A/E8357A/E8358A from mains before cleaning. Use a dry cloth or one slightly dampened with water to clean the external case parts. Do not attempt to clean internally.

Assistance

Product maintenance agreements and other customer assistance agreements are available for Agilent Technologies products.

For any assistance, contact your nearest Agilent Technologies Sales and Service Office. Refer to Table 5-1 on page 5-4.

Shipment for Service

If you are sending the instrument to Agilent Technologies for service, ship the analyzer to the nearest Agilent Technologies service center for repair, including a description of any failed test and any error message. Refer to Table 5-1 for a list of Agilent Technologies sales and service offices.

Ship the analyzer using the original or comparable antistatic packaging materials.

Table 5-1 Agilent Technologies Sales and Service Offices

UNITED STATES

Instrument Support Center Agilent Technologies Company (800) 403-0801

EUROPEAN FIELD OPERATIONS

Headquarters Agilent Technologies S.A. 150, Route du Nant-d'Avril 1217 Meyrin 2/ Geneva

Switzerland (41 22) 780.8111 France **Agilent Technologies France** 1 Avenue Du Canada Zone D'Activite De Courtaboeuf F-91947 Les Ulis Cedex

France (33 1) 69 82 60 60

Germany Agilent Technologies GmbH **Agilent Technologies Strasse** 61352 Bad Homburg v.d.H Germany (49 6172) 16-0

Great Britain Agilent Technologies Ltd. Eskdale Road, Winnersh Triangle Wokingham, Berkshire **RG41 5DZ England** (44 118) 9696622

INTERCON FIELD OPERATIONS

Headquarters **Agilent Technologies Company** 3495 Deer Creek Rd. Palo Alto, CA 94304-1316

USA

(415) 857-5027

Australia Agilent Technologies Australia Ltd. 31-41 Joseph Street

Blackburn, Victoria 3130 (61 3) 895-2895

Canada

Agilent Technologies (Canada)

Ltd.

17500 South Service Road Trans-Canada Highway Kirkland, Quebec H9J 2X8

Canada (514) 697-4232

Japan

Agilent Technologies Japan, Ltd. Measurement Assistance Center 9-1 Takakura-Cho, Hachioji-shi Tokyo 192-8510, Japan TEL (81)-426-56-7832 FAX (81)-426-56-7840

Singapore

Agilent Technologies Singapore (Pte.) Ltd. 150 Beach Road #29-00 Gateway West Singapore 0718 (65) 291-9088

Taiwan

Agilent Technologies Taiwan 8th Floor, H-P Building 337 Fu Hsing North Road

Taipei, Taiwan (886 2) 712-0404

China

(86 1) 256-6888

China Agilent Technologies Co. 38 Bei San Huan X1 Road Shuang Yu Shu Hai Dian District Beijing, China

5-4 Chapter 5

Safety Symbols

The following safety symbols are used throughout this manual. Familiarize yourself with each of the symbols and its meaning before operating this instrument.

WARNING	Warning denotes a hazard. It calls attention to a procedure which, if
CAUTION	Caution denotes a hazard. It calls attention to a procedure that, if not correctly performed or adhered to, would result in damage to or destruction of the product. Do not proceed beyond a caution note until the indicated conditions are fully understood and met.

not correctly performed or adhered to, could result in injury or loss of life. Do not proceed beyond a warning note until the indicated conditions are fully understood and met.

General Safety Considerations

Safety Earth Ground

WARNING	This is a Safety Class I Product (provided with a protective earthing ground incorporated in the power cord). The mains plug shall only be inserted in a socket outlet provided with a protective earth contact. Any interruption of the protective conductor, inside or outside the product, is likely to make the instrument dangerous. Intentional interruption is prohibited.	
CAUTION	Always use the three-prong AC power cord supplied with this product. Failure to ensure adequate earth grounding by not using this cord may cau product damage.	
Before A	Applying Power	
WARNING	If this product is not used as specified, the protection provided by the equipment could be impaired. This product must be used in a normal condition (in which all means for protection are intact) only.	
WARNING	If an instrument handle is damaged, you should replace it immediately. Damaged handles can break while you are moving or lifting the instrument and cause personal injury or damage to the instrument.	
CAUTION	This instrument has autoranging line voltage input. Be sure the supply voltage is within the specified range.	
CAUTION	This product is designed for use in Installation Category II and Pollution Degree 2 per IEC 1010 and 664 respectively.	
CAUTION	Ventilation Requirements: When installing the product in a cabinet, the convection into and out of the product must not be restricted. The ambient temperature (outside the cabinet) must be less than the maximum operating temperature of the instrument by 4 $^{\circ}$ C for every 100 watts dissipated in the cabinet. If the total power dissipated in the cabinet is greater than 800 watts, then forced convection must be used.	

5-6 Chapter 5

Servicing

WARNING	These servicing instructions are for use by qualified personnel only. To avoid electrical shock, do not perform any servicing unless you are qualified to do so.
WARNING	No operator serviceable parts inside. Refer servicing to qualified personnel. To prevent electrical shock, do not remove covers.
WARNING	The opening of covers or removal of parts is likely to expose dangerous voltages. Disconnect the instrument from all voltage sources while it is being opened.
WARNING	The power cord is connected to internal capacitors that may remain live for 5 seconds after disconnecting the plug from its power supply.

Regulatory Information

This section contains information that is required by various government regulatory agencies.

Instructions for Use

This product has been designed and tested in accordance with IEC Publication 1010, Safety Requirements for Electronic Measuring Apparatus, and has been supplied in a safe condition. The instruction documentation contains information and warnings that must be followed by the user to ensure safe operation and to maintain the product in a safe condition.

Install the instrument so that the detachable power cord is readily identifiable and is easily reached by the operator.

The detachable power cord is the instrument disconnecting device. It disconnects the mains circuits from the mains supply before other parts of the instrument. **The front panel switch is only a standby switch and is not a LINE switch (disconnecting device).**

An externally installed switch or circuit breaker (which is readily identifiable and is easily reached by the operator) may be used as a disconnecting device.

5-8 Chapter 5

Instrument Markings



The instruction documentation symbol. The product is marked with this symbol when it is necessary for the user to refer to the instructions in the documentation.



The CE mark is a registered trademark of the European Community.



The CSA mark is a registered trademark of the Canadian Standards Association.



The C-Tick mark is a registered trademark of the Australian Spectrum Management Agency.



This is a symbol of an Industrial Scientific and Medical Group 1 Class A product.

The ON, OFF, and STANDBY symbols are used to mark the positions of the instrument power line switch. The AC symbol is used to indicate the required nature of the line module input power.

ON symbol — ON symbol

STANDBY symbol
 □ OFF symbol

OFF symbol \sim AC (alternating current) symbol

Declaration of Conformity

DECLARATION OF CONFORMITY

According to ISO/IEC Guide 22 and CEN/CENELEC EN 45014

Manufacturer's Name: Agilent Technologies, Inc.

Manufacturer's Address: 1400 Fountaingrove Parkway

Santa Rosa, CA 95403-1799

USA

Declares that the products

Product Name: PNA Series RF Network Analyzer

Model Number: E8356A, E8357A, E8358A

Product Options: This declaration covers all options of the above

products.

Conform to the following product specifications:

EMC: IEC 61326-1:1997+A1:1998 / EN 61326-1:1997+A1:1998

Standard Limit CISPR 11:1990 / EN 55011-1991 Group 1, Class A IEC 61000-4-2:1995+A1998 / EN 61000-4-2:1995 4 kV CD, 8 kV AD IEC 61000-4-3:1995 / EN 61000-4-3:1995 3 V/m, 80 - 1000 MHz 0.5 kV sig., 1 kV power IEC 61000-4-4:1995 / EN 61000-4-4:1995 IEC 61000-4-5:1995 / EN 61000-4-5:1996 0.5 kV L-L, 1 kV L-G IEC 61000-4-6:1996 / EN 61000-4-6:1998 3 V, 0.15 – 80 MHz IEC 61000-4-11:1994 / EN 61000-4-11:1998 1 cycle, 100%

Safety: IEC 61010-1:1990 + A1:1992 + A2:1995 / EN 61010-1:1993 +A2:1995

CAN/CSA-C22.2 No. 1010.1-92

Supplementary Information:

The products herewith comply with the requirements of the Low Voltage Directive 73/23/EEC and the EMC Directive 89/336/EEC and carry the CE-marking accordingly.

Santa Rosa, CA, USA 18 August 2000

Greg Pfeiffer/Quality Engineering Manager

For further information, please contact your local Agilent Technologies sales office, agent or distributor.

5-10 Chapter 5

Compliance with German Noise Requirements

This is to declare that this instrument is in conformance with the German Regulation on Noise Declaration for Machines (Laermangabe nach der Maschinenlaermrerordung –3.GSGV Deutschland).

Acoustic Noise Emission/Geraeuschemission		
LpA<70 dB	Lpa<70 dB	
Operator Position	am Arbeitsplatz	
Normal Operation	normaler Betrieb	
per ISO 7779	nach DIN 45635 t. 19	

Symbols	Average key, 2-9	configuration guide, 4-13
+/- key, 2-11	В	connecting USB accessories, 1-16-1-22
. key, 2-11		connectivity, 4-3
NT .	backspace key, 2-11	connectors, rear panel, 2-12-2-14
Numerics	backup	contents, Help table of, 4-10
015, Option (configurable test	user description, 1-40	context-sensitive Help, 4-12
set), 2-4	window, opening the, 1-32 bandwidth, setting IF, 3-6, 3-24	Control Panel, opening, 1-37
10 MHz reference	basic measurements, 4-5	conversion, AM-PM, 4-8
input connector, 2-12	before applying power, 5-6	cover, removing, 5-7
output connector, 2-13	bench top set up, 1-8	crosstalk, 4-6
1CM, Option (rack mount kit	brochures, 4-13	CSA mark, 5-9
without handles), 1-5, 1-13 1CP, Option (rack mount kit with	,	C-Tick mark, 5-9
handles), 1-5, 1-10	C	_
nanacs), 1 5, 1 10	cable	D
A	AC power, 1-4	dangerous voltage, 5-7
	external trigger, 1-4	data
About Network Analyzer, 4-2	information, 4-13	analyzing, 4-8
absolute output power, 4-8	Cal key, 2-9	comparing, 4-8
AC	calibrate, 4-7	fast transfer, 4-5
input, 2-13 power cord, 1-4, 1-6, 1-24	calibration	manipulating, 4-8
symbol, 5-9	data, saving, 3-11, 3-28	points, increasing the number
access levels, 1-40	kit, 3-9, 3-26, 4-13	of, 4-6
accessory	performing a, 3-8-3-11,	printing, 4-7
information, 4-13	3-25-3-28	recalling, 4-7 saving, 4-7
part numbers, 1-4	standards, 4-7	saving, 4-7 saving calibration, 3-11, 3-28
reducing the effect of an, 4-6	measuring, 3-10, 3-27	date, setting the, 1-28
accuracy, 4-6	type, 3-8, 3-25	daylight savings time, 1-28
calibration, 4-7	validity, 4-7	decimal key, 2-11
active entry toolbar, 2-6	wizard, 3-8, 3-25	declaration of conformity, 5-10
adapter, parallel port, 1-4	Cancel key, 2-9	definition of terms, 4-11
adding new users, 1-37–1-44	cautions, 5-5	delay, group, 4-8
administrative tasks, 1-31	CD POM drive 1.5	disk
administrator	CD-ROM drive, 1-5 CE mark, 5-9	drive, 2-4
description, 1-40	center frequency	mapping a, 4-7
password, 1-27	entering, 3-5, 3-23	emergency repair, 1-31
Agilent	Certificate of Authenticity, 1-26	inserting a floppy, 1-33
address, 5-4	changing display formats,	removing a floppy, 1-34
telephone number, 4-3, 5-4 Web site, 4-13	3-18-3-20, 3-33-3-34	display, 2-4, 2-6–2-7
agreement, license, 1-25	channel attributes, 3-2	features, 2-2
altitude, 1-6	Channel key, 2-9	formats, 3-19, 3-33
amplifier parameters, 4-8	Channel Setup keys, 2-9	Display keys, 2-9
AM-PM conversion, 4-8	channels, multiple measurement,	displaying multiple measurement channels, 3-15-3-17,
analyzing data, 4-8	3-15-3-17, 3-31-3-32	3-31–3-32
application notes, 4-3	check, operator's, 1-45	down arrow key, 2-8
Arrange key, 2-9	cleaning, 5-3	dynamic range, 4-6
assistance, 5-3	Click key, 2-8	dynamic range, 10
Authenticity, Certificate of, 1-26	COM programming Help 4.6	E
automatic log on, 1-42	COM1 connector 2 12	
automation, 4-3	COM1 connector, 2-13	earth ground, 1-6, 5-6
autoscale, 3-13, 3-29	Command keys, 2-9 comparing data, 4-8	ease of use, 4-3 ECAL module, connecting an,
autoscale all, 3-13	complex impedance, 4-8	1-19
auxiliary	compression, gain, 4-8	electrical requirements, 1-6
I/O connector, 2-14	computer name, 1-27	electrically long devices, 4-6
output connectors, 2-4	configurable test set option, 2-4	emergency repair disk
	O	O

Index Index-1

creating, 1-31–1-36 Enter key, 2-11 Entry keys, 2-11 environmental requirements, 1-6 external AM input connector, 2-12 detector input connector, 2-12 trigger cable, 1-4 F F1, F2, F3, F4 keys, 2-8 fast data transfer, 4-5 fast sweep, 4-5 find data, 4-8 firmware version, 4-2 flange kit, 1-5 installation, 1-10, 1-13 flatness, 4-8 flexibility, 4-3 floppy disk drive, 2-4 Format key, 2-10 formats changing display, 3-18–3-20, 3-33–3-34 display, 3-19, 3-33 frequency entering a, 3-5, 3-23 terminator, 3-5 front panel, 2-4, 2-4–2-11 display, 2-6–2-7 features, 2-2 keys, 2-8–2-11	Help button, 4-12 context-sensitive, 4-12 glossary, 4-11 homepage, 4-4 how to use, 4-5 index, 4-9 key, 2-9 on the Web, 4-13 printed version, 1-5 starting, 4-2 table of contents, 4-10 hibernate, 2-4 hibernation, 1-23 high-power components, 4-8 hub, 1-5 connecting a USB, 1-19, 1-20 USB, 1-16 humidity, 1-6 I IF bandwidth, setting, 3-6, 3-24 impedance, 4-8 index, Help system, 4-9 inserting a disk into the disk drive, 1-33 instruction documentation symbol, 5-9 instrument markings, 5-9 ISM1-A mark, 5-9 isolation, reverse, 4-8	automatically, 1-42 without passwords, 1-42 M M/u key, 2-11 Macro/Local key, 2-10 main index, 4-9 maintenance, 5-3 agreement, 5-3 manipulating data, 4-8 manuals, online, 4-13 mapping a disk drive, 4-7 Marker Function key, 2-10 Marker key, 2-10 Marker Search key, 2-10 marker toolbar, 2-7 markers, using, 4-8 math operations, 4-8 Math/Memory key, 2-10 Measure key, 2-10 Measure key, 2-10 Measure key, 2-10 Measure Setups key, 2-9 measurement calibration, 4-7 errors, 4-7 multiple channels, 3-15-3-17, 3-31-3-32 selecting, 3-4, 3-22 toolbar, 2-7 windows, opening, 3-12-3-14, 3-29-3-30
G	keyboard, 1-4 connecting a USB, 1-17, 1-21	using a mouse and keyboard, 3-3-3-20
G/n key, 2-11	keypad, 2-4, 2-8–2-11	using the keypad, 3-21-3-34
gain, 4-8	features, 2-2	mechanical calibration kit, 3-9, 3-26
gain compression, 4-8	keyword search, 4-9	memory, trace, 4-8
general purpose interface bus. See GPIB	kits, calibration and verification, 4-13	menu titles, 2-6
general safety considerations, 5-6	knob, front panel, 2-11	Menu/Dialog key, 2-9 minimizing the network analyzer
German noise requirements, 5-11 glossary, 4-11	L	application, 1-31
GPIB connector, 2-14	LAN	model number, 4-2 mouse, 1-4
graticule, 2-7	computer name, 1-27	connecting a USB, 1-17, 1-21
ground, 1-6 safety earth, 5-6	connector, 2-13	multimedia presentation, 4-3
group delay, 4-8	left tab key, 2-8 license agreement, 1-25	N.T
guest description, 1-40	Limit Table key, 2-10	N
н	limits, defined, 4-8	name, computer, 1-27 Navigation keys, 2-8
handle	linear phase deviation, 4-8 literature, product, 4-3	network analyzer application
damaged, 1-8, 1-11, 5-6	local area network. See LAN	minimizing, 1-31, 1-37
installation, 1-8, 1-10	locate data, 4-8	restoring, 1-35 new users, adding, 1-37–1-44
kit part number, 1-4	logging on, 1-25–1-29	newsletter, 4-13
		iicwsicter, 4 10

Index-2

noise requirements, 5-11	Preset key, 2-10	S
noise, trace, 4-6	preset the analyzer, 3-3, 3-21	safety
numeric keys, 2-11	Print key, 2-10	considerations, 5-6
•	printed version of help, 1-5	earth ground, 5-6
0	printing, 4-7	symbols, 5-5
OFF symbol, 5-9	probe power connector, 2-4	sales offices, 5-4
offices, sales and service, 5-4	product	Save key, 2-10
	information, 4-13	saving
OK key, 2-9 ON symbol, 5-9	overview, 4-3	calibration data, 3-11, 3-28
On/Off switch, 1-23, 1-24, 2-4	product key, 1-26	data, 4-7
online manuals, 4-13	program	scale
opening	minimizing the analyzer, 1-31,	automatic scaling, 3-13, 3-29
Help, 4-2	1-37	setting manually, 3-5, 3-23
measurement windows,	restoring the analyzer, 1-35	Scale key, 2-10
3-12-3-14, 3-29-3-30	programming, 4-6	SCPI index, 4-9
operator's check, 1-45	index, 4-9	SCPI programming Help, 4-6
results, 1-47		screen grid, 2-7
Option, 2-4	Q	serial
015, configurable test set, 2-4	quick start, 4-5	interface bus connector, 2-13
1CM	quick start, 4-5	number, network analyzer, 4-2
installation, 1-13-1-15	R	service
rack mount kit without		guide, 1-5
handles, 1-5, 1-13	rack mount	notes, 4-13
1CP	flange kit, 1-5	offices, 5-4
installation, 1-10–1-12	rail set, 1-5	warnings, 5-7
rack mount kit with handles,	the analyzer, 1-10-1-12,	setting
1-5, 1-10	1-13-1-15	date, 1-28
optional equipment, 1-5	rail set, 1-5	time, 1-28
options, display of built-in, 4-2	installation, 1-10, 1-13	settings, regional, 1-25
output power, absolute, 4-8	rear panel	shipment
overview, 4-3	connectors, 2-12-2-14	for servicing, 5-3
0.01.10.11, 1.0	features, 2-2	verifying initial, 1-3
P	tour, 4-5	shut down, 1-23
	Recall key, 2-10	Smith chart, 3-19, 3-33
packaging materials, 5-3	recalling data, 4-7	span, entering, 3-5, 3-23
parallel	receiver crosstalk, 4-6	S-parameter, selecting an, 3-4,
interface port connector, 2-13	reference level, setting, 3-5, 3-23	3-22
port adapter, 1-4	reflection accuracy, 4-6	speed, 4-5
part numbers, accessory, 1-4	regional settings, 1-25	stability, 4-6
pass/fail results, 4-8	regulatory information, 5-8	standard user description, 1-40
password	removing	standards, calibration, 3-10, 3-27
administrator, 1-27	disk from the disk drive, 1-34	4-7
entering a user, 1-40	the cover, 5-7	standby switch, 5-8
logging on without a, 1-42	repair disk, 1-31	STANĎBY symbol, 5-9
performance, 4-3	replicator description, 1-40	Start/Center key, 2-9
phase	requirements, electrical and	starting
deviation, 4-8	environmental, 1-6	Help, 4-2
measurement accuracy, 4-6	Restore Up/Down key, 2-10	the network analyzer, 1-23
measurements, 4-8	restoring the network analyzer	status bar, 2-7
plus/minus backspace key, 2-11	application, 1-35	stimulus toolbar, 2-7
port features, 2-4	restricted user description, 1-40	Stop/Start key, 2-9
power	reverse isolation, 4-8	sweep control toolbar, 2-6
cord, 1-4, 1-6, 1-24	right tab key, 2-8	Sweep Setup key, 2-9
down, 1-23	running the operator's check,	Sweep Type key, 2-9
supply, 5-8	1-45-1-47	sweeping, fast, 4-5
switch, 2-4		switch
user description, 1-40		On/Off, 1-23, 1-24, 2-4
Power key, 2-9		

Index-3

standby, 5-8	mouse, 1-4
switching between	connecting, 1-17, 1-21
measurements, 4-5	user
	adding a new, 1-37–1-44
T	description, 1-40
tab keys, 2-8	interface, 4-5
table of contents, 4-10	Utility keys, 2-10
tables, 2-7	
telephone number, Agilent, 4-3,	V
5-4	ventilation requirements, 1-7, 5-6
temperature, operating, 1-6	verification kits, 4-13
test	verifying the shipment, 1-3
operator's check, 1-45	version, firmware, 4-2
port, 2-4	VGA output connector, 2-13
port bias input	video graphics adapter. see VGA
connector, 2-13	voltage, power requirements, 1-6
fuse, 2-13	
throughput, 4-3	W
increasing, 4-5	warnings, 5-5
time	for servicing, 5-7
setting the, 1-28	Web Help, 4-13
zones, 1-28	window
title bar, 1-31	attributes, 3-2
toolbar	control buttons, 2-6
active entry, 2-6	Window key, 2-9
marker, 2-7	windows
measurement, 2-7	opening measurement,
stimulus, 2-7	3-12-3-14, 3-29-3-30
sweep control, 2-6 tour, front and rear panel, 4-5	Windows 2000, accessing, 1-31
trace	wizard, calibration, 3-8, 3-25
attributes, 3-2	
bar, 2-7	
memory, 4-8	
noise, 4-6	
Trace key, 2-9	
Trace Setup keys, 2-10	
training, 4-13	
trigger cable, 1-4	
Trigger key, 2-9	
turning off the analyzer, 1-23	
tutorial, 4-8	
U	
unit terminators, 3-23	
units keys, 2-11	
Universal Serial Bus. See USB	
up arrow key, 2-8	
USB	
accessories, connecting,	
1-16-1-22	
CD-ROM drive, 1-5	
connector, 2-4, 2-13	
hub, 1-5, 1-16	
connecting, 1-19, 1-20	
keyboard, 1-4	
connecting, 1-17, 1-21	

Index-4