								E	4419)B-08	8-S
Ş	5	Е	R	V	Ι	С	Е	Ν	0	Т	Е
							S	SUPERSEDE	S: None	Э	
	Agi	ilent E	4419B	EPM]	Powe	r Mete	r				
	<section-header><text><text><text><text><text><text><text></text></text></text></text></text></text></text></section-header>										
	DATE: October 2000										
ADMI	NIST	RATIV	E INFC	RMATI	ON						

SERVICE NOTE CLASSIFICATION:									
SAFETY									
ACTION CATEGORY:	ON SPECIFIED FAILURE	STANDARDS: 0.25 hours LABOR							
LOCATION CATEGORY:	CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER	SERVICE IRETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP ISEE TEXT SEE TEXT SEE TEXT							
AVAILABILITY:	ALWAYS	AGILENT RESPONSIBLE UNTIL : ALWAYS							
AUTHOR: FC	ENTITY: E600	ADDITIONAL INFORMATION:							

© 2000 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Situation:

It has been highlighted that the force-fit connector connecting the earth wire to the Power Supply Unit can be fitted in two different ways.

By fitting the connector with the bottom (flat) side facing the large capacitor on the Power Supply Unit, the gap between them is maximised (approximately 2mm).

By fitting the connector with the top (rounded) side facing the large capacitor on the Power Supply Unit, the gap between them is minimised (approximately 1.2mm).

The gap should be maximised at all times to ensure the unit meets the design and regulatory requirements relating to electrical insulation. This requirement is such that the gap should be at least 1.71mm.

Solution / Action:

During the replacement of the Power Supply Unit, the force-fit connector will be disconnected.

Ensure that this connector is re-fitted such that the bottom (flat) side of it is facing the large capacitor on the Power Supply Unit.

