

S E R V I C E N O T E

SUPERSEDES: NONE

8656B Signal Generators**Serial Numbers:** 0000A00000 / 9999Z99999**Semi-rigid Cable Replacement instructions****To Be Performed By:** Agilent-Qualified Personnel**Situation:**

When certain assemblies are replaced during an instrument repair, damage can be caused to the associated semi-rigid cables. The damage caused may result in instrument output level inaccuracy.

Solution/Action:

For all instrument repairs which involve replacing a board which is loaded with roeder connectors (part number 5021-2826), i.e. a board which has semi-rigid cables feeding signals to or from it, the associated semi-rigid cables should also be replaced.

The boards containing this type of connector are attenuator and output assemblies. The current list of assembly numbers affected are:

08657-60113
 08657-60159
 08657-60196
 08657-60197
 08657-60271
 08657-60976
 08657-60986

DATE: October 1995

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR:

EV

ENTITY:

E600

ADDITIONAL INFORMATION:

