S E R V I C E N O T E

SUPERSEDES: None

8664A Synthesized Signal Generator

Serial Numbers: 3203A00254/3203A00275 (Refer to specific serial numbers in text)

Potential RPP Assembly Failures

Duplicate Service Notes: 8665A-04

Parts Required: 08665-80100, RPP Assembly

Situation:

Instruments with specific serial numbers noted below may have defective RPP (Reverse Power Protection) assemblies. The RPP assembly protects the RF output circuitry from damage due to externally applied power. Failure symptoms include no RF output or a low output level (relative to front-panel settings).

The RPP assembly consists of several components, one of which is reed relay encased in a glass tube with teflon plugs at both ends. An elastomer envelope is used to secure coil windings around the glass tube and to provide consistent electrical characteristics.

The RPP fails when the elastomer expands beyond its nominal size and contacts the external connections of the reed relay. This causes a low impedance RF path to ground.

Continued

DATE: 23 April 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor 2.5 hrs
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE ☐ RETURN USED ☐ RETURN INVENTORY: ☐ SCRAP ☐ SEE TEXT ☐ SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	RESPONSIBILE UNTIL: 01 June 1995
AUTHOR: LHL	ENTITY: 1000	ADDITIONAL INFORMATION:

© 1993 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Page 2 Service Note 8664A-03

NOTE:BILLINGS WILL ONLY BE ACCEPTED FOR INSTRUMENTS WITH SERIAL NUMBERS LISTED BELOW. INSTRUMENTS WITH SERIAL NUMBERS NOT LISTED UTILIZE THE REDESIGNED RPP ASSEMBLY AND DO NOT REQUIRE MODIFICATION.

Affected Serial Numbers:

Standard Instruments

P/N 08664-61003, RF/RPP Assy

3203A00254

3203A00257

3203A00258

3203A00259

3203A00260

3203A00261

3203A00262

3203A00263

3203A00264

3203A00265

3203A00266 3203A00268

3203A00271

22021100271

3203A00272

3203A00273

Instruments with Option 008 (Pulse Modulation) P/N 08664-61005, RF/RPP Assy

3203A00256

3203A00267

3203A00274

3203A00275

Solution/Action:

- 1. Remove the original RPP assembly and replace it with the part number listed above. Refer to Figure 1 for assembly and component location.
- 2. Run the internal diagnostics after replacing the RPP assembly.
- 3. Perform RF Level Accuracy Performance Test to insure that the instrument meets specifications.

Service Note 8664A-03 Page 3

