

S E R V I C E N O T E

SUPERSEDES 8665B-01

**8665B Synthesized signal generator**

**Serial Numbers:** 0000A00000 / 3035A00185

**I/O assembly replacement requires modification to reference assembly**

**Duplicate Service Notes:**

8665A-09 Serial Numbers: 0000A00000 / 3026A00585

8665B-07 Serial Numbers: 0000A00000 / 3020A00192

**To Be Performed By:** Agilent-Qualified Personnel

**Situation:**

When an I/O assembly (08665-69104, 08665-60204 or 08665-60304) is replaced in instruments (serial numbers noted above) a jumper on the Reference assembly (P/N 1258-0209) must be removed to ensure proper operation of the reference oscillator.

**NOTE:**

Billings related to replacement of the I/O or Reference assemblies are not covered by this service note.

**Solution / Action:**

Remove J17 on the I/O assembly. This jumper is located at the front edge of the I/O assembly near the J11 Coax Discriminator connector.

DATE: August 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
<b>MODIFICATION RECOMMENDED</b>			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 0.1 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: MW	ENTITY: 5320	AGILENT RESPONSIBLE UNTIL: August1, 2003	
		ADDITIONAL INFORMATION: None	