E8267D-16 SERVICE NOTE

Supersedes: NONE

E8267D Digital Signal Generator

Serial Numbers: MY0000000/MY46520025

US00000000/US46470713

E8267D w/007 (Ramp sweep) found when sweeping between 1GHz and 2 GHz, the sweep frequency may appear to FM and then return to a swept signal.

Parts Required: P/N	Description	Qty
NONE		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFIC	CATION:	
INFORMATION ONLY		
AUTHOR: Hong Hee, Ng	PRODUCT LINE: PL15	
ADDITIONAL INFORMATION:		

© AGILENT TECHNOLOGIES, INC. 2007 PRINTED IN U.S.A.



September 14, 2007

Page 2 of 2 E8267D-16

Situation:

For the instrument with option 007, when performing the ramp sweep between 1GHz and 2GHz, the sweeping may appear to be FM signal at certain frequency.

Solution/Action:

- 1. Check the instruments firmware revision. Make sure the revision is C.04.71 or >C.04.92.
- 2. Connect the instrument to the LAN and write down the IP address.
- 3. Open a web browser on your pc. Enter the following URL, replacing <ip address> with the actual IP address of your instrument, http://<ip address>/update.
- 4. Type in or pastes the scripts to the manual update column then select EXECUTE. After the process has executed, there will be a message stating "Operation completed".

cd "FREQ SWEEP MULTIPLIER",3,8 cc "FREQ SWEEP MULTIPLIER" cd "FREQ SWEEP MODULUS LATCH VALUE",3,9 cc "FREQ SWEEP MODULUS LATCH VALUE" ky 43765