
8560E-09

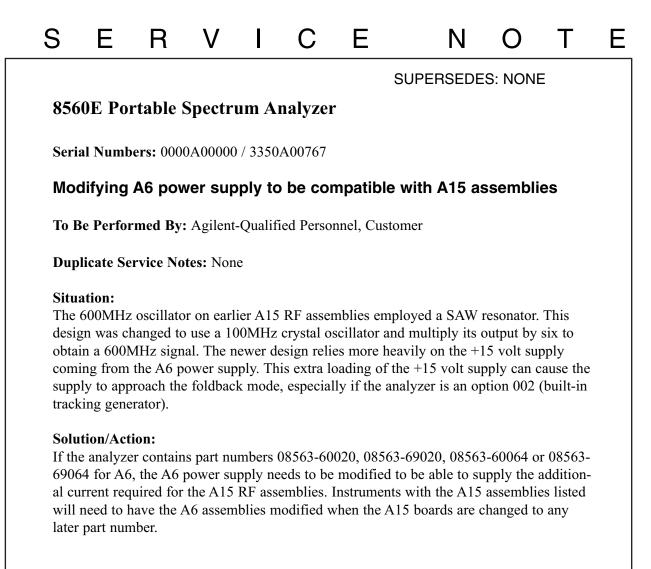

Continued

DATE: 07 March 1994

ADMINISTRATIVE INFORMATION

| SERVICE NOTE CLASSIFICATION: | | | | |
|------------------------------|---------|-------------------------|--|--|
| INFORMATION ONLY | | | | |
| AUTHOR: | ENTITY: | ADDITIONAL INFORMATION: | | |
| GPB | 5300 | | | |
| | | | | |

© 1994 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



| Standard Instruments: | 08563-60016, 08563-60036, 08563-69036, 08563-60044, 08563-69044 |
|-------------------------|---|
| Option 103 Instruments: | 08563-60010, 08563-60035, 08563-69035, 08563-60043, 08563-69043, 08563-60045, 08563-69045 |
| Option 008 Instruments: | 08563-60046, 08563-69046 |

Resistor A6R309 needs to be changed from 0.15 ohms to 0.12 ohms. Kits have been set up to replace the A15 assemblies listed above. Kit part numbers are 5063-0670 for standard instruments (OCXO and no Sig ID), 5063-0671 for option 103 units, and 5063-0672 for option 008 only instruments. In addition, the necessary parts and installation note are structured to the Rebuilt Exchange A15 boards.

| Part Number | Description | Qty |
|-------------------------|--------------------|-----|
| 08563-60054 (5063-0670) | A15 Standard | 1 |
| 08563-60055 (5063-0671) | A15 TCXO | |
| 08563-60056 (5063-0672) | A15 Sig ID | |
| 9320-5325 | Label | 1 |
| 0811-2616 | Resistor, 0.12 Ohm | 1 |
| 5962-5033 | Installation Note | 1 |

Table 1: Contents of 5063-0670, 5063-0671 and 5063-0672 Kits