8560E-10

S	Е	R	V	Т	С	Е	Ν	0	Т	Е
							SUPERSEDE	S: None	!	
856	60E Por	table	Spectr	um A	nalyze	r				
Seri	al Numbe	ers:								
350)A00755	3350A	A00756	33504	400758	3350A	00759			
335()A00760	3350A00761		3350A00762		3350A	00763			
3350)A00764	3406A	A00768	34064	400771	3406A	00773			
3406	5A00774									
8560 8561 8563	l icate Ser DE-10 1E-07 3E-09	vice i vo								
	ation:									
6005 in 11	56 A15 RF	assemt	olies may	y experi	ence hig	h Display	3-60054, 08563- yed Average Nois ts from a spuriou	se Levels	(DANL)	
The	*	signal or					by using a later v third LO signal j		the A15	
	ecognize a ctor attach		•			-	rify that there is	a surface-	mount	

DATE: May 1994

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:								
	MODIFICATION	RECOMMENDED						
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: Labor 1.0 Hour						
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT						
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: May 1995						
AUTHOR: GPB	ENTITY: 5300	ADDITIONAL INFORMATION:						

© 1994 AGILENT TECHNOLOGIES
PRINTED IN U.S.A.

