

S E R V I C E N O T E

SUPERSEDES: None

8561E Portable Spectrum Analyzer

Serial Numbers: 3450A00858 / 3517A01144

Intermittent flashing display intensity

Duplicate Service Notes:

- 8560E-13
- 8561E-10
- 8563E-13
- 8564E-07
- 8565E-07

To Be Performed By: Agilent-Qualified Personnel, Customer

Parts Required: 1 ea. 1810-0495 Resistor Network

Situation:

Display intensity can intermittently change in some instruments. The problem appears as “flashing” and is caused by a resistor network A6R405. The problem appears to be restricted to date code 9446.

Solution/Action:

Replace the A6R405 with a part bearing date code other than 9446.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: GB	ENTITY: 5320	AGILENT RESPONSIBLE UNTIL: January 1998	
		ADDITIONAL INFORMATION:	