## 8561EC-04

# S E R V I C E N O T E

Supersedes: None

## 856xEC Series Portable Spectrum Analyzer

Duplicate Service Notes.	
8565EC-04	4120A00556/4123A00640
8564EC-04	4120A00538/4123A00598
8563EC-04	4120A01365/4123A01645
8562EC-04	4120A00563/4123A00710
8561EC-04	4120A00389/4123A00421
8560EC-04	4120A00396/4123A00460

### **ADMINISTRATIVE INFORMATION**

**Duplicate Service Notes:** 

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	[[]] IMMEDIATELY X ON SPECIFIED FAILURE X AGREEABLE TIME	STANDARDS: LABOR: 1.5 Hours		
LOCATION CATEGORY: TEXT	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER	SERVICE X RETURN USED X RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP [[]] SEE TEXT [[]] SEE TEXT   SEE TEXT		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL:		
AUTHOR: JC  ADDITIONAL INFOR	PRODUCT LINE: [product line] MATION:			

© AGILENT TECHNOLOGIES, INC. 2002 PRINTED IN U.S.A.



Page 2 of 3 8561EC-04

To Be Perfomed By: Agilent-Qualified Personel

**Parts Required:** 

P/N	Description	Qty.
8150-4222	30 Gauge Wire	4


#### **Situation:**

For the instruments specified above, inductors within the A5 IF assembly are not making good connections to ground thereby giving error messages related to the A4 Log Amp board. Error numbers that appear in the lower right-hand corner of the screen on account of this problem are errors 561, 562, and 565.

### **Solution/Action:**

If the serial number of the instrument applies to the ones above, the following butch may solve the problem. Remove the shielding from the A5 IF assembly. Locate the inductors, and according to the attached photograph, insert and solder one end of the 8150-4222 wire into the hole connecting to the inductors and solder the other end to the ground plane on the front layer of the board. Do this for each inductor. See attached picture, the arrows point to where the jumpers are attached.

Page 3 of 3 8561EC-04

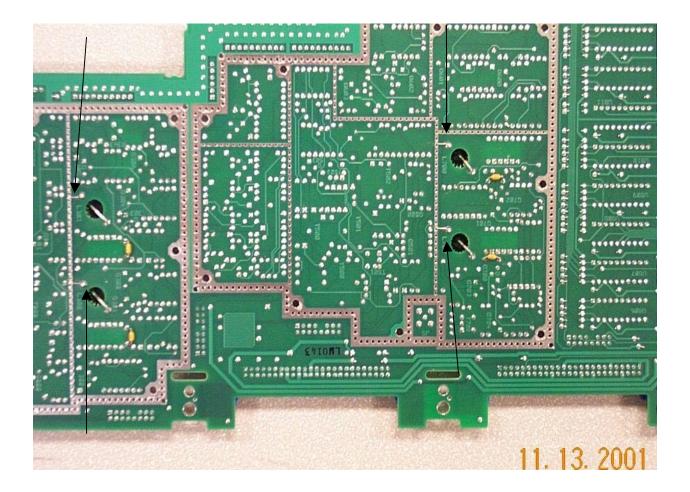

Add jumpers according to the picture above.