

S E R V I C E N O T E

SUPERSEDES: None

8562A Portable Spectrum Analyzer

Serial Numbers: 3040A05449 / 3040A05454, 3040A05456 / 3040A05465,
3040A05467 / 3040A05470, 3040A05472, 3040A05473,
3040A05475, 3040A05476, 3040A05491, 3040A05492

Duplicate Service Notes:

- 8560A-14
- 8561A-27
- 8561B-16
- 8562A-58
- 8562B-56

Possible damage to video out buffer on A3 interface

Situation:

A high level on the Video signal at pin 2 of transistor array A3U101 will cause transistor A3U101A to saturate. Damage will occur to this transistor due to excessive current flowing from +15 VF line on pin 1 to ground through diode A3CR104.

Solution/Action:

Diode A3CR104 needs to be removed. This diode is mounted on the circuit side of the board from pin 14 of A3U101 to one end of A3R110. A3U101 should also be replaced. The part number of the array is 1858-0032.

DATE: 05 November 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input type="checkbox"/> ON SPECIFIED FAILURE <input checked="" type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 1.0 Hour
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: GPB	ENTITY: 5300	AGILENT RESPONSIBLE UNTIL: 05 November 1994	
		ADDITIONAL INFORMATION:	