8562E-05

S E	R	V		С	Е		Ν	0	Т	Ε
						SUPER	SEDES	: NONI	E	
8562E Port	table S	pectru	m Ai	nalyzer						
Serial Numbe	rs: See	Below								
Reducing 3	00 kHz	Sideb	ands							
Duplicate Ser	vice Not	es:								
8562E-05 Seria 8563E-17 Seria 8564E-12 Seria 8565E-12 Seria	als: 3645 als: 3641 als: 3641	A06020 A00611 A00533	/ 3743. / 3743. / 3743.	A07920 A01005 A00793						
To Be Perform	ned By:	Agilent	-Qualif	ied Perso	nnel					
Parts Require	ed:									
P/N	Descr	ription			Quant	tity				
08564-60026	A6A2	Regulat	tor Ay.		1 ea.					
									Continue	ed

DATE: December 1997

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:									
MODIFICATION RECOMMENDED									
ACTION CATEGORY:	<ul> <li>IMMEDIATELY</li> <li>ON SPECIFIED FAILURE</li> <li>AGREEABLE TIME</li> </ul>	STANDARDS: LABOR 0.5 Hours							
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE     RETURN     USED     RETURN       INVENTORY:     SCRAP     PARTS:     SCRAP       SEE TEXT     SEE TEXT     SEE TEXT							
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: December 1999							
AUTHOR: GPB	ENTITY: 5320	ADDITIONAL INFORMATION:							

© 1997 AGILENT TECHNOLOGIES
PRINTED IN U.S.A.



## Situation:

Some instruments may fail the Spurious Response spec at 300 kHz offset from a signal. This can be the result of inadequate filtering on the -5 Volt bias supply to the A8 Low Band Mixer.

## **Solution / Action:**

Replace the older A6A2 Regulator assembly 08564-60009 with part number 08564-60026 or later. Later regulator assemblies haved added filtering on the -5 volt supply. This modification can also improve performance of instruments which already meet the Spurious Response specifications.