# S E R V I C E N O T E

SUPERSEDES: None

## **85644A Tracking Source**

**Serial Numbers:** 0000A00000 / 3317A00154

### **Duplicate Service Notes:**

85644A-02 85645A-02

## **Eliminating ALC Oscillations**

#### **Situation:**

Oscillations at approximately 1MHz are sometimes seen superimposed on the output of the Tracking Source when doing stimulus-response measurements with a host spectrum analyzer. The oscillations originate in the ALC amplifier A2U521.

#### **Solution/Action:**

Replace A2U521 with part number 1826-1049.

DATE: 23 November 1993

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor 0.5 Hour
LOCATION CATEGORY:	<ul><li>■ CUSTOMER INSTALLABLE</li><li>■ ON-SITE</li><li>■ SERVICE CENTER</li></ul>	SERVICE RETURN USED RETURN INVENTORY: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: 23 November 1995
AUTHOR: GPB	ENTITY: 5300	ADDITIONAL INFORMATION:

© 1993 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

