

S E R V I C E N O T E

SUPERSEDES: None

**8565E Portable Spectrum Analyzer**

**Serial Numbers:** 3442A00239 / 3517A00333

**Intermittent flashing display intensity**

**Duplicate Service Notes:**

- 8560E-13
- 8561E-10
- 8563E-13
- 8564E-07
- 8565E-07

**To Be Performed By:** Agilent-Qualified Personnel, Customer

**Parts Required:** 1 ea. 1810-0495 Resistor Network

**Situation:**

Display intensity can intermittently change in some instruments. The problem appears as “flashing” and is caused by a resistor network A6R405. The problem appears to be restricted to date code 9446.

**Solution/Action:**

Replace the A6R405 with a part bearing date code other than 9446.

DATE: January 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
<b>MODIFICATION RECOMMENDED</b>					
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour		
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: January 1998		
AUTHOR: GB	ENTITY: 5320	ADDITIONAL INFORMATION:			