

S E R V I C E N O T E

SUPERSEDES: NONE

8563E opt. 026	Spectrum Analyzers
8592L opt. 026	Spectrum Analyzers
8593E opt. 026	Spectrum Analyzers
8362X	Source Products
8363X	Source Products
8375X	Source Products
8371X	Source Products
8373X	Source Products
867X	Source Products

Tightening torque on p/n 08673-60040 APC 3.5mm(m)to(f) connector.

Serial Numbers: See below

Spectrum Analyzer Products:

8592L w/option 026	Serial Numbers:	3826A01209, 3826A01272
8593E w/option 026	Serial Number:	3829A03625, 3829A03626, 3829A03627, 3829A03642, 3829A03666, 3829A03673
8563E w/option	Serial Numbers:	026 3821A08971 / 3821A09443

Continued

DATE: February 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR 0.5 Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: BD	ENTITY: 5320	AGILENT RESPONSIBLE UNTIL:	Product Support Life
		ADDITIONAL INFORMATION:	

Source Products:

83620B	Serial Numbers: 3722A00674 / 3722A00750
83621B	Serial Numbers: 3614A00249 / 3614A00275
83622B	Serial Numbers: 3722A00169 / 3722A00185
83623B	Serial Numbers: 3722A00615 / 3722A00675
83623L	Serial Numbers: 3722A00167 / 3722A00176
83624B	Serial Numbers: 3722A00216 / 3722A00227
83630B	Serial Numbers: 3722A00488 / 3722A00550
83630L	Serial Numbers: 3722A00333 / 3722A00353
83631B	Serial Numbers: 3614A00162 / 3614A00173
83711B w/option 1E9	Serial Numbers: US37100917, US37100916, US371000878, US37100877, US37100876, US37100828, US37100825, US37100822
83712B w/option 1E9	Serial Numbers: US37100749, US37100748, US3710A00747, US3710A00746, US37100729, US37100726, US37100725, US37100724, US37100674, US37100666, US37100662, US37100660, US37100657
83731B w/option 1E9	Serial Numbers: US37100721, US37100673
83732B w/option 1E9	Serial Numbers: US37101158, US37101126, US37101124, US37101115, US37101092, US37101091, US37101084, US37101064, US37101058
83751A	Serial Numbers: 3614A00384 / 3614A00409
83751B	Serial Numbers: 3614A00216 / 3614A00221
83752A	Serial Numbers: 3614A01437 / 3614A01551
83752B	Serial Numbers: 3614A00876 / 3614A00928

Duplicate Service Notes:

8592L-M71
 8593E-M71
 8563E-M71
 83620B-M71
 83621B-M71
 83622B-M71
 83623B-M71
 83623L-M71
 83624B-M71
 83630B-M71
 83630L-M71
 83631B-M71
 83711B-M71
 83712B-M71
 83731B-M71
 83732B-M71
 83751A-M71
 83751B-M71
 83752A-M71
 83752B-M71

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Description	Quantity
08673-60040	APC 3.5mm Connector	1

Situation:

The retaining ring used inside part number 08673-60040, APC 3.5mm(m) to(f) has been recently powder coated with a lubricant known as MOLY-D. This lubricant prevents connector savers from being torqued to the correct value (9 inch lbs.) inside the connector. Connectors containing this lubricant typically spin at ~2 inch-lbs. Such a low value of torque can cause power holes and intermittent amplitude fluctuations in all applications.

The lubricant was used from 15 JUN 98 through 24 SEP 98 and therefore affects products that were shipped or had this connector changed within this timeframe. The list shown above indicates the model and serial numbers for which the 08673-60040 connector may contain a MOLY-D retaining ring. Solution / Action: For suspect 08673-60040 connectors, perform the following acceptance test:

Perform the following acceptance test:

1. Install p/n 5061-5311 APC 3.5mm(f)to(f) or equivalent connector saver with a 3/8" shoulder nut.
2. Finger tighten the connector saver into the connector in question.
3. Hold the knurled end of 08673-60040 and place a torque wrench on the 3/8" nut of the APC 3.5mm(f)to(f) connector saver.
4. If the combined connector (knurled body plus connector saver) will withstand a 9 inch lb. torque without spinning, accept it. If not replace the 08673-60040 under warranty.